A \ 296
(1 = \)
Sh No 27-14

CALL NO 621 94 HOL-1

TURNING

AND

MECHANICAL MANIPULATION.

BY THE LATE

CHARLES HOLTZAPFFEL,

ASSOCIATE OF THE INSTITUTION OF CIVII ENGINEERS, LONDON
HONORARY MEMBER OF THE ROYAL SCOTTISH SOCIFTY OF ARIS, EDINBURGH
CORRESIONDING MFMBER OF THE AMERICAN INSTITUTE OF NEW YORK
ALSO OF THE FRANKLIN INSTITUTE, HILLADELIHIA

ETG ETG

VOL 1

MATERIALS THEIR DIFFERENCES CHOICE AND PRIPALATION VARIOUS MODES OF WORKING THEM GENERALLY WITHOUT CUTTING TOOLS

VOL II

THE PRINCIPLES OF CONSTRUCTION ACTION AND APPLICATION
OF CUTTING TOOLS USED BY HAND AND ALSO OF
MACHINES DERIVED FROM THE HAND TOOLS

VOL III

ABRASIVF AND MISCELLANEOUS PROCESSES WHICH CANNOT BE ACCOMPLISHED WITH CUITING TOOLS

Every Volume is complete in itself

TURNING

AND

MECHANICAL MANIPULATION

INILADED AS

A WORK OF GENERAL REFERENCE AND PRACTICAL INSTRUCTION

ON THE LATHE,

FOLLOWED BY AMATEURS

TO TO THE VARIOUS MECHANICAL PURSUITS

TO TH

BY THE LATE

CHARLES HOLTZAPFFEL,

ASSOCIATE OF THE INSTITUTION OF CIVIL INGINEERS IONDON HONOR MY MEMBER OF THE ROYAL SCOTISH SOCIETY OF ARTS, EDINBURGH CURRESPONDING MEMBER OF THE AMERICAN INSTITUTE OF THE ALSO OF THE FRANCISM INSTITUTE THILADMITHIA ETC, ETO

VOL II

THE PRINCIPLIS OF CONSTRUCTION ACTION AND APPLICATION
OF CULTING TOOLS USED BY HAND AND ALSO OF
MACHINES DERIVED FROM THE HAND TOOLS

Illustrated by upwards of Seven Hundred Woodcuts

TONDON

PUBLISHED BY HOLIZAPITEL & CO, 61, CHARING CROSS, AND 127, LONG ACRL

And to be had of all Booksellers

1875



LONDON

BRADBURY IGNEW & CO PRINTERS WHITFRIARS

GENERAL SKETCH

OF THE

CONTENTS OF THE WORK

VOL I

MATERIAIS THEIR DIFFERENCES CHOICE AND PRFPARATION, VARIOUS MODES OF WORKING THEM GENERALLY WITHOUT CUTTING TOOLS

Introduction—Materials from the Vegetable the Animal and the Mineral King doms—Their uses in the Mechanical Aits depend on their structural differences and physical characters. The modes of severally preparing working and joining the materials with the practical description of a variety of Processes, which do not generally require the use of Tools with cutting edges.

VOL II

THE PRINCIPLES OF CONSTRUCTION ACTION AND APPLICATION OF CUTTING TOOLS USED BY HAND AND ALSO OF MACHINES DERIVED FROM THE HAND TOOLS

The principles and descriptions of Cutting Tools generally—namely Chisels and Planes Furning Lools Boring Tools Screw cutting Tools Saws Files Shears and Punches The hand tools and their modes of use are first described and subsequently various machines in which the hand processes are more or less closely followed

VOL III

ABRASIVE AND MISCELLANEOUS PROCESSES WHICH CANNOT BE ACCOMPLISHED WITH CUTTING TOOLS

Grinding and Polishing viewed as extremes of the same piocess and as applied both to the production of form and the embellishment of surface in nuncious cases to which from the nature of the materials operated upon and other causes Cutting Tools are altogether inapplicable. Preparation and application of Varnishes Lackers, &c.

* The F11st Second and Third Volumes of this worl are written as accompany ing bools and have one Index in common

A few additional copies of the Indix have been printed for the convenience of those who may dishe to bind the Index with Vols I and II

OF THE SECOND VOLUME

CHAP XXII —GENERAL REMARKS UPON CUTTING TOOLS	AGΓ
SECT 1 The angles and positions of tools as regards the act of cutting—Their division into paring scraping and shearing tools—angles and positions	457 463
CHAP XXIII—CHISELS AND PLANFS	
SECT 1 Introduction—The are hatchet adze bis ool in or Indian adze paring knife drawing knife chisel and planing tool for metal contrasted Bench planes of various I inds or those used for flat surfaces the mouths of planes described the spokeshave planes with single and double nons planes of low middle half mitre and upright pitches	
and the joiner's scraper SECT 2 Growing planes—For cutting with the gruin or across the grain— The fillister plough grooving drawer bottom and slit deal planes— The router various gages the coopers croze banding planes and	472
rounding planes for cylindrical rods SECT 3 Moulding planes—Fheir general character—difficulty of applying them to the vertical parts of mouldings remedy proposed by the author—On working or sticking mouldings explanations of the terms the	484
SECT 4 Remarks on the bench and the use of planes—On the construction of Joiner's benches bench stops hooks and holdfasts—On sharpening, adjusting and using bench planes straight edges winding sticks	489
squaring thick and thin works the shooting board Sect 5 Planing-machines for wood—Those invented by Bentham Bramah Brunel Muir Paxton Burnet & Poyer briefly considered	494 503
CHAP XXIV —TURNING TOOLS	
Sign 1 Facility of turning compared with corpentry—General remarks on the sections of woods and on the tools respectively used for turning and carpentry	508
Sign 2 Funning tools for soft wood—Gouge chisel hook tools underhand tools broads side cutting sciew cutting and parting tools for soft woods	512

S man	2 Thursday Analy for Land and Land and Comment of the Comment of t	PIGE
SECT	3 Turning tools for hard wood and wory—Gouge side cutting flit	
	point bevil and parting tools—Curvilinear tools simple and complex for mouldings both external and internal—Screw cutting tools	517
SECT	4 Tuning tools for brass—Round or rough out tool square tool planish	or t
DLCI	ing tools the last sometimes burnished on their edges and held in a	
	-	
	restless manner—Many of the other tools for brass nearly resemble those used for every. The arm rest and its employment	520
SECT	5 Turning tools for won and strel—Triangular tool graver flat chisel	520
DEGI	heel and hook tools—nail head tools—cranked or hanging tools	523
SECT	6 Fixed or machine tools for turning and planing—By comparison with	525
DIOI	hand tools their forms requiremore rigid observance of principle—Fixed	
	tools for soft wood—for hard wood and 1vory—for brass—for 1ron—	
	general principles—Nasmyth's tool gage—Cutter birs or tool holders	
	with small changeable cutters—finishing hanging or springing tools	527
	with private custoff and in the state of spiritiging tools	541
	CHAP XXV —BORING TOOIS	
SECO	1 Roung hate for good Warrang brands of order fluted on some tubular	
DECI	1 Boing bits for wood—Various kinds of awls—fluted or semi tubulai bits—center bits—English American and German screw augers—or	
	dinary braces and angle braces for wood	539
SECT	2 Drills for metal used by hand—Small double cutting drills used with	ออฮ
2201	the drill bow—larger single cutting drills used in the hand brace and	
	in boring machines—including pin drills and also square and cone	
	countersinks of each kind	546
SECT	3 Methods of w rking drills by hand power-Watch drills various	010
	drill bows and drill-stocks—Smith sold press drill outline of modern	
	contrivances for the same purpose—Ratchet and lever drills—Coiner	
	drill with bevil pinions—Shanks's differential sciew drill	553
SECT	4 Drilling and boring machines—The lathe very much used for boring	
	with fixed drills of numerous kinds—Sketch of the general characters	
	of drilling machines for small holes—and also of boring machines with	
	revolving and sliding cutter bars such as are used for the largest	
	steam cylinders	563
SECT	y T	
	verse sections for making taper and cylindrical holes both in woods	
	and metals—Comparison between the actions of drills and broaches	572
	CHAP XXVI —SCREW CUTTING TOOLS	
~		
SECT	1 Introductory remarks—Observations on the screw both elementary	
G	and descriptive—Division of the subject of screw cutting	577
SECT	0 0 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	
SECT	note page 635) by Plumier Robinson Maudslay Allan Walsh etc	579
DECT		
	of numerous transverse sections on their longitudinal sections and their general applications—Taps with loose cutters—Original taps and	
	cutters for cutting the dies of diestocks the teeth of worm wheels	
	and screw tools Screw taps and cutters for wood	F00
	man noto! Toom Solott outpa and outpots for Wood	583

PAGE

688

Srct	4 On cutting external screws with screw dies etc —Screw box for cutting wood screws—Screw plates for small metal screws—Old and modern screwstocks or diestocks—Proportions of original or master typs used for cutting the dies of diestocks—Various forms of dies considered Sir John Robison's dies also Keir's and Jones's dies with detached	
	outtons. On producing left hand screws from right hand apparatus.	
	Whitworth s and Bodmei s patent screw stocks—screwing machines	593
SECT	and and of follows in contain strews in the of the surface of the surface of	611
Srct	and modern apparatus for this pul pose and their apparatus	612
SECT	On cutting screws in lathes with traversing tools—Various simile continuances for cutting short screws invented by Besson Grandjean Thout Healey and Varley—Machinery for cutting long and accurate screws by the modern system of guide screws and change wheels—the smaller application used as an addition to the ordinary slide rest—the larger constitutes the screw cutting or slide lathe—Mode of computing the pitches of screws from the wheelsand guide screws employed—Screw tools or chasing tools of ordinary kinds used in slide rests and slide lathes those by Clement Bodmer and the Author—Roberts s tool slide—Shanks s tool slide for cutting both in the to and no movement—Backstay for supporting long and slender screws whilst being cut	615
SECT	8 Various rooks of originating and improving series, etc.—Enstasing and some tackle for ordinary and general purposes—Secondly, the apparatus for regulating and micrometrical screws required to agree in pitch with Standard Measure—Method of originating series with the inclined plane used in some fusee cutting engines and improved by Reid Modes of perfecting the screw introduced by Ramsden Maudslay, Barton Allan and Clement fully explained—Account of the constituction of Mr Donkins rectilinear dividing engine in which the micrometrical errors in the best sciews due principally to the want of	20.5
Sec	homogeneity in the materials may be discovered and compensated for 9 Scient threads considered in respect to their proportions forms and general characters—Relative strengths of screws and nuts comparison of square and angular threads split nuts to compensate for wear different sections of screw threads and their purposes—Inconvenience experienced from the dissimilarity of screws—System of screws to agree with S and and Measure proposed by Mr Whitworth for universal adoption this proposal surrounded by various and almost insurmount able difficulties—Modes of forming screws, differing from all those be for enoticed namely by Wilks Warren, Perkins, Scott and Rand	635 655
	CIIAP XXVII—SAWS	
SE	T 1 Division of the subject forms of saw teeth—Introduction descriptions of the teeth used in various kinds of saws and their several purposes	682

SECT 2 Sharpening and setting saws—Fully explained as ic aids the five usual modes employed. The tools used namely, the horses files strikes and set hammons the ordinary saw set plier saw set and saw

set for circular saws

Sect 3 Rectilinear aws used by hand—Table of the dimensions of rectilinear saws in three divisions—Frist division—Faper saws mostly without frames—Felling saws cross cutting saws various pit saws some of them with frames—Instructions for marking out and sawing round and squared timber—Hand saws panel saws compass keyhole and pruning saws and directions for their use—Second division—Puillel saws with backs—Tenon sash carea e and dovetail saws sawing block cutting tenons and mortises and also dovetails of all kinds—Simths screw head saw comb makers saw double saws for cutting racks—Third division—Paillel saws used in frames and instructions for their application—Will saw blades pit veneer saw chair maters saw wood cutters saw Continental frame saw turning or sweep saw—The smith's frame saw side frame saw piercin—saw buhl saw the practice of buhl and marquetry work fully explained.

698

SECT 4 Rectilinear or recipiocating saw machines—Those at the Govern ment and City saw mills—American and Continental fire wood saw machine—Vertical saw mills for deals—also those for squire and round timber—Small vertical machine from the Manuel du Tourneur Mac Duff's—Lunds—and Professor Williss vertical sawing machines for small purposes—including buhl works

739

SECT 5 Common applications of the curcular saw to small works—Smallest circular saws mounted on the lathe for telescope tubes screw heads making joints &c —Small saw spindle platforms of wood and iron saw stops parallel and angular guides—Sawing rectangular pieces grooves rebates cross cutting the ends of pieces square or bevil

Sawing bevilled edges and oblique prisms fully exemplified by the formation of the various Mosaic works of the I unbridge turner

Sawing regular and irregular prisms also regular irregular single double and mackled pyramids—The subject minutely illustrated by the formation with the circular saw, of the five regular bodies or platonic solids and a variety of other solids that occur in mineralogy and crystallography with all the angles critically given

751

Sect 6 Common applications of circular saws to large works—Table of dimensions of circular saws given in three divisions with the speed and power severally required for them—Various general conditions—Spindles for large saws benches and platforms stops and parallel guides for the same—Sawing rectangular pieces

783

SECT 7 Less common or specific applications of circular saws to large worls
—Sawing grooves rebates and tenons—Pow & Lyne's sawing machine
for combs—Cross cutting the ends of pieces square or at angles—
Sawing works with bevilled edges Lastman's machine for feather
edged boards sawing hexagonal and other wood pavement—I rofessor
Williss mode of blocking out architectural mouldings—Sawing works
bevilled in both planes Mr Donkin's saw bench—Curvilinear sawing
—Trephine saw and various others used in surgery cylindrical or
drum saws used for felloes of wheels backs of chairs brushes &c—
Smart's machinery for sawing the curvilinear staves of calks

792

SECT 8 Crevilar saws and machinery for cutting veneers—Veneers known to the Romans and until recently cut by the pit sawyers—Brunel's split ting machine for veneers—Modern veneers aws—The smaller application with single plates for leaves of ivory and small veneers of wood—The

SLOT

SECT

SECT

	PAGE
lar er application or the modern veneer mill its action fully explained and figured—Conclusion of the chapter—Additional illustrations of circular saws for cutting off piles under water sawing slate and sawing ends of railway bars whilst red hot	805
CHAP XXVIII—LILES	
Lot 1 General and descriptive view of files of usual 1 inds— Explanation of the six principal features in files—Description and purposes of the files principally used namely taper hand cotter pillar half-round triangular cross round square equallin kinfe and slitting files Description of other files loss frequently used—Sketch of the manufacture of files and rasps—Different means of grasping the file to adapt it to various specific uses	817
SECT 2 General and descriptive view of files of less usual kinds—Rifflers for sculptors and others—Floats or single cut files used for ivory horn and tortoiseshell the quannett—White s perpetual file—Rouls and Ericcson's machines used for cutting the teeth of files—Sir John Robison's concave half round file—and also his project for file cutting	l ; 83 7
SECT 3 Preliminary remarks on using files and on holding works that are to be filed.—The three positions of the individual corresponding modes of holding the file and general observations on filing—Chipping pickling or grinding works preparatory to filing—On cleaning files. Modes of grasping works to be filed the taper vice tail vice vice benches tripod vice stand table and parallel vices, wood and meta vice clamps—Pin vice and sliding tongs used for small works especially those of cylindrical forms—Filing boards and Sheffield flatting.	e .l
steps to be strong to the strangle of the stra	it ee y
grinding them together 5.501 5 Instructions for originating straight edges and trial plates or plan meters—Joiner's method of preparing wooden straight edges the employed in commencing steel straight edges which latter are after wards delicately corrected by working on a series of three—On originating plane surfaces in trop, or planometers	000 se sr g1 872
SLOT 6 Instructions for filing rectilinear works in which several or did to super ficies have to be wrought—Works with plane surfaces and squaredges worls with bevilled edges works with rebates and grooves sor of those filed up in different pieces for the facility of manipulation. Filing mortises and apertures—Drifts or punches used in combination with files in completing square and other mortises and holes to key ways in wheels &c. SLOT 7 Instructions for filing our vibracar works a cording to the three or any prodes—The operation less difficult than filing flat surfaces.	ne na he 878 di
many mounts are negation incessan	tlv

file often nearly a counterpart of the work its position incessantly

Sect of Punches used in fly presses and miscellaneous examples of their products—General characters of the fly press—Some peculiarities in fly presses and machinery of analogous kinds—Productions of presses—

PAGE Disks for coin ingenious compensatory method of ensuring their critical equality of weight-Punching disks for buttons washers with round and square holes The links for chains of various kinds for machinery, including chains for pin wheels and Oldham's chain for common spur wheels intended to act as leather bands Peculiar punching tools used for making watch chains-Punching the teeth of straight and circular saws-Punching copper caps and steel pens-Larivière's perforated metals for colanders and various domestic purposes—Punches used in the manufacture of Jeffreys patent respirators—Buhl work made by punching or stamping—Sketch of the mode of cutting brads tacks and 934 nails by punching or shearing tools SECT 4 Punching machinery used by engineers-Nearly the same in general arrangement as the shearing tools-The punching engine commonly used for cutting curvilinear lines in thick plates—Colthurst's and Hick's comparative experiments on the force required in using punches 950

APPENDIX

NOTES REFERRING TO THE FIRST VOLUME

		NOTES REFERRING TO THE FIRST VOICINE	
Refers	to Vol	I	
Note	Page	- more management tropher from decay	953
H	22	Payne's Patent process for preserving timber from decay	953
I	25	The bassoolah or Indian adze (by the late Sir J Robison) Irving s Patentcarving machine principally applicable to mouldings	954
J	46	Irving s Patent carving machine principally applicable to figures	954
K	46	Jordan's patent carving machine, principally applicable to figures	955
\mathbf{L}	46	Tomes s patent dentifactor for carving artificial teeth and gums	957
M	121	Straightening stag horn and buck horn for kinfe handles	957
N	155	Making isinglass glue (by the late Sir J Robison)	957
0	160	Prosser s patent process for works made of dry clay with dies	958
P	191	Clays patent process for manufacturing wrought iron Nasmyth's patent direct action steam hammer (by the Patentee)	958
\mathbf{Q}	196	Nasmyth's patent direct action so an hammer (5) sales at the Patentee)	961
${f R}$	196	Nasmyth s patent steam pile driving engine (by the Patentee)	962
S	202	The Oliver or small lift hammer worked by the foot	
${f T}$	226	The manufacture of wrought iron tubes (explained by Mr Pros	
		sers Synoptical table—followed by brief professional notices	963
		of the several patents)	970
U	256	Remarks on Sir J Robison s workshop blowpipe (by the Inventor)	970
∇	283	Amalgams used by dentists for stopping teeth	970
W	323	Babbett s patent anti friction metal for bearings of machinery	971
\mathbf{x}	30	Craufurd's patent process for making galvanised iron	972
Y	302	Morewood & Rogers s patent for making galvanized tinned iron	973
Z	308	Portable brass furnace by Holtzapsiel & Co	974
$\mathbf{A}\mathbf{A}$	37	Berlin method of moulding delicate and complicated objects	974
$\mathbf{A}\mathbf{B}$	42	4 Fluid employed in India for lubricating draw plates	974
$\mathbf{A}^{\mathbf{C}}$	41	Foxalls patent method of raising vessels in sheet metal	976
ΑD	43	1 Drawing taper brass tubes for locomotive engines	
AD	43	1 Rand s patent method of making collapsible tubes for oil colours	977
AF	43	3 Clay props used by the Asiatics instead of binding wire in soldering	978
A G	1 44	4 Pumice stone used by dentists, instead of charcoal in soldering	810

NOTES REFERRING TO THE SECOND VOLUME

	to Vol	II	
Note	Page		PAGE
\mathbf{AH}	4 8 2	Silcock & Lowe's patent planes for joiners and cabinet makers	978
ΑI	487	Lund s screw router plane for working recesses in cabinet work	979
\mathbf{AJ}	4 88	Falconer s improved circular plough for joiners	979
$\mathbf{A}\mathbf{K}$	495	Franklin's screw bench hook for carpenters	979
\mathbf{AL}	495	De Beauforts vice or stop for joiner's benches	979
$\mathbf{A}\mathbf{M}$	495	S Nicholl's stop or clamp for joiner's benches	950
AN	504	Lsdaile & Margrave's machine for cutting scale boulds for boxes	981
$\mathbf{A}\mathbf{O}$	5 05	On machines for planing wood by Paxton and by Burnett & Poyer	981
AP	505	Mayers patent machine for cutting splints for chemical matches	992
$\mathbf{A}\mathbf{Q}$	533	Side cutting tool for iron to be used in the slide rest	983
AR	538	On lubricating metal turning tools with water	983
$\mathbf{A}\mathbf{S}$	53 8	Paper on the principles of tools for turning and planing metals	
		(by Charles Babbage Esq FRS &c)	984
\mathbf{AT}	538	The author's description of tools and tool holders for turning and	201
		planing metals constructed by C Babbage Fsq	987
ΑU	538	Paper on the principles of tools for turning and planing metals	901
	000		001
ΑV	538	(by the Kev Prof Willis of Cambridge A.M. F.R.S. &c.) Paper on a new form of tool holder with detached blades for	991
	000	turning or planing most la and an agree la fig.	
		turning or planing metals and on a new mode of fixing tools upon the slide rest (by Prof Willis)	
AW	542	Frontship a owner dura content between the	996
AX	544	Franklin s expanding center bits for holes of various diameters	1001
AY	554	The American screw auger patented by Mr Ash	1002
AZ	557	Freeman s registered drill tool for actuating small drills	1002
BA	557	Mac Dowall's Archimedean screw dull stock	1003
BB	557	MacDowall's retangular Archimedean drillstock for dental surgery	1003
BC	563	Capt D Davidson's rectangular drill stock for dental surgery	1004
BD		G Scott s apparatus for boring and tapping cast iron main pipes	1004
BE	567	Collas lathe drill for boring holes out of the solid	1006
	567	C Holtzapffel's boring bit with changeable cutters for the lathe	1006
BF	567	The Cornish boring bit with loose cutters for the lathe	1007
BG	567	Maudslays boring bit with loose cutters for the lathe	1008
BH	567	Stiven a registered lathe drill	1008
BI	567	Kittoe's expanding half round bit for the lathe	1009
BJ	572	G Wright inventor of the modern system of boring large cylinders	1010
BK	580	Mallett's method of describing regular and irregular spirals	1010
BL	696	On sharpening the teeth of saws by means of grindstones	1011
$\mathbf{B}\mathbf{M}$	789		
		sheet metals and wires—and proposals for a new system of gages	
		founded on the decimal subdivision of the standard inch	1011
BN	751	Bodmers patent for making the tires of locomotive wheels	1021
B0	803	Harvey's patent curvilinear saws for long or short works	1022
BP	827	G OZGO OZ HICO	1022
\mathbf{BQ}	839		1023
BR	841	Inventors of various file cutting machines	1023
BS 7	Vol I	299 Table of decimal proportions of the pound avoirdupois	1023
BT '	Vol I	46 Gibb's Carving Machine patented 1829	1025

TURNING

AND

MECHANICAL MANIPULATION

VOL II

THE PRINCIPLES OF CONSTRUCTION ACTION AND APPLICATION
OF CUTTING TOOLS USED BY HAND AND ALSO OF
MACHINES DERIVED FROM THE HAND TOOLS

CHAPTER XXII

GENERAL REMARKS UPON CUTTING TOOLS

INTRODUCTION

THE title of the present volume appears to be sufficiently descriptive without additional explanation, consequently the author will alone offer a few words on the notions which led to the division of the volume into the eight chapters enumerated in the table of contents, and on their particular arrangement

The chisel was selected as the subject of the first chapter, as from the simplicity of its form and action, it may be viewed as a keen wedge, sometimes employed with quiet pressure, at other times used with percussion, as in tools of the character of axes and adzes, and the stiaight chisel mounted in a stock for its guidance becomes the plane. Further, the carpenter's chisel may be used as a turning tool, and many tools of this kind, the second in the classification, follow the condition of chisels and planes, if we imagine the tool to be held at rest and the work to revolve against it, on a fixed axis. The practice of turning is naturally associated with that of boing holes, although in most cases, the boring tool revolves whilst the work remains at rest. Turning and boring, each circulatory processes, led to the selection of the screw as the subject of the next chapter, for revolution combined

H H

VOL II

with rectilinear advance, are exhibited in all the numerous modes of producing screws

Saws were ideally compared with some of the scraping chisels, but with a multiplication of points and these sometimes arranged in continuous order as in the circular saw. The file from its vast assemblage of scraping teeth, was likened to a multiplication of the saw, but unfortunately the file has not been engrafted upon any machine, embodying the manipulation of the unassisted instrument. Shears and punches are next considered in great measure as parallel subjects, and the rectilinear edges of shears although mostly duplicated, nevertheless bear some resemblance to simple chisels, although from their duplication they act on both sides of the material, and lastly the ordinary punch is comparable with the rectilinear edges of the shears and chisels, if we do but conceive these to be bent into the circular form

Should these grounds for the arrangement adopted be deemed fanciful or visionary, it may be added that some order or selection was imperative, and it is hoped the present will serve as efficiently as any other that could be selected

SECT I —THE ANGLES AND POSITIONS OF TOOLS, AS REGARDS THE ACT OF CUTTING

THE section now to be commenced refers exclusively to the principles and construction of cutting tools, which will be considered in a general manner, and without reference to any particular branches of mechanical art, the tools and applications being selected by their characters and principles alone

All edged tools may be considered to be wedges formed by the meeting of two straight, or of two curvilinear surfaces, or of one of each kind, meeting at angles varying from about 20 to 120 degrees

Some few tools are pointed, from the meeting of three or more planes or surfaces

Occasionally, as in the hatchet, the chipping chisel, and the turner's chisel for soft wood, the tool is ground from both sides, or with two bevils or chamfers, at other times, as in the carpenters chisels and plane irons, the tool is ground from one side only, and in such cases, the general surface or shaft of the tool constitutes the second plane of the wedge, this difference does not affect the principle

The general characters of cutting tools, namely their angles, and their relations to the surfaces to be produced, depend upon the hardness of the opposed substances, and the direction and nature of their fibres, these primary characters require especial consideration

The particular or specific characters of cutting tools, namely, the forms of their blades, stocks, or handles, are adapted to the convenience of the individual or the structure of the machine by which they are guided, these secondary characters, the less require or admit of generalization

It will be now attempted to be shown that, granting the latitude usual in all classifications cutting tools may be included in three groups, namely, Paring Tools, Scraping Tools, and Shearing Tools

First—Paring or splitting tools, with thin edges the angles of which do not exceed sixty degrees, one plane of the edge being nearly coincident with the plane of the work produced (or with the tangent, in circular work). These tools remove the fibres principally in the direction of their length, or longitudinally, and they produce large coarse chips or shavings by acting like the common wedge applied as a mechanical power.

Secondly—Scraping tools with thick edges that measure from sixty to one hundred and twenty degrees. The planes of the edges form nearly equal angles with the surface produced or else the one plane is nearly or quite perpendicular to the face of the work (or becomes as a radius to the circle). These tools remove the fibres in all directions with nearly equal facility, and they produce fine dust like shavings by acting superficially

Third'y—Shearing, or separating tools with edges of from sixty to minety degrees, generally duplex, and then applied on opposite sides of the substances. One plane of each tool, or of the single tool, coincident with the plane produced

In explanation of these views, the diagram, fig 316, is supposed to represent seven different tools, the bevils or edges of which are all at the angle of sixty degrees, this may be considered as the medium angle of the paring, scraping and shearing tools

The cutting and scraping tools are supposed to be moving from A to B, which line represents the face of the work, or the tools may be considered to be at rest, and the work to be moving from B to A

Or, in turning, the tool may be supposed to remain fixed, and the circle to represent the moving surface of the work, one plane of the tool then becomes a tangent or radius


The shearing tools, if in pairs, are proceeding towards each other on the line CD, whilst AB still represents the face of the work. The single tools act on the same principle, but the body of the material, or the surface of the bench or support, supplies the resistance otherwise offered by the second tool.

The tools a c, f are bevilled or chamfered on both sides, the others from one side only, in these latter the general face of the tool forms the second side of the angle, and allowing for exag geration, both as to excess and deficiency, the diagram may be considered to represent the edges of the following tools

[a, b, c, d, Splitting and Paring Tools, proceeding from A to B]

a-The axe, or the cleaver for splitting

b—The side hatchet, adze, paring and drawing knives, paling chisels, and gouges, the razor, pen knife, spokeshave, the engravers graver, and most of the engineers cutting, turning and planing tools for metal

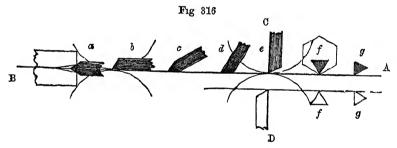

c—The turning chisel, for soft wood, the chipping chisels, for iron stone, &c

d—The joiner's chisels, and carving tools, used with the bevils downwards, the joiner's planes, the cross cut chisel for metal, and some other metal tools

[e, f, Seraping Tools, proceeding from A to B]

e—When single, the scraping tools for turning the hardwoods, ivory, and brass, the hand plane for metal, and when multiplied, the various saws, and files

f-When single, a triangular scraper for metal, and when

multiplied, the cross cut saw for wood, and also polygonal broaches or rimers with any number of sides, for metal

[e, f, Shearing Tools, proceeding from C to D]

e—When duplex, shears with edges from eighty to ninety degrees, commencing with delicate lace scissors for single threads, and ending with the engineer's shears for cutting iron bars and plates upwards of two inches thick, also duplex punches with rectangular edges, for punching engines and fly presses

e-When single, the carpenter's firmer and mortise chisels, the paring knife moving on a hinge, and cutting punches for

gun wadding and thin materials

f—When duplex, common nippers for wire, more generally, however, the blades are inclined, so that one bevil of each blade lies in one and the same plane, and which is vertical to A B, as at g g

f-When single, the smith's cutting off chisel

In practice, the tools differ from the constant angle of sixty degrees assumed in the diagram for the convenience of explanation, as the angles of all tools are determined by the hardness, and the peculiarity of fibre or structure, of the several substances upon which they are employed. The woods and soft fibrous materials, require more acute angles than the metals and hard bodies and the greater or less degree of violence to which the tools are subjected, greatly influences likewise the angles adopted for them

Thus, under the guidance of a little mechanism, the thin edge of a razoi, which is sharpened at an angle of about 15 degrees, is used to cut minute slices or sections of woods, in all directions of the grain, for the purpose of the microscope. But the car penter and others require more expeditious practice, and the first change is to thicken the edges of the tools to range from about 20 to 45 degrees, to meet the rough usage to which they are then exposed, whether arising from the knots and hard places in the woods, or the violence applied

In tools for iron and steel from 60 to 70 will be found a very common angle, in those for biass 80 to 90 in hexagonal broaches for metal it increases to 120, and in the octagonal broach some times employed the angle is still greater, in the circular broach

required by clock and watchmikers the angle disappears and the tool ceases either to cut or scrape, it resolves itself into an instrument acting by pressure or becomes a burnisher

To a certain extent, every different material may be considered to demand tools of a particular angle, and again the angle is somewhat modified by the specific mode of employment—these conditions jointly determine the practical angles suited to every case, or the angles of greatest economy, or most productive effect

The diagram shows that independently of the measure of the angle of the tool, we have to consider its position as legards the surface of the work the broad distinction being that in the paring tools the one face of the wedge or tool is applied nearly parallel with the face of the work, and in the scraping tools it is applied nearly at right angles as explained in the foregoing definitions Indeed the paring tools, if left to themselves, will in some cases assume the position named thus for example, if we place a penknife at an elevated angle upon a cedar pencil and attempt to carry it along as a carpenter's plane, the pen knife if held stiffly will follow the line of its lower side and dig into the wood but if it be held slenderly, it will swing round in the hand until its blade lies flat on the pencil and it will even require a little twisting or laising to cause it to penetrate the wood at all This disposition appears to be equally true, in the thin edges of the penknife or razor, and in the thick edges of the strong paning tools for metal

The action of a cutting tool in motion is twofold. The moving force is first exerted on the point of the wedge to sever or divide the substance particle from particle, the cohesion of the mass now directly opposes the entry of the tool, and keeps it back. But the primary motion impressed on the tool having severed a shaving, proceeds to bend or curl it out of the way, the shaving ascends the slope of the wedge, and the elasticity of the shaving confines the tool in the cleft, presses it against the lower side, disposes it to pursue that line, and therefore to dig into the substance

In pursuing the more detailed examination of different cutting tools employed in the mechanical arts, amongst the several classifications which might be adopted, it appears to the author to be the more generally useful to consider the various tools in separate

chapters under the following heads, namely, Chisels and Planes
—Turning tools—Boring tools—Screw cutting tools—Saws—
Files—Shears and Punches—as some of all these kinds of tools
may be found in every work 100m

The several chapters and sections will be commenced with the tools for the woods, which are perhaps the more commonly used by the amateur, the corresponding tools for metal will generally be then considered, and lastly some illustrations will be given of the same tools applied to various machines, still further to prove the uniformity of principle upon which they act, throughout these several circumstances


These comparative views may serve to show the similitude of principle in tools for like purposes, whether the tools be large or small, whether they be used for wood or metal, and either by hand or machinery, and in cases of indecision or difficulty, a glance through any one section or chapter may denote, either the most appropriate of the ordinary tools, or may occasionally suggest some new modification to suit a particular case, in imitation of the numerous conversions which will be already found to exist amongst the tools used in the constructive arts

SECT II —THE FORMS AND MOTIONS OF TOOLS, AS REGARDS THE PRODUCTION OF LINES, SUPERFICIES, AND SOLIDS

The principles of action of all cutting tools, and of some others, whether guided by hand or by machinery, resolve them selves into the simple condition, that the work is the combined copy of the form of the tool, and of the motion employed. Or in other words, that we exactly put into practice the geometrical definitions employed to convey to us the primary ideas of lines, superficies, and solids, namely, that the line results from the motion of a point, the superficies from the motion of a line, and the solid from the motion of a superficies

It therefore follows, as will be shown, that when the tool is a point having no measurable magnitude, that two motions must be impressed upon it one equivalent to the breadth, and another equivalent to the length of the superficies. When the tool is wide, so as to represent the one dimension of the superficies, say its breadth, then only one motion is to be impressed, say a motion equivalent to the length of the superficies, and these two are either rectilinear or curvilinear, accordingly as straight or curved superficies are to be produced

To illustrate this in a more familiar way than by the ideal mathematical conceptions, that a point is without magnitude, a line is without breadth, and a superficies without thickness, we will suppose these to be materialised, and to become pieces of wood and that the several results are formed through their agency on soft clay

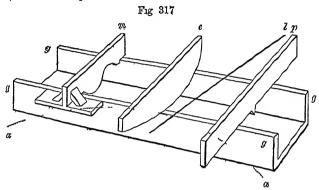

Thus supposing g g, to be two boards, the edges of which are parallel and exactly in one plane, and that the interval between them is filled with clay, by sliding the board p, along the edges of g g the point in p, would produce a line, and if so many lines were ploughed that every part of the clay were acted upon by the point a level surface would at length result. The line l, such as a string or wire, carried along g g, would at one process reduce the clay to the level of the edges of the box

Either the point or the line, might be applied in any direction whatever, and still they would equally produce the plane, provided that every part of the material were acted upon, and this, because the section of a plane is everywhere a right line, and which conditions are fulfilled in the elementary apparatus, as the edges of g are straight and give in every case the longitudinal guide and with l, the second line is formed at once, either with a string a wire or a straight board, but in p, the point requires a second or transverse guide, and which is furnished by the straight parts of the board p rubbing on the edges of g g, and therefore the point obtains both a longitudinal and a transverse guide, which were stated to be essential

The board c, with a circular edge, and m, with a moulding, would respectively produce circular and moulded pieces, which

would be straight in point of length in virtue of g g, the line of motion, and curved in width in virtue of c or m the lines of the tools. But now c and m, must always advance parallel with their starting positions, or the width of the moulding would vary, and this is true whenever curved guides or curved tools are employed, as the angular relation of the tool must be then constantly maintained, which it is supposed to be by the external piece of guide attached to m

Supposing g g, each to have circular edges, as represented by the dotted arc a, or to be curved into any arbitrary moulding, the same boards p, l, c, m, would produce results of the former transverse sections, but the clay would in each case present, longitudinally the curved figure of the curved longitudinal boards a a here also the line of the tool and the line of the motion would obtain in the result

If, to carry out the supposition, we conceive the board a a, to be continued until it produced the entire circle we should obtain a cylinder at one single sweep, if the wire l, were carried round at right angles to a a. But to produce the same result with the point p, it must be done either by sweeping it round to make circular furrows very near together, or by traversing the point from side to side, to make a multitude of contiguous lines, parallel with the axis of the cylinder. In either case we should apply the point to every part of the surface of the cylinder, which is the object to be obtained, as we copy the circle of a a, (which is supposed to be complete) and the line l, or the trans verse motion of p, which is equivalent to a line

But it is obvious that, in every case referred to, there is the choice of moving either the clay or the tool, without variation in the effect. If in respect to the circular guide a a, we set the clay to rotate upon its center, we should produce all the results without the necessity for the guide boards a a, as the axis being fixed, and the tool also fixed, the distance from the circum ference to the center would be everywhere alike, and we should obtain the condition of the circle by motion alone, instead of by the quide and such, in effect, is turning

An every day example of this identical supposition is seen in the potter's wheel, and the potter also, instead of always describing the lines of his works with his hands, as in sketching, occasionally resorts to curved boards or templets, as for making the mouldings for the base of a column, or any other circular ornament. But here as also in ordinary turning, we have choice, either to employ a figured tool or to impress on a pointed tool a path identical with the one section, for example the sphere is turned either by a semicircular tool applied parallel with the axis, or else by sweeping a narrow or pointed tool around the sphere in the same semicircular path.

Having shown that in every case, the superficies is a copy of the tool and of the one motion, or of the point and the two motions, it will be easily conceived that the numerous superficies and solids emanating from the diagonal spiral, oval, cycloid, epicycloid and other acknowledged lines which are mostly themselves the compositions of right lines and of circles, may be often mechanically produced in three different ways

First, by the employment of tools figured to the various shapes, and used with only one motion of traverse, secondly, by the use of figured guides, cams, or shaper plates by which the motion is constrained, just the same as p makes a right or a curved line in virtue of its straight or curved guide, and thirdly, by the employment of a point actuated by two motions, by the composition of which most geometric lines are expressed

Thus when uniform motions are employed, two rectilinear motions produce a diagonal to themselves, one circular and one continued right line motion give the spiral, the screw, and the cycloid, also if during one circular revolution, either the circle or the point make one oscillation in a right line, we obtain the oval—by two circular movements we obtain the epicycloid, by three motions the compound or double epicycloid, and so on And when one or both of the rectilinear or circular generating motions are variable as to velocity, we obtain many different kinds of curves, as the parabola, hyperbola, and others—and thence the solids, arising from the revolutions of some of these curves upon an axis

We produce the practical composition of any two lines or movements whether regular or irregular, by impressing these movements on the opposite extremities of an inflexible line or rod, from which rod we obtain a compounded line, if we trace the motion of a point inserted in any part of the rod, and we obtain a compounded superficies, if we copy the motion of the entire line. This may need explanation

Supposing that in fig 317, the back guide g g to remain a straight line, the front to become the circular arc a a the board p, being now traversed in contact both with the straight and curved edges, the point p would describe a line if it were close against the line g g or an arc if close against the arc a a mid way it would describe an arc of about half the original curvature. On the other hand, the line l would cut off the clay in a superficies, possessing at the three parts these same conditions, and merging gradually from the right line to the arc a

But a similar composition of the two lines or motions would occur, were the lines g g a a, to be exchanged for any others, similar or dissimilar parallel or oblique, or irregular in two directions and in mechanical practice we combine, in like manner two motions to produce a compound line or a compound superficies. Indeed in many cases there is no alternative but to impart to two edges g a of a block the marginal outlines of the superficies and then generally by hand labour, to reduce all the intermediate portions under the guidance of a strught edge applied at short intervals upon the two edges which thus become compounded or melted together in the superficies. Numbers of irregular surfaces can be produced by this mode alone

In fine, in mechanical processes, we translate the mathe matical conceptions of the rectilinear, circular, and mixed motions of points and lines, into the mechanical realities of rectilinear, circular, and mixed motions of pointed or linear tools

It is not imperative, however, that the tools should have but one fixed point or edge, as without change of principle a succes sion of similar points may be arranged in a circle, to constitute a revolving cutter which by its motions will continually present a new point, and multiply the impldity of the effect. In most cases, the introduction of a tool with a figured outline, cancels the necessity for the means otherwise required to generate such figured line by the motion of a point, and a tool with a figured superficies, cancels also the remaining motion required to produce the superficies, and the tool is simply impressed as a stamp or die

In tracing the method of applying these theoretical views to the explanation of the general employment of cutting tools, or the practice of the workshop, we may safely abandon all apprehension of complexity, notwithstanding the almost bound less variety of the elements of inachinery, and other works of cutting tools. For although all the regular figures and solids referred to, are in reality met with, besides a still greater number of others of an irregular or arbitrary character, still by far the greater majority of pieces resolve themselves into very few and simple parts, namely, solids with plane superfices, such as prisms, pyramids, and wedges, and solids with circular superficies, such as cylinders, cones, and spheres. These are frequently as it were strung together in groups, either in their entire or dissected states, but as they are only wrought one surface at a time, the whole inquiry may be considered to resolve itself into the production of superficies

And it may be further stated that the difference between the modes of accomplishing the same results by hand tools or by machinery bears a very close resemblance to the difference between the practices, of the artist who draws the right line and circle by aid of the unassisted hand, and of the mechanical draftsman, who obtains the same lines with more defined exact ness under the guidance of the rule and compasses

The guide principle is to be traced in most of our tools. In the joiner's plane it exists in the form of the stock or sole of the plane, which commonly possesses the same superficies as it is desired to produce. For instance, the carpenter's plane used for flat surfaces is itself flat, both in length and width, and therefore furnishes a double guide. The flat file is somewhat under the same circumstances, but as it cuts at every part of its surface, from thousands of points being grouped together it is more treacherous than the plane, as regards the surface from which it derives its guidance, and from this and other reasons, it is far more difficult to manage than the carpenter's plane

In many other cases the cutting instrument and the guide are entirely detached, this is strictly the case in ordinary turning, in which the circular guide is given by the revolution of the lathe mandrel which carries the work the surface of which becomes the copy of the tool, or of the motion impressed upon the tool, either by the hand of the workman under the guidance of his eye alone, or by appropriate mechanism

When the lathe is employed under the most advantageous circumstances to produce the various geometrical solids or

figures, the tool is placed under the guidance of a ruler or rather of a slide, by which its path is strictly limited to a recti linear motion. Thus for a cylinder the slide is placed exactly parallel with the rotary axis of the mandrel, and for a plain flat surface the tool is moved on a slide at right angles to the axis. Generally two slides fixed in these positions are attached to the lathe to carry and guide the tool, the machine being known as the sliding rest, but mostly the one slide only is used as a traversing or directional slide for guiding the tool, the other as an adjusting or position slide, for regulating the penetration of the tool into the work

Sometimes the two slides are moved simultaneously for the production of cones, but more generally the one slide is placed oblique and used alone. The lather is employed with great effect in producing plane surfaces, but the more modern engine the planing machine, the offspring of the slide or traversing lather recently adverted to, is now also very much employed for all kinds of rectilinear works.

The planing machine being intended principally for retilinear solids of all kinds, its movements are all rectilinear, and these are in general restricted to three, which are in the same relation to each other as the sides of a cube, namely, two are horizon tal and at right angles to each other, and the third is vertical, and therefore perpendicular to the other two. The general outline of the machine will be conceived by imagining a horizontal railway to take the place of the revolving axis of the lathe, and the slide rest of the lathe to be fixed vertically against the face of a bridge stretching over the railway

In the general structure of this most invaluable machine, the railway is the cutting slide, upon which the work is slid to and fro. For producing a horizontal surface, the horizontal slide is employed for traversing the tool across the face of the work, which is thus reduced by ploughing a series of parallel grooves, not exceeding in distance the width of the pointed tool, so that first the line, and then the surface arise, exactly as in the geome trical suppositions. For vertical planes, the vertical is the traversing slide, the horizontal the adjusting, and for oblique planes the vertical slide is swivelled round to the assigned angle, the imaginary railway being employed in all cases to give the cutting motion.

To advance into greater detail would be to encroach on the subject of the succeeding chapters, although it may be added, that when we examine into almost any machine employed in cutting, it will be found that the end to be obtained is always a superficies, either plane or curved, and which superficies reduced to its elementary condition presents length and breadth

When, therefore we have put on one side the mechanism required for connecting and disconnecting the engine with the prime mover whether animal steam, or other power, it will be found that when the superficies is produced by a pointed tool, the primary motions resolve themselves into two, which may be considered representative of length and breadth The velocity of the one pilmary motion, is suited to the speed pioper for cutting the material with the most productive effect, which for the metals is sometimes as low as ten or twenty feet per minute, measured at the tool and for the woods the speed is above ten or twenty times as great * The velocity of the other primary motion is generally very small, and often intermittent, and it becomes a mere creep or traverse motion, by which the pointed tool is gradually moved in the second direction of the superficies, under formation

In producing circular bodies one of these primary motions becomes circulating or rotary, and in complex or irregular forms, an additional movement, making in all three, or sometimes four are compounded, and lastly, when linear or figured tools are employed one of the motions is generally expunged

^{*} The principal limit of velocity in cutting machines appears to be the greatest speed the tool will safely endure without becoming so heated by the friction of separating the fibres as to lose its temper or proper degree of hardness

The cohesion of iron being very considerable a velocity materially exceeding ten to twenty feet per minute would soften and discolour the tool whereas in general the tools for iron are left nearly or quite hard. Brass having much less cohesion than iron allows a greater velocity to be used lead and tin admit of still more speed and the fibrous cohesion of the soft woods is so small that when the angles of the tools are favourable there is hardly a limit to the velocity which may be used. Water soap and water oil milk and other fluids are in many cases employed and especially with the more fibrous metals for the purpose of lubricating the cutting edges of the tools to keep down the temperature the fluids reduce the fluition of separating the fibres and cool both the tool and work thereby allowing an increase of velocity, and at the same time they lessen the deterioration of the instrument and which when blunted excites far more friction and is likewise more exposed to being softened than when keen and in perfect working order. There are however various objections to the constant use of lubricating fluids with cutting tools.

The other movements of cutting machines may be considered as secondary, and introduced either to effect the adjustment of position at starting, or the changes of position during the progress of the work, or the resettings by which the same superficies is repeated as in the respective sides of a prism, or the teeth of a spur wheel, which may be viewed as a complex prism

The above two or three movements may in general be im pressed wholly upon the tool, wholly upon the work, or partly upon each, and which explains the very many ways which, in cases of simple forms, may be adopted to attain the same result

In numerous instances likewise, all the movements are as it were linked together in a chain, so that they may recur at proper intervals, without the necessity for any other adjustment than that which is done prior to the first starting, such are very appropriately called self acting machines, and these, in many cases, give rise to very curious arrangements and combinations of parts, quite distinct from the movements abstractedly required to produce the various superficies and solids, in which the mathematician and mechanician from necessity exactly agree, when their respective speculations are sifted to their elementary or primary laws, which are few, simple, and alike for all

Mr Nasmyth has written an interesting paper, entitled, "Remarks on the Introduction of the Slide Principle, in Tools and Machines employed in the production of Machinery *

This principle although known for a far greater period, has within less than half a century, and in many respects even within less than the fourth of a century, wrought most wonderful changes in the means of constructing mechanism, possessed of nearly mathematical accuracy. The whole of this is traced to the employment of the two, or the three slide movements, to which method Mr. Nasmyth has judiciously applied the term "Slide Principle," but the object in this place is rather to examine in detail the principles and practices, than to refer to the influence these have had on manufacturing industry, and thence on the general condition of mankind, and upon our own nation in particular

^{*} See Buchanan's Mill Work, by G. Rennie, FRS 1841 Page 393

CHAPTER XXIII

CHISELS AND PLANES

SECT I -INTRODUCTION, BENCH PLANES

Ir we drive an axe or a thin wedge, into the center of a block of wood, as at a, fig 318, it will split the same into two parts through the natural line of the fibres leaving rough uneven surfaces, and the rigidity of the mass will cause the rent to precede the edge of the tool The same effect will partially occur when we attempt to remove a stout chip from off the side of a block of wood with the hatchet adze, paring or diawing knife, the paring chisel, or any similar tool So long as the chip is too ligid to bend to the edge of the tool, the lent will precede the edge, and with a naked tool, the splitting will only finally cease when the instrument is so thin and sharp, and it is applied to so small a quantity of the material, that the shaving can bend or ply to the tool, and then only will the work be cut or will exhibit a true copy of the smooth edge of the instrument, in opposition to its being split or rent, and consequently showing the natural disruption or tearing asunder of the fibres


In fig 318 are drawn to one scale several very different paring tools, which agree however in similitude with the type, b fig 316 page 460, and also corroborate the remark on page 462, that in the paring tools, the one face of the wedge or tool is applied nearly parallel with the face of the work." In tools ground with only one chumfer, this position not only assists in giving direction to the tool, but it also places the strongest line of the tool exactly in the line of resistance, or of the work to be done

For example the axe or hatchet with two bevils, a fig 318, which is intended for hewing and splitting, when applied to paring the surface of a block, must be directed at the angle a which would be a much less convenient and less strong position than b, that of the side hatchet with only one chamfer but for paring either a very large or a nearly horizontal surface, the side

hatchet in its turn is greatly inferior to the adze c, in which the handle is elevated like a ladder, at some 60 or 70 degrees from the ground, the preference being given to the horizontal position

for the surface to be wrought. The instrument is held in both hands, whilst the operator stands upon his work in a stooping position the handle being from twenty four to thirty inches long, and the weight of the blade from two to four pounds

The adze is swung in a circular path almost of the same curvature as the blade, the shoulder joint being the center of motion, and the entire arm and tool forming as it were one inflexible radius, the tool there fore makes a succession of small aics, and in each blow the arm of the workman is brought in

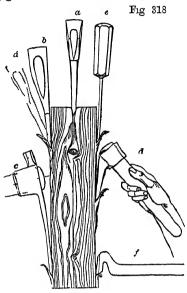

contact with the thigh which thus serves as a stop to prevent accident. In coarse preparatory works, the workman directs the adze through the space between his two feet, he thus surprises us by the quantity of wood removed, in fine works, he frequently places his toes over the spot to be wrought, and the adze penetrates two or three inches beneath the sole of the shoe, and he thus surprises us by the apparent danger yet perfect working of the instrument, which in the hands of the shipwright in particular, almost rivals the joiner's plane at is with him the nearly universal paring instrument, and is used upon works in all positions

The small Indian adze or Bassoola's d fig 318, in place of being cucular like the European adze, is formed at a direct angle of about 45 or 50 degrees, its handle is very short, and it is used with great precision by the nearly exclusive motion of the elbow joint * In order to grind either of these adzes, or per cussive

^{*} This very useful instrument (says Sir John 1 obison) varies a little in different districts in weight and in the angle which the cutting face forms with the line of the handle, but the form shown is the most general and the weight averages about

chisels, it is necessary to remove the handle, which is easily accomplished as the eye of the tool is larger externally as in the common pickaxe, so that the tool cannot fly off when in use, but a blow on the end of the handle easily removes it

The chisel e, admits of being very carefully placed, as to position, and when the tool is strong, very flat and not tilted up it produces very true surfaces as seen in the mouths of planes. The chisel when applied with percussion, is struck with a wooden mallet but in many cases it is merely thrust followed by its handle. It will shortly be shown that various other forms of the handle or stock of the chisel, enable it to receive a far more defined and effective thrust which give it a different and most important character. The paring knife fig. 8, p. 26, Vol I, exhibits also a peculiar but most valuable airangement of the chisel, in which the thrust obtains a great increase of power and control and in the drawing knife the narrow transverse blade and its two handles form three sides of a rectangle, so that it is actuated by traction instead of by violent percussion or steady thrust


The most efficient and common paring tool for metal, namely f, has been added to fig 318 for comparison with the paring tools for wood, its relations to the surface to be wrought are exactly the same as the rest of the group, notwithstanding that the angle of its edge is doubled on account of the hardness of the material, and that its shaft is mostly at right angles, to meet the construction of the slide rest of the lathe or planing machine

The chisel, when inserted in one of the several forms of stocks or guides, becomes the plane, the general objects being, to limit the extent to which the blade can penetrate the wood, to provide a definitive guide to its path or direction, and to restrain the splitting in favour of the cutting action

In general, the sole or stock of the plane is in all respects an

I lb 12 oz The length of handle is about twelve or thirteen inches and in use it is grasped so near the head that the forefinger rests on the metal the thumb nearly on the back of the handle the other ingels brasp the front of it the nails approaching the ball of the thumb. The wrist is held firmly the stroke being made principally from the elbow the inclination of the cutting face being nearly a tangent to the circle described by the instrument round the elbow joint as a center the exact adjustment being made by the grasp and the inclination of the wrist which is soon acquired by a little practice. In this way very hard woods may be dressed for the lathe with a degree of ease and accuracy not attainable with the small axe used in this country.

accurate counterpart of the form it is intended to produce, and it therefore combines in itself the longitudinal and the transverse sections, or the two guides referred to in the theoretical diagram page 464, and the annexed figure 319 the parts of which are all drawn to one scale, may be considered a parallel diagram to 317, page 464, so far as regards planes

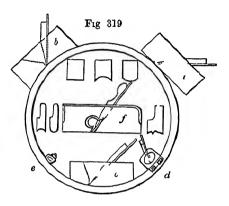

Thus, although convex surfaces, such as the outside of a hoop may be wrought by any of the straight planes, applied in the direction of a tangent as at a, it is obvious the concave plane, b, would be more convenient. For the inside of the hoop, the radius of curvature of the plane must not exceed the radius of the work thus c, the compass plane, would exactly suit the curve, and it might be used for larger diameters, although in a less perfect manner. For the convenience of applying planes to very small circles, some are made very narrow or short, and with transverse handles such as d, the plane for the hand rails of staircases, the radius of its curvature being three inches, it resembles the spokeshave e, as respects the transverse handles although the hand rail plane has an iron, wedge, and stop, much like those of other planes

The sections of planes, are also either straight, concave, convex, or mixed lines, and suited to all kinds of specific mouldings, but we have principally to consider their more common features, namely, the circumstances of their edges and guides, first of those used for flat surfaces, called by the joiners, bench planes secondly, the grooving planes, and thirdly, the moulding planes

The various surfacing planes are nearly alike, as regards the arrangement of the non-the principal differences being in their magnitudes. Thus the maximum width is determined by the average strength of the individual, and the difficulty of main taining with accuracy the rectilinear edge. In the ordinary bench planes the width of the iron ranges from about 2 to 21 miches.*


The lengths of planes are puncipally determined by the degree of straightness that is required in the work, and which may be thus explained The joiners plane is always either balanced upon one point beneath its sole, or it rests upon two points at the same time, and acts by cropping off these two points, with out descending to the hollow intermediate between them therefore clear that by supposing the work to be full of small undulations the spokeshave, which is essentially a rany short plane, would descend into all the hollows whose lengths were greater than that of the plane, and the instrument is therefore commonly used for curved lines But the greater the length of the plane, the more nearly would its position assimilate to the general line of the work, and it would successively obliterate the minor errors of undulations, and provided the instrument were itself rectilinear, it would soon impart that character to the edge or superficies submitted to its action The following table may be considered to contain the ordinary measures of surfacing planes

Names of Planes	Lengths m inches	Widths in inches	Widths of Irons
Modelling Planes like Smoothing Planes	1 to 5	- 1 to 2	— to 1½
Ordinary Smoothing Planes	$6\frac{1}{2}$ to 8	28 to 38	- 13 to 23
Rebate Planes	$9\frac{1}{2}$	§ to 2	§ to 2
Jack Planes	12 to 17	$-2\frac{1}{2}$ to 3	- 2 to 21
Panel Planes	$14\frac{1}{2}$	— 3 1	<u> </u>
Trying Planes	20 to 22	3¼ to 3 €	$-2\frac{3}{8}$ to $2\frac{1}{5}$
Long Planes	24 to 26	3 5	- 2 5
Jointer Planes	28 to 30	3출	- 2 ³ / ₄
Coopers Jointer Planes	60 to 12	- 5 to 54	— 3¹ to 3¾

The succession in which they are generally used is the jack plane for the coarser work the trying plane for finer work and trying its accuracy and the smoothing plane for finishing

^{*} The non is scarcely a proper name for the plane iron, which is a cuttor of blade composed partly of iron and steel but no confusion can arise from the indiscriminate use of any of these terms

The diagram, fig 320, is one quarter the full size, and may be considered to represent the ordinary surfacing planes, the mouths of which are alike, generally about one third from the front of the plane, and thus constituted. The line a, b, is called the sole c, d, upon which the blade is supported, is the bed, and this in planes of common pitch, is usually at an angle of 40° with the perpendicular

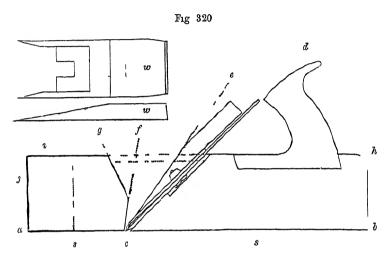

The mouth of the plane is the narrow aperture between the face of the iron, and the line c, f, which latter is called the wear the angle between these should be as small as possible, in order that the wearing away of the sole, or its occasional correction, may cause but little enlargement of the mouth of the plane, at the same time the angle must be sufficient to allow free egress for the shavings, otherwise the plane is said to choke. The line g, is called the front, its angle is unimportant, and in practice it is usually set out one quarter of an inch wider on the upper surface than the width of the iron

The wedge of the plane which fixes the iron, is commonly at an angle of 10°, and it is slightly driven between the face of the iron and the shoulder or abutment c e. It is shown by the two detached views that the wedge w, is cut away at the central part, both to clear the screw which connects the double iron, and to illow room for the escape of the shavings. The wedge is loosened by a moderate blow, either on the end of the plane at h, on the


top at i, or by tapping the side of the wedge, which may be then pulled out with the fingers a blow on the front of the plane at j, sets the iron forward or deeper but it is not resorted to

In all the bench planes, the non is somewhat narrower than the stock, and the mouth is a wedge-formed cavity, in some of the narrow planes the cutting edge of the non extends the full width of the sole, as in the rebate plane f fig 319, page 475, in these and others, the narrow shaft of the iron and the thin wedge alone proceed through the stock and there is a curvilinear mouth extending through the plane—the mouth is taper, to turn the shavings out on the more convenient side—When the planes only cut on the one part of the sole, as in fig 332 page 485 the angular mouth extends only part why through the plane, and the curvilinear perforation is uncalled for

In the diagram, fig 320, when the stock terminates at the dotted line, s s, it represents the smoothing plane, when it is of the full length, and furnished with the handle or toat, it is the jack plane or panel plane, the still longer planes have the toat further removed from the iron, and it is then of the foilin shown in fig 330, page 483

Fig 321 represents, one eighth the full size, a very effective plane, which is commonly used on the continent for roughing

Fig 321




out, or as our jack plane, the horn h, being intended for the left hand, whilst the right is placed on the back of the stock. The Indians and Chinese bore a hole through the front of the plane for a transverse stick, by which a boy assists in pulling the plane across the work. When the plane is very large, it is by the Chinese,

and others, placed at the end of the bench at an angle, and allowed to rest on the ground, whilst the work is slid down its face, and a similar position is employed by the coopers in our own country for planing the staves of casks, the plane being in such cases, five or six feet long and very unwieldy, the upper part is supported on a prop, and the lower rests on a transverse piece of wood or sleeper

The amount of force required to work each plane is dependent on the angle and relation of the edge on the hardness of the material, and on the magnitude of the shaving, but the required force is in addition greatly influenced by the degree in which the shaving is bent for its removal in the most perfect manner

The diagrams 322 to 326 represent of their full size, paits of the irons and mouths of various planes, each in the act of removing a shaving. The sole or surface of the plane rests upon the face of the work, and the cutter stands as much in advance of the sole of the plane, as the thickness of the shaving, which is in each case so bent as to enable it to creep up the face of the inclined iron through the nairow slit of the plane called its mouth the width of which determines the extent to which the fibre of the wood can tear up or split with the grain

The spokeshave, fig 322, cuts perhaps the most easily of all the planes, and it closely assimilates to the penknife, the angle of the blade is about 25 degrees, one of its planes lies almost in contact with the work, the inclination of the shaving is slight, and the mouth is very contracted. The spokeshave works very easily in the direction of the grain, but it is only applicable to small and rounded surfaces and cannot be extended to suit large flat superficies as the sole of the plane cannot be cut away for such an iron, and the perfection of the mouth is comparatively soon lost in grinding the blade

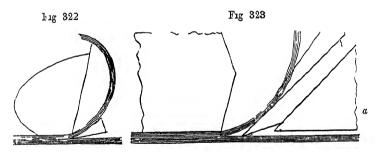

The diagrams, figs 323, 4 and 5, suppose the plane nons to be ground at the angle of 25° , and to be sharpened on the more refined oilstone at 35° so as to make a second bevel or slight facet as shown by the dotted lines a in each of the figures—the irons so ground are placed at the angle of 45° or that of common pitch it therefore follows, that the ultimate bevel, which should be very narrow, lies at an elevation of 10° from the surface to be planed

Fig 323 represents the mouth of an old jack plane, from the sole of which about half an inch of wood has been lost by wear

and correction, which is no uncommon case. The wide mouth allows a partial splitting of the fibres before they creep up the face of the single iron, this plane works easily, and does not greatly alter the shavings, which come off in spiral curls, but the work is left rough and torn


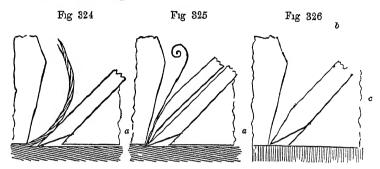


Fig 324, a similar but less worn plane with a closer mouth allows less of the splitting to occur, as the shaving is more sud dealy bent in passing its nairower mouth, so that the cutting now begins to exceed the splitting, as the wood is held down by the closer mouth—the shaving is more broken and polygonal, but the work is left smoother

The same effects are obtained in a much superior manner in the planes with double irons, such as in fig 325, the top iion is not intended to cut but to present a more nearly perpendicular wall for the ascent of the shavings, the top iron more effectually breaks the shavings, and is thence sometimes called the break iron

Now therefore, the shaving being very thin, and constrained between two approximate edges, it is as it were bent out of the way to make room for the cutting edge, so that the shaving is removed by absolute *cutting*, and without being in any degree split or rent off

The compound or double iron is represented detached, and of half size in fig 327 in this figure the lower piece c, is the one



used for cutting, the upper piece t or the top iron, has a true

edge, which is also moderately sharp, the top non is placed from one sixteenth to one fifteeth of an inch from the edge of the cutter, the two are held together so closely by the screw which passes through a long mortise in c and fits in a tapped hole in t that no shaving can get between them

The constant employment of the top iron in all available cases, shows the value of the improvement, and the circumstances of the plane working the smoother but harder, when it is added and the more so the closer it is down, demonstrate that its action is to break or bend the fibres. This is particularly observable in the coarse thick shavings of a double iron jack plane, compared with those of the same thickness from a single iron plane, the latter are simply spiral and in easy curves whereas those from the double iron are broken across at short intervals, making their character more nearly polygonal, and the same difference is equally seen in thinner shavings, although of course less in degree


Fig 326 represents the iron of a plane intended "for the use of cabinet makers and others, who require to cut either hard or coarse grained wood,' the upper bevel given to the iron, being considered to dispense with the necessity for the top iron but it is obviously much more difficult to produce a true right lined edge, by the meeting of two planes, each subject to error in sharpening, than when one exists permanently flat as in the broad surface of the blade *

The same edge may be obtained by a blade with a single chamfer, the flat side of which is placed in either of the dotted positions of fig 326. The first, or b, is that previously in common use in the ordinary moulding planes for mahogany, and c is almost the position of the bed for the iron of the mitte plane, also previously common in all three planes, the ultimate angle of the face of the cutter is just 60 degrees from the horizontal

Fig 328 represents the mouth of the mitre plane full size, and fig 329 the entire instrument one eighth size. The stock is much less in height than in ordinary planes, and the iron lies at an angle of about 25°, and is sharpened at about the ordinary angle of 35°, making a total elevation of 60°, which, together with the delicate metallic mouth, render the absence of the top

^{*} See Transactions of the Society of Arts, 1825 vol xlin p 85

non unimportant, even when the plane is used lengthways of the fibres, although its ostensible purpose is to plane obliquely across their ends, as in the formation of mitie joints

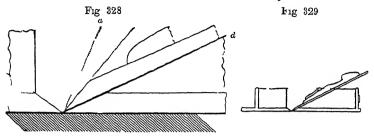

In all ordinary planes the mouth gets wider as the iron is ground away because of the unequal thickness or taper form of the blade as seen at c, fig 327. In the mitre plane this is avoided by placing the chamfer upwards, now therefore the position of the blade is determined by its broad flat face which rests on the bed of the instrument d, and maintains one constant position as regards the mouth, uninfluenced by the gradual loss of thickness in the iron

The smoothing and trying planes are also made with metal soles, and with single irons of ordinary angles, as one great pur pose of the top iron is to compensate for the enlargement of the mouth of the plane by wear, this defect is almost expunged from those with iron soles, and which are gradually becoming common, both with single and with double irons. See Appendix, Note AH, page 978


Some variation is made in the angles at which plane irons are inserted in their stocks. The spokeshive is the lowest of the series, and commences with the small inclination of 25 to 30 degrees, and the general ingles and purposes of ordinary planes, are nearly as follows. Common pitch, or 45 degrees from the horizontal line is used for all the bench planes for deal and similar soft woods. York pitch or 50 degrees from the horizontal for the bench planes for mahogany, wainscot, and hard or stringy woods. Middle pitch, or 55 degrees, for moulding planes for deal, and smoothing planes for mahogany, and similar woods. Half pitch, or 60 degrees, for moulding planes for mahogany, and woods difficult to work, of which birds eye maple is considered one of the worst.

Boxwood and other close hard woods, may be smoothly scraped, if not cut, in any direction of the grain, when the angle constituting the pitch entirely disappears, or with a common smoothing plane in which the cutter is perpendicular, or even leans slightly forward, this tool is called a scraping plane and is used for scraping the ivory keys of plano fortes, and works inlaid with ivory brass, and hardwoods, this is quite analogous to the process of turning the hardwoods

The cabinet maker also employs a scraping plane with a perpendicular iron, which is grooved on the face, to present a scries of fine teeth instead of a continuous edge, this which is called a toothing plane, is employed for roughing and scratching veneers and the surfaces to which they are to be attached, to make a tooth for the better hold of the glue

The smith's plane for brass, iron, and steel, fig 330, has likewise a perpendicular cutter, ground to 70 or 80 degrees, it is adjusted by a vertical sciew, and the wedge is replaced by an end screw and block, as shown in the figure which is one eighth size. In the planes with vertical mons, the necessity for the narrow mouth ceases, and in the smith's plane some of the


nons, or more properly cutters, are also grooved on the faces, by which their edges are virtually divided into several narrow pieces, this enables the instrument to be more easily employed in roughing out works, by abstracting so much of the width



of the iron, and by giving it a greater degree of penetration, but the finishing is done with smooth edged cutters, and those not exceeding from five eighths of an inch to one inch wide

It is well known that most pieces of wood will plane better from the one end than from the other, and that when such pieces are tuined over, they must be changed end for end likewise the necessity for this will immediately appear, if we consider the shade lines under the plane irons a, b, fig 331, to represent the natural fibres of the wood which are rarely parallel with the fice of the work. The plane a, working with the grain,

would cut smoothly, as it would rather piess down the fibics than otherwise, whereas b would work against the grain, or would meet the fibres cropping out, and be libble to tear them up

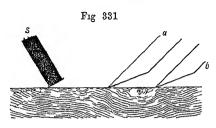

It was explained in Chap IV, Vol I that the handsome characters of showy woods, greatly depend on all kinds of in regularities in the fibres so that the conditions a and b fig 331, continually

occui in the same piece of wood and in which we can therefore scarcely produce one straight and smooth cut in any direction Even the most experienced workmen will apply the smoothing plane at various angles across the different parts of such wood according to his judgment in extreme cases, where the wood is very curly knotty, and closs grained the plane can scarcely be used at all, and such pieces are finished with the steel scraper

This simple tool was originally a piece of broken window glass and such it still remains in the hands of some of the gun stock makers but as the cabinet maker requires the rectilinear edge he employs a thin piece of saw plate, which is represented black and highly magnified at s, fig 331. The edge is first sharpened at right angles upon the oilstone and it is then mostly but nished, either square or at a small angle so as to throw up a trifling buil, or wire edge. The scraper is held on the wood at about 60°, and as the minute edge takes a much slighter hold, it may be used where planes cannot be well applied. The scraper does not work so smoothly as a plane in perfect order upon ordinary wood and as its edge is rougher and less keen it drags up some of the fibres and leaves a minute roughness, interspersed with a few longer fibres.


SECT II -GROOVING PLANES

We may plane across the grain of hard mahogany and box wood with comparative facility, as the fibres are packed so closely, like the loose leaves of a book when squeezed in a press that they may be cut in all directions of the grain with nearly equal facility, both with the flat and moulding planes But the weaker and more open fibres of deal and other soft woods

cannot withstand a cutting edge applied to them parallel with themselves or laterally, as they are torn up, and leave a rough unfinished surface. The joiner uses therefore, for deal and soft woods, a very keen plane of low pitch, and slides it across obliquely, so as to attack the fibre from the one end, and virtually to remove it in the direction of its length, so that the force is divided and applied to each part of the fibre in succession.

The moulding planes cannot be thus used, and all mouldings made in deal and woods of similar open soft grain, are consequently always planed lengthways of the grain, and added as separate pieces. As however many cases occur in carpentry in which rebates and grooves are required directly across the grain of deal, the obliquity is then given to the *won* which is inserted at an angle, as in the skew rebate and fillister and the stock of the plane is used in various ways to guide its transit

Many of these planes present much ingenuity and adaptation to their particular cases for example fig 332 is the side view, and fig 333 the back of the side fillister, which is intended to

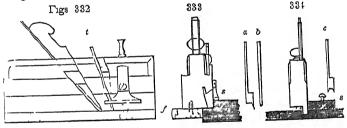


plane both with and across the grain, as in planing a ichate around the margin of a panel. The loose slip, or the fence f is adjusted to expose so much of the oblique iron as the width of the rebate, the screw stop s, at the side, is raised as much above the sole of the plane as the depth of the rebate, and the little tooth t, or scoring point (shown detiched in two views a, b), precedes the bevelled iron, so as to shear or divide the fibrics as with the point of a penkinfe, to make the perpendicular edge keen and square. This plane is therefore a four fold combination of two measures and two cutters. The oblique iron, and the tooth or cutter, are pretty constantly met with in the planes used across the grain

Others of these planes have less power of adjustment, for

instance the glooving plane fig 334 for planing across the grain, has two separate teeth or else a single tooth with two points c, in addition to the cutting non which is commonly placed square across the face of the plane—the groove is only used for the reception of a shelf its sides are therefore the more important parts, and the obliquity of the iron may be safely omitted. The fence can no longer be a part of the instrument, as it is often used in the middle of a long piece, a wooden straight edge s, is therefore temporarily nailed down to guide the plane, and the stop is sometimes a piece of boxwood fitted stiffly in a mortise through the stock, at other times it is adjusted by a thumb screw, as in the figure 334

The plough, fig 335, is a grooving plane, to work with the grain it has similar powers to the fillister, but with a greater horizontal range. The width of the groove is determined by that of the blade, of which each plough has several they are retained in the perpendicular position by a thin iron plate, which enters a central angular groove in the back of the blade. The teeth or scoring points are now uncalled for as the non works perfectly well the lengthway of the fibre. The screw stop is the same as before but the fence f is built upon two trans verse stems s, one only seen, passing through mortises in the body of the plane, and fixed by wedges. In the German plough the position of the fence f is determined and maintained by two wooden screws, instead of the stems s s and there are two wooden nuts to each screw, one on each side of the stock of the plough

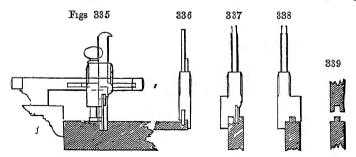

Other grooving planes for working with the grain are also made without teeth, examples of which may be seen in the drawer bottom plane 336, and the slit deal planes, of which 337 makes the groove, and 338 the tongue, used for connecting

boards for partitions and other purposes, with the groove and tongue joint 339 The planes of this class being generally used for one specific purpose and measure, are unprovided with loose parts, as they are worked until the sole of the plane, or some of its edges come in contact with the wood and stop the further progress of the cutter

Fig 340, the reglet plane, is of this kind it derives its name from being employed in making the parallel slips of wood, or reglet used by the printer for the wide separation of the lines of metal type—the adjustable fences are screwed fast, as much in advance of the sole of the plane as the required thickness of the reglets or rules which are then planed away until, from the slips resting on the bench, the tool will cut no longer

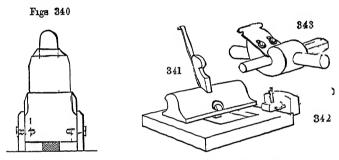


Fig 341 is a router plane, it has a broad surface carrying in its center one of the cutters belonging to the plough, it is used for levelling the bottoms of cavities, the stock must be more than twice the width of the recess, and the projection of the iron determines the depth, the sides of the cavities are prepared before hand with the chisel and mallet. The ordinary name for this plane is not remarkable for its propriety or elegance, it is generally called the "old woman's tooth. See Appendix, Note AI, page 979

The carpenters gages, for setting out lines and grooves parallel with the margin of the work are closely associated with the system of fences or rails. The stem of the gage fig 342, is retained in the head, or stock, by means of a small wedge, and the cutter is fixed in a hole at right angles to the face of the stem, by another wedge. The marking gage, for setting out lines, has a simple coincal point, the cutting gage, for cutting veneers and thin wood, has a lancet-shaped knife, and is a

very effective tool, the router gage for inlaying small lines of wood and brass, has a tooth like a narrow chisel

There are other forms of gages, some of these have screw adjustments, in the most simple, the stem is a wooden screw, flattened on one side, and the herd of the gage consists of two wooden nuts, which become fixed when screwed fast against each other. The mortise gage, which is much used, has two points that may be adjusted to scribe the widths of mortises and tenons. In the bisecting gage there are two sliding pieces or heads which are made to embrace the object to be bisected and the scribing point is in the center of two equal arms jointed respectively to the two sliding heads.*

The cooper's croze is used for making the grooves for the heading of casks after the ends of the staves have been levelled by a tool called a sun plane like a jack plane, but of a circular plan. The croze is similar to the gages, except that it is very much larger the head is now nearly semicircular, and terminates in two handles, the stem, which is proportionally large is also secured by a wedge, but the cutter is composed of three or four saw teeth, closely followed by a hooked router, which sweeps out the bottom of the groove

The banding planet is allied to the gages, and is intended for cutting out grooves and inlaying strings and bands in strught and circular works, as in the rounded corners of prano fortes and similar objects. It bears a general resemblance to the plough fig 335, but it is furnished in addition with the double tooth c of the grooving plane, fig 334. In the banding plane, the central plate of the plough is retained as a guide for the central positions of the router and cutter, which are inserted, so as to meet in an angle of about 80 degrees, between two short projections of the central plate, the whole of the parts entering the groove are compressed within the length of one inch, to pass through curvatures of small radius, there are various cutters and fences, both straight and circular, according to the nature of the work. See Appendix Note AJ, page 979

Fig 343 is a plane which is the link betwixt carpentity and

^{*} See H R Palmer's gage for marking center lines —Trans Soc of Arts, 1813 vol xxxx p 248

⁺ Mr R Onwms banding plane —Trans Soc of Aits 1817 vol axxv p 122

turning, the conical hole in the plane is furnished with a cutter placed as a tangent to the circle, so that the wood enters in the rough octagonal form, and leaves it rounded, fit for a broom, an umbrella handle, or an office rule; sometimes either the work or plane is driven by machinery, with the addition of one or two preparatory gouges, for removing the rougher parts

SECT III -MOULDING PLANES


All the planes hitherto considered, whether used parallel with the surfaces, as in straight works, or as tangents to the curves, as in curved works, are applied under precisely the same circum stances as regards the angular relation of the mouth, because the edge of the blade is a right hie parallel with the sole of the plane, but when the outline of the blade is curved, some new conditions arise which interfere with the perfect action of the instrument. It is now proposed to examine these conditions in respect to the semicicle, from which the generality of mouldings may be considered to be derived.

In the astragal, a, b c, d, e, fig 344, a small central portion at c, may be considered to be a horizontal line, two other small portions at b, and d, may be considered as parts of the vertical dotted lines, b f, and d, g, and the intermediate parts of the semicircle are seen to merge from the horizontal to the vertical line

The reason why one moulding plane figured to the istragal cannot, under the usual construction, be made to work the vertical parts of the moulding with the same perfection as the horizontal, consists in the fact that whereas the ordinary plane iron presents an angle of some 45 to 60 degrees to the sole of the plane, which part is meant to cut, it presents a right angle to the side of the plane, which part is not meant to cut. Thus if the parts of the iron of the square rebate plane, which protrude through the sides of the stock, were sharpened ever so keenly they would only scrape and not cut, just the same is the scraping plane with a perpendicular iron

When however the relate plane is meant to cut at the sule, it is called the side relate plane and its construction is then just reversed, as shown in the three views fig 316, that is, the non is inserted perpendicularly to the sole of the plane, but at a horizontal angle x x, or obliquely to the side of the plane, so

that the cut is now only on the one side z z, of the plane, and which side virtually becomes the sole A second plane sloped

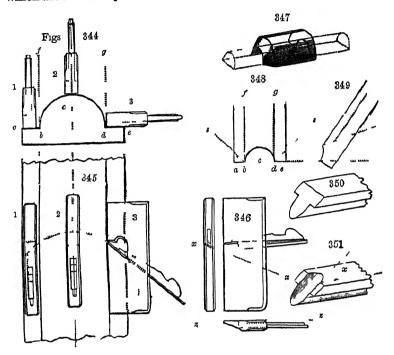

the opposite way, is required for the opposite side, or the planes are made in pairs and are used for the sides of grooves, and places maccessible to the ordinary rebate plane

In the figures 344 and 345 the square rebate planes 1 and 2, will cut the horizontal surfaces a, b, and c, perfectly, because the irons present the proper slopes to these surfaces, but in attempting to plane the vertical line b f, with the side of 1, we should fail, because the cutter is at right angles to that superficies, and it would only scrape, or be said to drag. The plane 3, when laid on its side, would act perfectly on the vertical face, but now it would be ineffective as regards the horizontal. The square rebate plane, if applied all round the semicircle, would be everywhere effective so long as its shaft stood as a radius to the curve, in fact as at 2, and 3 as then the angle of the iron would be in the right direction in each of its temporary situations. But in this mode a plane to be effective throughout, demands

either numerous positions of the plane, or an iron of such a kind as to combine these several positions

Theoretically speaking therefore, the face of the cutter suit able to working the entire semicircle or bead, would become a cone, or like a tube of steel bored with a hole of the same dia meter as the bead, turned at one end externally like a cone, and split in two parts. Fig 347 would represent such a cutter, and which just resembles a half-round gouge applied horizontally and sharpened externally. But this theoretical cutter would present all the difficulties of the spokeshave iron, as to the trouble of fixing it, its interference with the sole of the plane, and the difficulty of maintaining the form of the mouth of the instrument, if made as a spokeshave, owing to the reduction of the cutter in sharpening.

But as the iron 3, and also the side rebate, fig 346, work perfectly well in their respective positions, or when the cutters are inclined horizontally, whilst the central iron 2, only requires to be inclined vertically, it occurred to me that by employing a cutter in all respects as usual, except that its face should be curved as in the arc connecting the three irons in fig. 345, the one tool would cut equally well at every point of the cuive, and experience proved the truth of the supposition The precise form of the non will be readily arrived at, by cutting out in card the diagram, fig 348, and bending it to a circular sweep, until the parts exterior to the dotted lines b f,-d g, just meet the spring of the bead, at about the angle of half or middle pitch, or 30 or 35 degrees from the right angle and it will be then found necessary to cut away the corners to the lines b s,-d s, or so much of them as dip below the straight surface of the fillet, as seen in fig 349

The author had a plane constructed exactly in agreement with the above particulars, that is with an iion curved to about the third of a circle, the mouth of the plane was curved to cor respond, and in every other respect the instrument was as usual, it was found entirely successful

The inclination of the tool to each part of the work is very

^{*} The cutter 347 is used for making the cylindrical rollers upon which ribbons are wound the cutter is fixed at the end of a slide and is worked by a lever the cylinders are made at two cuts in lengths of 8 or 10 inches and afterwards divided

nearly alike, and it assimilates at different parts to each of the ordinary rebate planes, all of which work well. Namely at the crown of the moulding c, to the square rebate planes, at the spring b and d, to the side rebate planes, and at the fillets a b, d e, to the skew rebate. And notwithstanding the fluted form of the iron, no greater difficulty is experienced in sharpening the iron in the new form like a gouge, than in the old like a chisel, the figure of the end being nearly alike in each case.*

As all the imperfections in the actions of moulding planes occur at the vertical parts, there is a general attempt to avoid these difficulties by keeping the mouldings flat or nearly without vertical lines. For example, concave and convex planes, called hollows and rounds, include generally the fifth or sixth sometimes about the third of the circle, and it is principally in the part between the third and the semicircle that the dragging is found to exist, and therefore, when a large part of the circle is wanted, the plane is applied at two or more positions in succession

In a similar manner large complex mouldings often require to be worked from two or more positions with different planes, even when none of their parts are undercut, but in which latter case this is of course indispensable. And in nearly all mouldings the plane is not placed perpendicularly to the moulding but at an angle so as to remove all the nearly vertical parts, as far towards the horizontal position as circumstances will admit


The above forms of cutters suggested for mouldings are each applicable to most mouldings but from their nature they are too troublesome for ordinary use

For instance we may employ a cutter such as 347 the lower surface of which as in 350 is the astragal or any other moulding the general slope of chamfer will cause the tool to cut at the fillets and at ϵ which parts are horizontal but the lines of the mouldings which are vertical require the tool to be fluted to obtain the horizontal angle ϵ shown in dotted lines in 351, and there is all the inconvenience of the nearly horizontal position of the spokeshave iron

The iron when sloped at the accustomed angle of pitch requires to be convex for a convex moulding and to be sharpened behind and by the converse for a concave moulding the tool must be also concave and sharpened in front and all vertical lines in the moulding require the cutter to be fluted as in fig 351 at x. Mixed or flowing mouldings will require on the same principle the cutter to have nearly the sections of the mouldings and to be sharpened always in front in the spokeshave form of iron but partly in front and partly behind in the sloping irons but these conditions are far too complex except in some favourable cases. The cutters are always made flat on the face and to lessen the difficulty, the mouldings are drawn shallow with but few or no vertical parts, or else they are wrought by two or more different planes

Thus the plane for the moulding, fig 352 would have its stock perpendicular to the dotted line a b connecting the extreme parts

of the moulding, the angular deviation being generally called the spring. The spring is also partly determined by the position which is most fivourable to the maintenance of the form of the cutter in sharpening it, as the obliquity of the sole of the plane causes the cutter, when advanced through it, also to shift sideways and cause a disagreement between their figures.

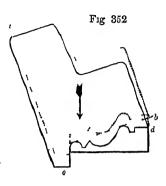


In the act of working, or, as it is called, in *sticking* the moulding the wood is always first accurately squared to its dimensions to serve as a guide, and it is then sometimes roughly bevelled nearly to the line a b, the plane is applied in the dotted position, the blank edge o of the plane, tests against the edge of the piepared wood, and determines what is called the "on of the moulding, that is, how far the plane can proceed upon the wood, and the planing is continued vertically until the blank edge d stops the further action, or determines the "down," by resting upon the solid wood beneath it—In some cases where the planes are unprovided with fences or blank edges, or that they are applied in places where fences in the ordinary form are mapplicable, a slip of wood is nailed down for their guid ance, as in fig. \$34, page 485

Wide moulding planes have been occasionally worked by two individuals, one to guide and thrust as usual, the other to pull with a rope. The top iron is however absent from the whole of the group if we except the capping plane used for the upper surfaces of staircase rails, which are faintly rounded. The absence of the top iron is partly compensated for, by the pitch of moulding planes being, as stated on page 482, about 10 degrees more upright than in bench planes for the same materials. The angles and edges of many of the small planes are box slipped, that is, slips of boxwood are inlaid in the beech wood, in order that the projecting edges or the quirks may possess greater durability.

SECT IV -REMARKS ON THE BENCH, AND USE OF THE PLANE

It is not the present intention to resume the consideration of the joiner's planes in this work, it therefore appears desirable before quitting the subject to add a few instructions respecting the modes of keeping them in order, and of using them in which some kind of bench or support for the work is always required

The benches are made in various ways, from a few rough boards nailed together to the structure shown in fig 353, which represents one of the most complete kind of cabinet makers benches, carefully connected by screw bolts and nuts its surface is a thick plank planed very flat and true, with a trough to receive small tools, without interfering with the surface of the bench

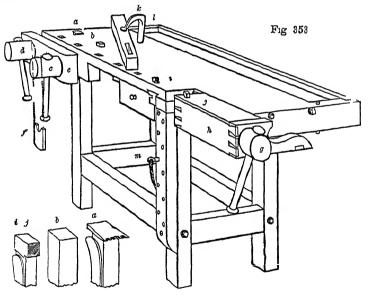

The wood to be planed is laid on the bench, and is stayed by an iron bench hook a which is fitted in a mortise, so that it may be placed at any required elevation, or flush with the surface of the bench. The bench hook has teeth projecting from its face, intended to stick into the wood, and retain it from moving sideways, but to avoid the injury which would be inflicted by the teeth on nearly finished works, there is also a square wooden stop b, fitted tight into a square mortise. These are shown

removed, and on a much larger scale, at the foot of the engraving, the same letters of reference being repeated

The two side sciews c, d, constitute with the chop e, a kind of vice, the sciew c, simply compresses, the sciew d, has a piece f, called a garter (shown detached), which enters a groove in the cylindrical neck of the sciew d, so that when the sciews are both opened, d serves to bring the chop e outwards. The chops are greatly used for fixing work by the sides or edges, and as they open many inches, small boxes, drawers, and other works, may be pinched between them

There are other constructions of benches which it is unneces sary to describe, some have only one of the screws c, d, the other being replaced by a square bar fixed in e, and many are not furnished with the end screw g, which draws out the sliding piece h, that is very carefully fitted The end screw serves also as a vice for thin works which are more conveniently held at right angles to the position of the side screws, but its more valuable purpose is for holding work by the two ends, which mode is exceedingly convenient, especially in making grooves, rebates, and mouldings, as the work is in no danger of slipping away from the tools There are several square holes along the front of the bench, for an non stop i, which has a perpendicular and slightly roughened face, and a similar stop j, is also placed in h, and as the latter slides a quantity not less than the interval between the holes, pieces of any length below the longest may be securely held

For holding squared pieces of wood upon the bench, as in making mortises or dovetails, the holdfast k is used in the manner shown, it is an L formed iron, the straight arm of which fits loosely in a hole in the bench, the work is fixed by driving on the top at k, and it is released by a blow on the back at l. Sometimes also the holdfast is made in two pairs jointed toge ther like the letter T, with a screw at the one end of the transverse piece, by which the work can be fixed without the hammer, but the former mode is far more common and is sufficiently manageable. And m is a pin which is placed in any of the holes in the leg of the bench, to support the end of long boards, which are fixed at their other extremity by the screws c d. We will now proceed to the management of the planes. See Appendix, notes Λ K, Λ L, and Λ M, pp. 979 and 980

Of the bench planes enumerated in the list on page 476, the following are most generally used, namely the jack plane for the coarser work, the trying plane for giving the work a better figure or trying its straightness and accuracy and the smoothing plane for finishing the surface without detracting from the truth obtained by the trying plane. Sometimes when the wood is very rough and dirty, two jack planes are used still more to divide the work, and these instruments are managed in the following manner.

The remarks on pages 477 8 explain that, for long planes, the iron is released by a blow of the hammer on the top of the plane at the fiont—the smoothing, and all short planes are struck at the back of the plane, and never on the top, or the wedge may be tapped sideways, and pulled out with the fingers

The top non is then removed, by loosening the screw, and sliding it up the mortise, until its head can pass through the circular hole in the cutting iron

The plane iron having been ground to an angle of some 25 degrees with the stone running towilds the edge, it is next sharpened at an angle of about 35 degrees on the oilstone. The iron is first grasped in the right hand, with the fore finger only above and near the side of the iron, and with the thumb below, the left hand is then applied with the left thumb lapping over the right and the whole of the fingers of that hand on the surface of the non—the edge should be kept nearly square across the oilstone as when one corner precedes the other the foremost angle is the more woin

When the iron is required to be very flat, as for the finishing planes the surface of the oilstone should be kept quite level, and the blade must be held at one constant angle, but when it is required to be round on the edge, a slight roll of the blade is required edgeways, lastly the flat face of the iron is laid quate flat on the oilstone, to remove the wire edge, and if required, the edge is drawn through a piece of wood to tear off this film, after which the iron is again touched on the oilstone, both on the chamfer and flat surface, as the edge when finished should be perfectly keen and acute

The iron is frequently held too high to expedite the sharpening it is clear, that should it be elevated above 45°, or the pitch of the plane, the bevil would be in effect reversed, and it could only

act as a burnisher exactly at 45° the keen edge would be soon worn away, and the condition of the burnisher would remain, and within certain limits, the lower or thinner the edge is sharp ened the better. Perhaps the angle of 35° which is assumed, is as favourable as any, as if the edge be too acute the durability greatly decreases and therefore some regards also shown to the degree of wear and fitigue the non is called upon to endure.*

The edge of the non is likewise ground to different forms according to the work, thus, the jack plane is found to work more easily when the non is rounded as an arc, so that whether it project in the center more or less than one sixteenth of an inch, the common measure, the angles of the iron should sink down to the sole of the plane at the corners of the mouth

The ease thus afforded appears more or less due to three causes. The rounded from makes its first penetration more easily, as it commences as it were with a point, or very narrow edge—the from has to penetrate the wood as a wedge first to cut and then to bend the shaving, and it is likely that the reduction of labour in the cutting, by the narrow portion of the edge being employed, is greater than the increase, in bending a thicker but narrower shaving—and lastly—the curved from distantly approaches the condition of the skew from, and in all inclined blades there is a partial sliding or saw like motion, which is highly favourable to cutting—The mons for the finishing planes, although sharpened as flat as possible at other parts, are faintly rounded at the corners to prevent their leaving marks upon the wood

The cutting non having been sharpened, the top iron is sciewed fast at the required distance from the edge, say for coarse works one sixteenth, and for fine work, one fortieth or fiftieth of an inch. The compound iron is placed in the mouth of the plane, and the eye is directed from the front along the sole, to see that it projects uniformly and the required quantity, the wedge is then put in with the right hand, and slightly tapped with the hammer. If this should by chance carry forward the iron also, a blow on the back of the plane at h, fig. 320, p. 477,

^{*} When the minute chamfer of the plane iron is almost parallel with the sole of the plane it will for a short time be entirely effective. Thus is an experiment drive the iron a very small quantity through the sole and sharpen it by allowing the colstone to rub both on the edge and on the wood behind. This will produce a very accurate edge, and the iron when set back will cut beautifully

or on the upper surface of the long planes at a partially with driws the nion and in this manner by a few slight blows on the end or either edge of the iron, and on the end of the wedge, the adjustment is readily effected. Violence should be avoided, as the wedge if overdriven might split the plane, and long before that it would distort the sole and drive the back wood up, which means that the wood behind the iron would be driven so as to stand slightly in advance of that before the iron, the two parts of the sole becoming slightly discontinuous or out of line. The non-should be always so slenderly held, that one or two mode rate blows would release the iron and wedge

There is a very ingenious modification of the double non plane,*in which the cutter is a thin unperforated blade of steel placed between a brass bed and an iron top piece, the cutter, instead of being fixed and adjusted in the ordinary manner by taps of the hammer, is managed by the quiet action of various screws

In a plane patented in America, in 1832, the bottom or cutting iron is made as usual, but without any mortise, the top iron has a thumb screw at its upper end, and moves on two lateral pins or fulcrums $\frac{3}{4}$ inch from its lower edge—the pins fit into two grooved pieces of metal let into the sides of the plane—the lengths of the grooves exactly determine the situation of the top iron—When therefore the cutter is placed in its required position, the thumb screw is turned, it bears on the upper part of the cutter, and tilts the top iron, until its lower edge also bears hard against the usual part of the cutter, and thereby fixes it without a wedge

The main hindiances to the general employment of these constructions appear to be their increased cost, and the great dexterity with which the required adjustments are accomplished by the accustomed hand with the apparently rude, yet sufficient, means of the hammer |

The planes being respectively in good working condition, the board to be planed is laid on the bench, and if it should be obviously higher, either at the opposite corners from being "in winding, or in the middle, or at the edges from being "cast and

^{*} Invented by Mr H Bellingham See Trans Soc of Arts, 1836 vol li

[†] The same remark applies to Mr F E Franklin's Screw Bench Hook, (idem vol lin) intended to supersede α or j fig 353 page 494

rounding,' these partial prominences are first removed with the jack plane, but in general the shavings should be of the full length of the work, or at any rate a yard long

The toat of the plane is held in the right hand, the front being grasped with the left hand, the thumb towards the work man, the planes require to be pressed down on the work during the cut, this is done less by an exertion of the muscles, than by slightly inclining the body, to cause its weight to rest partly upon the plane. During the return stroke, the pressure should be discontinued to avoid friction on the edge, which would be thereby rounded, and there is just an approximation to lifting the heel of the plane off the work or in short pieces it is entirely lifted. The general attempt should be to plane the work somewhat hollow, an effect which cannot however really occur, when the plane is proportionally long and quite straight


The sole of a long plane is in a great measure the test of the straightness of the work, thus when the rough outside has been removed with the jack plane, the trying plane is employed, which is set with a much finer cut, and the workman will in a great measure tell the condition of the surface by the continuity and equality of the shavings. It is however also needful to examine its accuracy with a straight edge, the edge of the plane applied obliquely across the board is in general the primary test, but as the work approaches to perfection the straight edge is laid parallel with the sides of the work, and also diagonally across it, and towards the last, the work if small is raised to the level of the eye, or in large pieces, the workman stoops to attain the same relative position.

In using the straight edge the workman is partly guided by the eye, or the line of light that is observable between the instrument and the work, and partly by the sense of touch, as he tries whether the straight edge, when it is very slightly rotated as on a center, bears hardest at the ends or in the middle, and he applies the plane accordingly *

Or supposing A to be concave exactly like B or to become B', then B and C

^{*} The straight edge is simply a wide thin bar of wood or metal made as accurately straight as possible—the truth of a straight edge can be only proved by the examination of a series of at least three—Thus, supposing A to be perfect, B to be slightly concave and C to be slightly convex—it might happen that B and C exactly agreed but A could not agree with either of them

The foregoing mode refers to surfaces of moderate width, but when the pieces are narrow, or two or more distant parts alone are required to be in one level, the winding sticks are employed These are two straight edges, say twenty to thirty inches long, which are placed transversely upon the ends of the work and parallel with each other, they receive their direction from the respective ends or transverse sections, and should these be inclined to each other, or in winding instead of parallel, the winding sticks would magnify the error This is explained by the diagram fig 354, the eve placed on the level of the imagi nary plane, bounded by the edges a b c d, of the winding sticks. would find the edge of a b exactly parallel with that of c d, but if c d were situated as in the dotted lines the disagreement of position arising from the twist or inclination of the edge would be immediately appaient. It is important that the winding sticks should be parallel, as then the eye may be directed to then upper edges, thereby avoiding the interference of the work If the work be perfect the two sticks appear in exact parallelism, when from the foreshortening, cd, is nearly eclipsed



Nearly all the works in carpentry are first prepared as paral lelograms of various proportions, whether they are to be subse quently used in that simple form, or to be worked with grooves, rebates or mouldings, or to be connected by joints of various kinds. We will now follow up the formation of one flat surface, by explaining the order in which to produce the three pairs of parallel rectangular surfaces in fig 355 namely, A a, the two faces, B b, the two sides, and C c, the two ends, and in this and every work possessing flat surfaces, it is of the utmost consequence that one face A, should be first wrought in the most careful and exact manner as above described, to serve

would also agree but B and B would disagree therefore the rectilinear form can only be proved to exist when A B and C will bear a strict comparison in each binary combination


as the foundation or base from which all the other measures are to be successively derived

The works are generally sawn out a trifle above the required sizes, and the subsequent modes of proceeding depend upon the proportions of the pieces, or whether they are thick as in carpentry, or thin as in joinery and cabinet making. In thick pieces, after the face A, has been planed quite flat, the side B is next wrought, and a short square is used to examine whether the two are exactly at right angles for this purpose the stock of the square is rested against A, and the blade on B at various parts of the work, or indeed the square is slowly traversed to ascertain that the angle is everywhere in agreement with the square. The angle A B, is then marked with pencil lines extending on the face and side, to denote that this angle is to serve as the foundation for the subsequent measures

Before proceeding to plane the second face a, the marking gage, fig 342 p 487, is adjusted until its point stands exactly as far from the head of the gage as the intended thickness of the work The gage is then subbed forcibly against the finished face A, so as to scratch a line on the edges of B b indicative of the intended new surface a, and which is then worked with the same care and precaution as its companion A After this b, is similarly worked, when the width of the faces A a, have been also scored by the marking gage applied against the true side B In planing a and b the square is applied from B and Arcspectively, to ensure the rectangular forms of the edges, and the gage is also used together with the square to test the parallelism of the work, and lastly, the ends C c are marked on all four sides with the square, preparatory to the use of the saw, or the formation of the tenons, mortises, or dovetails by which the parts are attached When the works are planed with rebates, grooves, or mouldings, the squaring up of the four sides is always the pieliminary step, although in some cases the principal attention is devoted to the two surfaces A B especially when they are only required to serve for the attachment of other parts of the worl

In squaring up works cut out of thin plank, the mode is different the pit saw leaves the board nearly parallel, and when the piece has been cut out with the hind saw, the face A is first tried up, that is, corrected with the trying plane, the piece is next gaged to thickness, either at the ends only, or on all four edges, and the second face a, is planed up. The rectangular piece is next fixed in the screw clamp of the bench with the edge B upwards, and which is made quite straight with the trying plane in its ordinary position, and tested with the square, the two ends C c, are next marked off with the square, and planed from the corrected edge B, and lastly b is gaged and shot down to the width. By these means, should the fibres have been split, or spalled off in shooting the ends, the removal of the edge b, as the last piecess would correct the evil. There are some very useful contrivances employed in planing the edges of thin works, and which will be next adverted to

In squaring or shooting the edges of boards, the shooting board drawn in figs 356 and 357, is very much used, it is a contrivance to enable the side A of the work (the ends of which are shaded in each of these views), to be laid flat on a bed e, whilst the plane lies on its side, either on the bench, or upon the additional piece f, and provided the shooting board is parallel and straight, and that the sole of the plane is at right angles to its side, the rectangular forms of the edges are much more readily attained. The work is, nevertheless, examined with the square, as if the set of the iron be imperfect it will introduce a little error and which is corrected by tapping the iron sideways, to correct its position

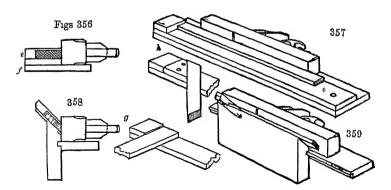

In squaring the ends C c, the transverse block g of the shooting board is the rectangular gage, and the cross piece also partly supports the fibres from tealing away, for bevils corresponding blocks are fitted to it as represented at h, but the mitie, or the

angle of forty five degrees there shown is the one principally required. To plane the edges, B or C, to the mitre or other angle, the respective beds upon which the work and plane are supported are required to be to each other in that particular angular relation, as in figs 358 and 359, which represent the mitre block for angles of forty five degrees

These contrivances of external fences materially assist in pieces much narrower than the face of the plane, and the order in which the six faces are dressed, is very closely followed, although with different tools, in other arts, in which the works consist of like surfaces requiring a similarly strict relation to each other

SECT V-PLANING MACHINES FOR WOOD

In using hand tools the instrument rests immediately upon the face of the work under formation, and in repeating any one result, the same careful attention is again required in every successive piece. But it was explained in the last chapter, that in the machines acting by cutting, the accuracy is ensured far more readily, by running either the work or the tool, upon a straight slide, an axis, or other guide, the perfection of which has been carefully adjusted in the first formation of the machine, and the slide or movement copies upon the work, its own relative degree of perfection. The economy of these applications is there for egenerally very great, and they are frequently most into resting, on account of the curious transitions to be observed from the hand processes to the machines, in some cases with but little, in others with considerable change in the general mode of procedure

The first planing machine for wood is supposed to have been that invented by General Bentham, who took out a patent for it in 1791, it was based on the action of the ordinary plane, the movements of which it closely followed. This contrivance reduced the amount of skill required in the workman, but not that of the labour, it appears to have been but little used. The board to be planed was sometimes laid on a bench, at other times fixed by long cheeks having teeth which penetrated its edges, the mon of the plane extended the full width of the board, and the stock of the plane had slips to rest on the bench and cheek the cutting action, when the board was reduced to the intended thickness, much the same as in the reglet plane, fig 310

For feather edged boards, the two slips were of unequal

thicknesses, for those intended to be taper in their length, the guide rails had a corresponding obliquity, and were fixed to the bench. The plane was moved to and fixed to a crank, it was held down to its work by weights, and the plane was lifted up in the back stroke to remove the friction against the cutter *

The scale board plane, abbreviated into scabbard plane for cutting off the wide chips used for making hat and bonnet boxes, is, in like manner, a plane exceeding the width of the board, it is loaded with weights, and dragged along by a rope and wind lass, the projection of the iron determines the thickness of each shaving or scale board. This construction is also reversed, by employing a fixed iron drawing the wood over it and letting the scale board descend through an aperture in the bench, each of these modes is distinctly based on the common plane. See Appendix Note A. N., page 981

The late Mr Joseph Bi imah took out a patent in 1802 for a planing machine for wood, one of which may be seen in the Gun Carriage Department, Woolwich Aisenal The timber is passed under a large horizontal wheel, driven by the steam engine at about ninety revolutions per minute, the face of the wheel is armed with a series of twenty eight gouges, placed horizontally and in succession around it, the first gouge is a little more distant from the center, and a little more elevated than the next, and so on The finishing tools are two double irons just like those of the joiner, but without the advantage of the mouth

Mr Bramah employed the principle of his famous hydrostatic press (patented in 1791), both for raising the cutter wheel to suit the different thicknesses of wood, and also for traversing the timber under the cutters upon guide rails, the latter, by means of an endless chain connected with the piston of the pump, by a rack, pinion, and drum. The bottom of the axis of the cutter wheel is cylindical to the extent of its vertical adjustment, and is fitted in a tube terminating at its upper part in a cupped leather collar impervious to oil or water as in the hydrostatic press. The injection of water into the tube by a small force pump, lengthens the column of fluid, upon which the which is supported as on a solid post, the descent of the which is effected by allowing a portion of water to escape by a valve †

^{*} See the Encyclopædia Metropolitana &c &c

⁺ Mr Bramah's patent includes many modifications of fixed and revolving

A more recent machine for planing flooring boards and other wood works, consists of a series of knives placed parallel with, and around the axis of, a small cylinder, the board is passed underneath the cutter whilst it is in rapid motion, this may be called an adzing machine, and the knives are of the full width of the board

In M1 Muir's patent planing machine for flooring boards, a rotary adze roughly planes the bottom unother operates on the top of the board, afterwards, two oblique fixed cutters, like the skew rebate irons but with top irons, remove each a shaving of the full length and width of the deal, two cutters make the sides parallel, and two others groove the edges for the tongues, or in fact, these are four revolving planes or saws in order to expedite their effect The board enters the machine as left from the saw mill, it is thrust forward by the engine, and comes out very speedily in a condition nearly ready for fixing, the eight operations being simultaneous, but sometimes a little finishing with the hand smoothing plane is required at those parts where the grain is unfavourable to smooth cutting Other machines. by Paxton, by Burnett and Poyer, and others, are used for preparing sash bars, and similar works * See Appendix, Notes AO & AP, pages 981 & 982

The preceding machines are mostly intended to work with the grain, and I am only acquainted with one rectilinear planing machine that is exclusively intended for cutting across the grain, namely, the mortising engine, one of the series of machines erected at Portsmouth in 1807, by Mr Brunel, for the manufacture of ships blocks!

A hole is first bord through the block at the commencement of the intended groove for the sheave, and it is extended by the successive action of a mortising or paring tool, which rides

cutters for planing and cutting wood and metal works—also a machine for turning spheres and for cutting wooden bowls one out of the other and likewise other encohanceal contrivances—See Specification Gregory's Mechanics vol ii p 415

^{*} See the description of Paxton's machine Trans Soc of Arts vol lin p 97 see also specification of Burnett and Poyer's patent

The reader is likewise referred to the foot note page 32 vol 1, on Taylor s patent machine for chopping out the staves for casks a similar mode was proviously employed for chipping into fragments the dye woods the logs of which fell against the revolving disk through an inclined shoot

⁺ Now Sir Mark Isambard Brunel

perpendicularly up and down, just before the tool descends, the block is traversed a quantity equal to each cut or shaving

The cutter is made cylindrical, and is formed just like a quill pen, but solid and with an elliptical cutting edge instead of the points "The chisels are provided with small teeth which are fitted into dove-tailed notches formed in the blade of the chisel. These are called scribers, they have a sharp edge projecting a short distance beyond the inside edge of the chisel, and therefore in descending through the mortise, the scribers cut the sides of the mortise fair, and make two clefts which separate the chip (which will be cut out at the next stroke), at its edges from the inside of the mortise, so that the chip comes out clean without splitting at the edges, and this makes the inside of the mortise as clean and smooth as possible"* A hole is drilled nearly in the axis of the cylinder, for the insertion of a pin, by which the shavings are thrust out when they happen to clog the hole

By forming the tool of a semicircular section and with two small fins, or edges projecting at right angles from the ends of the diameter, and then sharpening it so that the diameter becomes a straight chisel edge, the scribing points are formed in the solid with the chisel, and are continually restored as the toolissharpened. The tool is then perfectly analogous to fig 334, page 485, if we suppose the plane condensed into a long chisel of semicircular section, equal to the diameter of the hole, the progressive elongation of which it has to effect

There are many useful applications of revolving figured planes, moving through curved paths, by which we obtain figures of double curvature, as explained in the theoretical diagram, fig 317, page 464 Mr Brunel introduced an example of this in the scoring engine, one of the machines recently adverted to, for the manufacture of ships' blocks

It is intended to form the groove around the block, for the rope by which it is attached to the rigging. The revolving plane is a disk of brass with a round edge and two cutters, inserted at an angle of about 30° with the radius, it traverses around the one side of the block, and receives its direction from a shaper plate or pattern placed parallel with the block, by which

^{*} Reess Cyclopedia article 'Machinery for manufacturing Ships Blocks.

arrangement the cutter makes the groove deep at the ends, but shallow where it passes the pin or axis of the sheave The same method has been subsequently extended to shaping the entire block with cutters of the full width, applied at four times *

These several machines are compounds of slides and guides, and of fixed or revolving planes the relative degrees of perfection attained, depend on the stability of the machines, and their respective agreement with the principles of the ordinary hand tools, which are generally themselves, the last stages of a long series of gradual improvements

But the absence of some of the true characters of the plane, in nearly the whole of the machines for wood, namely, the proper obliquities of the iron the frequent want of the mouth of the plane, and of the top or breaker iron, which so greatly restrains the splitting and tearing up of the fibres prevent the machines from producing, in the softer woods, the smooth finished work of hand tools, in the management of which the judgment of the operator can be employed to combat the peculiarities of fibre But the enormous productive powers of such machines, out weigh these drawbacks, and the more especially so, as the general forms or outlines are repeated by them in a most exact manner, and a little after trimming by hand imparts the neces sary finish

In speaking of the apparatus for ornamental turning, there will be occasion to show that these same principles are strictly embodied in miniature, in the various parts of the complex lathe for ornamental turning, but as the hardwood and ivory therein generally used, admit of the employment of scraping tools, not requiring either the obliquity of the cutter, or the mouth of the plane, the above objections do not apply to them, and their several results exhibit a much nearer approach to perfection

^{• *} In revolving planes for wood the cutters should always present in obliquity of about 30 to the radius otherwise of when the cutters are placed radially they only scrape or act like saws. Some of these planes are made of one disk of steel in which case there are four five or six openings like the mouths of rebate planes, the one side of each wedge or cutter is now a part of the circumference the other is elevated some 20 or 30 degrees thereby resembling the spokeshave from This form of cutter, although nearly perfect is very expensive, and difficult to maintain in order.

CHAPTER XXIV

TURNING TOOLS

SECT I -FACILITY OF TURNING COMPARED WITH CARPENTRY

THE process of tuning is accomplished with considerably more facility truth, and expedition, than any other process requiring cutting tools because in the most simple application of the ait the guide principle is always present, namely, that of rotation. The expedition of the process is due to its being un interrupted or continuous, except as regards the progressive changes of the tool, and which is slowly traversed from pair to pair, so as to be nearly always in action.

To choose the most simple condition, let us suppose the material to be in rotation upon a fixed axis, and that a cutting tool is applied to its surface at fifty places. Provided the tool remain quiescent at one place, for the period of one revolution of the material, the parts acted upon will each become one circle, because the space between the tool and the axis is for a period constant, and the revolution of the material converts the distance of the tool from the center, into the radius of one circle, and the same is equally true of the fifty positions

The fifty cucles will be concentric, or parallel with each other, because the same axis extended, or continued as a line, remains constant, or is employed for each of them and therefore conceiving the fifty circles to be as many parts of the outline of a vase or other object simple or complex it will be strictly symmetrical, or equidistant from the central line at corresponding parts

Each of the fifty circles will also become the margin of a plane at right angles to the axis, and which axis being a straight line, the whole of the circles will be parallel, and therefore the top and bottom of the vase will be also exactly parallel. And yet all these accurate results must inevitably occur, and that without any measurement, provided the material revolve one on fixed

axis, and that the tool is for a short period constant or stationary at each part of the surface, conditions inseparable from the tunners art

The punciple of rotation upon a fixed axis, removes the necessity for many of the steps and measurements required to produce with accuracy the various angular solids employed in carpentry and many other aits. For example, at page 501 the methods were explained by which the joiner produces the three pairs of parallel surfaces A a, B b, C c, of fig 355, and which are generally required in each separate piece of his work. And in making a box he has to combine six such pieces with the same relations of parallelism, and therefore thirty six various surfaces have to be operated upon, to obtain the hollow cube, or the carpenter's box

The tunner s box consists of two pieces, in place of six, as the bottom and its four sides are resolved into one piece, when of wood, by nature in the forest when of metal, by man in the crucible. The surfaces are therefore reduced from thirty six to eight, namely the inner and outer surfaces of the bottom and hid amounting to four, and the inner and outer sides or margins, amounting to four also, and the revolution of the work upon one axis places the eight in exact and true relation with extreme rapidity

For example, the ends or terminal planes of the box, are from necessity at right angles to the axis of rotation, and parallel with each other. In each of these superficies, the question of being in or out of winding ceases, as if straight, they can only be planes or cones, and which the one straight edge immediately points out

The principle of rotation ensures circularity in the work, and perpendicularity or equality as regards the central line, it only remains, therefore, to attend to the outline or contour. The right line serves to produce the cylinder, which is a common outline for a box, and the employment of mixed, flowing, and arbitrary lines, produces vases and ornaments of all kinds, the beauty of which demands attention alone to one single element, or conception, namely, that of form, and in the choice and production of which a just appreciation of drawing and proportion greatly assist

In the art of drawing, it is almost essential to the freedom of

the result, that the lines should be delineated at once, and almost without after correction in the art of turning, it is always desirable to copy a drawing or a sketch, but having nearly attained the end, the tool may be continually re applied, partially to remove any portions which may appear redundant, until the most scrupulous eye is satisfied

The combining of the several parts of turned objects, as the separate blocks of which a column or other work is composed, is greatly facilitated from the respective parallelism of the ends of the pieces of which turned objects consist, and the circular tenons and mortises, whether plain or screwed, place the different pieces perpendicular and central with very little trouble


These several, and most important facilities in the art of turning are some amongst the many reasons for its having obtained so extensive and valuable an employment in the more indispensable arts of life, as well as in its elegances

The relative advantages of the different sections of the tree, as regards the works of the turner and carpenter, were explained with figures in the fifth chapter of Vol I at pages 49 and 50, where it is shown that, from various reasons, the transverse section of the entire tree or branch is the most generally proper for the lathe and therefore in turning the tops and bottoms of works, as in figs 13 and 14, page 49, Vol I we are cutting across the ends of the fibres, and in turning the sides of the same we are, as it were, proceeding across the width of a plank or board

The tools used in turning the woods act much in the manner of the blades of the carpenter s planes, but as we have now, at all times, a circular guide in the lathe mandrel, we do not require the stock of the plane or its rectilinear guide. Although if we conceive the sole of the plane applied as the tangent to the circle, the position it would give is nearly retained, but we are no longer encumbered with the stock or guide. In turning tools for soft woods, the elevation of the tool, and the angle of its edge are each of them less than in ordinary planes, and in those for the hard woods both angles are greater.

For example, the softest woods are turned with tools the acute edges of which measure about 20 to 30 degrees, and are applied nearly in coincidence with the tangent, as in fig 360

These tools closely assimilate to the spokeshave, which is the plane of the lowest pitch and keenest edge. On the contrary, the hardest woods may be tuined with the above soft wood tools, applied just as usual, but on the score of economy and general

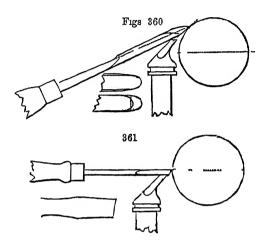

convenience, the edges are thickened to from 60 to 80 degrees, and the face of the tool is applied almost horizontally on the lathe rest, or as a radius to the circle, as in fig 361, thus agreeing with the opposite extreme of the planes, in which the cutter is perpendicular and much less acute, as in the scraping and toothing planes, which are only intended to scrape and not to cut

The hard wood tools may be figured, and employed as scrapers in turning the members of the capital or the base of a column, or similar object in hard wood or ivory, but if we try the same tools on deal, ash, and other soft woods, we shall in vain attempt to produce the capital of a column, or even its cylindrical shaft, with a thick horizontal tool as in hard wood, for the fibies would not be cut, but forcibly torn asunder, and the surface would be left coarse and ragge i

But a reference to the planes with which the joiner proceeds across the fibres of deal, will convey the particulars suited to the present case, the non is always thin and sharp, and applied in an oblique manner, so as to attack the fibre from the one end, and virtually to remove it in the direction of its length

It is proposed now to describe some of the more important of

the turning tools commencing with those employed on the soft grained woods, but it would be both hopeless and unnecessary to attempt the notice of all the varieties which are to be met with in the hands of different individuals, and as their prac tical applications will be entered upon in detail in the suc ceeding volume, only so much will be here advanced as it is hoped may serve to explain the modifications of the general principles of cutting tools, to some of the more usual purposes To avoid repetition, it may be observed, that in general the position of the tool for turning the cylinder, and secondly that for the flat surface or plane, will be alone de For works of intermediate angles, whether cuives or flowing lines, the position of the tool slides from that for the cylinder to that for the plane, or the reverse, and these changes will be readily made apparent, when the reader gradually moves either a tool or even a rod of wood, from the one to the other of the described positions


It may be added, that most of the tools for metal are applied direct from the gundstone, the oilstone being used for such tools only as are employed for the more delicate metal works, or for the last finish of those of stronger kinds, all the tools for wood, ivory, and similar materials are invariably sharpened on the oilstone. It may be desirable to remark, in addition, that the rough exterior faces of all works should be turned with narrow or pointed tools, and only a narrow portion at a time, until the surfaces are perfectly true or concentric as wide flat tools applied to rough irregular surfaces, especially of metal, would receive a vibratory, or rather an endlong motion, quite incompatible with truth of work

SECT II —TURNING TOOLS FOR SOIT WOOD Angle 20 to 30 —Figures generally half si e

The tools most generally used for turning the soft woods, are the gouge and chisel, figs 362 to 365 wherein they are shown of one fourth their medium size, they vary from one eighth to two inches wide, and as they are never driven with the mallet, they do not require the shoulders of the carpenter's tools, they are also ground differently. The turning-gouge is ground externally and obliquely, so as to make the edge elliptical, and it is

principally the middle portion of the edge which is used the chisel is ground from both sides, and with an oblique edge, and figs 366 and 367 represent the full thickness of the chisel and its ordinary angles, namely, about 25 to 30 degrees for soft, and 40 for hard woods. The gouges and chisels wider than one inch are almost invariably fixed in long handles measuring with the blades from 15 to 24 inches, the smaller tools have short handles in all from 8 to 12 inches long

Fig 360 shows the position of the gouge in turning the cylinder, the bevil lies at a tangent, and the tool generally

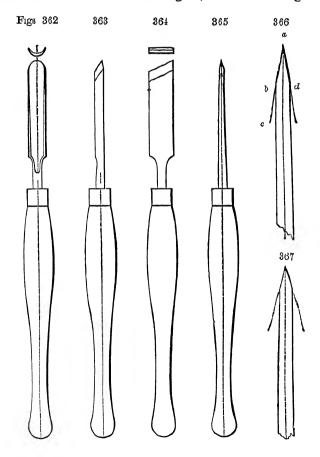


rests on the middle of the back, or with the concave side upwards, the extremity of the handle is held in the right hand

close to the person and the left hand grasps the blade, with the fingers folded beneath it, and in this mainer the gouge is traversed along the cylinder

For turning the flat surface, the gouge is supported on its edge, that is with the convex side towards the plane of the work, and with the handle nearly horizontal, to bring the center of the chamfered edge in near coincidence with the plane, the tool is inclined rather more than the angle at which its chamfer is ground and it is gradually thrust from the margin to the center of the work

The gouge is also used for hollow works, but this application is somewhat more difficult. For the internal plane, the position is almost the same as for the external, except that the blade is more inclined horizontally, that it may be first applied in the center, to bore a shallow hole, after which the tool is traversed across the plane, by the depression of the hand which moves the tool as on a fulcrum, and it is also rotated in the hand about the fourth of a circle, so that in completing the margin, or the internal cylinder, the tool may lie as in fig. 360, but with the convex instead of the concave side upwards as there shown

In figs 368 and 370 are represented the plans, and in 369 and 371 the elevations, of the hook tools for soft wood,

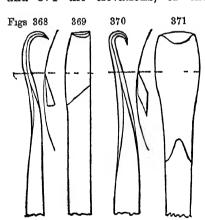

which may be called internal gouges, they differ some what in size and form, the blades are from 6 to 12 inches long, the handles 12 to 15. They are sharpened from the point around the hook as far as the dotted lines, mostly on one, some times on both sides, as seen by the sections. The hook tools follow very nearly the motion of the gouge in hollowing, the rest is placed


rather distant and oblique, the tool is moved upon it as a fulcium, and it is also rotated in the hand, so as always to place the bevil of the tool at a very small inclination to the tangent

The finishing tools used subsequently to the gouges or hook

tools have straight edges, the chisel, fig 364, is the most common, its position closely resembles that of the gouge, subject to the modifications called for by its rectilinear edge. If, for example, the edge of the chisel were just parallel with the axis of the cylinder, it would take too wide a hold—there would be risk of one or other corner digging into the work, and the edge, from its parallelism with the fibres, would be apt to tear them out—All these inconveniences are avoided by placing the edge oblique, as in fig 364, in which the tool may be supposed to be seen in plan, and proceeding from right to left, fig 360 being still true for the other view, the tool is turned over to proceed from left to right, and both corners of the tool are removed from the work, by the obliquity of the edge—The tool may be ground square across, but it must be then held in a more sloping position which is less convenient

Turning a flat surface with the chisel is much more difficult. The blade is placed quite on edge, and with the chamfer in agree ment with the supposed plane a, b, c, fig 366, the point of the chisel then cuts through the fibres, and removes a thin slice which becomes dished in creeping up a, d, the bevil of the tool, it then acts something like the scoring point of the planes or the point of a penknife. Flat surfaces, especially those sunk beneath the surface, as the insides of boxes, are frequently smoothed

with an ordinary firmer chiscl, which is ground and shaipened with one bevil, but rather thicker than for caipently. The edge is then burnished like the scraper, p. 484, and it is applied horizontally like a hard wood tool, as in fig. 361, but against the face or plane surface. The wire edge ther lies in the required position, but it must be frequently renewed.

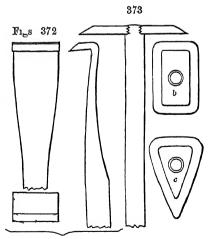


The broad, represented in

three views in fig 372 endures much longer, but it requires to be held downwards or underhand, at about an angle of 40 to 50

degrees from the horizontal, in order to bring its edge into the proper relation to the plane to be turned. Another form of the broad is also represented in fig 373 it is a cylindrical stem, upon the end of which is screwed a triangular disk of steel, sometimes measuring 3 inches on the sides, and sharpened externally on each edge, this tool requires the same position as the last. Broads of the forms b, c are also used, but principally for large works, the plank way of the grain *

For the insides of cylinders, the side tool fig 374, which is represented in three views is sometimes used, it is sharpened on both edges, and applied horizontally. The tool fig 375, also shown in three views, serves both for the sides and the bottoms of deep works, but it does not admit of being turned over, and 376 is another form of the same tool for shallower works, the cranked form of which is considered to give it a better purchase

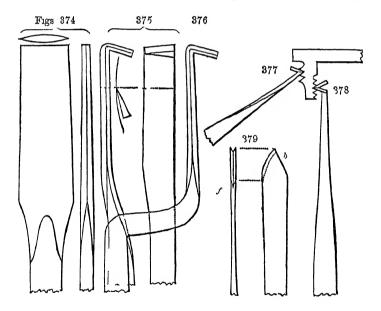

The tools used for cutting screws in soft wood, by aid of the traversing or screw mandrel lathe, partake of the same general characters as the others, and are represented in their relative positions, fig 377 is for the outside, and 378 for the inside

^{*} Similar tools are also used for turning pewter wares

screw To conclude the notice of tools of this class, the parting tool, fig 379, has an angular notch or groove on its upper surface, from which it results that when the tool is shaipened on the bevil b, the upper face f presents two points, which sepa rate the fibres by a double incision. This method wastes only as much wood as equals the thickness of the tool, and it leaves the work smooth and flat, whereas, when the angle of the chisel is used for the same purpose, several cuts are required, and the gap must present a greater angle than the bevil of the tool, and which consumes both time and wood

The various turning tools for soft woods which have been described are, with the exception of the gouge and chisel nearly restricted to the makers of Tunbridge ware, toys, and common turnery, with them they are exceedingly effective, but to others somewhat difficult. The amateur turner scarcely uses more than the common gouge and chisel, and even these but insufficiently, as much may be done with them, it has been shown, for in stance, that moulding tools cannot be used for the soft woods, but they are efficiently replaced by the gouge for the concave, and the chisel for the convex mouldings, which proceedings will, however be detailed in the fourth volume

A good fair practice on the soft woods would be found very greatly to facilitate the general manipulation of tools, as all those for the soft woods, demand considerably more care as to their positions and management than those next to be described

SECT III —TURNING TOOLS FOR HARD WOOD AND IVORY

Angle 40 to 80 —Figures generally half size


The gouge is the preparatory tool for the hard as well as for the soft woods, but it is then ground less acutely, the soft wood chisel may indeed be employed upon the hardest woods, but this is seldom done, because the tools with single bevils, held in a horizontal position, as in fig 361, page 511, are much more manageable, and on account of the different natures of the



materials they are tholoughly suitable, notwithstanding that their edges are nearly as thick again as those of soft wood tools

In general, also, the long handles of the latter are replaced by shorter ones, as in figs 380 and 381 measuring with the tools from 8 to 12 inches, but these give in general an abundant purchase, as from the nearly horizontal position of the tool, the lathe rest or support can be placed much nearer the work


The hard-wood tools are often applied to a considerable extent of the work at one time, and the finishing processes are much facilitated by selecting instruments the most nearly in cories pondence with the required shapes. Rectilinear surfaces, such as cylinders, cones, and planes, whether external or internal, necessarily require tools also with rectilinear edges, which are sloped in various ways as regards their shafts, they are made both large and small, and of proportionate degrees of strength to suit works of different magnitudes, the following are some of the most usual kinds

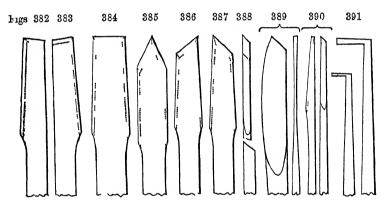

The right side tool fig 382, cuts on the side and end, the dotted lines being intended to indicate the undercut bevil of the edge, it is thus named because it cuts from the right hand towards the left. The left side tool, fig 383 is just the reverse. The flat tool, fig 384, cuts on both sides, and on the end likewise, and in all three tools the angle seen in plan, is less than a right angle, to allow them to be applied in rectangular corners. The point tool, fig 385, is also very convenient, and bevil tools, figs 386 and 387, the halves of the former, are likewise employed, figs 388 show the general thicknesses of these tools. When any of them are very narrow they are made proportionally deep to give sufficient strength, the extreme case being the parting tool, fig. 389,

which is no longer required to be fluted as in the corresponding tool for soft wood but the side tools, when used for small and deep holes, necessarily require to be small in both respects, as in fig 390. The application of the *inside parting tool*, fig 391, has been previously shown on page 151. Vol. I, in respect to the removal of rings of ivory from the interior of solid works, in preference to turning the materials into shavings, it is also useful in some other undercut works.

Some of the curvilinear tools for hard wood are represented in the annexed group, the semicircular or round tool, fig 392,

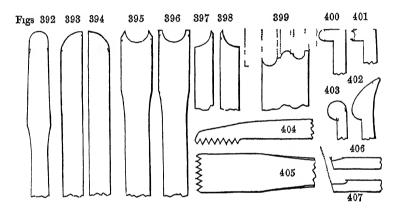

is the most general, as concave mouldings cannot be made without it, and it is frequently divided, as in the quarter round tools, figs 393 and 394, it is convenient that these should be exact counterparts of the mouldings, but they may also be used for works larger than themselves, by sweeping the tools around the curves. Convex mouldings are frequently made by rectilinear tools, which are carried round in a similar manner, so as to place the edge as a tangent to the curve, but the bead, fig 395, the astragal, fig 396, or the quarter hollows figs 397 and 398, facilitate the processes and complete the one member of the moulding at one sweep, and enable it to be repeated any number of times with exact uniformity

Frequently the tools are made to include several members, as the entire base or capital of a column, as in fig 399 Similar figured tools, have been applied to turning profiles of about one or one and a half inches high, by employing four different tools, embracing each about a quarter of the profile, and applied at four radial positions, around a ring of some three to five inches diameter the rings are cut up into radial slices and turned flat on each face prior to being glued upon tablets. Profiles have been likewise successfully and more skilfully turned by the ordinary round point, and flat tools, which processes will be proposed as examples in the practical part of the fourth volume

Figs 400 to 403 represent some of the various kinds of inside tools, which are required for hollowing vases and undercut works and 404 the inside screw tool and 405 the outside screw tool for hard wood, ivory and the metals. These tools are made with many points and are bevilled like the rest of the group. They will be further noticed in the chapter on screw-cutting tools.

The hollow tools, figs 395 to 398, may be sharpened with a narrow slip of oil stone used almost as a file, but their sweeps are more accurately sharpened by conical metal gunders, supplied with emery, as will be explained, most other moulding tools, and the screw tools, are only sharpened upon the face. The ends of these tools may be whetted at a slope if it be more gradual, than in fig 406. This, however, increases the angle of the edge, but by nicking in the tools as in fig 407, by applying them transversely on the gundstone the original angle is main tained, and which is the better mode for screw tools more especially

SECT IV -TURNING TOOLS FOR BRASS

Angles 70 to 90 -Figures generally the same as the tools for hard word

The turning tools for brass are in general simple, and nearly restricted to round, point, flat, right and left side tools, parting tools and screw tools, they closely resemble the hard wood tools, except that they are generally ground at angles of about 60° or 70°, and when sharpened it is at an angle of 80° or 90°, some few of the finishing or planishing tools, are ground exactly at 90°, upon metal laps or emery wheels, so as to present a cutting edge at every angle and on both sides of the tools

It is not a little curious that the angles which are respectively suitable to brass and to iron, are definitively shown to be about 90 and 60 degrees. For turning brass, a worn out square file is occasionally ground on all sides to deprive it of its teeth, it is used as a side tool, and is slightly tilted, as in

fig 408, just to give one of the edges of the prism sufficient penetration, but applied to iron, steel, or copper, it only scrapes with inconsiderable effect. A triangular file, fig 409, similarly ground, cuts iron with great avidity and effect, but is far less



suited to brass it is too penetrative, and is disposed to dig into the work. It appears indeed, that each different substance requires its own particular angle, from some circumstances of internal arrangement as to fibre or crystallization not easily accounted for

A stout narrow round tool, fig 392, in a long handle, serves as the gouge or roughing out tool for brass work others prefer the point fig 385, with its end slightly rounded, which combines, as it were the two tools with increased strength, a small but strong right side tool 382 is also used in rough turning, the graver figs 411 and 412, although occasionally employed for brass is more proper for iron, and is therefore described in the next section

The wide finishing tools should not be resorted to under any chromstances until the work is roughed out nearly to the shape, and reduced to perfect concentrative or truth, with narrow tools which only embrace a very small extent of the work

It is the general impression that in taking the finishing cuts on brass it is impolitic, either to employ wide tools, or to support them in a rigid-solid manner upon the rest as it is apt to make the work full of fine lines or strice. This effect is perhaps jointly attributable to the facility of vibration which exists in brass and similar alloys, to the circumstance of their being frequently used in thin pieces on the score of economy, and to their being rotated more rapidly in the lather than iron and steel, to expedite the progress of the work

When a wide flat tool is laid close down on the rest and made to cut with equal effect throughout its width, lines are very likely to appear on the metal and which if thun, rings like a bell from the vibration into which it is put, but if the one

corner of the tool penetrate the work to the extent of the thick ness of the shaving whilst the other is just flush with the surface, or out of work, the vibration is lessened, and that whether the penetrating angle or the other move in advance

The biass turner frequently supports the smoothing tool upon the one edge only, and keeps the other slightly elevated from the rest by the twist of the hand, which thus appears to serve as a cushion or spring to annul the vibrations, fig 410 shows about the greatest inclination of the tool Some work men with the same view interpose the finger between the tool and the rest, in taking very light finishing cuts The general practice however, is to give the tool a constant rotative shuffling motion upon the supported edge, never allowing it to remain strictly quiet, by which the direction of the edge of the tool is continually changed, so as not to meet in parallelism any former striæ which may have been formed, as that would tend to keep up the exciting cause, namely, the vibration of the metal more the inclination of the tool, the greater is the disposition to turn the cylinder into small hollows

Some workmen burnish the edges of the finishing tools for brass, like the joiner's scraper, of the firmer chisel used in soft wood turning. On account of the greater hardness and thick ness of the edge of the tool, it cannot be supposed that in these cases any very sensible amount of burn or wire edge is thrown up. The act appears chiefly to impart to the tool the smooth ness and gloss of the burnisher, and to cause it, in its turn, to burnish rather than cut the work, the gas fitters call it a planishing tool, but such tools should never be used for accurate works until the surface is perfectly true and smooth

The hard wood and brass turners avoid the continual neces sity for twisting the lathe rest in its socket to various angular positions, as they mostly retain it parallel with the mandrel, and in turning hollow works they support the tool upon an arm rest, this is a straight bar of iron, which resembles a long handled tool, but it has a rectangular stud at the end, to prevent the cutting tool from sliding off

The position of the arm rest and tool, as seen in plan, are therefore nearly that of a right angle, the former is held under the left arm, the latter in the right hand of the workman, the fore fingers of each hand being stretched out to meet near the end of the tool This may appear a difficult method, but it is in all respects exceedingly commodious, and gives considerable freedom and choice of position in managing the tool, the advantage of which is particularly felt in guiding the first entry of the drill or the path of the screw tool, and in brass work it likewise renders the additional service of associating the tool with the elastic frame of the man. But when particular firm ness and accuracy are required the tool should be supported upon the solid rest as usual

SECT V —TURNING TOOLS FOR IRON, STEEL, ETC


Angles 60 to 90 —Figures generally one sixth the full size

The triangular tool is one of the most effective in turning these metals as was adverted to at page 521, the triangular tool is also used by the engravers and others for scraping the surfaces of the metals, and it is then applied nearly perpendicular, or as a penknife in erasing, but when the triangular tool is placed nearly as a tangent against the inner or outer edge of a ring or cylinder, as in fig 409 it seems almost to devour the metal, and instead of scratching, it brings off coarse long shavings. In turning the flat sides of the ring, the face of the tool is placed almost in agreement with the plane to be turned

The graver, which is also an exceedingly general tool, is a square bar of steel ground off at the end, diagonally and obliquely, generally at an angle of from 30 to 50 degrees. The parts principally used are the two last portions of the edge close to the point, and to strengthen the end of the tool a minute facet is sometimes ground off, nearly at right angles to the broad chamfer, or principal face

The proper position of the tool in turning a cylinder, will be most readily pointed out by laying the chamfer of the tool in exact contact with the flat end of such cylinder, it will be then found that one of the lateral angles of the tool will touch the rest, and the obliquity in the shaft of the tool, would be the angle, at which the graver is ground, instead of which it is held square and slightly clevated above the horizontal position, as shown in fig 411. The graver is notated upon the supporting angle, which sticks into the rest much the same as the edge of the triangular tool in fact, the two tools, although different in form, remove the shaving in a very similar manner.

In using the graver and other tools for the metals, it is the aim to avoid exposing the end of the tool to the rough gritty surface of the material This is done by cleaning the surface, espe




cially the extreme edge with an old file, and beginning at that edge, the work is at one sweep reduced nearly to its required diameter by a wide thin cut which may be compared with a chamfer, or a conical fillet connecting the rough external surface with the smooth reduced cylinder. Therefore after the first entry, the point of the tool is buried in the clean metal below the crust, and works laterally which is indeed the general path of pointed tools for metal

When the graver is used in the tuin bench with intermittent motion, as for the pivots of watches, the axes for sextants and other delicate works—it is applied overhand or inverted, as in fig 412, but it is then necessary to withdraw the tool during each back stroke of the bow, to avoid the destruction of the acute point, and which alone is used—The graver when thus applied in lathes with continuous motion, is only moved on the rest as on a fulcium, and in the plane in which it lies, rather as a test of work done, than as an active instrument

The edge of the graver is afterwards used for smoothing the stronger kinds of work, it is then necessary to incline the tool horizontally to near the angle at which it is ground, in order to bring the sloping edge parallel with the surface. But the smoothing is better done by a thick narrow flat tool, ground at about sixty degrees, the handle of which is raised slightly above the horizontal, as in fig. 413, in order that its edge may approach the tangential position, here also the tool is rotated on one edge, after the manner of the brass tools or the graver

For many slight purposes requiring rather delicacy than strength as in finishing the rounded edge of a washer, the flat tool is inverted or placed bevil upwards, as in fig 414, the lower side then becomes the tangent, and the edge the axis of rotation of the tool the same as in turning convex mouldings with the soft wood chisel. Indeed, many analogies may be traced be tween the tools respectively used for soft woods and iron, except that the latter are ground at about twice the angle to meet the increased resistance of the hard metal, and the tools are mostly sustained by the direct support of the rest instead of resting in great measure against the hands of the individual

For instance, the *heel tool* which is used for rough turning the metals, is represented of the full size in the side view fig 415, and the front view, fig 416, and also on a smaller scale in figs 417 and 418 The dotted lines a, fig 417, denote the relative

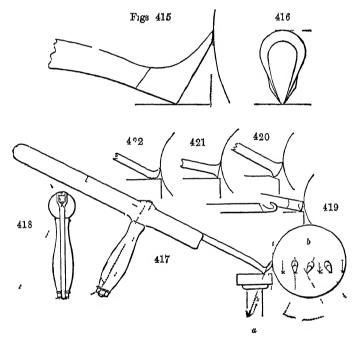

position of the fluted gouge, and although the heel or hook tool occupies nearly the same spot, its edge is of double the thickness, and the entire resistance of the cut is sustained by the heel of the tool, which is poised upon the flat horizontal surface of the rest—the shaft of the tool is bent nearly at right angles that it may be held either above or below the shoulder of the workman as preferred—Some variation is made in the form and size of

the heel tools, and they are occasion illy pointed instead of round upon the cutting edge


The heel tool is slightly rotated upon its heel in its course along the work, so that, as seen at b, its edge travels in short arcs, and when its position becomes too inclined, a fresh footing is taken, on this account the straight handle, employed in ordinary tools, is exchanged for the transverse handle represented. In the best form of heel tools the square shaft lies in a groove in the long handle, and is fixed by an eye bolt and nut, passing through the transverse handle, as seen in the section 418. Notwithstanding the great difference between the materials upon which the gouge and heel tool are employed, their manage ment is equally easy as in the latter the rest sustains the great pressure, leaving the guidance alone to the individual

Fig 419 represents another kind of hook tool for iron which is curiously like the tools, figs 368 to 371, p 514, used for soft wood, the common differences being here also observable, namely the increased strength of edge, and that the one edge is placed upon the rest to secure a firm footing or hold

Nail head tools are made much on the same principle, one of these fig 420, is like a cylinder, terminating in a chamfered overhanging disk to be rolled along so as to follow the course of the work, but it is rather a theoretical than practical institument. When, however, the tool is made of a square or rectangular bar, and with two edges as at fig 421, it is excellent, and its flat termination greatly assists in imparting the rectilinear form to the work. Occasionally the bai is simply bent up at the end to present only one edge, as in fig 122, it is then necessary the cuived part should be jagged as a file to cause it to dig into the rest like the others of its class, and which present some analogy to the soft wood tools, figs 372 and 373, p 510

The cranked or hanging tools, fig 423, are made to embrace the rest, by which they are prevented from sliding away, with out the necessity for the points and edges of the heel tools, the escape of the cranked tool sideways is prevented by the pin inserted in one of the several holes of the rest. The direct penetration is caused by the depression of the hand, the side way motion by rotating the tool by its transverse handle, which is frequently a hand vice temporarily sciewed upon the shaft

To save the trouble of continually shifting the lathe rest, an iron wedge, (not represented,) is generally introduced at a, between the rest and the back of the tool, when the wedge is advanced at intervals it sets the tool deeper into the work, when it is withdrawn it allows more room for the removal of the tool



The succeeding figure, 424, represents a tool of nearly similar kind, the stock is of iron, and it carries a piece of steel, about three or four inches long, and one inch square, which is forged hollow on the faces by means of the fuller, to leave less to be ground away on the stone The rectilinear edges of this tool are used for smoothing iron rollers, non ordnance, and other works turned by hand, and to preserve the edge of the tool, thin spills of hard wood are sometimes placed between the cutter and the bar Under favourable arrangements these tools also are managed with great facility, indeed it occasionally happens that the weight of the handle just supplies the necessary pressure to advance the tool, so that they will rest in proper action without being touched by the hand, a tolerable proof of the trifling muscular effort occasionally required, when the tools are judi clously moulded and well applied

These hand tools and various others of the same kinds, although formerly much used by the millwrights, are now in a great measure replaced by the fixed tools applied in the sliding rest, some account of which will be given in the next section

SECT VI —FIXED OR MACIINE TOOLS FOR TURNING AND PLANING

Angles as in the hand tools — Figures generally one fourth to one eighth

the full size


The performance of fixed tools is, in general, much more effective than that of hand tools, as the rigid guides and slides now employed, do not suffer the muscular fatigue of the man, nor do they experience those fluctuations of position to which his hand is liable. Therefore, as the tool pursues one constant undeviating course, the corresponding results are obtained both

more economically and more accurately by the intervention of the guide principle, or the slide rest from which we derive the slide lathe and thence the planing machine and many other most invaluable tools

The cutting edges of machine tools mostly follow the same circumstances as those of hand tools but additional care is required in forming them upon principle, because the shafts of the fixed tools are generally placed with little power of deviation either at right angles to or parallel with, the surfaces to be wrought the tools are then held in the non grasp of screws and clamps, in mortises, staples, and grooves. The tools do not, therefore admit of the same accommodation of position to compensate for erroneous construction, or subsequent deterioration from wear, as when they are held in the hand of the work man, and directed by his judgment

It must also be additionally boine in mind that, however pon derous elaborate, or costly the *machine* may be, its effectiveness entirely depends upon the proper adaptation and endurance of the cutting tool, through the agency of which it produces its results

The usual position of the fixed turning tools is the horizontal

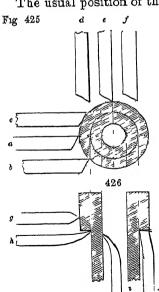

line, as at a, fig 425 and unless the tools always lie on the radius (or any other predetermined line.) various interferences occur instance the tool proceeding in either of the lines b or c, could not reach the center of the work, and a portion would then escape being wrought, the curvature of the circle at b, would sacrifice the pro per angle, and expose the tool to fracture from the obliquity of the and at c, the edge would be altogether out of contact and the tool could only rub and not These evils increase with the diminution of the circle, and although the diagram is greatly

exaggerated for illustration, the want of centrality is in truth

an evil of such magnitude that various continuances are resorted to by which either the entire slide rest, or the cutter alone may be adjusted for height of center

The planing tools for metal are in general fixed vertically, and the path of the work being in the majority of planing machines, rectilinear and horizontal, the tool may be placed at d, e, or f, indifferently, there being no interference from curvature as in turning

In those modifications of the pluning machine in which as in Brunel's mortising engine the cutter travels perpendicularly, and is also fixed perpendicularly, as in the key groove or slotting engines and the paring engines, the general form of the tool f, or that of a strong paring chisel, is retained, but the blade is slightly inclined in its length as at f, fig. 426 to avoid touching the surface to be wrought except with its cutting edge, and the length of the tool supplies a little elasticity to relieve the friction of the back stroke

Although all the various forms of hand turning tools are more or less employed as fixed tools, still the greater part of the work is done with the point tool (such as g in the plan fig 426) the angle of which should be slightly rounded, but for working into an angle, the point of the tool is thrown off as at h, so that its shaft may avoid either side of the angle, and it is then called a side tool. For internal works, and in small apertures especially, the abrupt curvature requires particular attention to the central position of the tool i, and a frequent sacrifice of the most projer form of the chamfer or edge. I will now describe a few of the slide rest tools in the previous order, namely, those for soft wood for hard wood, for brass, and for iron

The fixed tools for soft wood require the same acute edges, and nearly tangential positions, as those used by hand, and if these conditions exist, it is quite immaterial whether the tool touch



the work above or below the centre, but the central line, or a, fig 425, is the most usual. The soft wood gouge, or hook tool, is

successfully imitated by making an oblique hole in the end of a bar of steel, as seen in two views in fig 427 but it is not very lasting or a bar of steel may be bent to the form of fig 428, and sharpened internally either rounded to serve as a gouge or straight and inclined as a chisel, but neither of these tools admits in itself of adjustment for center

The difficulty of center is combited by the use of a tool exactly like a common gouge or chisel, but only an inch or two long, and with a cylindrical stemalso an inch or two long by which it may be retained at any height in the end of a bar of iron having a nearly perpendicular hole and an appropriate side screw for fixing the tool, this construction is abundantly strong for wood

The fixed tools for hardwood and wory, follow the several forms of the hand tools figs 382 to 405 pp 518 19, except in having parallel stems, they are always placed horizontally and are treated in all respects just as before. Care should be taken how ever, that the end of the tool is its widest part, in order that, if it be sent in below the surface of the work, as in cutting a groove, it may clear well, and not tub against the sides

In sharpening the tools intended for hard wood and ivory, the oil stone should be applied principally at the end or on the chamfer of the tool, as this will not reduce the height of center, which it is always important to retain. If, however, the tools should eventually become chamfered off, after the manner of fig. 406, p. 519, they may be annealed, and thrown up to place the chamfered part in the line of the general face, they are then ic-hardened, and ground up as at first. But as most of the slide rests for wood turning are fitted into pedestals by means of a cylindrical stem with a vertical screw adjustment the tools may be at all times accurately centered when particular care is required, and this provision is of still greater importance with the several revolving cutters applied to the slide rest, which will be hereafter adverted to

The fixed tools for brass and for won whether used in the lathe or the planing machine, will be considered in one group, the principal difference is, that the tools for brass present an angle of nearly 90 degrees, the tools for iron an angle of 60, to the superficies to be wrought. Indeed the angles or edges of the cube, may be considered as the generic forms of the tools for brass, and the angles or edges of the tetrahedron, as the generic

forms of the tools for iron, that is, supposing the edges or planes of these solids to be laid almost in contact with the line of motion or of the cut, in order that they may fulfil the constant conditions of the paring tools, described at page 462, and again referred to at pages 472 to 474


The fixed tools for brass and similar alloys resemble, as in hand turning the more simple of the hard wood tools, except that they are sharpened a trifle thicker on the edge, they are however, nearly restricted to the point tool the narrow round tool and to the side tool, which is represented at \jmath , fig. 426. It is ground so that the two cutting edges meet at an angle not exceeding about 80 degrees, that in proceeding into rectangular coiners it may clear each face by about five degrees and it will then cut in either direction, so as to proceed into the angle upon the cylindrical line, and to leave it upon the plane surface, or it may be applied just in the reverse manner without intermission

When the tool is used for rough work the corner is slightly rounded, but in finishing it is usually quite sharp, and as it differs only some ten degrees from the solid angle of a cube, it is abundantly strong. If the tools acted upon a considerable extent or width of the brass, they would be liable to be set in vibration, but as the paths of the cutters are determined by the guide principle employed the point fulfils all that can be desired

The fixed tools for won present more difficulties than the generality of the foregoing kinds first, the edges of the tools are thinner, and more interfered with in the act of grinding as the vertical height of the cutting edge is reduced when either face of the wedge is ground and secondly they are exposed to far more severe strains from the greater hardness of the material, and the less sparing manner in which it is reduced or wrought, owing to its smaller price and other circumstances, and there fore, the most proper and economic forms of the tools for iron are highly deserving of attention

The fracture of a tool when it is overloaded, commonly points out the line of greatest resist ince or strain. The tool fig. 420, on next page although apparently keen is very weak, and it is besides disposed to pursue the line at which its wedge formed extremity meets the work, or to penetrate at an angle of some 30 degrees (see page 462). Figure 429, would probably break through a line drawn nearly parallel with the face a b, of the

work under formation that portion should therefore be made very nearly parallel with a b the line of resistance in order to impart to the tool the strength of the entire section of the steel so that should it now break, it would have a much longer line of fracture. The tool thus altered is very proper for brass, an alloy upon which acute tools cannot be favourably employed.




But with the obtuse edge of fig 430 other metals will be only removed with considerable labour as it must be remembered the tool is a wedge and must insinuate itself as such amongst the fibros of the material. To give the strengthened tool the proper dogree of penetration the upper face is next sloped as in 431, to that angle in which the minimum of friction and the maximum of durability of the edge most nearly meet, and which for iron is shown to be about 60 degrees as in the trian gular tool fig 409. The three planes of pointed tools for iron, meeting at 60 degrees, constitute the angle of the tetrahedron, or the solid with four equilateral planes like a triangular pyra mid the base and sides of which are exactly alike

But the form of 431 would be soon lost in the act of grinding, therefore to conclude, the tool is made in the bent form of fig 432, in which the angles of 431 are retained, and the tool may be many times ground without departing from its most proper form. This is in effect extending the angle of the tetra hedron into the triangular prism ground off obliquely, or rather, as seen in the front view fig 433 into a prism of five sides, the front angle of which viries from 60 degrees to 120 degrees, and is slightly rounded the latter being most suitable for rough work, sometimes the front of the prism is half round, at other times quite flat, these forms are shown in fig 439.

The extremities of figs 431 and 432 approach very closely to the form of the graver used for engraving on steel and copper plates, than which no instrument works more perfectly. The slender graver, whether square or lozenge, is slightly bent, and has a flattened handle so that the nidge behind the point may lie so nearly parallel with and so completely buried in the line or groove under formation, as to be prevented or checked, by the surface contact, from digging into the work. This is another confirmation of the fact that the line of penetration is that of the lower face of the cutter or wedge or that touching the work

In adopting the crank formed tools 432 the principle must not be carried into excess, as it must be remembered, we can never expunge elasticity from our materials whether viewed in relation to the machine the tool or the work

The tool should be always grasped as near the end as place ticable therefore the hook or crank should occupy but little length as the distance from the supposed line of the fixing screw c to the edge of the tool, being doubled, the flexure of the instrument will be fourfold when trebled ninefold, in fact as And also as the flexure may be supposed to occur from nearly the center of the bar (that is neglecting the crook) the point of the tool should not extend beyond the central line otherwise when the tool bends its point would dig still deeper into the work from its rotation on the intersection of c and o the point situated behind the central line would spring away from or out of instead of into the work Io extend the wear of the cranl ed tools they are commonly forged so that the point is nearly level with the upper surface of the shaft as in fig 438, they then admit of being many times ground before they reach the central line, and they are ultimately ground, (always at the end of the prism and obliquely) until the hook

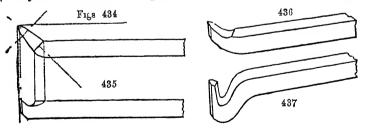


is entirely lost. This avoids such frequent recuirence to the forge fire, but it is a departure from the right principle to allow the point to extend beyond the center line o—See Appendix, Note A. Q., page 983

The works of the lathe and planing machine frequently present

angles or rebates, chamfers grooves, and under cut lines, which require that the tool should be bent about in various ways, in order that their edges may retain as nearly as possible the same relations to all these surfaces as the ordinary surfacing tools figs 431 and 432 have to the plane a b For instance the shaft of the tool 431, when bent at about the angle of 45 degrees, becomes a side cutting and ficing tool, as shown in plan in fig 434 in elevation in 435 and in perspective in 436 and in like manner the cranked tool 432 when also bent as in 434 becomes 437 and is also adapted to working into angular corners upon either face

Mr Nasmyth's tool gage, shown in elevation in 438, and in plan in 439, entirely removes the uncertainty of the angles given

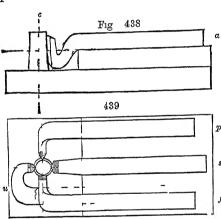


to those irregular bent tools for instance, when a the shaft of the tool is laid upon the flat surface and applied to the iron cone c, whose side mea sures about 3° with the perpendicular, it serves with equal truth for s the tool for surfaces, p f, the side cutting tools, used also for perpendicular f cuts and fillets and u for undercut works

In applying tools to lathe works of small diameters, it is necessary to be very exact and not to place them above the center, or they immediately independent as this soon occurs with tools having so small an angle it appears desirable to make the cone gage for small lathe works of about twice the given angle, and to mark upon the cone a circle exactly indicative of the height of center, the tool can be then packed up to the center line, with one or two slips of sheet iron, to be afterwards placed beneath the tool when it is fixed in the lathe rest. In small hollow works, the most lasting of the crunk formed tools, are entirely inapplicable indeed so much attention is required to prevent the tool from rubbing against the interior sur faces, that the ordinary ingles cannot be employed, and the

cone gage cerses to be useful but in every other case it should be constantly resorted to the additional thickness a is required to make it applicable to the crank formed tools *

Fig 440, represents a cutter introduced in the Block Machinery at Portsmouth to lessen the difficulty of making and restoring the tools, for turning the wrought non pins for the sheaves, it consists of a cylindrical wire which from being ground off obliquely, presents an elliptical edge—the tool is fixed in a stock of non, terminating in an oblique hole, with a binding screw—The tool, when used for iron, in the "pin turning lathes, was made solid, when used for turning the surfaces of the wooden shells, in the "shaping engine—it was pierced with a central hole, the latter could only facilitate the process of sharpening without altering the character of the edge, which continued under the same circumstances as when solid

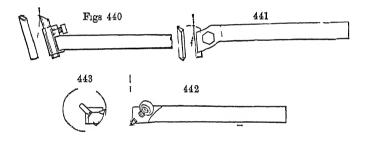

About sixteen years back, the author made for his own use, a tool such as fig 440, but found that with rough usage the cutter was shivered away, on account of its breadth, and he was soon led to substitute for the solid cylinder, a triangular cutter, the final edge of which was slightly rounded, and placed more nearly perpendicular, in a split socket with a side screw, as in fig 441. The strength of the edge was greatly increased, and it became, in fact an exact copy of the most favourable kind of tool for the lathe, or planing machine, retaining the advantage that the

^{*} The general similitude between some of the authors figures 429 to 439 (engraved in Jan 1840) and part of those in Mr James Nasmyth's article on Lools, in Buchanan's Mill Work (published in Dec 1841) is solely due to their being each indebted to the same individual (namely to Mr Joseph Clement), for the general theory advanced and which associates the principles of machine tools for metal that are of comparatively modern date, with those of cutting tools generally, even of the most primitive kinds

original form could be always kept, with the smallest expenditure of time, and without continually ie forging the blade to the manifest deterioration of the steel from passing so frequently through the fire it being only requisite to grind its extremity like a common graver, and to place it so much higher in the stock as to keep the edge at all times true to the center

A light and a left hand side tool for angles the former seen in figs 442 and 443, were also made the blade and set screw were placed it about 45°, and at a sufficient vertical angle, to clear both the inside of a cylinder of three inches diameter, and also to face the bottom or surface. These side tools inswered very well for cast non-but fig 411, the ordinary surfacing tool is excellent for all purposes and has been employed in many extensive establishments *

In turning heavy works to their respective forms a slow motion and strong pointed tools are employed but in finishing these works with a quicker rate of motion there is risk of putting the lathe in a slight tremor, more putricularly from the small periodic shocks of the toothed wheels which in light finishing cuts are no longer kept in close bearing as in stronger cuts


Under these circumstances, were the tools rigid and penetra tive, each vibration would produce a line or scratch upon the surface but the finishing or hanging tools figs 441 and 445, called also springing tools which are made of various curves and degrees of strength, yield to these small accidental motions. The first resembles in its angles the rest of the tools used for brass the second those for non, their edges are rectalinear, and

The prismatic cutters admit of the usual variations of shape—sometimes two binding screws are used and occasionally a tail screw to receive the direct strain of the cut—When the blades are only used for cutting in the one direction say from right to left they may with advantage be ground with a double inclination—for as all these pointed tools work laterally—the true inclination of some 60—to the nation facet of fillet operated upon—is then more strictly ittained

Considerable economy results from this and reveral other applications in which the cutter and its shaft are two distinct parts. The small blades at steel admit of being formed with considerable case and accuracy and of being hardened in the most perfect manner. And when the cutters are fixed in strong bars or shafts of iron they receive any required degree of strength and the one shaft or carriage will serve for any successive number of blades.

The blades are sometimes made flat or convex in the front and ground much thinner to serve for soft wood the tools for hard wood and wory being more easily ground do not call for this application of detached blades

sometimes an inch wide. The width and elasticity of these finishing tools prevent them acting otherwise than is scrapers, for removing the slight superficial roughness, without detracting from the accuracy of form previously given. In a somewhat similar manner the broad hand flat tool rendered elastic by its partial support as in fig 410 page 521 is frequently used for smoothing briss works, and others turned with the slide rest

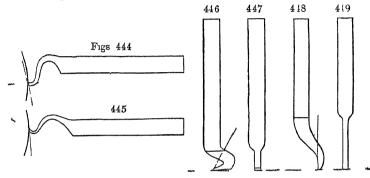

Figs 446 and 447 represent a very excellent finishing tool introduced by Mr Clement for planing cast and wrought non, and steel, it resembles the cranked tools generally, but is slighter it is made smooth and flat upon the extremity or rather in a very minute degree rounded. This tool is shapened very keenly upon the oilstone, and is used for extremely thin cuts, generally one quarter of an inch wide, and when the corners just escape touching, the work is left beautifully smooth, the edge should on no account stand in advance of the center line. But to avoid the chatters so hable to occur in brass works, Mr Clement prefers for that material the elastic planing tool, figs 448 and 449 its edge is situated considerably behind the center

In concluding the notice of the turning tools, it may be neces sary to add a few words on those used for lead, tin, zinc, copper, and their ordinary alloys. The softest of these metals, such as lead, tin and soft pewter may be turned with the ordinary tools for soft wood, but for the harder metals, such as zinc, and hard alloys containing much aritimony the tools resemble those used for the hard woods, and they are mostly employed dry

Copper, which is much haider and tougher, is turned with tools similar to those for wrought non, but in general they are sharpened a little more keenly and water is allowed to drop

upon the work to lessen the risk of dragging or tearing up the face of the copper, a metal that neither admits of being turned or filed with the ordinary facility of most others. Silver and gold, having the tenacious character of copper, require similar turning tools, and they are generally lubricated with milk

In the above and nearly all the metals except non and those of equal or superior hardness, there seems a disposition to adhere, when by accident the recently removed shaving gets forcibly pressed against a recently exposed surface, (the metals at the time being chemically clean, see page 482 Vol I) this disposition to unite is nearly prevented when water or other fluid is used

Water is occasionally resorted to in turning wrought non and steel, this causes the work to be left somewhat smoother, but it is not generally used, except in heavy work, as it is apt to rust the machinery oil fulfils the same end, but is too expensive for general purposes —See Appendix, Note AR, page 983

Cast iron having a crystalline structure, the shavings soon break, without causing so much friction as the hard ductile metals cast iron is therefore always worked dry, even when the acute edges of 60 degrees are thickened to those of 80 or 90, either from necessity, as in some of the small boring tools, or from choice on the score of duiability, as in the largest boring tools and others. Brass and gun metal are also worked dry although the turning tools are nearly rectangular, as the copper becomes so far modified by the zinc, or tin, that the alloys, although much less crystalline than castiron, and less ductile than copper, yield to the turning tools very cleanly without water

But when tools with rectangular edges are used for wrought iron and steel, on account of the greater cohesion of these materials, they must be lubricated with oil, grease, soap and water, or other matter, to prevent the metals from being torn And the screw cutting tools many of which present much surface friction and also rectangular or still more obtuse edges, almost invariably require oil or other unctuous fluids, for all the metals

It will be shown in the practice of metal turning, that the diamond point, figs 64 and 65, page 178 Vol I, is occasionally used in turning hardened steel and other substances, figs 72 to 74 are constantly used in engraving by machinery, and in graduating mathematical instruments—See Appendix, Notes AS to AV pages 988 to 1001

CHAPIER XXV

BORING TOOLS

SECT I -BORING BITS FOR WOOD


THE process of boring holes may be viewed as an inversion of that of turning generally the work remains at rest, and the tool is revolved and advanced. Many of the boring and drilling tools have angular points, which serve alike for the removal of the material, and the guidance of the instrument, others have blunt guides of various kinds for directing them, whilst the cutting is performed by the end of the tool

Commencing as usual with the tools for wood the brad awling 450 may be noticed as the most simple of its kind, it is a cylindrical wire with a chisel edge, which rather displaces than removes the material, it is sometimes sharpened with three facets as a triangular prism. The awl, fig 451, used by the wire workers, is less disposed to split the wood, it is square and sharp on all four edges, and tapers off very gradually until near the point, where the sides meet rather more abruptly

The generality of the boring instruments used in carpentry are fluted, like reeds split in two parts, to give room for the shavings and they are sharpened in various ways as shown by figures 452 to 456. Fig. 452 is known as the shell, and also as the gouge bit, or quill bit, it is sharpened at the end like a gouge, and when revolved it shears the fibres around the margin of the hole, and removes the wood almost as a solid core. The shell bits are in very general use, and when made very small, they are used for boring the holes in some brushes

Fig 453, the spoon bit, is generally bent up at the end to make a taper point, terminating on the diametrical line, it acts something after the manner of a common point drill, except that it possesses a keen edge suitable for wood. The spoon bit is in very common use the cooper's dowel bit, and the table bit, for making the holes for the wooden joints of tables, are of this

kind, occasionally the end is bent in a semi-circular form, such are called duck nose bits from the resemblance and also brush bits from their use—the diameter of the hole continues undiminished for a greater depth than with the pointed spoon bit

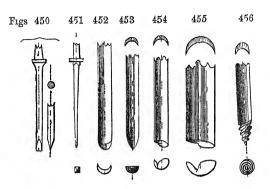

The nose bit, fig 454, called also the slit nose bit, and auger bit, is slit up a small distance near the center, and the larger piece of the end is then bent up nearly at right angles to the shaft so as to act like a paring chisel, and the coiner of the reed, near the nose also cuts slightly. The form of the nose bit which is very nearly a diminutive of the shell auger, fig. 155, is better seen in the latter instrument, in which the transverse cutter lies still more nearly at right angles, and is distinctly curved on the edge instead of radial. The augers we sometimes made three inches diameter, and upwards, and with long removable shanks, for the purpose of boring wooden pump barrels, they are then called pump bits.

There is some little uncertuinty of the nose bits entering exactly at any required spot, unless a small commencement is previously made with another instrument as a spoon bit a gouge, a biad awl, a center punch or some other tool, with augers a prepulatory hole is invariably made, either with a gouge, or with a center bit exactly of the size of the auger. When the nose bits are used for making the holes in sash bars for the wooden pins or dowels, the bit is made exactly parallel and it has a square brass socket which fits the bit, so that the work and socket being fixed in their respective situations, the guide principle is perfectly applied. A "quide tube" built up

as a tripod which the workman steadies with his foot, has been recently applied by Mr Charles Mry of Ipswich for boring the auger holes in railway sleepers exactly perpendicular *


The gunlet fig 456 is also a fluted tool, but it terminates in a sharp worm or screw, beginning as a point and extending to the full diameter of the tool, which is drawn by the screw into the wood. The principal part of the cutting is done by the angular corner intermediate between the worm and shell which acts much like the auger, the gimlet is worked until the shell is full of wood when it is unwound and withdrawn to empty it

The center bit, fig 457, shown in three views, is a very beautiful instrument, it consists of three parts, a center point or pm, filed triangularly, which serves as a guide for position, athin shearing point or nucker, that cuts through the fibres like the point of a knife, and a broad chisel edge or cutter, placed obliquely to pure up the wood within the circle marked out by the point. The cutter should have both a little less radius and less length than the nicker upon the keen edge of which last the correct action of the tool principally depends

Many variations are made from the ordinary center bit, fig 457, sometimes the center point is enlarged into a stout cylin

direct plug, so that it may ex actly fill a hole previously made, and cut out a cylindrical coun tersink around the same, as for the head of a screw bolt. This tool, known as the plug center bit, is much used in making frames and furniture, held toge ther by screw bolts. Similar tools but with loose cutters.

inserted in a diametrical mor

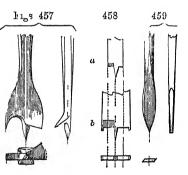

tise in a stout shaft, are also used in ship building for inlaying the heads of bolts and washers, in the timbers and planking

The name coopers center but is very short, and is enlarged behind into a cone, so that immediately a full cask has been bored the cone plugs up the hole until the tap is inserted. The center bit deprived of its chisel edge, or possessing only the pin and nicker, is called a button tool it is used for boring and

See Minutes of Conversation, Inst Civil Ingineers 181' page 76

cutting out at one piocess the little leather disks or buttons, which serve as nuts for the screwed wires in the mechanism connected with the keys of the organ and piano forte

The expanding center bit, shown on a much smaller scale in fig 460 is a very useful instrument it has a central stem with a conical point, and across the end of the stem is fitted a transverse bar adjustable for radius. Where the latter carries only a lancet shaped cutter it is used for making the margins of circular recesses and also for cutting out discs of wood and thin materials generally, when, as in Mr James Stone's modification the expanding center bit has two shearing points or nickers, and one



chisel formed cutter, it serves for making
Fig 460 grooves for inlaying rings of metal or wood
in cabinet work, and other purposes *—See

Appendix note AW, p 1001


The above tools being generally used for woods of the softer kinds, and the plankway

of the grain the shearing point and oblique chisel of the center bit, fig 457, are constantly retained but the corresponding tools used for the hard woods assume the characters of the hard wood tools generally. For instance a fig 458 has a square point, also two cutting edges, which are nearly diametrical, and sharpened with a single chamfer at about sixty degrees, this is the ordinary drill used for boring the finger holes in flutes and clarionets which are afterwards chamfered on the inner side with a stout knife the edge of which measures about 50 degrees. The key holes, are first scored with the cup key tool, b, and then drilled, the tools a, and b, being represented of corresponding sizes, and forming between them the annular ridge which indents the leather of the valve or key

When a, fig 458, is made exactly parallel and sharpened up the sides it cuts hard mahogany very cleanly in all directions of the grain, and is used for drilling the various holes in the small machinery of piano fortes, this drill (and also the last two), is put in motion in the lithe and in fig 459, the lathe drill for hard woods, called by the French langue de carpe, the center point and the two sides melt into an easy curve, which is sharpened all the way round and a little beyond its largest part

Various tools for boring wood have been made with spiral

stems in order that the shavings may be enabled to ascend the hollow worm, and thereby save the trouble of so frequently with drawing the bit. For example, the shaft of fig. 461, the single lip auger is forged as a half round bar, nearly as in the section above, it is then coiled into an open spiral with the flat side outwards, to constitute the cylindrical surface, and the end is formed almost the same as that of the shell auger, fig. 455. The twisted gimlet fig. 462, is made with a conical shaft, around which is filed a half round groove the one edge of which becomes thereby sharpened, so as gradually to enlarge the hole after the first penetration of the worm, which, from being smaller than in the common gimlet, acts with less risk of splitting

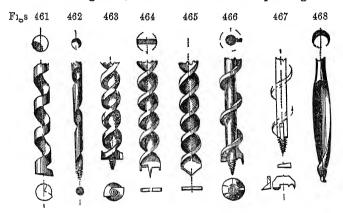

The ordinary screw auger, fig 463, is forged as a parallel blade of steel, (seen in the section, fig 464, which also refers to 463 and 465,) it is twisted red hot, the end terminates in a worm by which the auger is gradually drawn into the work, as in the gimlet, and the two angles of lips are sharpened to cut at the extreme ends, and a little up the sides also

The same kind of shaft is sometimes made as in fig 464, with a plain conical point, with two scoring cutters and two chisel edges, which receive their obliquity from the slope of the worm it forms as it were a double center bit, with two lips grafted on a spiral shaft. The same shaft has also been made, as in fig 465, with a common drill point and proposed for metal but this seems scarcely called for but it is in this form very effective in Hunter's patent stone boring machine, intended for stones not harder than sandstones—the drill is worked by a

cross, guided by a tube and forced in by a screw cut upon the shaft carrying the drill so that the stone is not ground to powder, but cast off in flakes with very little injury to the drill

Another sciew auger which is perhaps the most general after the double lipped sciew auger, fig 463, is known as the American screw auger and is shown in fig 466, this has a cylindrical shaft, around which is brazed a single fin or rib, the end is filed into a worm as usual, and immediately behind the worm a small diametrical mortise is formed for the reception of a detached cutter, which exactly resembles the nicking point and chisel edge of the center bit, it may be called a center bit for deep holes The parts are shown detached in fig 467 The loose cutter is kept central by its square notch, embracing the central shaft of the auger it is fixed by a wedge driven in behind and the chisel edge rests against the spiral worm Spare cutters are added in case of accident and should the sciew be broken off, a new sciew and moitise may be made by depriving the instru ment of so much of its length The instrument will be found on trial extremely effective, and on account of the great space allowed for the shavings, they are delivered perfectly, until the worm is buried a small distance beneath the surface of the hole

The Americans have also invented an auger, said to be thoroughly applicable to producing square holes, and those of other forms the tool consists of a steel tube, of the width of the hole, the end of the tube is sharpened from within, with the corners in advance or with four hollowed edges. In the center of the square tube works a screw auger, the thread of which projects a little beyond the end of the tube, so as first to pene trate the wood, and then to drag after it the sheath, and thus complete the hole at one process the removed shavings making their escape up the worm and through the tube. For boring long mortises, two or more square augers are to be placed side by side, but they must necessarily be worked one at a time *

Fig 468 the list of this group of spiral drills, is used in


^{*} This is described in Gill's Fichinical repository vol xi page 317. The author has never seen one it seems far too complex in instrument for general purposes and its success appears to be overlated. The tools figs 461 to 466, are also ascribed to America, whether truly or not it is impossible to say. I ig 461 is in partial use. The twisted gimlet is a good tool, but as it is somewhat more expensive than the common kind it is less used. These several instruments are probably derived from the common series auger fig. 463 which is, I believe. I nglish

Germany and two of the instruments were brought from that country and deposited in the Museum of the Society of Arts by Mr Bryan Donkin* The tool acts as a hollow taper bit or rimer, and the screw form point and shaft, assist in drawing it into the wood but the instrument must pass entirely through for making cylindrical holes!

The most usual of the modes of giving motion to the various kinds of boring bits is by the ordinary carpenters brace with a crank formed shaft. The instrument is made in wood or metal and at the one extremity has a metal socket called the pad with a taper square hole, and a spring catch used for retaining the drills in the brace when they are withdrawn from the work and at the other, it has a swivelled head or shield which is pressed forward horizontally by the chest of the workman, or when used vertically, by the left hand, which is then commonly placed against the forehead.

The ordinary carpenters brace is too fimiliarly known to require further description but it sometimes happens, that in

coiners and other places there is not room to swing round the handle, the angle brace fig 469, is then convenient. It is made entirely of metal, with a pair of bevil pinions and a winch handle that is placed on the axis



of one of these, at various distances from the center, according to the power or velocity required. Sometimes the bevil wheel attached to the winch handle is thice or four times the diameter of the pinion on the drill, this gives greater speed but less power §

The augers, which from their increased size require more power, are moved by transverse handles, some augers are made with shanks, and are rivetted into the handles just like the

^{*} See Frans vol aliv p 75

[†] The coopers but is sometimes made with a gimlet worm a semi-cenical shell and a conical plug to stop the hole until the tap is inserted

¹ The carpenter's brace is sometimes fixed vertically with the power of revolving and of being depressed by a lever in some respects like the smith's press drill, fig 494, page 558 See ilso Manuel du Tourneur 1816 Plate IX vol in

^{\$ 116, 469} is reduced from Plate IX of the Manuel du Tourneur

gimlet occasionally the handle has a socket or pad for receiving several augers but the most common mode, is to form the end of the shaft into a ring or eye, through which the transverse handle is tightly driven. The brad awls, and occasionally the other tools requiring but slight force are fitted in straight handles, many of the smaller tools are attached to the lather mandrel by means of chucks and the work is pressed against them either by the hand or by a screw, a slide or other contrivance, figs 458 and 459, are always thus applied


SECT II -DRILLS FOR METAL, USED BY HAND

The frequent necessity in metal works for the operation of drilling holes, which are required of all sizes and various degrees of accuracy, has led to so very great a variety of modes of per forming the process, that it is difficult to arrange with much order the more important of these methods and apparatus

It is, however intended to proceed from the small to the large examples in the present section some of the general forms of the drills for metal will be first noticed, in the next section will be traced the modes of applying hand power to drills, commencing with the delicate manipulation of the watchmaker, proceeding gradually to those requiring the different kinds of braces and ending with the various apparatus for driving large drills by hand power. In the fourth section the machine processes will be adverted to commencing with the ordinary lathe and ending with the boring apparatus for the largest cylinders, the concluding section of this chapter will be devoted to the various drills, cutters, and broaches required for making coincal or taper holes.

The ordinary piercing drills for metal do not present quite so much variety as the wood drills recently described the drills for metal are mostly pointed, they consequently make conical holes, which cause the point of the drill to pursue the original line and eventually to produce the cylindrical hole. The comparative feebleness of the drill-bow limits the size of the drills employed with it to about one quarter of an inch in diameter but as some of the tools used with the bow, agree in kind with those of much larger dimensions it will be convenient to consider as one group the forms of the edges of those drills, which cut when moved in either direction

Figs 470, 471 and 472, represent, of their largest sizes the usual forms of drills proper for the reciprocating motion of the drill bow because their cutting edges being situated on the line

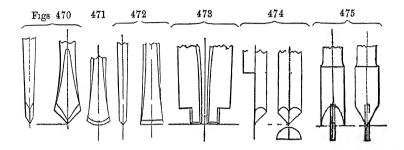

of the axis and chamfered on each side, they cut, or rather scrape, with equal facility in both directions of motion


Fig 470 is the ordinary double cutting diill, the two facets forming each edge meet at an angle of about 50 to 70 degrees, and the two edges forming the point meet at about 80 to 100, but the watchmakers who constantly employ this kind of drill, sometimes make the end as obtuse as an angle of about 120 degrees the point does not then protiude through their thin works, long before the completion of their work Fig 471, with two cucular chamfers, bores cast non more rapidly than any other reciprocating drill, but it requires an entry to be first made with a pointed drill, by some, this kind is also preferred for wrought iron and steel The flat ended drill, fig 472, is used for flattening Fig 473 is a duplex expanding drill, the bottoms of holes used by the cutlers for inlaying the little escutcheons and plates of metal in knife handles the ends are drawn full size, and the explanation will be found at page 135 of the first volume

Fig 474 is also a double cutting drill, the cylindrical wire is filed to the diametrical line and the end is formed with two facets. This tool has the advantage of retaining the same diameter when it is sharpened it is sometimes called the Swiss drill and was employed by M. Le Rivière, for making the numerous small holes, in the delicate punching machinery for manufacturing perforated sheets of metal and pasteboard, these drills are some times made either semicircular or flat at the extremity, and as they are commonly employed in the lathe, they will be

further noticed in the fourth section, under the title of half round boring bits

The square countersink fig 475 is also used with the drill bow, it is made cylindrical and pierced for the reception of a small central pin, after which it is sharpened to a chisel edge as shown. The countersink is in some measure a diminutive of the pin drills, fig 482 to 485, page 550, and occasionally circular collars are fitted on the pin for its temporary enlargement or around the larger part to serve as a stop, and limit the depth to which the countersink is allowed to penetrate, for inlaying the heads of screws. The pin is removed when the instrument is sharpened

By way of comparison with the double cutting drills, the ordrang forms of those which only cut in one direction, are shown in figs 476, 477, and 478 Hig 476 is the common single cutting

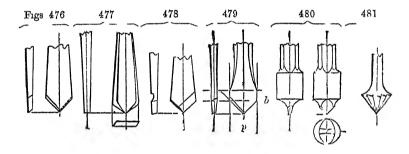

drill, for the drill bow, brace, and lathe, the point, as usual, is nearly a rectangle but is formed by only two facets, which meet the sides at about 80° to 85°, and therefore he very nearly in contact with the extremity of the hole operated upon, thus strictly agreeing with the form of the turning tools for brass Lig 177 is a similar drill particularly suitable for horn tortorse shell, and substances hable to agglutinate and clog the drill, the chainfers are rather more acute and are continued around the edge behind its largest diameter so that if needful, the drill may also cut its way out of the hole

Fig 478, although never used with the drill bow, nor of so small a size as in the wood cut, is added to show how completely the drill proper for non, follows the character of the turning tools for that metal, the flute or hollow filed behind the edge,

gives the hook formed acute edge required in this tool which is in other respects like fig 476—the form proper for the cutting edge is shown more distinctly in the diagram a fig 482

Care should always be taken to have a proportional degree of strength in the shafts of the drills otherwise they tremble and chatter when at work or they occasionally twist off in the neck, the point should be also ground exactly central, so that both edges may cut. As a guide for the proportional thickness of the point it may measure at b, fig. 479, the base of the cone, about one fifth the diameter of the hole and at p, the point about one eighth, for easier penetration—but the fluted drills are made nearly of the same thickness at the point and base

In all the drills previously described except fig 474, the size of the point is lessened each time of sharpening, but to avoid this loss of size, a small part is often made parallel, as shown in fig 479. In fig 480, this mode is extended by making the drill with a cylindrical lump so as to fill the hole this is called the recentering drill. It is used for commencing a small hole in a flat bottomed cylindrical cavity or else in rotation with the common preicing drill and the half round bit in drilling small and very deep holes in the lathen see sect in p 567. Fig 480 may be also considered to resemble the stop drill upon which a solid lump or shoulder is formed or a collar is temporarily attached by a side screw for limiting the depth to which the tool can penetiate the work


Fig 481 the cone countersulk may be viewed as a multiplication of the common single cutting drill. Sometimes, however, the tool is filed with four equi distant radial furrows, directly upon the axis, and with several intermediate parallel furrows sweeping at an angle round the cone. This makes a more even distribution of the teeth, then when all are radial as in the figure, and it is always used in the spherical cutters, or countersinks, known as cherries, which are used in making bullet moulds

On comparison, it may be said the single chamfered drill fig 476, cuts more quickly than the double chamfered fig 470 but that the former is also more disposed of the two to swerve or run from its intended position. In using the double cutting drills, it is also necessary to drill the holes at once to their full sizes, as otherwise the thin edges of these tools stick abruptly into the metal, and are hable to produce jugged or groovy surfaces, which

destroy the circularity of the holes the necessity for drilling the entire hole at once joined to the feebleness of the drill bow limits the size of these drills

In using the single chamfered drills, it is customary, and on several accounts desirable to make large holes by a series of two or more drills first the run of the drill is in a measure propor tioned to its diameter therefore the small tool departs less from its intended path, and a central hole once obtained it is followed with little after risk by the single cutting drill which is less This mode likewise throws out of action the less favourable part of the drill near the point, and which in large drills is necessarily thick and obtuse, the subdivision of the work enables a comparatively small power to be used for drilling large holes and also presents the choice of the velocity best suited to each progressive diameter operated upon But where sufficient power can be obtained it is generally more judicious to enlarge the holes previously made with the pointed duills, by some of the group of pin drills, figs 482 to 485, in which the guide principle is very perfectly employed they present a close analogy to the plug center bit, and the expanding center bit, used in carpentry

The ordinary pin drill, fig 482, is employed for making countersinks for the heads of screw bolts inlaid flush with the surface, and also for enlarging holes commenced with pointed drills, by

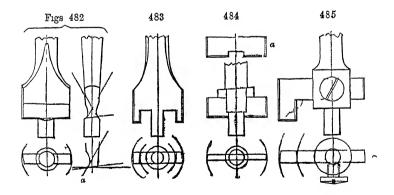


a cut parallel with the surface, the pin drill is also particularly suited to thin materials, as the point of the ordinary drill would soon pierce through, and leave the guidance less certain When

this tool is used for mon, it is fluted as usual, and a, represents the form of one edge separately

Fig 483 is a pin drill principally used for cutting out large holes in cast iron and other plates. In this case the narrow cutter removes a ring of metal, which is of course a less laborious process than cutting the whole into shivings. When this drill is applied from both sides, it may be used for plates half an inch and upwards in thickness as should not the tool penetrate the whole of the way through the piece may be broken out, and the rough edges cleaned with a file or a broach

Fig 484 is a tool commonly used for drilling the tube-plates for receiving the tubes of locomotive boilers—the material is about $\frac{3}{4}$ inch thick, and the holes $1\frac{3}{4}$ diameter—The loose cutter a, is fitted in a transverse mortise, and secured by a wedge—it admits of being several times ground, before the notch which guides the blade for centrality is obliterated—Fig 485 is somewhat similar to the last two, but is principally intended for sinking glooves, and when the tool is figured as shown by the dotted line, it may be used for cutting bosses and mouldings on parts of work not otherwise accessible

Many ingenious contrivances have been made to ensure the dimensions and angles of tools being exactly retained. In this class may be placed Mr Roberts's pin drill figs 486 and 487, in action it resembles the fluted pin drill, fig. 482, but the non



stock is much heavier, and is attached to the drilling machine by the square tang the stock has two grooves at an angle of about 10 degrees with the axis and rather deeper behind than in front. Two steel cutters or nearly parallel blades represented black, are laid in the grooves—they are fixed by the ring and two set screws, s s, and are advanced as they become worn rway, by two adjusting screws, a a, (one only seen,) placed at the angle of 10° through the second ring, which, for the convenience

of construction is sciewed up the drill shaft just beyond the square tang whereby it is attached to the drilling machine. The cutters are ground at the extreme ends but they also require an occasional touch on the oilstone to restore the keen ness of the outer angles which become somewhat rounded by the friction. The diminution from the trifling exterior sharpening is allowed for by the slightly taper form of the blades.

The process of drilling generally gives rise to more friction than that of turning and the same methods of lubrication are used but rather more commonly and plentifully thus oil is used for the generality of metals, or from economy soap and water milk is the most proper for copper, gold and silver, and cast iron and brass are usually drilled without lubrication as described at page 538. For all the above named metals, and for alloys of similar degrees of hardness, the common pointed steel drills are generally used but for lead and very soft alloys, the carpenters spoon bits and nose bits are usually employed, with water. For hardened steel and hard crystalline substances, copper or soft iron drills, such as fig. 67 or 71, page 178. Vol. I., supplied with emery powder and oil are needed, or the diamond drill points 66. 68 and 70 are used for hardened steel, with oil alone.*

Having considered the most general forms of the cutting parts

In boing light holes the earth is generally excavated by the process of misering up. The rods terminate in the miser which is a cylindrical non-case sometimes two to three feet diameter with a slightly conical bottom in which there is a slit much lile the mouth of a plane and covered with a leather flap to prevent the escape of the earth that has been collected.

In sinking the Aitesian wells lined with castiron tubes attiched end to end by internal flanges or screws a spring tool is used which expinds when it is thrust beneath the lower end of the scrics of pipes. See the account of sinling the Artesian well at Messrs Truman Hanbury and Co s Browery Minutes of Conversation Inst of Civil Ling 1842 p 192


The common pointed drill is used for mineral substraces not exceeding in hardness those enumerated under the terms 1 2 3 of the Lable of hardness p 1.8, Vol I

^{*} The boring tools used for the mineral substances are partly adverted to in the ninth chapter of Vol I beginning with the bits used for the softest materials those for boring through earth sand and clay in order to obtain water are enlarged copies of the shell nose and spiral bits used in carpentry attached to long vertical rods which are screwed together like jointed gun rods and are worked by a cross at the earth's surface. The rods are drawn up by a windlass and joint after joint is unscrewed until the bit with its contained earth is brought to the surface Various attempts have been made to avoid the tedious necessity for raising the rods by the employment of a hollow cylinder or magazine resting on the bit to receive the borings and to be drawn up occasionally to be emptied

of drills, we will proceed to explain the modes in which they are put in action by hand power beginning with those for the smallest diameters, and proceeding gradually to the largest

SECT III -METHODS OF WORKING DRILLS BY HAND POWER

The smallest holes are those required in watchwork, and the general form of the drill is shown on a large scale in fig 488, it is made of a piece of steel wire, which is tapered off at the one end flattened with the hammer, and then filed up in the form shewn at large in fig 470, p 547, lastly it is hardened in the candle. The reverse end of the instrument is made into a conical point, and is also hardened, near this end is attached a little brass sheave for the line of the drill bow, which in watchmaking is sometimes a fine horse hair, stretched by a piece of whalebone of about the size of a goose's quill stripped of its feather



The watchmaker holds most of his works in the fingers, both for fear of crushing them with the table vice, and also that he may the more sensibly feel his operations, drilling is likewise performed by him in the same manner. Having passed the bow string around the pulley in a single loop (or with a round twin), the center of the drill is inserted in one of the small center holes in the sides of the table vice, the point of the drill is placed in the mark or cavity made in the work by the center punch, the object is then pressed forward with the right hand, whilst the bow is moved with the left, the Swiss workmen apply the hands in the reverse order, as they do in using the turn bench

and which include some of the marbles Glass may also be drilled with fig 470 or 471 lubricated with turpentine. The sandstones are readily bored in Hunter's patent stone being muchine (see p 543 also Conv Civ Ling 1842 p 146) and the grantes are not bored but crushed by the jumper or chisel point see p 170 Vol 1

be the compact minerals such as 4–5–6 of the table the grinding tools may be used with sand but emery is more effective—this powder may be also employed for minerals not exceeding the hardness of 7 and 8—but emery being somewhat inferior in hardness to the ruby—this gen and the diamond marked 9 and 10 in the table require either diamond dust or splinters of the diamond, the outside slin and natural angles of which are much harder than the inside substance—See the ninth chapter of Vol I generally especially pages 178 to 180

Clockmakers and artisans in works of similar scale fix the object in the tail vice, and use drills such as fig 488 but often larger and longer they are pressed forward by the chest which is defended from injury by the breast plate namely a piece of wood or metal about the size of the hand, in the middle of which is a plate of steel, with center holes for the drill. The breast plate is sometimes strapped round the waist, but is more usually supported with the left hand, the fingers of which are ready to catch the drill should it accidentally slip out of the center


As the dull gets larger, the bow is proportionably increased in stiffness, and eventually becomes the half of a solid cone, about 1 inch in diameter at the larger end, and 30 inches long, the catgut string is sometimes nearly an eighth of an inch in diameter or is replaced by a leather thoug. The string is attached to the smaller end of the bow by a loop and notch, much the same as in the archery bow, and is passed through a hole at the larger end and made fast with a knot, the surplus length is wound round the cane, and the cord finally passes through a notch at the end, which prevents it from uncoiling

Steel bows are also occasionally used, these are made some thing like a fencing foil, but with a hook at the end for the knot or loop of the cord, and with a ferrule or a ratchet, around which the spare cord is wound Some variations also are made in the sheaves of the large drills, cometimes they are cylindrical with a fillet at each end, this is desirable, as the conduccessarily lies on the sheave at an angle, in fact in the path of a screw, it pursues that path, and with the recipion ition of the dull bow, the cold traverses, or screws backwards and forwards upon the sheave, but is prevented from sliding off by the fillet Occasionally indeed, the cylindrical sheave is cut with a sciew coarse enough to receive the cord, which may then make three or four coils for increased purchase, and have its natural screw like run without any fietting whatever but this is only desirable when the holes are large, and the dull is almost constantly used, as it is tedious The structure of to wind on the cord for each individual hole the bows, breast plates, and pulleys, although often varied, is sufficiently familiar to be understood without figures -See Appendix, Note A Y, page 1002

When the shaft of the drill is moderately long, the workman can readily observe if the drill is square with the work as regards

the holizontal plane and to remove the necessity for the observation of an assistant as to the vertical plane, a trifling weight is sometimes suspended from the dill shaft by a metil ring of hook, the joggling motion shifts the weight to the lower extre mity the tool is only horizontal when the weight remains central *

In many cases, the necessity for repeating the shaft and pulley of the drill is avoided, by the employment of holders of various kinds of drill stocks which serve to carry any required number of drill points. The most simple of the drill stocks is shown in fig. 489, it has the center and pulley of the ordinary drill,

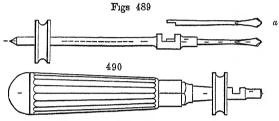

but the opposite end is pierced with a nearly cylindric it hole just at the inner extremity of which a diametrical notch is The drill is shown separately at a, its shank is made cylindrical, or exactly to fit the hole, and a short portion is nicked down also to the diametrical line, so as to slide into the gap in the dill stock, by which the drill is prevented from revolving the end serves also as an abutment whereby it may be thrust out with a lever Sometimes a diametrical transverse mortise, nurower than the hole, is made through the drill stock and the drill is nicked on both sides and Mr Gill proposes that the cylindrical hole of 489, should be continued to the bottom of the notch that the end of the dull should be filed off obliquely, and that it should be prevented from rotating, by a pin inserted through the cylindrical hole parallel with the notch the taper end of the drill would then wedge fast beneath the pin !

Dills are also frequently used in the drilling lathe, this is a miniature lather head, the frame of which is fixed in the table vice, the mandrel is presented for the drills, and his a pulley for


^{*} This is analogous to the level of the Indian masons and carpentors they squeeze a few drops of water on the upper surface of the strught edge which is made exactly parallel and the escape of the fluid from either end denotes that to be the lower of the two

[†] See Technical Repos 1892 vol n p 149 also Rees s Cyclopedia

the bow, therein resembling fig 490, except that it is used as a fixture

The figure 490 just referred to, represents one variety of another common form of the drill stock, in which, the revolving spindle is fitted in a handle, so that it may be held in any position, without the necessity for the breast plate—the handle is hollowed out to serve for containing the drills, and is fluted to assist the grasp

Fig 491 represents the socket of an 'unwersal drill stock' invented by Sir John Robison, it is pieced with a hole as large

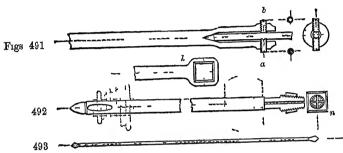

as the largest of the wires of which the dills are formed, and the hole terminates in an acute hollow cone. The end of the drill stock is tapped with two holes, placed on a drimeter the one screw a is of a very fine thread, and has at the end two shallow diametrical notches, the other b, is of a coarser thread and quite flat at the extremity. The wire drill is placed against the bottom of the hole and allowed to lean against the adjusting screw a and if the drill be not central, this screw is moved one or several quarter turns until it is adjusted for centrality, after which the tool is strongly fixed by the plain set screw b

Fig 492 is a drill stock, continued by Mr William Allen it consists of a tube, the one end of which has a fixed center and pulley much the same as usual, the opposite end of the tube has a piece of steel fixed into it which is first drilled with a central hole, and then turned as a conical screw, to which is fitted a corresponding screw nut n, the socket is then sawn down with two diametrical notches, to make four internal angles, and lastly, the socket is hardened. When the four sections are compressed by the nut their edges stick into the drill and retain it fast and provided the instrument is itself concentric, and the four parts are of equal strength, the centrality of the drill is

at once ensured The outside of the nut and the square hole in the key k are each taper, for more ready application and the drills are of the most simple kind namely lengths of wire pointed at each end, as in fig 493 *

The sketch fig 492, is also intended to explain another useful application of this drill stock, as an upright or pump drill. The latter is provided with a cross stiff from the ends of which, a string proceeds through the eye at the top of the drill shaft, which carries a large bulb of metal to give it momentum. The workman first coils the string around the drill stock this causes the ascent of the transverse rod, from the shortening of the string he then suddenly depresses the stick which by uncoiling the string moves the drill as many turns as there are coils, and the momentum continues the motion so as to wind up the string in the opposite direction, ready for the succeeding cut. The pressure of the hand is only given at the first period of each descent of the cross staff—See Appendix, Notes A. Z. to B. B. page 1003


Holes that are too large to be drilled solely by the breast drill and drill bow, are frequently commenced with those useful instruments, and are then enlarged by means of the hand brace, which is very similar to that used in carpentry except that it is more commonly made of iron instead of wood is somewhat larger, and is generally made without the spring eatch

Holes may be extended to about half an inch in diameter, with the hand brace, but it is much more expeditious to employ still larger and stronger braces, and to press them into the work in various ways by weights, levers, and screws, instead of by the muscular effort alone

Fig 494 represents the old smith's press drill, which although cumbious and much less used than formerly, is nevertheless simple and effective. It consists of two pairs of wooden standards, between which works the beam ab the pin near a is placed at any height, but the weight w is not usually changed, as the greater or less pressure for large and small drills is obtained by placing the brace more or less near to the fulcrum a and this part of the beam is shod with an non plate, full of small center holes for the brace. The weight is raised by the second lever cd the

^{*} See Technical Repository vol 11 1822 p 147

two being united by a chain, and a light chain of rope is also suspended from d to be within reach of the one or two men engaged in moving the brace. It is necessary to relieve the weight when the drill is nearly through the hole otherwise, it might suddenly break through and the drill becoming fixed, might be twisted off in the neck

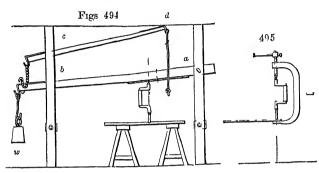

The inconveniences in this machine are, that the upper point of the brace moves in an arc instead of a right line, the limited path when strong pressures are used, which makes it necessity to shift the fulcrum a, and also the necessity for readjusting the work under the drill for each different hole, which in awkwardly shaped pieces is often troublesome


A portable contrivance of similar date as an non-bow frame or clamp shown in fig 495, the pressure is applied by a sciew, but in almost all cases whilst the one individual drills the hole, the assistance of another is required to hold the frame 195 only applies to comparatively thin parallel works, and does not present the necessary choice of position. Another tool of this kind, used for boring the side holes in cast non-pipes for water and gas, is doubtless familiarly known—the cramp or frame divides into two branches about two feet apart, and these terminate like hooks which loosely embrace the pipe, so that the tool retains its position without constraint and it may be used with great facility by one individual

Fig 496 will serve to show the general character, of various constructions of more modern apparatus to be used for supplying the pressure in drilling holes with hand braces. It consists of a cylindrical bur a upon which the horizontal rectangular rod b, is fitted with a socket, so that it may be fixed at any height,

or in any angular position, by the set sciew c Upon b slides a socket which is fixed at all distances from a, by its set sciew d and lastly, this socket has a long vertical screw e, by which the brace is thrust into the work

The object to be dilled having been placed level, either upon the ground, on trestles, on the work bench, or in the vice,

according to circumstances, the screws, c and d are loosened, and the brace is put in position for The perpendicularity of the brace is then examined with a plumb line, applied in two posi tions (the eye being first directed as it were along the noith and south line and then along the east and west,) after which the whole is made fast by the screws c and dThe one hole having been dulled, the socket and screws present great facility in re adjusting the instru ment for subsequent holes without the necessity for shifting the work, which would generally be attended

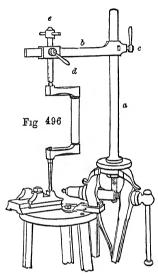


with more trouble, than altering the drill frame by its screws

Sometimes the 10d a is rectangular and extends from the floor to the ceiling, it then travelses in fixed sockets the lower of which has a set screw for retaining any required position In the tool represented, a rod a, terminates in a cast iron base, by which it may be grasped in the tail vice, or when required it may be fixed upon the bench, in this case the nut on a is unscrewed, the cast non plate when reversed and placed on the bench serves as a pedestal, the stem is passed through a hole in the bench, and the nut and washer when screwed on the stem beneath, secure all very strongly together in establishments where the most complete drilling machines driven by power are at hand, modifications of the press drill are among the indispensable tools many are contrived with screws and clamps, by which they are attached directly to such works as are sufficiently large and massive to serve as a foundation

Various useful drilling tools for engineering works, are fitted with left-hand screws, the unwinding of which elongate the tools, so that for these instruments which supply their own pressure it is only necessary to find a solid support for the center. They apply very readily in drilling holes within boxes and panels, and the abutment is often similarly provided by projecting parts of the castings, or otherwise the fixed support is derived from the wall or ceiling by aid of props arranged in the most convenient manner that presents itself.

Fig 497 is the common brace which only differs from that in fig 496 in the left hand screw, a right hand screw would be unwound in the act of drilling a hole when the brace is moved round in the usual direction which agrees with the path of a left hand screw. The cutting motion produces no change in the length of the instrument, and the screw being held at rest for a moment during the revolution sets in the cut-but towards the last the feed is discontinued as the elasticity of the brace and work, suffice for the reduced pressure required when the drill is nearly through, and sometimes the screw is unwound still more to reduce it.

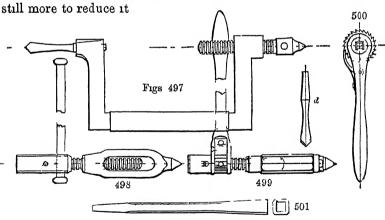

The lever drill, fig 498 differs from the latter figure in many respects, it is much stronger and applicable to larger holes, the drill socket is sufficiently long to be out into the left hand sciew, and the piece serving as the screwed nut, is a loop terminating in the center point. The increased length of the lever gives much greater purchase than in the crank formed brace, and in addition the lever brace may be applied close against a

surface where the crank brace cannot be turned round in this case the lever is only moved a half circle at a time, and is then slid through for a new purchase or sometimes a spanner or wrench is applied directly upon the square drill socket


The same end is more conveniently fulfilled by the ratchet drill fig 499, apparently derived from the last it is made by cutting ratchet teeth in the drill shaft or putting on the ratchet as a separate piece, and fixing a pall or detent to the handle the latter may then be moved backward to gather up the teeth and forward to thrust round the tool with less delay than the level in fig 498, and with the same power the two being of equal length This tool is also peculiarly applicable to reaching into angles and places in which neither the crank form brace, nor the lever drill will apply Fig 500, the ratchet lever, in part resem bles the natchet drill but the pressure screw of the latter instru ment must be sought in some of the other contrivances referred to as the ratchet lever has simply a square aperture to fit on the tang of the dull d which latter must be pressed forward by some independent means

Fig 501 which is a simple but necessary addition to the braces and drill tools is a socket having at the one end a square hole to receive the drills and at the opposite, a square tang to fit the brace, by this contrivance the length of the drill can be temporarily extended for reaching deeply seated holes. The sockets are made of various lengths, and sometimes two or three are used together to extend the length of the brace to suit the position of the prop, but it must be remembered, that with the additional length the torsion becomes much increased, and the resistance to end long pressure much diminished, therefore the sockets should have a bulk proportionate to their length

The French brace, fig 469, page 545, is also constructed in non, with a pair of equal bevil pinions, and a left hand center sciew like the tools, fig 497, 498, and 499 it is then called the corner drill. Sometimes also, as in the succeeding figures 502 and 503 the bevil wheels are made with a hollow square of axis, as in the ratchet lever, fig 500, the driver then hangs loosely on the square shank of the drill tool, or cutter bar, and when the pinion on the handle is only one third or fourth of the size of the bevil wheel with the square hole it is an effective driver for various uses the long tail or lever serves to prevent the rotation


of the driver, by resting against some part of the work or of the work bench

All the before mentioned tools are commonly found in a variety of shapes in the hands of the engineer, but it will be

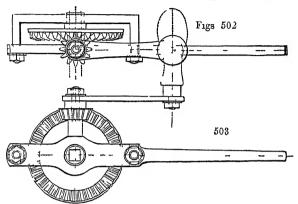

observed they are all driven by hand power and are curred to the work. I shall conclude this section with the description of a more recent drill tool of the same kind, invented by Mr A Shanks of Glasgow.

This instrument is represented of one eighth size, in the side view fig 504, in the front view, 505, and in the section 506, it

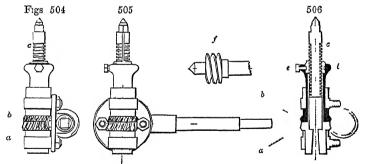

is about twice as powerful as fig 503, and has the advantage of feeding the cut by a differential motion. The tangent sciew moves at the same time the two worm wheels a and b * the former has 15 teeth, and serves to revolve the drill, the latter has 16 teeth, and by the difference between the two, or the odd

^{*} A principle first introduced in Dr Wollaston's Truchiometer, for counting the turns of a carriage wheel

tooth, advances the drill slowly and continually, which may be thus explained

The lower wheel a, of 15 teeth is fixed on the drill shaft and this is tapped to receive the center screw c, of four threads per inch. The upper wheel of 16 teeth is at the end of a socket d (which is represented black in the section fig. 506) and is connected with the center screw c by a collar and internal key, which last fits a longitudinal groove cut up the side of the screw c now therefore the internal and external screws travel constintly round, and nearly at the same rate the difference of one tooth in the wheels serving continually and slowly to project the screw c, for feeding the cut. To shorten or lengthen the instrument rapidly the side screw e is loosened, this sets the collar and key, free from the 16 wheel, and the center screw may for the time be moved independently by a spanner

The differential screw drill, having a double thread in the large worm, shown detached at f requires $7\frac{1}{2}$ turns of the handle to move the drill once round and the feed is one 64th of an inch for each turn of the drill—that being the sum of 16 by 4—See Appendix, Note B C, page 1004

SECT IV -DRILLING AND BORING MACHINES

The motion of the lathe mandiel is particularly proper for giving action to the various single cutting drills referred to they are then fixed in square or round hole drill chucks which so ew upon the lathe mandiel. The motion of the lathe is more uniform than that of the hand tools, and the popit head, with its flat boring flange and pressure sciew form a most convenient unangement, as the works are then carried to the drill exactly at right angles to the face. But in drilling very small holes in the lathe, there is some risk of unconsciously employing a greater pressure with the sciew, than the slender drills will bear. Some times the cylinder is pressed forward by a horizontal lever fixed on a fulcium, at other times the cylinder is pressed forward by a spring by a rack and pinion motion, or by a simple lever, and the best arrangement of this latter kind is that next to be described.

In the manufacture of harps there is a vast quantity of small drilling, and the pressure of the cylinder popul head is given by means of a long, straight, double ended lever, which moves

horizontally, (at about one third from the back extremity) upon a fixed post or fulcrum elected upon the back board of the lathe. The front of the lever is connected with the sliding cylinder by a link or connecting rod and the back of the lever is pulled towards the right extremity of the lather by a cord which passes over a pulley at the edge of the back board, and then supports a weight of about twenty pounds


Both the weight and the connecting rod, may be attached at various distances from the fixed fulcium between them. When they are fixed at equal distances from the axis of the lever the weight, if twenty pounds, presses forward the drill with twenty pounds less a little friction of the weight be two inches from the fulcium and the connecting rod eight inches the effect of the weight is reduced to five pounds of, on the other hand the weight be at eight and the connecting rod at two inches the pressure is fourfold, or eighty pounds

The connecting rod is full of holes, so that the lever may be adjusted exactly to reach the body of the workman, who standing with his face to the mandiel, moves the lever with his back and has therefore both hands at liberty for managing the work Sometimes a stop is fixed on the cylinder, for drilling holes to one fixed depth—gages are attached to the flange, for drilling numbers of similar pieces at any fixed distance from the edge in fact this very useful apparatus admits of many little additions to facilitate the use of drills and revolving cutters

Great numbers of circular objects such as wheels and pulleys, are chucked to revolve truly upon the lathe mandrel, whilst a stationary drill is thrust forward against them by which means the concentricity between the hole and the edge is ensured

The drills employed for boing works chucked on the lathe have mostly long shifts some parts of which are rectangular or parallel, so that they may be prevented from revolving by a hook wrench, (page 218, Vol I,) a spinner or a hand vice applied as a radius, or by other means. The ends of the drill shafts are pierced with small center holes, in order that they may be thrust forward by the screw of the popit head, either by hand or by self acting motion, namely a connection between either the mandrel or the prime mover of the lathe, and the screw of the popit head, by cords and pulleys, by wheels and printed to other contrivances.

The dulls figs 476 and 478, p 549 are used for boning ordinary holes, but for those requiring greater accuracy or a more exact repetition of the same diameter the lathe drills figs 507 to 509 are commonly selected Fig 507 which is drawn in three views and to the same scale as the former examples is called the half round bit, or the cylinder bit I he extremity is ground a little inclined to the right ingle both horizontally and vertically, to about the extent of three to five degrees It is necessary to turn out a shallow recess exactly to the diameter of the end of the bit as a commencement the circular put of the bit fills the hole, and is thereby retained central whilst the left angle removes the shaving This tool should never be sharpened on its diametrical face or it would soon cease to deserve its appcl lation of half round bit some indeed give it about one thirtieth more of the circumference It is generally made very slightly smaller behind, to lessen the friction and the angle, not in tended to cut, is a little blunted half way round the curve, that it may not scratch the hole from the pressure of the cutting It is lubricated with oil for the metals generally but is used dry for hard woods and every, and sometimes for brass

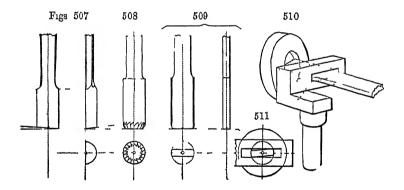

The rose bit, fig 508, is also very much used for light finishing cuts in brass, non, and steel, the extremity is cylindrical, or in the smallest degree less behind, and the end is cut into teeth like a countersink, the rose bit, when it has plenty of oil, and but very little to remove, will be found to act beautifully, but this tool is less fit for east iron than the bit next to be described. The rose bit may be used without oil for the hard woods and

ivory, in which it makes a very clean hole but as the end of the tool is chamfered it does not leave a flat bottomed recess the same as the half round bit and is therefore only used for thoroughfare holes

The drill fig 509 is much employed but especially for cast non work, the end of the blade is made very nearly parallel, the two front corners are ground slightly rounding and are chamfered the chamfer is continued at a reduced angle along the two sides to the extent of about two drameters in length this portion is not strictly parallel but is very slightly largest in the middle or barrel shaped this drill is used dry for cast from

Fig 509 in common with all drills that cut on the side may by improper direction cut sideways, maling the hole above the intended diameter but when the hole has been roughly bored with a common fluted drill, the end of the litter is used as a turning tool, to make an accurate chamfer, the bit 509 is then placed through the stay as shown in fig 510 and is lightly supported between the chamfer upon the work and the center of the populated the moment any pressure comes on the drill, its opposite edges stick into the inner sides of the loop (as more clearly explained in fig 511) which thus restrains its position, much the same as the point and edges of the turning tools for iron dig into the rest and secure the position of those tools.


It is requisite the drill and the loop should be exactly central fig 510 shows the common form of the stay when fitted to the lathe rest but it is sometimes made as a swing gate to turn aside, whilst the piece which has been drilled is removed, and the next piece to be operated upon is fixed in the lathe. Some times also the drill 509 has blocks of hindwood attached above and below it to complete the circle, this is usual for wrought non and steel and oil is then employed

These three varieties are exclusively lathe dails and are intended for the exact repetition of a number of holes of the particular sizes of the bits, and which, on that account, should remove only a thin shaving to save the tools from wear

The cylinder bits, however, may be used for enlarging holes below half an inch, to the extent of about one third their drameter at one cut, and for holes from half an inch to one inch, about one fourth their drameter or less, and as the bits increase in size, the proportion of the cut to the drameter should decrease

with the flange of the popit head enlarged into a table for the work which then lies in the horizontal position simply by gravity, or is occasionally fixed on the table by sciews und clamps. The structure of these important machines admits of almost endless diversity and in nearly every manufactory some peculiarity of construction may be observed.

Figs 512 and 513 exhibit Nasmyth's "Portable Hand drill which is introduced as a simple and efficient example, that may

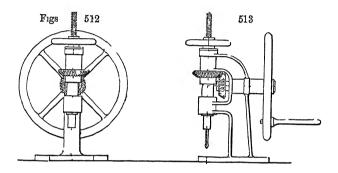

serve to convey the general characters of the drilling machines. The spindle is driven by a pair of bevil pinions, the one is attached to the axis of the vertical fly wheel, the other to the drill shaft, which is depressed by a screw moved by a small hand wheel

Sometimes, as in the lathe, the drilling spindle revolves with out endlong motion, and the tible is raised by a treadle or by a hand lever, but more generally the drill-shaft is cylindrical and revolves in and also slides through, fixed cylindrical bearings. The drill spindle is then depressed in a variety of ways, sometimes by a simple lever at other times by a treadle which either lowers the shaft only one single sweep, or by a ratchet that brings it down by several small successive steps through a greater distance, and mostly a counterpoise weight restores the parts to their first position when the hand or foot is removed. Friction clutches trains of differential wheels, and other modes, are also used in depressing the drill spindle, or in elevating the table by self acting motion. Frequently also the platform admits of an


^{*} Probably no individual has originated so many useful varieties of drilling machines as Mr Richard Roberts of the firm of Sharp Roberts and Co-Manchester

adjustment independent of that of the spindle for the sake of admitting larger pieces the horizontal position of the platform is then retained by a slide to which a rack and pinion move ment, or an elevating screw, is added *

Dulling machines of these kinds are generally used with the ordinary piercing drills, and occasionally with pin drills, the lat ter instrument appears to be the type of another class of boring tools namely, cutter bars, which are used for works requiring holes of greater dimensions or of superior accuracy than can be attained by the ordinary pointed drills

The small application of this principle, or of cutter bars, is shown on the same scale as the former drills, in fig 514, the cutter c is placed in a diametrical mortise in a cylindrical boring bai, and is fixed by a wedge, the cutter c extends equally on both sides, as the two projections or ears embrace the sides of the bai, which is slightly flattened near the mortises

Cutter bass of the same kind, are occasionally employed with cutters of a variety of forms, for making grooves recesses mouldings and even sciews upon parts of heavy worls and those which cannot be conveniently fixed in the ordinary lithe Fig 515 represents one of these, but its application to sciews will be found in the chapter on the tools for sciew-cutting



The larger application of this principle is shown in fig 516, in which a cast non cutter block is keyed fast upon a cylindrical bar the block has four, six, or more glooves in its periphery

^{*} The platform in a drillin machine at Messis Penn's Greenwich is placed between two side firmes with fillets a few inches apart so that it is supported at any height like a single drawer in in empty tier. The traverse of the drill shaft is rather more than equal to the space between the fillets

Ligures 512 and 513 are transcribed from plate 29 of Buchman's Mill Work by Rennie 1841 and plates 29 to 33 a of that work contain various other drilling machines similar to and explanating of those in seneral use

Sometimes the work is done with only one cutter and should the bar vibiate the remainder of the glooves are filled with pieces of hard wood so as to complete the bearing at so many points of the circle, occasionally cutters are placed in all the glooves, and carefully adjusted to act in succession, that is the first stands a little nearer to the axis than the second, and so on throughout, in order that each may do its share of the work but the last of the series takes only a light finishing cut, that its keen edge may be the longer preserved. In all these cutters the one face is radial, the other differs only four or five degrees from the right angle and the corners of the tools are slightly rounded

These cutter bars like the rest of the drilling and boring machinery, are employed in a great variety of ways, but which resolve themselves into three principal modes

First, the cutter bar revolves without endlong motion, in fixed centers of bearings, in fact, as a spindle in the lathe—the work is traversed, or made to pass the revolving cutter in a right line, for which end the work is often fixed to a traversing slide rest. This mode requires the bar to measure between the supports twice the length of the work to be boiled, and the cutter to be in the middle of the bar, it is therefore unfit for long objects.

Secondly the cutter bar revolves, and also slides with endlong motion, the work being at rest, the bearings of the bar are then frequently attached in some temporary manner to the work to be boiled, and are often of wood *

In another common arrangement, the boring bar is mounted in headstocks, much the same as a traversing mandrel, the work is fixed to the bearers carrying the headstocks and the cutter bar is advanced by a sciew. The screw is then moved either by the hand of the workman by a star wheel, or a ratchet wheel one tooth only in each revolution, or else by a system of differential wheels, in which the external screw has a wheel say of 50 teeth, the internal screw a wheel of 51 teeth, and a pair of equal wheels or pinions drives these two screws continually, so that the advance of the one fiftieth of a turn of the screw, or their difference is equally divided over each

^{*} Cylinders of forty inches diameter for steam engines have been thus bored by ittaching a cast iron cross to each end of the cylinder—the crosses are bored exactly to fit the boring bar one of them carries the driving gear and the bar is thrust endling by means of a screw moved by a ratchet or stu wheel

revolution of the cutter bu, much the same as in the differential motion of the sciew drill, fig 504, page 562


This second method only requires the interval between the fixed bearings of the cutter bar to be as much longer than the work, as the length of the cutter block, but the bar itself must have more than twice the length of the work, and requires to slide through the supports

Cutter bars of this kind are likewise used in the lathe in the act of boing the end of the bar then slides like a piston into the mandiel. Such bars are commonly applied to the vertical boring machines of the larger kinds which are usually fitted with a differential apparatus, for determining the progress of the cut, the bar then slides through a collar fixed in the bed of the machine

In some of the large boring machines either one or two holizontal slides are added, and by their aid, series of holes may be bored in any required arrangement. For instance, the several holes in the beams, or side levers, and cranks of steam engines, are boiled exactly perpendicular in a line, and at any precise distances, by shifting the work beneath the revolving spindle upon the guide or railway, in pieces of other kinds the work is moved laterally during the revolution of the cutters, for the formation of elongated countersinks and grooves

Thirdly In the largest applications of this principle, the boring bar revolves upon fixed bearings without traversing, and it is only needful that the boring bar should exceed the length of the work, by the thickness of the cutter block, of which it

has commonly several of different diameters. The cutter block, now sometimes ten feet diameter traverses as a slide down a huge boring bar, whose diameter is about thirty inches. There is a groove and key to couple them together, and the traverse of the cutter block down the bir, is caused by a side sciew, upon the

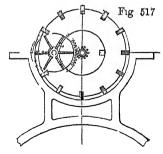

end of which is a large wheel that engages in a small pinion, faced to the stationary center or pedestal of the machine. With every revolution of the cutter bar, the great wheel is carried


around the fixed pinion, and supposing these be as 10 to 1 the great wheel is moved one tenth of a turn and therefore moves the screw one tenth of a turn also, and slowly traverses the cutter block

The continuance may be viewed as a huge self acting and revolving sliding test, and the diagram 517 shows that the cutter bars are equally applicable to portions of circles, such as the D valves of steam engines, as well as to the enormous interior of the cylinder itself * See Appendix Note B J page 1010

All the preceding boring tools cut almost exclusively upon the end alone. They are passed entirely through the objects, and leave each part of their own particular diameter, and therefore cylindrical but I now proceed to describe other boring tools that cut only on their sides go but partly through the work and leave its section a counterpart of the instrument. These tools are generally conical and serve for the enlargement of holes to sizes intermediate between the gradations of the drills, and also for the formation of conical holes, as for valves, stopcocks, and other works. The common pointed drill, or its multiplication in the rose countersink is the type of the series, but in general the broaches have sides which are much more nearly parallel.

SECT V-BROACHES FOR MAKING TAPER HOLFS

The tools for making taper holes are much less varied than the drills and boring tools for cylindrical holes. Thus the carpenter employs only the rimer which is a fluted tool like the generality of his bits it is sharpened from within, as shown in fig. 518, so as to act like a paring tool. Flutes and clarionets



are first perforated with the nose bit and then broached with taper holes, by means of tools of this kind, which are very

^{*} There is generally a small intermediate which between the two is presented, many other details of the large boring machines will also be found in Buch in in s Mill Work—as aheady noticed

carefully graduated as to their dimensions. Fig 519 represents a German rimer, used by wheelwrights for inlaying the boxes of axletrees, the loose blade is separated from the shell of the instrument, by introducing slips of leather or wood between the two, the detached cutter fits on a pin at the front, and is fixed by a ring or collar against the shaft

A curious times for the use of wine coopers, was invented by the late Mr John Hilton by which the holes were made more truly circular, and the shavings were prevented from dropping into the cask. The stock of the instrument consisted of a hollow brass cone, seen in section in fig 520, down one side there was a slit for containing a narrow blade or cutter, fixed by three or four screws placed drametrically. The tube was thus converted into a conical plane, the shavings entered within the tube, and were removed by taking out a cork from the small end of the cone.*

The broaches for metal are made solid, and of various sections as half round, like fig 521, the edges are then rectan gular but more commonly the broaches are polygonal, as in fig 522 except that they have 3 4, 5 6 and 8 sides and their edges measure respectively 60, 90 108, 120, and 135 degrees. The four, five, and six sided broaches are the most general, and the watchmakers employ a round broach in which no angle exists, and the tool is therefore only a burnisher, which compresses the metal and rounds the hole

Ordinary broaches are very acute, and fig 528 may be considered to represent the general angle at which then sides meet, nuncly less than one or two degrees—the end is usually chamfered off with as many facets as there are sides, to make a penetrating point, and the opposite extremity ends in a square tang, or shank, by which the instrument is worked


Square broaches, after having been filed up, are sometimes twisted whilst red hot, fig 527, shows one of these the rectingular section is but little disturbed, although the faces become slightly concave. The advantage of the tool appears to exist in its sciew form, when it is turned in the direction of the spiral, it cuts with avidity and requires but little pressure, as it is

^{*} See Frans Soc of Arts 1830 vol xlvm page 1'5

almost disposed to dig too forcibly into the metal when turned the reverse way as in unscrewing it requires as much or more pressure than similar broaches not twisted. This instrument, if bent in the direction of its length, either in the act of twisting or hardening, does not admit of correction by grinding, like those broaches having plane faces. It is not much used, and is almost restricted to wrought iron and steel

Large countersinks that do not terminate in a point are sometimes made as solid cones a groove is then formed up one side and deepest towards the base of the cone, for the insertion of a cutter, see fig 523. As the blade is narrowed by sharpening it is set a little forward in the direction of its length to cause its edge to continue slightly in advance of the general surface, like the iron of a plane for cutting metal

Fig 529 represents Mr Richard Roberts broach, in which four detached blades are introduced, for the sake of retaining



t e cone or angle of the broach with greater facility. The bar or stock has four shallow longitudinal grooves, which are nearly radial on the cutting face and slightly undercut on the other. The grooves are also rather deeper behind, and the blades are a little wedge form both in section and in length to constitute the cone and the cutting edges. In restoring the edges of the blades they are removed from the stock and their angles are then more easily tested when replaced, they are set nearer to the point, to compensate for their loss of thickness.

Broaches are also used for perfecting cylindrical holes, as well as for making those which are tiper. The broaches are then made almost parallel, or a very little the highest in the middle, they are filed, with two or three planes at angles of 90 degrees, as in figs 524 or 525. The circular part not being able to cut, serves as a more certain base or foundation, than when the tool is a complete polygon, and the stems are commonly made

small enough to pass entirely through the holes, which then agree very exactly as to size. Such tools are therefore rather entitled to the name of finishing drills, than broaches

The size of the parallel broaches is often slightly increased, by placing a piece or two of paper at the convex part, leather and thin metal are also used for the same purpose. Gun barrels are broached with square broaches, the cutting parts of which are about eight to ten inches long, they are picked on the four sides with slips or spills of wood, to complete the circle, as in fig. 526 in which the tool is supposed to be at work. The size of the bit is progressively enlarged by introducing slips of thin paper, piece by piece between two of the spills of wood and the broach, the paper throws the one angle more towards the center of the hole, and causes a corresponding advance in the opposite or the cutting angle. Sometimes, however, only one spill of wood is employed

A broach used by the philosophical instrument makers in finishing the barrels of air pumps, consisted of a thin plate of steel inserted diametrically between two blocks of wood, the whole constituting a cylinder with a scraping edge slightly in advance of the wood, slips of paper were also added

According to the size of the broaches, they are fixed in handles like brad awls, they are used in the brace, or the tap wrench, namely, a double ended lever with square central holes. Sometimes, also, broaches are used in the lathe just like drills, and for large works, broaching machines are employed, these are little more than driving gear terminating in a simple kind of universal joint, to lead the power of the steam engine to the tool, which is generally left under the guidance of its own edges, according to the common principle of the instrument

In drills and broaches the penetrating angles are commonly more obtuse than in turning tools, thus in drills of limited dimensions, the hook form of the turning tool for iron is map plicable, and in the larger examples, the permanence of the tool is of more consequence than the increased friction. But on account of the additional friction excited by the nearly rect ingular edges, it is commonly necessary to employ a smaller velocity in boring than in turning corresponding diameters, in order to avoid soft ening the tool by the heat generated, and in the duetale fibrous

metals as wrought iron, steel, copper and others, lubrication with oil water, &c, becomes more necessary than in turning

The drills and broaches form together a complete series First the cylinder bit the pin drills, and others with blunt sides, produce cylindrical holes by means of cutters at right angles to the axis, then the cutter becomes inclined at about 45 degrees, as in the common piercing drill and cone countersink, the angle becomes much less in the common typer broaches, and finally, disappears in the parallel broaches, by which we again produce the cylindrical hole but with cutters parallel with the axis, of the hole

Still considering the drills and broaches as one group the drills have comparatively thin edges, always less than 90 degrees, yet they require to be urged forward by a screw or otherwise, the resistance being sustained in the line of their axes. The broaches have much more obtuse edges never less than 90 and sometimes extending to 135 degrees, and yet the greater force required to cause the penetration of their obtuse edges into the material, is supplied without any screw, because the pressure in all these varied tools is at right angles to the cutting edge

Thus supposing the sides of the broach extended until they meet in a point as in fig 528, we shall find the length will very many times exceed the diameter, and by that number will the force employed to thrust forward the tool be multiplied, the same as in the wedge, whether employed in splitting timber or otherwise, and the broach being confined in a hole, it cannot make its escape but acts with great lateral pressure, directed radially from each cutting edge—and the broach under proper management leaves the holes very smooth and of true figure

CHAPIER XXVI

SCREW CUTTING TOOLS

SECT I -INTRODUCTORY REMARKS

An elementary idea of the form of the screw, or helix, is obtained by considering it as a continuous circular wedge, and it is readily modelled by wrapping a wedge-formed piece of paper around a cylinder, the edge of the paper then represents the line of the screw and which preserves one constant angle to the axis of the contained cylinder, namely, that of the wedge

The ordinary wedge of the diagonal may be produced by the composition of two unifor miectilinear motions, which if equal, produce the angle of 45°, or if unequal various angles more or less acute—and in an analogous manner, the circular wedge or the screw may be produced of every angle or coarseness, by the composition of an uniform circular motion, with an uniform rectilinear motion—And as either the rectiline u or the circular motion may be given to the work or to the tool indifferently, there are four distinct modes of producing screws, and which are all variously modified in practice

The screw admits of great diversity it may possess any dia meter, it may also have any angle that is, the interval between the threads may be either coarse or fine according to the angle of the wedge, or the ratio of the two motions and the wedge may be wound upon the cylinder to the right hand or to the left, so as to produce either right or left hand screws

The idea of double triple, or quadruple sciews, will be conveyed by considering two, three, or four black lines drawn on the uncovered edge of the wedge formed paper, or likewise by two, three or four strings or wires placed in contact, and coiled as a flat band around the cylinder, the angle remains un litered, it is only a multiplication of the furrows or threads—and lastly, the sciew may have any section, that is, the section of the worm or

thread may be angular, square, round, or of any arbitrary form Thus far as to the variety in sciews

The importance of this mechanical element, the screw, in all works in the constructive arts is almost immeasurable instance great numbers of sciews are employed merely for con necting together the different purts of which various objects are composed, no other attachment is so compact, powerful or generally available, these binding or attachment screws require, by comparison the least degree of excellence Other sciews are used as regulating screws for the guidance of the slides and the moving parts of machinery, for the sciews of presses and the like, these kinds should possess a much greater degree of excellence But the most exact screws that can be produced, than the last are quite essential to the good performance of the engines employed in the graduation of right lines and circles and of astionomical and mathematical instruments, in these delicate nucrometrical screws our wants ever appear to outstrip the most refined methods of execution

The attempt to collect and describe all the ingenious continuances which have been devised for the construction of screws, would be in itself a work of no ordinary labour or extent. I must, therefore, principally restrict myself to those varied processes now commonly used in the workshops, for producing with comparative facility, sciews abundantly exact for the great majority of purposes. It has been found rather difficult to arrange these extremely different processes in tolerable order but that which seems to be the natural order has been adopted thus

There appears to be no doubt, but that in the earliest production of the appaiatus for cutting screws, the external screw was the first piece made this plain circular metal screw was serrated and thus converted into the tap, or cutting tool, by which internal screws of corresponding size and form were next produced and one of these hollow screws, or dies, became in its turn the means of regenerating with increased truth and much greater facility, any number of copies of the original external screw. In these several stages there is a progressive advance towards perfection, as will be hereafter adverted to

These hand processes are mostly used for screws, which are at least as long if not longer than their diameters. The rotatory and rectilinear guides, and the one or several series of

cutting points are then usually combined within the tool This first group will be considered in three sections namely

II On originating screws

III On cutting internal screws, with sciew taps

IV On cutting external screws with screw dies

Subsequent improvements have led to the employment of the lathe, in producing from the above, and in a variety of ways, still more accurate screws. These methods are sometimes used for screws which possess only a portion of a turn, at other times for screws twenty or thirty feet long and upwards. The rotatory guide is always given by the mandrel, the rectilinear guide is variously obtained, and the detached screw tool or cutter, may have one single point, or one series of points which touch the circle at only one place at a time. This second group will be also considered in three sections, namely

V On cutting screws, in the common lathe by hand

VI On cutting sciews, in lathes with traversing mandrels

VII On cutting screws, in lathes with traversing tools

It may be further observed that the modes described in the six sections are in general applied to very different purposes, and are only to a limited extent capable of substitution one for the other at it to be also remarked that it has been considered convenient, in a great measure to abandon or rather to modify the usual distinction between the tools respectively used for wood and for metal. The eighth and concluding section of this chapter describes some refinements in the production of screws which are not commonly practised, and it is in some measure a sequel to the second section.

SECT II -ON ORIGINATING SCREWS

It appears more than probable, that in the earliest attempts at making a screw, a sloping piece of paper was cemented around the iron cylinder, this oblique line was cut through with a stout knife or thin edged file, and was then gradually enlarged by hand until it gave a rude form of screw. Doubtless, as soon as the application of the lathe was generally known, the work was mounted between centers so that the process of filing up the groove could be more easily accomplished, or a pointed turning tool could be employed to assist. Such, in fact, is one of the modes recommended by Plumier, for cutting the screw upon a

lathe mandrel for receiving the chucks even in preference to the use of the die stocks which he uiged were hable to bend the mandrel in the act of cutting the screw*

Nearly similar modes have been repeatedly used for the production of original screws, one account differing in several respects from the above is described as having been very successfully resorted to above fifty years back at the Soho works, Burmingham, by a workman of the name of Anthony Robinson, before the introduction of the screw cutting lathe

The screw was seven feet long six inches diameter and of a square triple thread, after the screw was accurately turned as a cylinder, the paper was cut parallel exactly to meet around the same and was removed and marked in ink with parallel oblique lines, representing the magins of the threads, and having been replaced on the cylinder the lines were pricked through with a center punch. The paper was again removed, the dots were connected by fine lines cut in with a file, the spaces were then cut out with a chisel and hammer and smoothed with a file to a sufficient extent to serve as a lead or guide

The partly formed screw was next temporarily suspended in the center of a cast from tube or box strongly fixed against a horizontal beam, and melted lead mixed with tin was poured into the box to convert it into a guide nut, it then only remained to complete the thread by means of cutters fixed against the box or nut but with the power of adjustment in fact in a kind of slide rest the screw being hinded round by levers †

Another very simple way of originating screws, and which is sufficiently accurate for some purposes, is to coil a small wire, around a larger straight wire as a nucleus—this last is frequently the same wire the one end of which is to be cut ruto the screw—The covering wire whose drameter is equal to the space required between the threads of the screw is wound on close and tight and made fast at each end—The coiled screw, being enclosed between two pieces of hard wood, indents a hollow or counterpart thread sufficient to guide the helical traverse and a fixed cutter completes this simple apparatus—Sec Appendix, Note B K, page 1010

^{*} L Ant du Tourneur by Plumier 1701 pages 15-19

[†] This mode which is described in Gill's Tech Repos vol vi p 261 is sud to have excited at the time great admiration from its success. It is probable a gun metal nut was cast upon this screw for use after the screw was finished

Common screws, for some household purposes, have been made of tinned iron wire two covering wires are folled on together, the one being removed leaves a space such as the ordinary hollow of the thread, and when these screws are dipped in a little melted tin the two wires become soldered together

Other modes have been resorted to for making original screws, by indenting a smooth cylinder, with a shaip edged cutter placed across the same at the required angle—and trusting to the surface or rolling contact, to produce the rotation and traverse of the cylinder—with the development of the screw—In the most simple application of this method, a deep groove is made along a piece of board in which a straight wire is buried a little beneath the surface, a second groove is made nearly at right angles across the first, exactly to fit the cutter, which is just like a table knife, and is placed at the angle required in the screw. The cutter when slid over the wire indents it carries it round and traverses it endways in the pith of a screw—a helical line is thus obtained which by cautious in unagement may be perfected into a screw sufficiently good for many purposes


The late Mi Henry Maudslay employed a cuttor upon cylin ders of wood, tin brass iron, and other materials, mounted to revolve between centers in a triangular bar lathe, the knife was hollowed to fit the cylinder and fixed at the required angle on a block adapted to slide upon the bar, the oblique incision carried the knife along the revolving cylinder. Some hundreds of screws were thus made, and their agreement with one another was in many instances quite remarkable on the whole he gave the preference to this mode of originating screws.*

M1 Allan's apparatus for originating screws for astronomical and other purposes is represented in plan in fig 530, in side elevation in fig 531, and 532 is the front elevation of the cutter frame alone. The piece intended for the screw, namely a a fig 530, is tuined cylindrical, and with two equal and cylindrical necks it is supported in a metal frame with two semi-circular

^{*} The reader is also referred to the Trans Soc of Arts vol xlu page 127 for the description of Mr Walsh's method of making original screws by rolling contact or with a short screw mounted as a milling tool to act only by pressure (see also figs 587 and 588 page 604 of this volume) the method appears however to be circuitous dithcult and very questionable. The instrument fig 30 page 124, vol 1 for cutting snake; in horn is virually in one inator of screws

bearings, b b, which are fixed on a slide moved by an adjusting screw c speaking of the apparatus the inventor says

"The instrument generates original screws perfectly true, of any number of threads, and right or left handed. In this case, the stock and cutter are made as in figs 530-531 and 532, the back of the stock is made into the segment of a circle s and the top of the cutter is continued into an index, t. The cutter is a single thread, and moves on its edge, v, as a center. This must fit true, and the stock fit close to the cutter, to keep it perfectly steady u, two screws to adjust and fisten the cutter to any required angle. The cutter should be rather elliptical for it is best to fit well to the cylinder at the greatest angle it will be ever used. When one turn has been given to

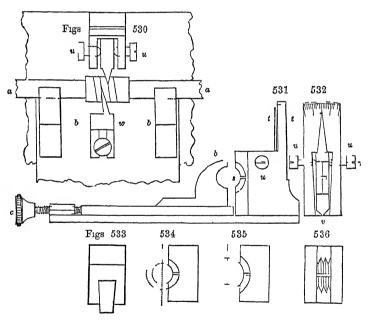

the cylinder, fig 530 a tooth w is put into the cut, and screwed fast—this tooth secures the lead, and causes every following thread to be a repetition of the first—and, though it might do without yet this is a satisfactory security."*

^{*} See Trans Soc of Arts 1816 vol xxxvv p 206 The engravings are copied from figs 6 to 12 of plate 23 An instrument based on the same general plum is described in the Mech Mag 1836, vol xxv p 377 but it is greatly inferior to the above

In cutting ordinary sciews, the dies, shown separately in figs 533 to 536, the consideration of which is for the present deferred, take the place of the oblique cutter in the former figures

The screw is also originated, by traversing the tool in a right line alongside a plain revolving cylinder. Sometimes the tool has many points and is guided by the hand alone, at other times the tool has but one single point and is guided mechanically so as to proceed say one inch or one foot in a right line, whilst the cylinder makes a definite number of revolutions. The tool is then traversed either by a wedge placed transversely to the axis, by a chain or metallic band placed longitudinally, or by another screw, connected in various ways with the screw to be produced by wheel work and other contrivances.


It would be injudicious to attempt at this place the explanation of these complex methods of originating sciews—some of them will, however, be introduced in the course of this chapter, whilst, for greater perspicuity, others will be deferred unto its latter pages—The next section will be now proceeded with on the supposition that a screw of fair quality has been originated by some of the means referred to

SECT III -ON CUTTING INTERNAL SCREWS WITH SCREW TAPS

The screw is converted into the tap, by the removal of paits of its circumference in order to give to the exposed edges a cutting action, whilst the circular paits which remain, scree for the guidance of the instrument within the helical groove, or hollow thread, it is required to form

In the most simple and primitive method four planes were filed upon the sciew as in fig 537, but this exposes very obtuse edges which can hardly be said to cut, as they form the thread partly by indenting and partly by raising or burning up the metal, and as such they scarcely produce any effect in castinon or other crystalline materials. Conceiving as in fig 537, only a very small portion of the circle to remain, the working edges of squared typs, form angles of (90+45 or) 135 degrees with the circumference, and the ingle is the greater, the more of the circle that remains. It is better to file only three planes as in fig 538, but the angle is then as great as 120 degrees even under the most favourable circumstances.

In taps of the smallest size it is imperative to submit to these conditions and to employ the above sections. Sometimes small intermediate facets or planes are tipped off a little obliquely with the file, to relieve the surface friction, this gives the instrument partly the character of a six or eight sided broach, and improves the cuting action.



There appears to be no doubt but that for general purposes, the most fivour ible angle for the edges of scient type and dies, is the radial line or an angle of 90 degrees. This condition manifestly exists in the half round type fig. 539, which is advocated in the annexed quotation from Sir John Robison, who in speaking of the tap, says. I propose that this should be made half round as it will be found that a type formed in this way will cut a full clear thread (even if it may be of a sharp pitch) without making up any part of it by the burn as is almost universally the case, when blunt edged or grooved taps are used.

"It has sometimes been objected to me by persons who had not seen half round taps in use, that from their containing less substance than the common forms do, they must be very hable to be broken by the strain required to turn them in the work. It is proved, however by experience, that the strain in their case is so much smaller than usual that there is even less chance of breaking them than the stouter ones. Workmen are aware that a half round opening bit makes a better hole and cuts faster than a five sided one, and yet that it requires less force to use it.

Fig 540 in which two thirds of the circle are allowed to remain, has been also employed for taps, this, although somewhat less penetrative than the last, is also less hable to displacement with the tap wrench. It is much more usual to employ three radial cutting edges instead of one only, and as in the best forms of

^{*} Select Papers read before the Soc of Arts for Scotland vol 1 page 41

taps, they are only required to cut in the one direction, or when they are screwed into the nut the other edges are then cham fered to make room for the shavings—thereby giving the tap a section somewhat like that of a ratchet wheel, with either three, four, or five teeth, as in figs 541 and 549


It is more common however, either to file up the side of the tap, or to cut by machinery, three concave or elliptical flutes as in 542, this form sufficiently approximates to the desider itum of the radial cutting edges it allows plenty of room for the shavings, and is easily wiped out. What is of equal or greater importance, it presents a symmetrical figure little hable to accident in the hardening either of distortion from unequal section, as in figs 539 and 540, or of cracking from internal angles, as in 540 and 541 *

Still considering alone the transverse section of the tap, it will be conceived that before any of the substance can be re moved from the hole that is being tapped, the circular part of the instrument must become embedded into the metal a quantity equal to the thickness of the shaving, and in this respect figs 537 and 538 in which the circular parts are each only the tenth or twelfth of the encumference appear to have the advantage over the modern taps 511 and 517 in which each arc is twice is long Such, however, is not the case, as the first two act more in the manner of the brouch, if we conceive that instrument to have senated edges but figs 511 and 512 act nearly as turning tools, as in general the outer or the circular surface is slightly icheved with a file, so as to leave the cutting edges a, somewhat m advance of the general periphery which is equivalent to chamfering the lower plane of the turning tool some 3 degrees (see page 534) to produce that relief which has been approprintely named the angle of separation

But in the tap fig 543, patented by Mi G Bodiner of Man chester, this is still more effectually accomplished. The instrument instead of being turned of the ordinary circular section

^{*} In fluting typs as in cutting the teeth of wheels the tap in which is frequently chucked in the lithe just is in turning but the mindred is held at rest by the dividing plate and the tool is a cutter revolving homizontally and to versed through the groove by the slide rest science. The round flutes are made with cutters having semicircular edges and placed centrally the ratchet form flutes are made with thick saws or square edged cutters the one edge of these is placed to intersect the center of the try and leave the radial edge.

in the lathe (or as the outer dotted line) is turned with three slight undulations, by means of an alternating radial motion given to the tool. From this it results, that when the summits of these hills are converted into the cutting edges, that not only are the extreme edges or points of the teeth made prominent, but the entire seriated surface becomes inclined at about the three degrees to the external circle, or the line of work so as exactly to assimilate to the turning tool, and therefore there is little doubt but that, under equal circumstances, Mr. Bodinci's tap would work with less friction than any other

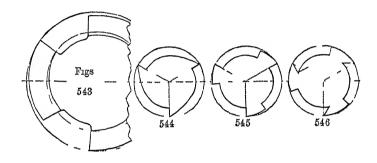


The principle of chamfering, or relieving the taps, must not however, be carried to excess, or it will lead to mischief, in explanation of which the diagrams 544 545, and 516 may be considered parallel with the forms 429 430, and 431, of page 532. For example the tap, if sloped behind the teeth as in 514, would be much exposed to fracture, and the instrument being entirely under its own guidance, the three series of keen points would be apt to stick irregularly into the metal, and would not produce the smooth, circular, or helical hole, obtained when the tool 515 is used, which may be considered parallel with the turning tool fig 430. The relief should be slight, and the surfaces of the teeth then assimilate to the condition of the graver for copper plates (see page 532), and thereby direct the tap in a very superior manner

The teeth sloped in front, as in figs 546, would certainly out more keenly than those of 545, but they would be much more exposed to accident, as the least backward motion or violence would be liable to snip off the keen points of the teeth und

therefore, on the score of general economy and usefulness the radial and slightly relieved teeth of fig 545, or rather of 542, are proper for working taps

It appears further to be quite impolitic, entirely to expunge the surface bearing or squeeze from the taps and dies, when these are applied to the ductile metals as not only does it, when slight, greatly assist in the more perfect guidance of the instrument but it also serves somewhat to condense or compress the metal.*

The transverse sections hitherto referred to, are always used for those taps employed in screwing the inner surfaces of the nuts and holes required in general mechanism. The longitudinal section of the working tap, is taper and somewhat like a broach, the one end being small enough in external diameter to enter the blank hole to be screwed and the other end being as large as the screw for which the nut is intended

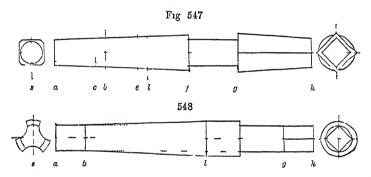

In many cases a series of two, three, or four taps must be used instead of only one single council tap, and the modifications in their construction are explained by the above diagrams, namely, fig 547, the tap formerly used for nuts and thorough fare holes and fig 548 the modern tap for the same purposes, the dotted lines in each represent the bottoms of the threads

^{*} Unless the typs cut very freely it is the general aim to avoid the necessity for tapping cast iron which is a granular and crystalline substance upt to crumble away in the typping or in the after use. The general remedy is the employment of bolts and nuts made of wrought iron or fixing sciewed wrought iron pins in the work by means of transverse keys and other contrivances and sometimes by the insertion of plugs of gun metal to be afterwards tapped with the sciew threads. In general also the small screws for cast iron are course and shallow in the thread compared with those for wrought non steel, and bruss.

In the former kind, the thread was frequently finished of a taper figure with the screw tool in the lathe, after which cither the four or three plane surfaces were filed upon it, as shown by the section at s the neck from f to g was as small as the bottom of the thread, and the tang from g to h was either square or rectangular for the tap wrench. The tang if square was also taper, the tap wrench then wedged fast upon the tap the sides of the tang if parallel were rectangular, and measured as about one to two, and there were shoulders on two sides to sustain the wrench

In the modern thoroughfare taps for nuts drawn to the same scale in fig 548 the thread is left cylindrical, from the screw-tool or the dies—then from a to b, or about one drameter in length is turned down cylindrical until the thread is nearly obliterated, from d to f, also nearly one drameter in length at the other end, is left of the full size of the bolt, and the intermediate part, b to d equal to three or four drameters, is turned to a cone, after which the tap is fluted as seen at s. The neck f g as before is as small as the bottom of the thread, and the square g h, measures dragonally the same as the turned neck

In using the modern instrument fig 548, the hold to be tapped is bored out exactly to fit the cylindrical plug a b, which therefore guides the tap very perfectly in the commencement, the tool is simply passed once through the nut without any retrograde motion whatever and the cylindrical part d f, takes up the guidance when the larger end of the cone enters the hole, at the completion, the tap drops through, the head being smaller than the bottom of the thread. The old four square taps could not be thus used for as they rather squeezed than cut, they had much more friction, it was necessary to move them backwards and forwards and to make the square for the wrench larger, to avoid the risk of twisting off the head of the tap. In taps of modern construction of less than half an inch diameter, it is also needful to make the squares larger than the proportion employed in fig. 548

In tapping shallow holes as only a small portion of the end of the tap can be used, the screwed part seldom exceeds two diameters in length, and as they will not take hold when made too conical, a succession of three or four taps is generally required. The sciewed part of the first may be considered to extend from a to b of fig. 547, of the second, from c to d of the third from e to f so that the prior tap may, in each case, prepare for the reception of the following one. The taps are generally made in sets of three, the first, which is also called the entering or taper tap, is in most cases regularly taper throughout its length, the second, or the middle tap is sometimes taper, but more generally cylindrical with just two or three threads at the end tapered off—the third tap which is also called the plug or finishing tap, is always cylindrical except at the two or three first threads, which are slightly reduced

Taps are used in various ways according to the degree of strength required to move them. The smallest taps should have considerable length, and should be fixed exactly in the axis of straight handles, the length serves as an index by which the true position of the instrument can be verified in the course of work with the same view as to observation and as an expeditious mode, taps of a somewhat larger size are driven round by a hand brace, whilst the work is fixed in the vice. Still larger taps require tap wienches or levers with central holes to fit the square ends of the taps, for sciew taps from one to two inches diameter, the wrenches have assumed the lengths of from four to eight feet, although the recent improvements in the taps have reduced the lengths of the wrenches to one half

Notwithstanding that the hole to be tapped may have been drilled straight, the tap may by improper direction proceed obliquely, the progress of the operation should be therefore watched, and unless the eye serve readily for detecting any falseness of position, a square should be laid upon the work, and its edge compared with the axis of the tap in two positions


In tapping deeply seated holes, the taps are temporarily lengthened by sockets, frequently the same as those used in drilling which are represented in fig 501, page 560, the tap wichch can then surmount those parts of the work which would otherwise prevent its application

Sometimes, for tapping two distant holes exactly in one line, the ordinary taper tap, fig. 548 is made with the small cylindrical part α b exceedingly long, so as to reach from the one

hole to the other and serve as a guide or director This is only an extension of the short plug a b fig 548, which it is desirable to leave on most taps used for thoroughfare holes

Some works are tapped whilst they are chucked on the lather mandrel in this case the shank of the tap, if in false position will swing round in a circle whilst the mandrel revolves, instead of continuing quietly in the axis of the lather Sometimes the center point of the popit head is placed in the center hole in the head of the tap in those which are fixed in handles it is better the handle of the tap should be dislled up to receive the cylinder of the popit head as in the lather taps for making chucks this returns the guidance more easily

Taps of large size, as well as the generality of cutting instruments have been constructed with detached cutters. For those exceeding about $1\frac{1}{2}$ inch diameter, Mr. Richard Jones recommends two steel plugs a a, to be inserted within taper holes in the body of the tap, as represented in fig. 549, and in the two sections b and c, the whole is then screwed and hardened



The advance of the cutters slightly beyond the general line of the thread, is caused by placing a piece of paper within the mortises a a, and to reheve the surface friction, each alternate tooth in the middle part of the length of the tap is filed away. Sometimes the cutters are parallel, and inserted only partway through and are then projected by set sciews placed also on the diameter as in the section c^*


The cutter bar, fig 515 p 569, may also be viewed as a tap with detached cutters. The cylindrical bar is supported in temporary fixed bearings, one of which embraces the thread (some times by having melted lead poured around the same), the bar moves therefore in the path of a screw. In cutting the external

^{*} See Trans Soc of Arts, 18'9, vol xlvn p 135

thread, the cutter represented is shifted inwards with the progress of the work, or a straight cutter shifted outwards, serves for making an internal screw pointed instead of serrated cutters may be also used, they are frequently adjusted by a set screw instead of the hammer, and are worked by a wrench

This sciew cutter bar, independently of its use for large awkward works, is also employed for cutting, in their respective situations sciews required to be exactly in a line with holes or fixed bearings, as the nuts of slides, presses, and similar works

Some taps or cutters are made cylindrical, and are used for cutting narrow pieces and edges, such as sciew cutting dies screw tools and worm wheels therefore it is necessary to leave much more of the circle standing, and to make the notches narrower than the width of the smallest pieces to be cut. But the grooves should still possess radial sides and when these are connected by a curved line, as in fig. 550, there is less risk of accident in the hardening. The number of the notches increases with the diameter, but the annexed figure would be better proportioned if it had one or two less notches, as in idvertently the teeth have been drawn too weak.



When the tool, figs 550 and 551, is used for cutting the dies of die stocks it is called an original tap of which further particulars will be given in the succeeding section, the tool is then fixed in the vice, and the die stock is handed round, as in cutting an ordinary screw. When 551 is used for cutting up sciew tools or the chasing tools for the use of the turning lathe, (figs 404 and 405 page 519) the cutter is then called a hob, or a screw-tool cutter, and its diameter is usually greater, it is now mounted to revolve in the lathe, and the screw tool to be cut, is laid on the rest is in the process of turning, and is pressed forcibly

against the cutter * Fig 551 is also used as a worm wheel cutter that is for cutting or for finishing the hollow sciew form teeth, of those wheels which are moved by a tangent sciew—as in the dividing engine for circular lines and many other cases in ordinary mechanism—The worm wheel cutter is frequently set to revolve in the lathe, and the wheel is mounted on a temporary axis so as to admit of its being carried round horizontally by the cutter, sometimes the wheel and cutter are connected by gear!

Attention has been hitherto exclusively directed to the forms of the taps used for metal but those for wood are very similar the tap fig 542, p 584, with three or four flutes, being the most common those of largest size are cast in iron, and require only a little filing up to sharpen the teeth

Different taps with loose teeth, have been adopted for wood screws of moderately large size, say exceeding $1\frac{1}{2}$ or 2 inches diameter. In the one case, shown in fig. 552, an ordinary wood screw t is first made, and at the bottom of the angular thread, a narrow parallel groove is cut in the lathe with a parting tool the screw is then turned down to the size of the hole to be tapped, leaving it as a plain cylinder with the square helical groove represented in the piece t

The next process is to insert a pointed cutter c, in a diame trical mortise and when the wooden tap is in use, it is guided by the block g which is bored to fit, and has two non plates p which enter the groove. The guide g is fixed to the work w, which is to be tapped, the bar glides forward in virtue of


In cutting up the inside screw tool fig 404 in which the slope and the curva ture of the teeth should be riversed an internal screw cutter has been recommended it is made like a screwed nut notched longitudinally on its inner surface

Another method is proposed—the inside sciew tool is laid in a lateral groove in a cylindrical piece of non—and the tool and cylinder are cut up with the die stocks as a common screw—by which mode the inside sciew tool obviously becomes the exact counterpart of the hollow thread of that particular diameter—See I echnological Repository 1821, vol vi—p 292—The right hand inside sciew tool is sometimes cut over a solid left hand hob, which is a more simple way of reversing the angle

⁺ The contact of the ordinary tangent screw with the worm wheel resembles that of the tangent to the circle whence the name but Hindley of York made the screw of his dividing choine to touch 15 threads of the wheel perfectly by giving the screw a curved section derived from the edge of the wheel and smallest in the middle. See Sineaton's Mercellancous Papers p. 183. I not Willis in his Litements of Mechanism. 1841. p. 163—5. explained the mode of cutting, such a tangent screw but showed that its advantages are more apparent than real.

the screw thread, and at each succeeding passage the cutter is advanced a small distance, until the work is tapped of the full diameter, the hollow space between the guide g and the work w, allows the cutter to pass entirely through the latter, the space being wider than the cutter

Another structure is shown in the Manuel du Tourneur A hollow non screw is made like fig 553, and a hole is dulled at the termination of the thread the extreme end of which is cham fered on the inner surface with a file, to make a keen angular edge of the shape of the thread, in its action the tool therefore somewhat assimilates to the plane, and the shavings escape through the center of the tube

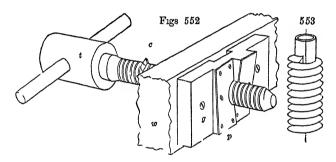


This appears to be much less serviceable than the contrivance fig 552, in which the helical guidance is perfect at the commencement and continues so until the end notwithstanding the gradual formation of the thread which may be cut at several repetitions instead of in one single cut, or in two cuts when two teeth are on opposite sides of the tube, fig 553. The arrangement of fig 552 may be considered as quite analogous to that of the screw cutter bar (fig 515 page 569,) whereas the hollow tap fig 553, is just the converse of the screw box described at the beginning of the following section

SECT IV -ON CUTTING LXTERNAL SCREWS, WITH SCREW DIFS, FTC

For the convenience of arrangement, this section will be commenced with the description of the instrument which is commonly employed for maling long screws in the soft woods, namely, the screw box, of which fig 551 is the section, fig 555 the plan of the principal piece through the line a and fig 556 the cutter, shown the full size for a two inch screw

The screw box consists of two pieces of wood, accurately attached by two steady pins and two sciews so as to admit of separation and exact replacement, the ends of the thicker piece are frequently formed into handles, by which the instrument is worked. A performing is made through the two pieces of wood the hole in the thinner piece is cylindrical and exactly agrees with the external diameter of the sciew, or of the piepared cylinder, and the hole in the thicker piece is sciewed with the same tap that is to be used for the internal screws or nuts, and which is shown in three views in fig. 557. The cutter or V, has a thin cutting edge sloped externally to the angle of the thread usually about 60 degrees, and thinned internally by a notch made with a trangular file—the cutter is inlied in the thicker piece of wood, and fastened by a hook form screw bolt and nut

In placing the cutter, four different conditions require strict attention. Its angular ridge should he as a tangent to the minci-circle—its edge should be shapened on the dotted line b, or at an angle of about 100 degrees with the back, its point should exactly intersect the ridge of the thread in the box—and it should he precisely at the rake or angle of the thread, for which purpose it is inlaid deeper at its blunt extremity

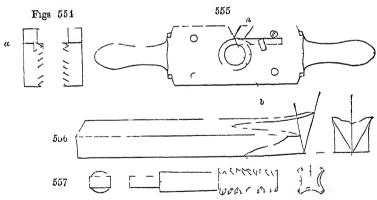

The piece of wood for the screw is turned cylindrical and a little pointed, it is then twisted into the screw box, the cutter makes a notch which extens upon the ridge of the wooden worm immediately behind the cutter, and this carries the work forward, exactly at the rate of the thread. The whole of the

material is removed at one cut and the shavings make their escape at the aperture or mouth m


In cutting the smallest sciews, with this well contrived and effective instrument, the screw box is held in the left hand and the work is screwed in with the right, or the box is applied whilst the work remains upon the mandrel of the lathe. When the thread is required to be continued close up to a shoulder, the screw is cut up as far as the entire instrument will allow the screw box is then removed, in order that the loose piece may be taken off from it, after which the screw is completed without impediment.

Screws of half an inch diameter and upwards, are generally fixed in the vice, whilst the screw box is handed round just like the diestock. For large screws exceeding two or three inches diameter, two of the V s or cutters are placed in the box, so as to divide the work, thereby lessening the risk of breaking the delicate edge of the cutter, the exact position of which is a matter of great nicety. The screw box has been occasionally used for wooden screws of 4, 6, and 8 inches diameter, and upwards and such large screws have been also made by hand with the saw, chisel mallet and ordinary tools, but these large screws are now almost entirely superseded by those of metal, which, for most purposes, are greatly superior in every point of view.

In cutting the metal sciew, or the bolt, the tools are required to be the converse of the tap, as they must have internal instead of external threads, but the radial notches are essential alike in each. For small works, the internal threads are made of fixed sizes and in thin plates of steel, such are called screw plates for larger works, the internal threads are cut upon the edges of two or three detached pieces of steel, called dies, these are fitted into grooves within diestocks and various other contrivances which admit of the approach of the screwed dies, so that they may be applied to the decreasing diameter of the screw, from its commencement to the completion

The thickness of the sciew plate is in general from about two thirds to the full diameter of the sciew, and mostly several holes are made in the same plate, from two to six holes are intended for one thread and are accordingly distinguished into separate groups by little marks as in fig 558. The serrating of the edges, is sometimes done by making two or three small holes and connecting them by the lateral cuts of a thin saw as in fig 559. The notches alone are sometimes made and when the holes are arranged as in fig 560 should the screw be broken short off by accident it may be cut in two with a thin saw and thus removed from the plate.


In making small screws the wire is fixed in the hand vice, tapered off with a file, and generally filed to an obtuse point, then, after being moistened with oil, it is screwed into the one or several holes in the screw plate which is held in the left hand. At other times, the work fixed in the lather is turned or filed into form and the plate is held in the right hand, but the force then applied is less easily appreciated. The harp makers and some others, attach a screw plate with a single hole to the sliding cylinder of the popit head. See page 564

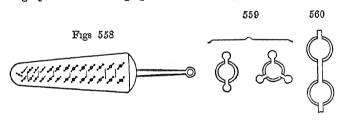

The sciew plate is sometimes used for common screws as large as from half to three quarters of an inchdiameter, such screws are fixed in the tail vice, and the screw plate is made from about 15 to 30 inches long, and with two handles, the holes are then made of different diameters, by means of a taper tap, so as to form the thread by two, three, or more successive cuts, and the screw should be entered from the large side of the taper hole. It is, however, very advisable to use the diestocks, in preference to the screw plates for all screws exceeding about one sixteenth of an inch diameter, although the unvarying diameter of the screw plate has the advantage of regulating the equal size of a number of screws, and as such is occasionally used to follow the diestocks, by way of a gage for size

The diestock, in common with other general tools, has received a great many modifications that it would be useless to trace in

greater detail, than so far as respects the varieties in common use or those which introduce any peculiarity of action in the cutting edges. A notion of the early continuances for cutting metal screws will be gathered from the figures 561 to 564 which are copied half size from Leupold's Theatrum Machinarum Generale 1724* For instance fig 561 is the sciew plate divided in two, and jointed together like a common rule, the inner edges are cut with threads, the larger of which is judiciously placed near the joint that it may be more forcibly compressed, there is a guide, a, a, to prevent the lateral displacement of the edges, which would be fatal to the action Similar instruments are still used, but more generally for screws made in the turning lathe

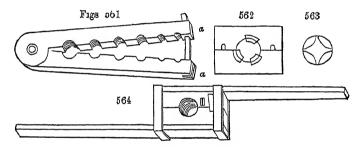


In one of these tools, the frame or stock is made exactly like a pair of flat pliers, but with loose dies cut for either one or two sizes of threads. Plier diestocks are also made in the form of common nut crackers, or in fact, much like fig. 561, if we consider it to have handles proceeding from a a, to extend the tool to about two or three times its length the guide a a is retained, and removable dies are added, instead of the threads being cut in the sides of the instrument. Sciewing tools are also made of one piece of steel, and to spring open, something like fig. 184, page 232, Vol. I, but shorter and stronger the threads are cut on the sides or ends of the bosses, which are flat externally, for the convenience of compression in the tail vice.

In general, however, the two dies are closed together in a straight line, instead of the arc of a circle—one primitive method, fig 564, extracted from the work referred to has been thus remodelled, the dies are inserted in rectangular taper

^{*} Moxon, Plumier, and others describe similar tools, and also the sciew box

holes in the ends of two long levers, which latter are connected by two cylindrical pins, carefully fitted into holes made through the levers and the ends of the pins are sciewed and provided with nuts which serve more effectually to compress the dies than the square rings represented in fig. 564

The diestock in its most general form has a central rectangul u aperture, within which the dies are fitted so as to admit of compression by one central screw the kinds most in use being distinguished as the double chamfered diestocks figs 505 and 566,

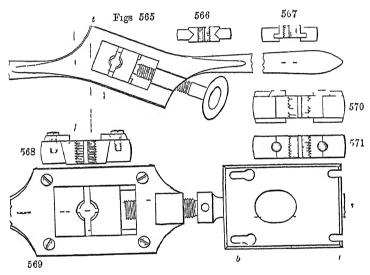

and the single chamfered diestock figs 568 and 569 the handles of which are partly shown by dotted lines. In the former, the aperture is about as long as three of the dies, about one third of the length of the chamfer is filed away at the one end, for the removal of the dies laterally, and one at a time. In the single chamfered diestock 569, which is preferable for large threads, the aperture but little exceeds the length of two dies and these are removed by first taking off the side plate b a, which is either attached by its chamfered edges as a slide, or else by four seriews, these when loosened, allow the plate to be slid endways, and it will be then disengaged, as the screws will leave the grooves at a, and the screw heads will pass through the holes at b

Sometimes dies of the section of fig 567 are applied after the manner of 566, and occasionally the rectangular aperture of

fig 569 is made parallel on its inner edges and without the side plate ba, the dies are then retained by steel plates either my eted or screwed to the diestock, as represented in fig 570, or else by two steel pins buried half way in the sides of the stock, and the remaining half in the die as shown in fig 571 These variations are of little moment as are also those concerning the general form of the stock, for instance, whether or not the handles proceed in the directions shown (the one handle s, being occa sionally a continuation of the pressure sciew), or whether the handles are placed as in the dotted position t In small die stocks, a short stud or handle is occasionally attached at right angles to the extremity, that the diestock may be moved like a winch handle and sometimes graduations are made upon the pressure screw, to denote the extent to which the dies are closed I hese and other differences are matters comparatively unimpor tant, as the accurate fitting of the dies, and their exact forms, should receive the principal attention

In general only two dies are used, the inner surface of each of which includes from the third to nearly the half of a circle, and a notch is made at the central part of each die, so that the pair of dies present four arcs, and eight series of cutting points or edges—four of which operate when the dies are moved in the one direction, and the other four when the motion is reversed, that is when the curves of the die and screw are alike


The formation of these parts has given use to much investigation and experiment, as the two principal points aimed at require directly opposite circumstances. For instance, the narrower the edges of the dies, or the less of the circle they contain, the more easily they penetrate, the more quickly they cut, and the less they compress the screw by surface friction or squeezing, which last tends to elongate the screw beyond its assigned length. But on the other hand the broader the edges of the dies, or the more of the circle they contain, the more exactly do they retain the true helical form, and the general truth of the screw

The action of sciew cutting dies is rendered still more difficult, because in general, one pair of dies, the curvatures and angles of which admit of no change, are employed in the production of a screw, the dimensions of which during its gradual transit from the smooth cylinder to the finished sciew, continually change

For instance, the thread of a sciew necessarily possesses two

magnitudes, namely the top and bottom of the groove, and also two angles at these respective diameters as represented by the dotted lines in the diagrams figs 572, 574 and 5.6 (which are drawn with straight instead of curved lines). The angles are nearly in the inverse proportion of the diameters of if the bottom were half the diameter of the top of the thread the angle at the bottom would be nearly twice that at the top (The mode of calculating the angles is subjoined to figs 614—617 page 657)

The figures show the original typs, master taps of cutters, from which the dies, figs 573 575 and 577, are respectively made, and in each of the three diagrams, the dies a are supposed to be in the act of commencing and the dies b in finishing, a screw of the same diameter throughout, as that in fig 572

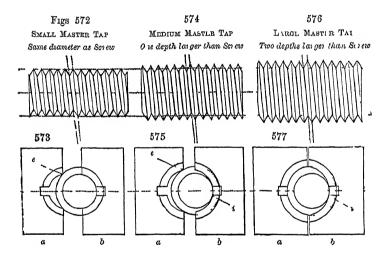

Of course the circumstances become the more perplexing the greater the depth of the thread whereas in shallow threads the interference may be safely overlooked. As the dies cannot have both diameters of the screw it becomes needful to adopt that curvature which is least open to objection. If, as in fig. 573, the curved edges of the dies a and b have the same radii as the finished screw, in the commencement, or at a, the die will only touch at the corners and the curved edges being almost or quite out of contact there will be scarcely any guidance from which to get the lead, or first direction of the helix, and the dies will be

likely to cut false screws, or else parallel grooves or rings * In addition to this, the curved edges present at the commencement a greater angle than that proper for the top of the screw, but at the completion of the screw or at b the die and screw will be exact counterparts, and will be therefore perfectly suitable to each other

If, as in fig 577, the inner curvature of the dies a and b be the same as in the blank cylinder, a will exactly agree both in diameter and angle at the commencement of the screw, but at the conclusion, or as at b, each will be too great, and the die and screw will be far from counterparts, and therefore ill adapted to each other

The most proper way of solving the difficulty in dies made in two parts, is by having two pairs of dies, such as 577 and 573, and which is occasionally done in very deep threads, a mode that was first published by Mr Allan, see figs 535 and 536 page 582 But it is more usual to pursue a medium course and to make the original tap or cutter fig 574 used in cutting the dies not of the same diameter as the bolt, as in figs 572 and 573, not to exceed the diameter of the bolt by twice the depth of the thread as in figs 576 and 577 but with only one depth beyond the exact size, or half way between the extremes, as in figs 574 and 575, in which latter it is seen the contact, although not quite perfect either at a or b, is sufficiently near at each for general practice

The obvious effect of diffcient diameters between the die and screw must be a falsity of contact between the surfaces and angles of the dies, thus, in 573 the whole of the cutting falls upon e the external angles, until the completion of the screw in b when the action is rather compressing than cutting. In fig 577, the first act is that of compressing, and all the work is soon thrown on t, the internal angles of the die, which become

^{*} Sometimes the dies cut a fine single thread screw of one half or one third the coarseness of that of the dies at other times a fine double or triple screw of the same rake or velocity as the dies and occasionally the dies cut concentric rings. These accidental results are mainly to be attributed to the diestocks being closed upon the screw bolt obliquely instead of at right angles—the edges of the dies do not then approach in the required relationship and the two dies each cut a distinct thread instead of one thread in common. In the act of placing the dies the stock should be slightly—wriggled—or moved vertically to allow the dies to select their true position on the bolt to be cut

gradually more penetrative, but eventually too much so, being in all respects the ieverse of the former. In the medium and most common example fig 575 the cut fulls at first upon the external angles e, it gradually dies awij and it is during the brief transition of the cut from the external to the internal angles e, that is, when the screw is exactly half formed, that the compression principally occurs


The compression or squeezing is apt to enlarge the diameter of the screw (literally by swaging up the metal,) and also to elongate it beyond its assigned length, and that unequally at different parts. Sometimes the compression of the dies in ikes the sciew so much coarsel than its intended pitch, that the screw refuses to pass through a deep hole cut with the appropriate tap not only may the total increase in length be occasionally detected by a common rule but the differences between twenty of thirty threads, measured at various parts with fine pointed compasses, are often plainly visible

Other and vastly superior modes for the formation of long screws, or those requiring any very exact number of threads in each inch of foot of their length will be shortly explained. Yet notwithstanding the interferences which deprive the die stocks of the refined perfection of these other methods, they are a most invaluable and proper instrument for their intended use, and the disagreement of curvature and angle is more or less remedied in practice by reducing the circular part of the dies in various ways and also in some instances, by the partial separation of the guiding from the cutting action

The most usual form of dies is shown in fig 578 but if every measure be taken at the mean as in fig 579 the tool possesses a fair, average, serviceable quality, that is, the dies should be cut over an original tap of medium dimensions namely, one depth larger than the screw such as fig 571, the curved surface should be halved, making the spaces and curves as nearly equal as may be, and the edges should be radial. Fig 580, nearly transcribed from Leupold's figure, 562, has been also used, but it appears as if too much of the curve were then removed.

Sometimes the one die is only used for guiding and the other only for cutting thus a, fig 581, is cut over two different diameters of master taps, which gives it an elliptical form. A large master typ, fig 576, is first used for cutting the pair of

dies, this leaves the large parts of the curve in a—the dies are subsequently cut over a small master tap, 572

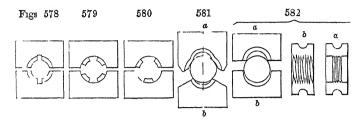

In beginning the screw, the die a serves as a bed with guiding edges these indent without cutting and also agree at the first start with the full diameter of the bolt—with the gradual reduction of the bolt it sinks down to the bottom of a which continually presents an angular ridge, nearly agreeing in diameter, and therefore in angle with the nascent screw—The inconveniences of the dies fig. 581—are that they require a large and a small master tap for the formation of every different sized pair of dies, and which latter are rather troublesome to repair. The dies also present more friction than most others, app wently from the screw becoming wedged within the angular sides of the die a

In fig 582 a construction advocated by Sir John Robison, the dies are first cut over a small master tap, fig 573 the threads are then partially filed or turned out of b, to fit the blank cylinder which therefore rests at the commencement upon blunt triangular, curved surfaces, instead of upon keen edges, and as the sciew is cut up, its thread gradually descends into the portions of the thread in b which are not obliterated. About one third of the thread is turned out from each side of the cutting die a, leaving only two or three threads in the center, as shown in the last view, and the surface of this die is left flat, that it may be ground up afresh when blunted and which is also done with other dies having plane surfaces.*

M₁ Peter Ken and M₁ William Jones have each proposed to assist the action of dies for large screws, by means of cutters, their plans will be sufficiently explained by the diagrams, figs 583 and 584. Mi Ken applied this mode to large screws of square threads for gun carriages—the dies were cut very shallow,

^{*} Select Papers of the Society of Arts for Scotland, vol 1 p 41

say one third of the full depth, and they were serrated on their inner faces to act like saws or files. The dies were used to cut up the commencement of the thread, but when it filled the shal low dies, their future office was not to cut but only to guide the ascent and descent of the stocks by the smooth surfaces of the dies rubbing upon the top of the square thread. The remaining portion of the screw was afterwards ploughed out by a cutter like a turning tool, the cutter being inserted in a hole in the one die, and advanced by a set screw, somewhat after the manner represented in the figures 583 and 584 *

Mr Jones employed a similar method for angular thread screws, and the cutter was placed within a small frame fixed to the one die. The screw bolt was commenced with the pair of dies which were closed by the set screw a 583, the cutter being then out of action. When the cutter was set to work by its adjusting screw b, it was advanced a little beyond the face of the die, and not afterwards moved, but the advance of a, closed the dies upon the decreasing diameter of the screw, the cutter always continuing prominent and doing the principal share of the work †

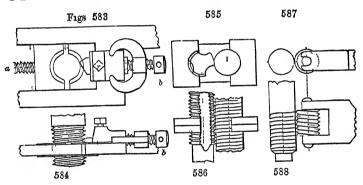


Fig 585 is the plan, and 586 the side elevation, of an old although imperfect expedient for producing a left handed screw from a right handed tap. It will be remembered the right and left hand screws only differ in the direction of the angle, the thread of the one coils to the right of the other to the left hand, and on comparing a corresponding tap and die, the inclinations of the external curve of the one, and the internal curve of the

^{*} Technical Repos vol viii pages 182 and 193

[†] Trans Soc of Arts, 1829, vol xlvu, p 135

other, necessarily differ in like manner as to direction. The mode employed therefore is to carry a right hand tap around the sciew to be cut—the temporary screw cutter possesses the same interval or thread as before—but the cutting angles of the tap, having the reverse direction of those of the die—the screw becomes left handed

The one die in 585 and 586 is merely a blank piece of brass or iron without any grooves the other is a brass die in which the tap is fixed as may be expected the thread produced is not very perfect, but in the absence of better means, this mode is available as the germ for the production of a set of left-hand taps and dies. Figs 587 and 588 represent a different mode of originating a left handed screw proposed by Mr Walsh the tool is to be a small piece of a right handed screw which is hardened and mounted in a frame like an ordinary milling or nurling tool and intended to act by pressure alone the diameter of the tool and cylinder should be alike *

The sciew stock first patented by the Messrs Whitworth of Manchester, is represented in fig 589 three narrow dies were fitted in three equidistant radial grooves in the stock, the ends of the dies came in contact with an exterior ring, having on its inner edge three spiral curves, (equivalent to three inclined planes,) and on its outer surface a series of teeth into which worked a tangent screw so that on turning the ring by the screw the three dies were simultaneously and equally advanced towards the center


These screw stocks were found to cut very rapidly, as every circumstance was favourable to that action. For instance, on the principle of the triangular bearing all the three dies were constantly at work, the original tap being slightly taper, every thread in the length of the die was performing its part of the work, the same as in a taper tap every thread of which removes its shaving, or share of the material, and the dies were narrow, with radial edges, which admit of being easily sharpened

This diestock has been abandoned by the Messrs Whitworth

See Trans Soc of Arts vol xlm p 127, this scheme is referred to likewise in the foot note on page 581 of this volume

Some methods of making the same taps and dies serve for cutting either right or left hand screws will be found in Frans Soc of Arts vol xli p 115 Manuel du Fourneur vol 1 plate 23 and Mechanics Magazine 1836 vol xxv p 376 These contrivances appear however, to possess little oi no value

in favour of their sciew stock subsequently patented, which is represented in fig 590. The one die embraces about one third of the circle, the two others much less—the latter are fitted into grooves which are not radial, but lead into a point situated near the circumference of the screw bolt—the edges of the dies are slightly hooked or ground respectively within the radius—and they are simultaneously advanced by the double widge and nut—the dies are cut over a large original, such—as fig—576, that is, two depths larger than the screw—The large die serves to line out or commence the screw—and the two others act alternately the one—whilst—the stock descends down—the—bolt, the—other during its ascent

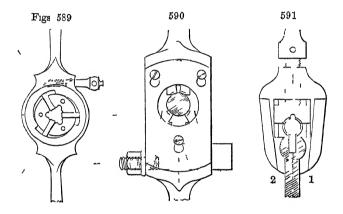

The last screw stock that will be here noticed is Mr G Bod mer s of Manchester, for which he also has obtained a patent It is seen that the one die embraces about one third the screw, the other is very narrow—the peculiarity of this construction is that a circular recess is first turned out of the screw stock and a parallel groove is made into the same—the one handle of the stock (which is shaded) nearly fills this recess—and receives the small die—If the handle were fitted mathematically true—it is clear it would be immovable—but the straight part of the handle is nar rower than the width of the groove—when the stock is turned round, say in the direction from 2 to 1, the first process is to rotate the handle in the circle, and to bring it in hard contact with the side 1, this slightly rotates the die also, and the one corner becomes somewhat more prominent than the other—When

the motion of the stock is reversed the handle leaves the side 1, of the groove and strikes against the other side 2 and then the opposite angle of the die becomes the more prominent and that without any thought or adjustment on the part of the workman as the play of the handle in the groove 1, 2 is exactly proportioned to cause the required angular change in the die

The cutting edges of the die act exactly like turning tools, and therefore they may very safely be bevelled or hooked as such as when they are not cutting, they are removed a little way out of contact, and therefore out of danger of being snipped off, or of being blunted by hard friction. The opposite die affords during the time an efficient guidance for the screw, and the broad die is advanced in the usual manner, by the pressure screw made in continuation of the second handle of the diestock, the dies are kept in their places by a side plate, which is fitted in a chamfered groove in the ordinary manner.

There is less variety of method in cutting external screws with the diestocks, than internal screws with taps, but it is desirable in both cases, to remove the rough surface the work acquires in the foundry or forge, in order to economise the tools and the best works are either bored or turned cylindrically to the true diameters corresponding with the screwing tools

The bolt to be sciewed is mostly fixed in the tail vice vertically but sometimes horizontally, the dies are made to apply fairly, (see foot note page 601) and a little oil is applied prior to starting. As a more expeditious method suitable to small sciews, the work is caused to revolve in a lathe, whilst the die stock is held in the hand, and larger screws are sometimes marked or lined out whilst fixed in the vice, the principal part of the material is then removed with the chasing tool of hand screw tool, fig. 405, p. 519, and the screw is concluded in the diestocks. In cutting up large screw bolts, two individuals are required to work the sciew stocks, and they walk round the standing vice or screwing clamp, which is fixed to a pedestal in the middle of the workshop

For sciewing large numbers of bolts, the engineer employs the bolt screwing machine, which is a combination of the ordinary taps and dies, with a mandrel, driven by steam power. In the machine invented by Mr. Fox, the mandrel revolves, traverses,

and carries the bolt, whilst the dies are fixed opposite to the mandrel, or else the mandrel carries the tap, and the nut to be sciewed is grasped opposite to it. In the machine invented by Mr Roberts the mandrel does not traverse, it carries the bolt, and the dies are mounted on a slide, or else the mandrel carries the nut, and the tap is fixed on the slide. The tap or die gives the traverse in every case, and the engine and strap supply the muscle, of course the means for changing the direction of motion and closing the dies, as in the hand process, are also essential *

Mr Roberts' screwing table is a useful modification of the bolt machine, intended to be used for small bolts, and to be worked by hand. The mandrel is replaced by a long spindle running, loosely in two bearings, the one end of the spindle terminates in a small wheel with a winch handle, the other in a pair of jaws closed by a screw, in other respects like fig. 85, p. 201 vol. I. The jaws embrace the head of the bolt, which is presented opposite to dies that are fixed in a vertical frame or stock, and closed by a loaded lever to one fixed distance. In tapping the nut, it is fixed in the place before occupied by the dies and the spindle then used, is bored up to receive the shank of the tap, which is fixed by a side screw. This machine ensures the rect angular position of the several parts, and the power is applied by the direct rotation of a hand wheel

It will be gathered from the foregoing remarks, that the die stock is an instrument of most extensive use and it would indeed almost appear as if every available construction had been tried with a general tendency to foster the cutting and to expunge the surface friction or rubbing action by the excess of which latter the labour of work is greatly increased, and risk is incurred of stretching the thread

^{*} See Buchanan's Mill Work by Rennie 1841 Plates 38 to 38 c

In Wright's Patent Machine for making—wood screws—for joinery work—the traverse of the mandrel is assisted by a screw guide of the same degree of coarse ness as the fixed dies and the blanks are advanced to the latter through the hollow mandrel, at the end of which they are retained by nippers, until the machine has screwed the former and supplies a new blank—In a former machine the traversing mandrel and a fixed turning tool were used—the thread is cut from base to point whilst the screw is supported in a back stay—For other modifications—see Lardner's Cyclopedia Manufactures in metal—vol 1—pp 201—9

In the patent diestocks the cutting is so much facilitated that the labour is reduced perhaps to less than the hilf of that required with the old fashioned and nearly semicilcular dies, fig 578, but when the guidance is too far sacrificed, the greedy action of the dies is a source of mischief For instance the in strument, fig 589, with three dies moving simultaneously, has been superseded because of its risk of cutting irregular or drunken screws for if from the dies being improperly placed. the thread does not exactly meet, or lead into itself in the first revolution of the dies, but finds its way in with a break in the curve, this break continues unto the end, as the three points of bearing so to speak, being narrow, they may pursue the irregular line, thus giving to the diestock a rolling or "wabbling' motion instead of a steady quiet descent This fault is also liable to occur in every diestock, in which there is any risk of the blank cylinder not being placed truly axial, from the dies touching only by points or narrow edges, instead of against a fair proportion of the curve, but when the dies are moderately broad, there is more chance of the defect being afterwards corrected

Subsequently to the introduction, by Messrs Whitworth, of their sciew stock, shown in fig 589, they invented a diestock with four dies the one side of each of which was radial. The dies acted two at a time just like turning tools, they were quite free from rubbing and were simultaneously advanced by two wedges yoked together by a cross piece, and moved by one screw. This ingenious plan was not however regularly adopted, on account of the deficiency of the guiding power, as the screw was supported between four series of points but it gave rise to the mode explained in fig 590, in which the broad guide is judiciously introduced.

It is difficult, however, to decide fairly and impartially upon the respective merits of diestocks, many of which approach very nearly to one another, as whether the facility of cutting, or the truth of the screw or any other point be made the standard of comparison, it is a judgment which must necessarily be given rather by opinion than by measure, and the conditions which are aimed at in all screw stocks, are in strictness unattainable in any owing to the varying dimensions of the object to be produced

From many reasons, it appears needless to strain the application of the diestock to the production of long screws, which

require either a very precise total length or a very precise equality in their several parts. The main inconvenience results from unavoidably mixing the guiding and cutting in the same part of the one instrument, an instrument which acts by producing a series of copies, of the few threads in the dies, and which copies become collectively the long screw. This mode of proceeding is equally as impolitic as setting out a line of 50 or 100 inches long with a little rule measuring only one or two inches

Neither can it be desirable to cut long and consequently slender screws, by an instrument used as a double ended lever, in the application of which the screw supported generally at the one end in the vice is very liable to be bent, as any small disturbing force at the end of the stock is multipled in the same proportion as the difference between the radii of the work and instrument. The liability to bend the screw is reduced to the minimum, in Mr. Allan's simple apparatus, (p. 582) for cutting the screws for dividing engines and other superior works but which mode is not adapted to ordinary screws, the machines for screwing bolts entail also little risk of bending the screw

On the whole it appears questionable whether for short screws, which are the legitimate works of the diestock, some of the better forms of the two part dies are not as good as any, and on the other hand it appears quite certain that for those screws in which particular accuracy is of real importance, that the screw cutting engine or turning lathe is beyond comparison more proper. This valuable engine will be soon referred to and in it the distinct processes of guiding and of cutting are completely detached and each may independently receive the most favourable conditions, whereas in all the modifications of the screw stock they are more or les intimately commingled, and are to a certain degree antagonists.

The screw cutting lathe has also the advantage that one good screw having been obtained as a guide its iclutive degree of perfection is directly imparted to the work, and it may be employed for cutting very course or very fine screws, or in fact any of the valuous kinds referred to in the preliminary description *

^{*} Some remarks will be offered in the last section, on the proportions and forms of screws of a variety of kinds

SECT V -ON SCREWS CUT BY HAND IN THE COMMON LATHI

Great numbers of sciews are required in worls of wood ivory and metal that cannot be cut with the taps and dies or the other apparatus hitherto considered. This arises from the nature of the materials the weakness of the forms of the objects, and the accidental proportions of the sciews many of which are comparatively of very large diameter and inconsiderable length. These and other circumstances, conspire to prevent the use of the diestocks for objects such as the screws of telescopes and other slender tubes, those on the edges of disks, rings, boxes, and very many similar works.

Sciews of this litter class are frequently cut in the lathe with the ordinary sciew tool and by dexterity of hand alone—there is little to be said in explanation of the apparatus and tools, which then consist solely of the lathe with an ordinary mindrel incapable of traversing endways and the screw tools or the chasing tools figs 404 and 405, page 519 with the addition of the aim rest, the details of the manipulation will be found in the practical section

The screw tool held at rest would make a series of rings because at the end of the first revolution of the object the points A B C of the tool would full exactly into the scratches A B C commenced respectively by them. But if in its first revolution, the tool is shifted exactly the space between two of its teeth, at the end of the revolution, the point B of the tool, drops into the groove made by the point A, and so with all the others, and a true screw is formed, or a continuous helical line, which appears in steady lateral motion during the revolution of the screw in the lathe

It is likely the tool will fail exactly to drop into the groove, but if the difference be inconsiderable, a tolerably good screw is nevertheless formed, as the tool being moved forward as equally as the hand will allow, corrects most of the error. But if the difference be great, the tool finds its way into the groove with an abrupt break in the curve, and during the revolution of the screw as it progresses it also appears to roll about sideways, instead of being quiescent, and is said by workman to be "drunk" this error is frequently beyond correction

It sometimes happens that the tool is moved too rapidly, and

that the point C drops into the groove commenced by A in this case the coarseness of the groove is the same as that of the tool, but the inclination is double that intended and the screw has a double thread, or two distinct helices instead of one the tool may pass over three or four intervals and make a treble or quadruple thread, but these are the results of design and skill, rather than of accident

On the other hand, from being moved too slowly the point B of the tool may fail to proceed so far as the groove made by A, but fall midway between A and B, in this case the screw has half the rise or inclination intended and the grooves are as fine again as the tool other accidental results may also occur which it is unnecessary to notice

The assemblage of points in the screw tools proper for the hard woods, ivory and metals, iender the striking of screws in these materials comparatively certain and excellent, that is as regards those individuals who devote sufficient pains to the acquisition of the manipulation, but the soft woods require tools with very keen edges of 20 to 30 degrees, and for these materials the screw tool is made with only a single point as represented in figs 377 and 378, page 516. With such a tool no skill will suffice to cut a good useful screw by hand alone, as the guiding and correctional power of the many points no longer exists, and in consequence those screws in soft wood which are cut in the lathe require the guidance to be given mechanically in the manner explained in the following section *


SECT VI --- ON CUTTING SCREWS IN LATHES WITH TRAVERSING MANDRELS

One of the oldest, most simple, and general apparatus for cutting short sciews in the lather by means of a mechanical guidance, is the *screw* mandrel or *traversing* mandrel which

^{*} The twisted moulds for upholsterers fringes are frequently screwed by hand a thin gouge or a carpenters fluted bit of the width of the groove is ground very obliquely from the lower side so as to leave two long edges or fangs projecting and the tool is sharpened from within. An oblique notch is made by hand at the end of the mould as a commencement and the tool wedging into the groove is guided along the rest at the same angle as the notch whilst the lather revolves slowly and completes the twist at one cut. To make the second groove parallel with the first the finger is placed beside the gouge and within the first twist, and so on with the others. The process is very pleasing from its rapidity and simplicity and is also sufficiently accurate for the end proposed.

appears to have been known, almost as soon as the iron mandrel itself was introduced

Fig 592 is copied from an old French mandrel mounted in a wooden frame and with tin collars cast in two parts, the upper halves of the collars are removed to show the cylindrical necks of the mandrel, upon the shaft of which are cut several shortscrews. In ordinary turning the retaining key k which is shown detached in the view k, prevents the mandrel from traversing, as its angular and circular ridge enters the groove in the mandrel, but although not represented, each thread on the mandrel is

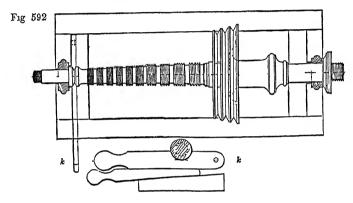

provided with a similar key, except that their cicular arcs are screw form instead of angular. In screw cutting, k is depressed to leave the mandrel at liberty—the mandrel is advanced slightly forward, and one of the screw keys is elevated by its wedge until it becomes engaged with its corresponding guide screw, and now as the mandrel revolves—it also advances or retires in the exact path of the screw selected

The modern screw mandrel lathe has a cast iron frame, and hardened steel collars which are not divided, the guide screws are fitted as rings to the extreme end of the hardened steel mandrel and they work in a plate of brass, which has six scollops, or semicircular screws upon its edge. When this mandrel is used for plain turning, its traverse is prevented by a cap which extends over the portion of the mandrel protruding through the collars *

^{*} For further details of the construction of the old screw mandrel lathes the reader is referred to Moxon, Plumier, Leupold, &c The durability of the modern

In cutting screws with either the old or modern screw man drel, the work is chucked and the tool is applied exactly in the manner of turning a plain object—but the mandrel requires an alternating motion backwards and forwards somewhat short of the length of the guide screw, this is effected by giving a swinging motion or partial revolution to the foot wheel—The tool should retain its place with great steadiness and it is there fore often fixed in the sliding rest, by which also it is then advanced to the axis of the work with the progress of the external screw, or by which it is also removed from the center in cutting an internal screw

To cut a screw exceeding the length of traverse of the mandrel, the screw tool is first applied at the end of the work, and when as much has been cut as the traverse will admit, the tool is shifted the space of a few threads to the left and a further portion is cut, and this change of the tool is repeated until the screw attains the full length required. When the tool is applied by hand, it readily assumes its true position in the threads—when it is fixed in the slide rest its adjustment requires much care

In sciewing an object which is too long to be attached to the mandrel by the chuck alone, its opposite extremity is sometimes supported by the front center or popit head but the center point must then be pressed up by a spring, that it may yield to the advance of the mandrel—this method will only serve for very slight works as the pressure of the screw tool is apt to thrust the work out of the center—It is a much stronger and more usual plan—to make the extremity or some more convenient part of the worl cylindrical, and to support that part within a stationary cylindrical bearing, or collar plate, which retains the position of the work notwithstanding its helical motion and supplies the needful resistance against the tool.*

hardened steel collars when duly proportioned and well fitted is most remarkable In illustration it may be mentioned that Holtzapffel and Co have been in the practice of making this class of lathe for 80 years and yet it is very rare for them to meet with a sciew mandrel lathe of their manufacture, in which the wear has been sufficient to require the renewal of the collars

^{*} In cutting the screws upon the ends of glass smelling bottles and similar works incapable of being cut with steel tools the bottle is mounted on a traversing mandrel which is moved slowly by hand and the cutting tool is a metal disk revolving rapidly on fixed centers and hiving an angular edge fed with emery and water in some rare cases a diamonl is used as the cutting tool

The amateur who experiences difficulty in cutting screws flying or with the common mandrel and hand tool unassistedly will find the screwmandrel an apparatus by far the most generally convenient for those works in wood ivory, and metal turning to which the sciew box and the taps and dies are mapplicable. For the sciew mandrel requires but a very small change of apparatus and whatever may be the diameter of the work it ensures perfect copies of the guide screws the half dozen varieties of which will be found to present abundant choice as to coarseness in respect to the ordinary purposes of turning

SECT VII —ON CUTTING SCREWS IN LATHES WITH TRAVERSING TOOLS

A great number of the engines for cutting screws, and also of the other shaping and cutting engines now commonly used, are clearly to be traced to a remote date, so far as their principles are concerned


For instance, the germs of many of these cutting machines in which the principles are well developed, will be found in the primitive rose engine machinery with coarse wooden frames, and arms shaper plates coads, pulleys, and weights described in the earliest works on the lather and referred to in pages 4 to 8 of Vol I whilst many others are as distinctly but more carefully modelled in metal in the tools used in clock and watch making, many of which have also been published

The principles of these machines being generally few and simple admit of but little change, but the structures, which are most diversified nay almost endless, have followed the degrees of excellence of the constructive arts at the periods at which they have been severally made, combined with the inventive talent of their projectors

In most of the screw cutting machines a previously formed screw is employed to give the traverse, such are copying machines, and will form the subject of the present section, and a few other engines serve to originate screws, by the direct employ ment of an inclined plane, or the composition of a rectilinear and a circular motion—the notice of this kind of screw machinery will be deferred until the next section

The carliest screw lathe known to the author, bears the date of 1569, and this curious machine, which is represented in

fig 593, is thus described by its inventor Besson "Fspece de Tour en nulle part encore veue et qui n'est sans subtilité, pour engraver petit à petit la Vis à l'entour de toute Figure ronde et solide, voire mesmes ovale" *

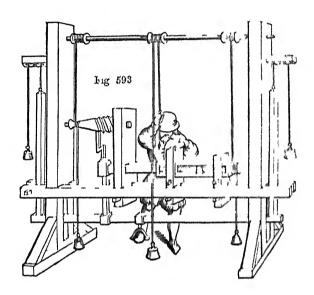


The tool is traversed alongside the work by means of a guide screw, which is moved simultaneously with the work to be operated upon, by an arrangement of pulleys and cords too obvious to require explanation. It is however worthy of remark, that bad and imperfect as the constructive arrangement is this early machine is capable of cutting screws of any pitch, by the use of pulleys of different diameters, and right and left hand screws at pleasure by crossing or uncrossing the cord, and also that in this first machine the inventor was aware that a screw cutting lather might be used upon elliptical, coincal, and other solids.

The next illustration, fig. 594, represents a machine described as 'A Lathe in which without the common art, all sorts of screws and other curved lines can be made." this was invented by

^{*} The figure is copied half size from plate 9 of the work intitled ' Ins Instruments Mathématiques et Méchanques, de Invent'es par Jaques Resson First Latin and French I dit fol 1569 Second Edit I yous, 1578 also a Latin I lit I yous 1582 The same copper plates are used throughout

M Grandjean pilor to 1729* The constructive details of this machine, which are also sufficiently apparent, are in some respects superior to those in Besson's, but the two are alike open to the imperfection due to the transmissions of motion by cords and Grandjean's is additionally imperfect, as the scheme represented will fail to produce an equable traverse of the

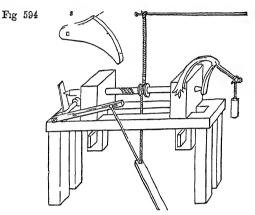


mandiel compared with its revolution, owing to the continual change in the angular relations between the arms of the bent lever, and the mandrel and cord respectively. Sometimes the spiral board or templet s, is attached to the bent lever, to act upon the end of the mandiel, this also is insufficient to produce a true screw in the manner proposed.

Several of the engines for cutting screws appear to be derived from those used for cutting fusees, or the short screws of hyper bolical section, upon which the chains of clocks and watches are wound, in order to counteract the unequal strength of the different coils of the spiral springs. The fusee engines, which are very numerous, have in general a guide screw from which the traverse of the tool is derived, and the illustration fig. 595, selected from an old work published in 1741, is not only one of the earliest but also of the most exact of this kind, and it exhibits likewise the primitive application of change wheels, for producing screws of varied coarseness from one original

^{*} Communicated to the Académie Royale in 1799 and printed in the Machines approuvées tome v 1735. As a matter of arrangement, this figure belongs to Sect VI but as a specimen of early mechanism its present place seems more appropriate.

This instrument is nearly thus described by Throut "A lathe which carries at its extremity two toothed wheels—the upper is attached to the arbor, the clamp at the end of which holds the axis of the fusee to be cut, the opposite extremity is retrined by the center, the fusee and arbor constitute one piece, and nie turned by the winch handle—The lower wheel is put in movement by the upper—and turns the screw which is fixed in its center—the nut can traverse the entire length of the screw, and to the nut is strongly hinged the lever that holds the graver or cutter, and which is pressed up by the hand of the workman—Several pairs of wheels are required and the smaller the size of that upon the mandrel, the less is the interval between the threads of the fusee—*

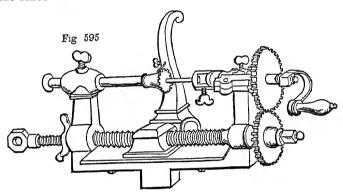

In the general construction of the fusee engine, the guide screw and the fusee are connected together on one axis, and are moved by the same winch handle—the degree of fineness of the thread on the fusee is then determined by the intervention of a lever generally of the first order, a great variety of constructions have been made on this principle; the mode of action will be more clearly seen in the next figure, wherein precisely the same movements are applied to the lathe for the purpose of cutting ordinary screws

The apparatus now referred to is that invented by Mr Healey

^{*} Thront's Tranté d'Horlogérie Michanique et Pratique, &c. 4to, Paris 1711 vol 1 page 69 plate 27 The name of the inventor is not given


[†] Three are described in Throut's Treatise namely in plates 25 26 and 27 the first by Regnaud de Chaalon Other examples will be found in Rees's Cyclo pedia Article Fu ee Plates Horology 36 and 37

of Dublin an amateur * it is universal, or capable within certain limits of cutting all kinds of sciews either right or left handed and is represented in plan in fig 596 in which C is the chuck which carries the work to be screwed, and t is the tool which lies upon r r' the lathe rest, that is placed at right angles to the bearer, and is always free to move in its socket s, as on a center, because the binding screw is either loosened or removed

On the outside of the chuck C is cut a coarse guide screw, which we will suppose to be right hinded. The nut n, which fits the sciew of the chuck, is extended into a long him, and the latter communicates with the lathe rest by the connecting hod c c As the lathe revolves backwards and forwards the aim n (which is retained horizontally by a guide pin g),

travelses to and fio as regards the chuck and work, and causes the lathe rest r r' to oscillate in its socket s. The distance s t being half s t a right hand screw of half the coarseness of the guide will be cut, or the tool being nearer to and on the other side of, the center s as in the dotted position t', a finer and left hand screw will be cut

The rod c c may be attached in differently to any part of n n, but the smallest change of the relation of s t to s r, would mar

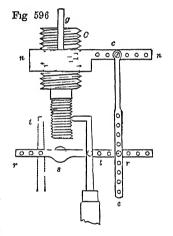


the correspondence of screws cut at different periods, and there for t and r should be united by a swivel joint capable of being fixed at any part of the latherest r, which is omitted in Mr Healey's perspective drawing of the apparatus

This is one of the least perfect of the modes of originating screws, it should therefore be only applied to such as are very short, as owing to the variation in the angular relation of the parts the motion given to the tool is not strictly constant or equable, when in the midway position, the several parts should lie exactly at right angles to each other, in order, as fur as possible, to avoid the error. The inequality of the screw is

imperceptible in the short fusee, and it would be there harmless even if more considerable, but a perfect equality of coarseness or of angle, is imperative in longer sciews, and those to be fitted one to the other a condition uncalled for in the fusee, which has only to carry a chain

The apparatus invented by the late Mr S Varley and represented in plan in figs 597 and 598, although it does not present the universality of the last, is quite correct in its action and fair more available, it is evidently a combination of the fixed mandrel, and the old screw mandrel, fig 592, p 613. Four different threads are cut on the tube which surrounds the mandrel, and the connection between the guide screw and the work, is by the long bar b b, which carries at the one end a piece g filed to correspond with the thread, and at the other, a socket in which is fixed a screw tool t, corresponding with the guide at the time employed

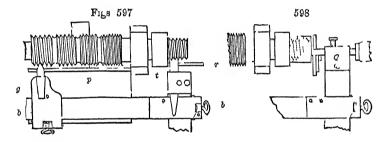

The lathe revolves with continuous motion, and the long but or rod being held by the two hands in the position shown, the guide g, and the tool t, are traversed simultaneously to the left by the screw guide, and when the tool meets the shoulder of the work, both hands are suddenly withdrawn, and the bar is shifted to the right for a repetition of the cut and so on until the completion of the screw. The guide g, is supported upon the horizontal plate p, which is parallel with the mandrel, and the tool t, hes upon the lathe rest τ

Beneath the tool is a sciew which rubs against the lathe rest τ , and serves as a stop, this makes the sciew cylindrical or conical, according as the rest is placed parallel or oblique. For the internal sciew, the tool is placed parallel with the bar, as in fig. 598, and the check sciew is applied on the side towards the center, against a short bar, parallel with the axis of the lather

621

As in the screw mandiel lathes, the sciews become exact copies of the screw guides and to a certain extent the mechanism fulfils the office of the slide rest but at the same time, more trouble is required for the adjustment of the apparatus. In general the guide rod must be supposed to act somewhat as an incumbrance to the free use of the tool, which is applied in a less favourable manner when the sciew is small compared with the exterior diameter of the work, as it must then project considerably from the bar so that on the whole the traversing mandrel is a far more available and convenient arrangement *


None of the machines which have been hitherto described are proper for cutting the accurate screws, of considerable length or of great diameter, required in the ordinary works of the engineer, but these are admirably produced by the screw cutting lathes, in which the traverse of the tool is effected by a long guide screw, connected with the mandrel that carries the work by a system of change wheels, after the manner employed a contury back, as in fig 595. The accuracy of the result now depends almost enturely upon the perfection of the guide screw, and which we will suppose to possess very exactly 2-4, 5-6, or some whole number of threads in every inch although we shall for the present pass by the methods employed in producing the original guide screw which thus serves for the reproduction of those made through its agency

The smaller and most simple application of the system of change wheels for producing sciews, is shown in fig 599. The work is attrached to the mandrel of the lathe by means of a chuck to which is also affixed a toothed wheel marked M, therefore the mandrel, the wheel, and the work partake of one motion in common the tool is carried by the slide rest, the principal slide of which is placed parallel with the axis of the lathe as in turning a cylinder, and upon the end of the sciew near the mandrel, is attached a tooth wheel S, which is made to engage in M the wheel carried by the mandrel

As the wheels are supposed to contain the same number of teeth they will revolve in equal times or make continually turn for turn, and therefore in each revolution of the mandrel and

^{*} The details of this apparatus will be found in the description of the same by Mr Cornelius Vailey, the nephew of the inventor in the frans Soc of Arts vol alm, p 90 1825

work, the tool will be shifted in a right line a quantity equal to one thread of the guide screw and so with every coil throughout its extent of motion. Consequently the motion of the two axes being always equal and continuous the screw upon the work will become an exact copy of the guide screw contained in the slide rest, that is, as regards the interval between its several threads its total length, and its general perfection

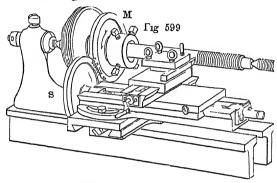


But the arrows in M and S, denote that adjoining wheels always travel in opposite directions, when therefore the mandrel and slide rest are connected by only one pair of wheels as in fig 599 the direction of the copy sciew is the reverse of that of the guide. The right hand screw being far more generally required in mechanism when the combination is limited to its most simple form, of two wheels only, it is requisite to make the slide rest screw left handed, in order that the one pair of wheels may produce right hand threads

But a right hand slide rest screw may be employed to produce at pleasure both right and left hand copies by the introduction of either one or two wheels, between the exterior wheels M and S fig 599. Thus one intermediate axis, to be called I, would produce a right hand thread and so on alternately and this mode in addition allows the wheels M and S to be placed at my distance asunder that circumstances may require

In making double thread screws the one thread is first cut, the wheels are then removed out of contact and the mandrel is moved exactly half a turn before their replacement, the second thread is then made. In treble threads the mandrel is twice discinginged, and moved one third of a turn each time, and so on

When intermediate wheels are employed, it becomes necessary to build up from the bearers some description of pedestal, or from the lathe head some kind of bracket, which may serve to carry the axes or sockets upon which the intermediate wheels revolve. These parts have received a great variety of modifications, three of which are introduced in the diagrams 600 to 602, the wheels supposed to be upon the mandrel are situated on the dotted line M M, and those upon the slide rest on the line S S

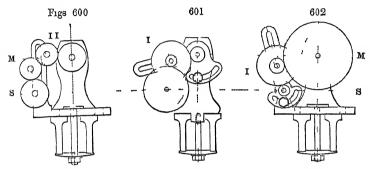

The rectangular bracket in fig 600, has two straight mortises; by the one it is bolted to the bearers of the lathe and by the other it carries a pair of wheels, whose pivots are in a short picce, which may be fixed at any height or angle in the mortise, so that one or both wheels I I, may be used according to circumstances. In fig 602, the intermediate wheel, or wheels, are carried by a radial arm which circulates around the mandrel, and is fixed to the lathe head by a bolt passed through the circular mortise. In fig 602 a similar radial arm is adjustible around the axis of the slide rest sciew, in the fixed bracket


Sometimes the wheel supposed to be attached to the sliderest, is carried by the pedestal or arm, fixed to the bed or headstock of the lathe, in order that a shaft or spindle may proceed from the wheel S, and be coupled to the end of the slide lest sciew, by a hollow square or other form of socket so as to enable the rest to be placed at any part of the length of the bearer and permit a sciew to be cut upon the end of a long rod *

^{*} The shaft sometimes terminates at each end in universal joints in order to accommodate any trifling wint of parallelism in the parts of however the central shaft be placed unequally oblique the motion transmitted ceases to be uniform or it is accelerated and retaided in every revolution which is fatal in screw cutting

This change in the position of the slide rest is also needful in cutting a screw which exceeds the length the rest can travelse, as suchlong screws may then be made at two of more distinct operations, before commencing the second trip the tool is adjusted to drop very accurately into the termination of that portion of the screw cut in the first trip, which requires very great care, in order that no falsity of measurement may be discernible at the parts where the separate courses of the tool have met. This method of proceeding, has however from necessity, been followed in producing some of the earliest of the long regulating screws, which have served for the production of others by a method much less hable to accident, namely, when the cut is made uninterruptedly throughout the extent of the work

In the larger application of the system of change wheels the entire bed of the lathe is converted into a long slide test the tool carriage, with its subsidiary slides for adjusting the position of the tool, then traverses directly upon the bed, this mode has given rise to the name "traversing or slide lathe," a machine which has received and continues to receive a variety of forms in the hands of different engineers. It would be tedious and unnecessary to attempt the notice of their different constructions, which necessarily much resemble each other, more especially as the principles and motives, which induce the several constructions and practices, rather than the precise details of apparatus, are here under consideration

The arrangement for the change wheels of a screw cutting lathe given in fig 603, resembles the mode frequently adopted

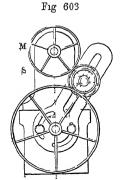

The guide screw extends through the middle of the bed and projects at the end there is a clasp nut, so that when required, the slide rest may be detached from the screw and moved independently of the same. The train of wheels is placed at the left extremity of the lathe, there is a ridial arm which circulates around the end of the main screw, the aim has one or two straight mortises, in which are fixed the axes of the intermediate wheels, and there are two circular mortises, by

which the arm may be secured to the lathe bed, in any required position by its two binding screws

On comparing the relative facilities for cutting screws, either with the slide rest furnished with a train of wheels or with the traversing or screw cutting lathe, the advantage will be found greatly in favour of the latter for instance

With the slide-iest airangement fig 599, the work must be always fixed in a chuck to which the first of the change wheels can be also attached, the wheels frequently prevent the most favourable position of the slides from being adopted and in cutting hollow screws the change wheels entirely prevent the tool carriage of the slide-rest from being placed opposite to the center, and therefore awkward tools, bent to the rectangular form, must be then used The slide rest also requires frequent attention to its parallelism with the axis of the lathe, or the screws cut will be conical instead of cylindrical

With the travelsing lathe, from the wheels being at the back of the mandiel, no interference can possibly alise from them, and consequently the work may be chucked indiscriminately on any of the chucks of the lithe, every position may be given to the slide carrying the tool and therefore the most favourable, or that nearest to the work, may be always selected, and the tools need not be crooked. As the tool carriage travelses at once on the bearers of the lithe the adjustment for parallelism is always true and the length of travelse is greatly extended

The system of screw cutting just explained is very general and practical for instance one long and perfect guide screw (which we will call the guide) containing 2, 4, 6, 8, 10, or any precise number of threads per inch having been obtained, it becomes very easy to make from it subsequent screws (or copies), which shall be respectively coarser and finer in any determined degree. The principle is, that whilst the copy makes one revolution, the guide must make so much of one revolution, or so many, as shall traverse the tool the space required between each thread of the copy and this is accomplished by selecting change wheels in the proportions of these quantities of motion, or, in other words, in the proportion required to exist between the guide screw and the copy

In explanation, we will suppose the guide to have 6 threads

per inch, and that copies of 18 14, 12\frac{1}{2} 8, 3, 2, 1 threads per inch, are required the two wheels must be respectively in the proportions of the fractions $\frac{6}{18}$ $\frac{6}{14}$ $\frac{6}{12}$ $\frac{6}{3}$ $\frac{6}{3}$ $\frac{6}{3}$ $\frac{6}{3}$ $\frac{6}{1}$ the guide being constantly the numerator. The numerator also represents the wheel on the mandrel, and the denominator that on the guide screw any multiples of these fractions may be selected for the change wheels to be employed

For example, any multiples of $\frac{c}{18}$ as $\frac{1}{36}$ $\frac{18}{54}$, $\frac{2}{7}$ &c, will produce a screw of 18 threads per inch the first and finest of the group, and any multiples of $\frac{c}{1}$ as $\frac{0}{16}$ $\frac{180}{20}$, &c will produce a screw of 1 thread per inch, which is the last and coarsest of those given

Screws 2, 4 or 6 times as fine will result from interposing a second pair of wheels, respectively multiples of $\frac{1}{2}$, $\frac{1}{4}$, $\frac{1}{6}$, and placed upon one axis

For instance the pair of wheels $\frac{2}{7}\frac{4}{2}$ used for producing a sciew of 18 threads per inch, would, by the combination A, produce a copy three times as *fine*, or a sciew of 54 threads per inch *

And the wheels $\frac{120}{20}$, used for the screw of one thread per inch, would by the combination B, produce a copy thice times as coarse, or of three inches rise. Whatsoever the value of the intermediate wheels, whether multiples of $\frac{2}{4}$, $\frac{7}{8}$, the pitches of those screws which would be otherwise obtained by the two exterior wheels alone and in this manner a great variety of screws, extending over a wide range of pitch, may be obtained from a limited number of wheels

For instance the apparatus Holtzapffel & Co have recently added to the slide rest after the manner of figs 599 and 601, has a series of about fifteen wheels, of from 15 to 114 teeth, employed with a screw of 10 threads per inch, several hundred varieties of screws may be produced by this apparatus the finest of which has 320 threads per inch, the coasest measures 7½ inches in

^{*} Fig 601 represents the which referred to in combination A and fig 602, those in combination B

each coil or rise and the screws may be made right or left handed, double triple, quadruple, or of any number of threads. The finest combinations are only useful for self acting turning, those of medium coarseness serve for all the ordinary purposes of screws, whilst the very coarse pitches are much employed in ornamental works of the character of the Elizabethan twist and in cutting these coarse screws the motion is given to the slide rest screw and by it communicated to the mandiel

The value of any combination of wheels may be calculated as vulgar fractions by multiplying together all the driving wheels as numerators, and all the driven wheels as denominators, adding also the fractional value, or pitch, of the guide screw, thus in the first example A

The fraction denotes that $\frac{1}{54}$ of an inch is the *pitch of the screw* or the interval from thread to thread, also that it has 54 threads in each inch, and which is called the late of the screw

And in C the numbers in which example were selected at random the screw would be found to possess rather more than 32 threads per inch *

In initiation of the method of change wheels, the slide rest sciew is sometimes moved by an arrangement of catgut bands, resembling that represented in Besson's sciew lathe, page 616

One band proceeds from the pulley on the mandrel to a spindle overhead having two pulleys, and a second cord descends from this spindle to a pulley on the slide rest! The method offers

^{*} The fractions should be reduced to their lowest terms before calculation to avoid the necessity for multiplying such high numbers. Thus the first example would become reduced to $\frac{1}{3} \times \frac{1}{3} = \frac{1}{5}$, and would be multiplied by inspection if the numerators and denominators may be taken crossways if more convenient thus as equal to $\frac{1}{3}$ and $\frac{1}{6}$ is also equal to $\frac{1}{3}$ fractions which are smaller than and the lowest terms respectively of $\frac{1}{6}$ and the second case could not be thus treated and the whole numbers must there be multiplied as they will not admit of reduction. Other details will be advanced and tables of the combinations of the change wheels will be also given in treating of the practice of cutting sciews

⁺ This apparatus has been applied to cutting the expanding horn snikes. See Manuel du Iournem inst edit 1796 vol n plate 21 and second edit 1816 vol n plate 16 see also page 124-5 of the inst volume of this work.

facility in cutting screws of various pitches by changing the pulleys, and also either right or left hand screws, by crossing or uncrossing one of the bands

The plan is unexceptionable, when applied for traversing the tool slowly for the purpose of turning smooth cylinders or surfaces (which is viitually cutting a sciew or spiral of about 100 coils in the inch) and in the absence of better means, pulleys and bands are sometimes used in matching sciews of unknown or irregular pitches, by the tedious method of repeated trials, as on slightly reducing with the turning tool, the diameter of either of the driving pulleys, the screw or the work becomes gradually finer and reducing either of the driven pulleys makes it coarser but the mode is scarcely trustworthy, and is decidedly far inferior to its descendant, or the method of change wheels

The screw tools, or chasing tools, employed in the traversing littles for cutting external and internal screws resemble the fixed tools generally except as regards their cutting edges, the following figures 604 to 606 refer to angular threads, and 607 and 608 to square threads

Angular sciews are sometimes cut with the single point fig 604, a form which is easily and correctly made, the general angle of the point is about 55° to 60°, and when it is only allowed to cut on one of its sides or bevils, it may be used fear lessly as the shavings easily cuil out of the way and escape But when both sides of the single point tool are allowed to cut it requires very much more crutious management, as in the latter case, the duplex shavings being disposed to cuil over opposite whys they pucker up is an angular film, and in fine threads they are hable to break the point of the tool, or to cause it to dig into and ten the work. Sometimes also, a fragment of the shaving is wedged so forcibly into the screw by the end of the tool, that it can only be extricated by a sharp chisel and hammer

In cutting angular screws, it is very much more usual and expeditious to employ screw tools with many points, which are made in the lathe by means of a revolving cutter or hob, figs 550 and 551 page 591. Screw tools with many points, are always required for those angular threads which are rounded

at the top and bottom, and which are thence called rounded or round threads *

Mr Clement gives to the screw tool for rounded threads the profile of fig 605, which construction allows the tool to be inverted so that the edges may be alternately used for the pur pose of equalizing the section of the thread. In making the tool 605, the hob (which is dotted) is put between centers in the traversing lathe, and those wheels are applied which would serve to cut a screw of the same pitch as the hob—the bar of steel is then fixed in the slide rest, so that the dotted line or the axis of the tool intersects the center of the hob—The tool is afterwards hollowed on both sides with the file, to facilitate the sharpening, and it is then hardened. In using the tool, it is depressed until either edge comes down to the radius proceeding from the (black) circle which is supposed to represent the screw to be cut, the depression gives the required penetration to the upper angle, and removes the lower out of contact †

Mi Bodmer's patent chasing tool is represented in fig 606 the cutter, c, is made as a ring of steel which is sciewed internally to the diameter of the bolt and turned externally with an undercut groove, for the small sciew and nut by which it is held in an iron stock, s, formed of a corresponding sweep, for distinctness the cutter and screw are also shown detached. The center of curvature of the tool is placed a little below the center of the lathe, to give the angle of separation or penetration, and after the tool has been ground away in the act of being sharpened, it is raised up, until its points touch a straight edge applied on the line a a of the stock, this denotes the proper height of center, and also the angle to which the tool is intended to be hooked, namely 10 degrees—each ring makes


^{*} Mr Clement considers the many points to act with less risk than the single point because in the processes of hirdening first the hob and then the screw tool they both become slightly enlarged or a little coarser than the pitch of the screw consequently part of the teeth cut on one side and part on the other but none of them on both sides of the points which latter action gives rise to confusion by interrupting the free escape of the shivings

[†] In maling a hob with rounded threads it is usual to prove whether the top and bottom of the thread are equally rounded by driving two different pieces of lead into the hob with a hammer the two impressions will only fit together so as to exclude the light when the departure from the simple angle is alike at the top and bottom of the hob and that the thread is perpendicular or does not lean. Muster tips are similarly proved

four or five cutters, and one stock may be used for several diameters of threads

Angular thread sciews are fitted to their corresponding nuts simply by reduction in diameter, but square thread sciews require attention both as to diameter and width of groove, and are consequently more troublesome. Square thread sciews are, in general, of twice the pitch, or double the obliquity of angular sciews of the same diameters, and, consequently the interference of angle before explained as concerning the die stocks refers with a twofold effect to square threads, which are in all respects much better produced in the sciew cutting lithe

The ordinary tool for square thread screws is represented in three views in fig 607, the shaft is shouldered down so as to terminate in a rectangular part which is exactly equal to the width of the groove, in general the end, done of the tool is

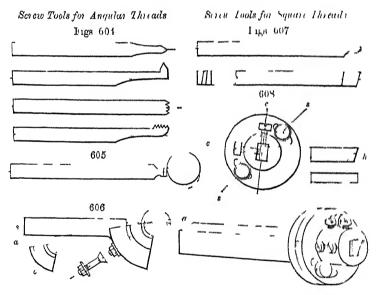

required to cut, and the sides are beyilled according to the angle of the sciew, to avoid rubbing against the sides of the thread. Tools which cut upon the side alone, are also occasionally used for adjusting the width of the groove. In either case it requires considerable care to maintain the exact width and height of the tool, the inclination of which should also differ for every change of diameter.

To obviate these sever il inconveniences the author several years back contrived a tool holder, fig 608, for carrying small blades made exactly rectangular. In height, as at h, the blades are alike, in width, w, they are exactly half the pitch of the threads and they are ground upon the ends alone. The parallel blades are clamped in the rectangular aperture of the tool socket by the four sciences c c and when the sciences s s, which pass through the circular mortises in the sockets, are loosened, the swivel joint and graduations allow the blades to be placed at the particular angle of the thread, which is readily obtained by calculation, and is estimated for the medium depth of the thread or midway between the extreme angles at the top and bottom *

One blade, therefore, serves perfectly for all screws of the same pitch both right and left handed, and of all diameters, as the tool exactly fills the groove, it works steadily, and the width of the groove and the height of center of the tool are also strictly maintained with the least possible trouble. The depth of the groove, which is generally one sixth more than its width, is read off with great facility by means of the adjusting screw of the slide rest, especially if, as usual the screw and its micrometer agree with the decimal division of the inch

The holder, fig 608 has been much and satisfactorily used for screws from about 20 to 2 threads per inch, but when the screw is coarse and oblique compared with its diameter the blade is ground away to the dotted line in h, and is sometimes bevilled on the sides almost to the upper edge, to suit the obliquity of the thread, but without altering the extreme width of the tool

The tools for external screws of very coarse pitch, are neces sarily formed in the lathe by aid of the corresponding wheels and a revolving cutter bar resembling fig 515, p 569. The soft tool is fixed in the slide rest, and is thereby carried against the revolving cutter bar, 515, which has a straight tool, either pointed or square as the case may be. The end of the screw tool is thus shaped as part of an internal screw the counterpart of that to be cut, the fixe of the screw tool is filed at right angles to the obliquity of the thread, and the end and sides are slightly bevilled for penetration, previously to its being hardened

Internal square threads of small size, are usually cut with

^{*} For the mode of calculating the angles of screws see foot note p 657

taps which resemble fig 548 p 587, except in the form of the teeth. When internal square threads are cut in the lathe, the tool assumes the ordinary form of a straight bar of steel, with a rectangular point standing off at right angles, in most respects like the common pointed tool for inside work

For very deep holes and for threads of very considerable obliquity cutter bars, such as fig 515 p 569, are used. The work and the temporary bearings of the bar, are all immoveably fixed for the time, and the bar advances through the bearings in virtue of its screw thread, or otherwise a plain bar, having a cutter only, and not being screwed may be mounted between centers in the screw lathe, and the work, fixed to the slide rest, may traverse parallel with the bar by aid of the change wheels. The cutter bar in some cases requires a ring to fill out the space between itself and the hole, to prevent vibration, and it is necessary to increase the radial distance of the cutter between each trip, by a set screw, or by slight blows of a hammer

Very oblique inside cutters are turned to their respective forms with a fixed tool in a manner the converse of that explained above and some peculiarities of management are required in using them, in order to obtain the under cut form of the internal thread,—but the consideration of which does not belong to this place


In cutting screws in the turning lathe the tool only cuts as it traverses in the one direction, therefore whilst the cuttor is moved backwards, or in the reverse direction, for the suc ceeding cut, it must be withdrawn from the work Sometimes the tool is traversed backwards by reversing the motion of the lathe, and in lathes driven by power, the back motion is frequently more rapid than the cutting motion, to expedite the process at other times the lathe is brought to jest the nut is opened as a hinge, so as to become disengued from the screw, and the slide test is traversed backwards by hand, or by a pinion move ment, and the nut is again closed on the screw, prior to the succeeding cut This mode answers perfectly for sciews of the same thread as the guide, and for those of 2, 4, 6, 8 times as coarse or as fine but for those of 21/4, 41/2, or any fractional times the value of the guide screw, the clasp nut cannot in general be employed advantageously

The progressive advance of the tool between each cut is commonly regulated by a circle of divisions of a micrometer on the slide restsciew, which should always correspond with the decimal division of the inch. The substance of the shaving may be pietty considerable after the first entry is made, but it should dwindle away to a very small quantity, towards the conclusion of the screw. To avoid the necessity for taxing the memory with the graduation at which the tool stood when it was withdrawn for the back stroke, the author has been in the habit of employing a micrometer exactly like that on the screw, which is set to the same graduation, and serves as a remembrancer, another method is to employ an aim or stop, which fits on the axis of the screw or handle with stiff friction, but nevertheless allows the tool to be shifted the two or three divisions required for each cut

In Mr Roberts's screw lathe, the nut of the slide screw instead of being a fixture is made with two tails as a fork, which embraces an eccentric spindle, by the half rotation of which spindle, the nut, together with the adjusting screw the slide and the tool, are shifted, as one mass a fixed distance to and from the center, between each cut so as first to withdraw and then to replace the tool. Whilst the tool is running back the screw is moved by its adjusting screw and divisions, the minute quantity to set in the tool for the succeeding cut, and the continual wear upon the adjusting screw, as well as the uncer

tainty of its being correctly moved to and fro by the individual, are each avoided

Sometimes, with the view of saving the time lost in running back two tools are used, so that the one may cut as the tool slide traverses towards the mandrel, the other in the contrary direction. Mr. Shands arrange ment for this purpose as applied to the sciewing of bolts in the lathe, is shown in fig. 609, f represents the

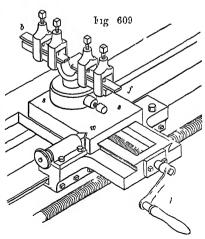

front, and b the back tool, which are mounted on the one slide 8%,

and all three are moved as one piece by the landle h which does not require any micrometer

In the first adjustment the wedge w, is thrust to the bottom of the corresponding angular notch in the slide s and the two tools are placed in contact with the cylinder to be sciewed. For the first cut, the wedge is slightly withdrawn to allow the tool f, to be advanced towards the work, and for the return stroke, the wedge is again shifted under the observation of its divisions, and the slide s s is brought forwards, towards the workman up to the wedge, this relieves the tool f and projects b, which is then in adjustment for the second cut, and so on alternately. The command of the two tools is accurately given by the wedge which is moved a small quantity by its sciew and micrometer between every alternation of the pair of tools, by the screw h

In cutting very long screws the same as in turning long cylindrical shafts, the object becomes so slender that the contrivance called a backstay, is always required for supporting the work in the immediate neighbourhood of the tool. The back stay is fixed to the slide plate or the saddle of the lathe which carries the tool, and is brought as near to the tool as possible, sometimes the dies or bearings are circular, and fit around the screw at other times they touch the same at two three, or four parts of the circle only. Some of the numerous forms of this indispensable guide or backstay, will be hereafter shown

In using the screw lathe with a backstay for long screws, it is a valuable and important method, just at the conclusion, to employ a pair of dies in the place usually occupied by the tool, as they are a satisfactory test for exact diameter, and they remove trifling errors attributable to veins and in egularities of the material, which the fixed tool sometimes fails entirely to reduce to the general surface. The tool and backstay may be each considered to be built on the tops of pedestals more or less lofty, and therefore more susceptible of separation by elasticity, than the pair of dies fixed in a small square frame. Six John Robison has judiciously proposed, in effect to link the backstay and turning tool together by the employment of a small frame carrying a semicircular die of lignum vitæ and a fixed turning

tool, adjusted by a pressure screw the frame to be applied either in the hand alone or in the slide rest, and to be inverted, so that the shavings may full away without elogging the cutter

SECT VIII —VARIOUS MODES OF ORIGINATING AND IMPROVING SCREWS, INCLUDING THOSE OF RAMSDLN, MAUDSLAY, BARFON, ALLAN, CLEMENT, AND OTHERS

The improvement of the screw has given rise to many viluable schemes and modes of practice which have not been noticed in the foregoing sections, notwithstanding their collective length. These practices, indeed, could not consistently have been placed in the former pages of this chapter because some of them must be viewed as refinements upon the general methods the earlier notice of which would have been premature and others exhibit various combinations of methods pursued by different eminent individuals with one common object and are therefore too important to be passed in silence, notwithstanding their miscellaneous nature.

To render this section sufficiently complete it appears needful to take a slight refrespective glance of the early and the modern modes of originating screws and screw apparatus—some account of the former may be found in the writings of Pappus, who lived in the fourth century *

The progressive stages which may be supposed to have been formerly in pictry general use for originating sciews, may be thus enumerated

- 1 The first screw tap may be supposed to have been made by the inclined templet, the file, and screw tool, it was imperfect in all respects and not truly helical but full of small irregularities
- 2 The dies formed by the above were considerably nearer to perfection, as the multitude of pointed edges of 1, being passed

^{*} The author has been told by a classical friend that in the works of Pappus Alexandrinus a Greek mathematician of the fourth century are to be found practical directions for making screws

The process is simply to make a templet of thin brass of the form of a right angled triangle the angles of which are made in accordance with the inclination of the proposed sciew. This triungle is then to be wrapped round the cylinder which is to be the desired sciew and a spiral line traced along its edge. The screw is subsequently to be excavated along this line. Minute practical directions are given not only for every step of this process but also for the division setting out and shaping the teeth of a worm wheel of any required number of teeth to suit the screw. (Vide Pappi Math. (i) lib viii prob. xviii)

through every groove of the die, the threads of the latter became more nearly equal in their rake or angle and also in their distances and form

- 3 The screw cut with such dies would much more resemble a true helix than 1 but from the irregularities in the first tap, the grooves in the die 2 would necessarily be wide, and their sides instead of meeting as a simple angle, would be more or less filled with ridges and 3 would become the exact counterpart of 2
- 4 A pointed tool applied in the lithe, would correct the form of the thread or groove in 3 without detracting from its improved cylindrical and helical character especially if the turning tool were gradually altered, from the slightly rounded to the acute form, in accordance with the progressive change of the sciew. The latter is occasionally changed end for end, either in the die stocks or in the lathe, to reverse the direction in which the tools meet the work, and which reversal tends to equalise the general form of the thread
- 5 The corrected screw 4, when converted into a master tap would make dies greatly superior to 2 it would also serve for cutting up screw tools, and lastly,
- 6 The dies 5 would be employed for making the ordinary screws and working taps, and this completes the one series of screwing apparatus


One original tap having been obtained, it is often made subservient to the production of others, for example a sciew tool, with several points cut over the conjected original 4 would serve for striking in the lather other master taps of the same thread but different drameters. The process is so much facilitated by the perfection of the screw tool, that a clever workman would thus without additional correction, strike master taps sufficiently accurate for cutting up other dies larger or smaller than 4. Sometimes also the dies 5 are used for marking out original taps a little larger or smaller than 4.

As a temporary expedient, the sciew tool may be somewhat spread at the forge fire to make a tool a little coarser, or it may be upset for one a little finer, and afterwards corrected with a file, or screw tools may be made entirely with the file, and then employed for producing, in the lathe, master taps of corresponding degrees of coarseness and of all diameters

These are in truth some of the progressive modes by which

under very careful management great numbers of good useful screwing apparatus have been produced and which answer per fectly well for all the ordinary requirements of "binding or attachment screws or as the cement by which the parts of mechanism and structures generally are firmly united together, but with the power of separation and reunion at pleasure

In this comparatively inferior class of sciews, considerable latitude of proportion may be allowed, and whether or not their pitches or rates have any exact relationship to the inch, is a matter of indifference as regards their individual usefulness but in superior screws, or those which may be denominated 'requlating and "micrometrical' screws, it does not alone suffice that the screw shall be good in general character, and as nearly as possible a true helix but it must also bear some defined proportion to the standard foot or inch, or other measure. The attainment of this condition has been attempted in various ways, to some of which a brief allusion was made in the second section, and a few descriptive particulars will now be offered

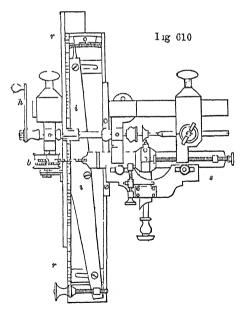

The apparatus for cutting original sciews by means of a wedge or inclined plane, appears to be derived from the old fusce engine, a drawing of which is given in fig. 610, in principle it is perfect, and it is also universal within the narrow limitation of its structure *

The handle h gives iotation to the work and at the same time by means of the lack rr and the pinion fixed on its axis, the handle traverses a slide which callies on its upper surface a bar \imath the latter moves on a center, and may be set at any inclination by the adjusting screw and divisions it is then fixed by its clamping screws. The slide \imath , carries the tool, and the end of this slide rests against the inclined plane \imath , through the intervention of a saddle or swing piece—the slide and tool are drawn to the left hand by the chain which is coiled round the barrel b, by means of a spiral spring contained within it

Supposing the bar it to stand square of it zero, no motion would be impressed on the tool during its triverse, which we will suppose to require 10 revolutions of the pinion. But if the bar were inclined to its utmost extent, so that we may suppose the one end to project exactly one inch beyond theother, in reference to the zero line or the pith of the slide, then during the 10 revolutions of the screw, the tool would traverse one inch, or the difference between the ends of the inclined bar i, and it would thereby cut a screw of the length of one inch, or the total inclination of the bar, and containing ten coils or threads

But the inclination of the bar is arbitiary, and may be any quantity less than one inch, and it may lean either to the right or left consequently the instrument may be employed in cutting all right or left hand screws, not exceeding 10 turns in length nor measuring in their total extent above one inch or the maximum inclination of the bar

The principle of this machine may be considered faultless but in action it will depend upon several niceties of construction, particularly the straightness of the slide and inclined but the equality of the rack and pinion and the exact contact between the tool slide and the inclined plane. These difficulties augment very rapidly with the increase of dimensions, and

^{*} The drawing is the half size of fig 1 plate xvii of Ferdinand Berthoud's Esan sun L Horlogenie Paris 1763 M Berthoud says. The instrument is the most perfect with which I am acquainted it is the invention of M le Lievre and it has been reconstructed and improved by M Gideon Duval. The templet or shaper plate determines the hyperbolical section of the fusee. Plate 37 of Rees's Cyclopedia contains an engraving of a different modification of the fusce engine also with an inclined plane which is ascubed to Hindley of York.

probably the machine made by Mr Adam Reid exclusively for cutting screws is as large as can be safely adopted the inclined plane is 44 inches long but the work cannot exceed $1\frac{6}{10}$ inch drim $2\frac{1}{4}$ inch long, or ten threads in total length. The application of the inclined plane to cutting screws is therefore too contracted for the ordinary wants of the engineer, which are now admirably supplied by the screw cutting lathes with guide screws and change wheels

The accuracy of screws has always been closely associated with the successful performance of engines for graduating circles and right lines, and the next examples will be extracted from the published accounts of the dividing engines made by Mr Ramsden*

* This eminent individual received a reward from the Board of Longitude upon the condition that he would furnish for the benefit of the public a full account of the methods of constructing and using his dividing machines and which duly appeared in the following tracts — Description of an Engine for dividing Mathe matical Instruments by Ramsden 4to 1777 Also Description of an Engine for Dividing Straight Lines by Ramsden 4to 1779, from which the following particulars are extracted —

The circular dividing engine consisted of a large wheel moved by a tangent screw the wheel was 45 inches diameter and had 2160 teeth so that six turns of the tangent screw moved the circle one degree—the screw had a micrometer and also a ratchet wheel of 60 teeth therefore one tooth equalled one tenth of a minute of a degree—the screw could be moved a quantity equal to one single tooth or several turns and parts by means of a cord and treadle so that the circular works attached to the dividing wheel could be readily graduated into the required numbers, by setting the tangent screw to move the appropriate quantities—the dividing knife or diamond point always moved on one fixed radial line by means of a swing frame


In ratching or cutting the wheel says Mr Ramsden the circle was divided with the greatest exactness I was capable of first into 5 parts and each of these into 3 these parts were then bisected 4 times this divided the wheel into 240 divisions each intended to contain 9 teeth. The ratching was commenced at each of the 240 divisions by setting the screw each time to zero by its micro meter and the cutter frame to one of the great divisions by the index the cutter was then pressed into the wheel by a screw and the cutting process was interrupted at the ninth revolution of the sciew. It was resumed at the next 240th division (or nine degrees off) as at first and so on

This process was repeated three times round the circle after which the ratching was continued uninterruptedly around the wheel about 300 times—this completed the teeth with satisfactory accuracy—The tangent screw was subsequently made as explained in the text—

The first upplication of the tangent screw and ratchet to the purposes of graduation appears to have been in the machine for cutting clock and witch wheels by Pietre Fardoil see plate 23 of Thiouts Fruite d Horlogene & Paris 1741 At page 55 is given a tible of ratchets and settings for wheels from 102 to 800 teeth

In Mr Ramsden's description of his dividing engine for circles, he says 'Having measured the circumference of the dividing wheel I found it would require a screw about one thread in a hundred coarser than the guide screw He goes on to explain that the guide screw moved a tool fixed in a slide carefully fitted on a triangular bar an arrangement equivalent to a slide rest and fixed tool the screw to be cut was placed parallel with the slide, and the guide screw and copy were con nected by two change wheels of 198 and 200 teeth (numbers in the proportion required between the guide and copy) with an intermediate wheel to make the threads on the two screws in the same direction A, no account is given of the mode in which the guide sciew was itself formed, it is to be presumed it was the most correct screw that could be obtained and was produced by some of the means described in the beginning of the present section

Mr Ramsden employed a more complex apparatus in originating the screw of his dividing engine for straight lines, which it was essential should contain exactly 20 throads in the inch, a condition uncalled for in the circular engine, in which the equality of the teeth of the wheel required the principal degree of attention. This second screw cutting apparatus which may be viewed as an offspring of the circular dividing engine, is represented in plan in fig. 611, and may be thus briefly explained.

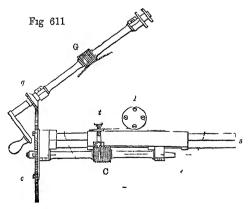

The guide sciew G is turned round by the winch, and in each revolution moves the larger tangent whice one tooth, the

tangent wheel has a small central boss of pulley p to which is attached the one end of an elastic slip of steel, like a watch spring the other end of the slip is connected with the slide s that carries the tool t, in a right line beside the screw C, which latter is the piece to be cut and C, is connected with the guide screw G, by a bevil pinion and wheel g and c, as 1 to 6

To proportion the traverse of the tool to the interval or pitch of the screw two dots were made on the slide s, exactly five inches asunder, and in that space the screw should contain 100 coils to be brought about by 600 turns of the handle. The guide screw was moved that number of revolutions and the diameter of p, was reduced by trial, until the 600 turns traversed the slide exactly from dot to dot these points were observed at the time through a lens placed in a fixed tube, and having a fine silver wire stretched diametrically across the same as an index *

The late Mr Henry Mudslay, devoted an almost incredible amount of labour and expense, to the amelioration of screws and screwing apparatus—which as regurded the works of the mill wright and engineer, were up to that time in a very imperfect state—With the view of producing screws of exact values, he employed numerous modifications of the chain or band of steel, the inclined knife the inclined plane and indeed each of the known methods which however he remodelled as additions to the

^{*} See 'Description of an Innine for Dividing Straight Lines pages 13 to 16 In the construction of his dividing engine for straight lines Rumsden very closely followed his prior machine for circular lines if we conceive the wheel spread out as a rectilinear slide On the one edge of the main slide which carried the work was cut a screw form rack with twenty teeth per inch which was moved by a short fixed screw of the same pitch by means of ratchets of 50 48 or 32 teeth respectively the screw could be moved a quantity equal to one single tooth or to several turns and parts by means of a treadle To obtain divisions which were incompatible with the subdivision of the inch into 1000 960 or 640 parts the respective values of one tooth the scale was laid on the slide at an angle to the direction of motion when the swing frame was placed to traverse the knife at right angles to the path of the slide the graduations were lengthened when the knife was traversed at right angles to the oblique position of the scale being divided they were shortened. This was to a small degree equivalent to having a scrow of variable length the serew form teeth of the rectilinear dividing engine the entire length, namely 25 6 mches was first divided very carefully by continual bisection into spaces of eight tenths of an inch by hand as usual and the screw cutter was placed at zero at each of these divisions pressed into the edge of the slide and revolved sixteen times after three repetitions at each of the principal spaces the entire length was ratched continuously until the teeth were completed

ordinary turning lathe with a triangular bar, a natural result as he was then in the frequent habit of constructing that machine and which received great improvement at his hands

It was noticed at page 581, that of all the methods he gave the preference to the inclined knife applied against a cylinder revolving in the lathe, by means of a slide running upon the bur of the lathe which besides being very rapid, reduced the mechanism to its utmost simplicity. This made the process to depend almost alone on the homogeneity of the materials, and on the relation between the diameter of the cylinder and the inclination of the knife, whereas in a complex machine every part concerned in the transmission of motion such as each axis, wheel and slide, entails its risk of individual error, and may depreciate the accuracy of the result, and to those sources of disturbance must be added those due to change of temperature, whether arising from the atmosphere or from friction, especially when different metals are concerned

A rod of wood, generally of alder and about two feet long, was put between the centers and reduced to a cylinder by a rounder or witchet (fig 313, p 487), attached to a slide running on the bar, the slide with the inclined knife was then applied, and the angle of the knife was gradually varied by adjusting screws, until several screws made in succession, were found to agree with some fixed measure. The experiment was then repeated with the same angle upon cylinders of the same diameter, of tin, brass, and other comparatively soft metals, and hundreds or it might almost be said, thousands of screws were thus made

From amongst these screws were selected those which, on that in the lathe, were found to be most nearly true in their angle or to have a quiescent gliding motion and which would also best endure a strict examination as to their pitch or intervals, both with the rule and compasses and also when two wore placed side by side, and their respective threads were compared, as the divisions on two equal scales

The most favourable sciew having been selected, it was employed as a guide screw in a simple apparatus which consisted of two triangular bars fixed level, parallel, and about one foot asunder, in appropriate standards with two apertures—the one bar carried the mandrel and populate as in the ordinary bar lathe—The slide rest embraced both bars, and was traversed

thereupon by the guide sciew placed about midway between the bais the guide sciew and mandrel were generally connected by three wheels or else by two or four, when the guide and copy were required to have the reverse direction. The mandrel was not usually driven by a pulley and cord but on the extremity of the mandrel was fixed a light wheel with one arm serving as a winch handle for rapid motion in running back, and six or eight radial arms (after the manner of the steering wheels of large vessels) by which the mandrel and the screw were slowly handed round during the cut


In a subsequent and stronger machine the bar carrying the mandrel stood lower than the other, to admit of larger change wheels upon it, and the same driving gear was retained. And in another structure of the screw cutting lathe, Mr. Maudslay placed the triangular bar for the lathe heads in the center, whilst a large and wide slide plate, moving between chamfer bars attached to the framing carried the sliding rest for the tool in this last machine, the mandrel was driven by steam power and the retrograde motion had about double the velocity of that used in cutting the screw. Indeed these machines may be furly considered to be the precursors of the present screw cutting lathes, in which the detached triangular bars or slides have been exchanged for one strong bearer with two ridges or fillets, upon which the slide plate moves for guiding the traverse of the tool

The iclations between the guide sciew and the copy were varied in all possible ways the guide was changed end for end, or different parts of it were successively used sometimes also two guide sciews were yoked together with three equal wheels, their nuts being connected by a bar jointed to each, and the center of this link, (whose motion thus became the mean of that of the guides) was made to traverse the tool. Steel screws were also cut and converted into original taps, from which dies were made to be themselves used in correcting the minor errors, and render the screws in all respects as equable as possible. In fact, every scheme that he could devise, which appeared likely to benefit the result, was carefully tried in order to perfect to the utmost, the helical character and equality of subdivision of the sciew

M1 Maudslay succeeded by these means, after great perse verance, 111 making a very excellent brass screw about seven

feet long, and which, compared with standard measure, was less than one sixteenth of an inch false of its nominal length. I aking the error as the one thousandth part of the total length of the screw, which was beyond its real quantity, to make from it a corrected screw by the system of change wheels would have required one wheel of 1000 teeth and another of one tooth less, or 999 but in reality the error was much less, and perhaps nearer the two thousandth of an inch, then the wheels of 2000 and 1999 teeth would have been required consequently the system of change wheels is scarcely applicable to the correction of very minute errors of length

The change of the thousandth part of the total length, was therefore given to the tool as a supplementary motion, which might be added to or subtracted from the total traverse of the tool in the mode explained by the diagram, fig. 612, in which all details of construction are purposely omitted. The copy C, and the guide screw G, are supposed to be connected by equal wheels in the usual manner, the guide screw carries the axis of the bent lever, whose aims are as 10 to 1, and which moves in a horizontal plane—the short arm carries the tool, the long aim is jointed to a saddle which slides upon a triangular bit ι



In point of fact, the tool was mounted upon the upper of two longitudinal and parallel slides, which were collectively traversed by the guide screw G. In the lower slide was fixed the axis or fulcrum of the bent lever, the short aim of which was connected by a link with the upper slide so that the compensating motion was given to the upper slide relatively to the lower

The triangular bar i i, when placed exactly parallel with the path of the tool would produce no movement on the same, and C, and G would be exactly alike, but if i i, were placed out of parallelism one inch in the whole length, the tool, during its traverse to the left by the guide screw G, would be moved to the right by the shifting of the bent lever one tenth of the displacement of the bar, or one tenth of an inch

Therefore whilst the guide screw G, from being coarser than required, moved the principal slide the one thousandth put of the total length in excess, the bent lever and inclined straight bar i i pulled back the upper or compensating slide, the one thousandth part, or the quantity in excess making the absolute traverse of the tool exactly seven feet, or the length required for the new screw C instead of seven feet and one sixteenth of an inch the length of G. To have lengthened the traverse of the tool the bar ii must have been inclined the reverse way in other words, the path of the tool is in the diagram the difference of the two motions in the reverse inclination its path would be the sum of the two motions and ii being a straight line, the correction would be evenly distributed at every part of the length*

Whilst Mr Maudslay's experiments in perfecting the screw were being carried on his friend Mr Barton | paid frequent visits to his manufactory and also pursued a similar course Mr Buton preferred, however, the method of the chain or flexible band for triversing the tool the exact quantity, because the reduction of the diameter of the pulley or drum, afforded a very ready means of adjustment for total length, and all the wheels of the mechanism being individually as perfect as they could be made a near approach to general perfection was naturally anticipated on the first tiral. This mode, however is subject to the circumstraduced by the clusticity or elongation of the chain or bind, and which is at the maximum when the greatest length of chain is uncoiled from the barrel

These two individuals having therefore arrived, by different methods as near to perfection as they were then respectively capable of, each made a screw of the same pitch, and 15 mehes long, and the two when placed side by side were found exactly to agree throughout their length, and were considered perfect. The two screws were submitted in 1810 to the scritting of that celebrated mathematical instrument maker, the late Mr. Edw. Troughton F.R.S., &c., who examined them by means of two powerful microscopes with cross wrices, such as a custod for reading off the graduations of astronomical instruments applied like a pair of the most refined compasses, to measure the

^{*} The apparitus was fitted to the second screwlathe of those described and the inclined bar was placed on temporary wooden standards

[|] Subsequently Sn J Paton Comptioller of the Mint &c

equality of some 20, 50, or 100 threads, taken indiscriminately at different parts of the length of the sciews* From this severe trial it resulted, that these screws which to the unassisted sight and for almost every purpose of mechanism were unexceptionable were found to be full of all kinds of errors, being unequally coarse at different parts, and even irregular in their angles, or 'drunk This rigid scrutiny led both parties to fresh and ultimately successful efforts, but of these our limits will only allow us to notice one apparently derived from the use of the two microscopes

Mi Barton employed two pairs of dies upon the one sciew the dies were fixed at various distances asunder upon one france or bar and the screw was passed through them. This was found to distribute the minute errors so completely, that little is maned to be desired as it is obvious that at those pairs where the screw was too coarse, the outer sides of the threads were cut, and which tended to shorten the screw, and where it was too short, the inner sides were cut, which tended to lengthen the screw in fact the two parts temporarily situated within the dies, were continually endeavouring to approximate themselves to the fixed unvarying distance, at which the dies were for the time placed †

Mr Maudslay did not restrict his attention to the correction of the screw for the purposes of science, but he also effected a great many improvements in the system of taps and dies by which they were made to cut instead of squeeze as to him are due the introduction of the three cutting edges and the division of the taps into the series of three, namely the entering of taper tap the middle and the plug tap by which shallow holes

^{*} The microscope had been long used in the process of graduating instruments but this invaluable mode of employing two microscopes in combination was first successfully practised by Mr Troughton

[†] Mr Briton informed the author that he employed the sciew corrected in the above manner in his engraving machine employed for cutting with the diamond the lines as fine as 2000 in the inch on the steel dies referred to in the note on page 42 vol 1 and he said that such was the accuracy of the mechanism that if a line were missed the machine could be set back for its insertion without any difference being perceptible. The author unintentionally ascribed the first application of the diamond to turning steel to Sir John Barton (see note page 179 vol 1) whereas it had been used long before by Ramsden in cutting the hardened steel screw for his rectilinear dividing engine. See his tract pages 14-15

[‡] The accuracy of a screw cut by Mr Mrudslay and employed in Mr Donkin s rectilinear dividing engine is indisputibly shown at page 654 of this volume

or dead holes, in cast non, can be safely tapped with full threads, a matter before impossible

This engineer also made a series of taps, from six inches dirmeter, for attaching the pistons of steam engines to their piston rods, to the smallest used in screw plates for watch work The diameters of these taps were derived from the ordinary subdivision of the inch into eighths and sixteenths, and their threads were jointly determined by the respective strength of each screw and the choice of defined rates, such as $3 \ 3\frac{1}{4} \ 4 \ 4\frac{1}{2}$, 6 8 &c, threads per inch To have employed one constant angle or proportion between the diameter and pitch would have introduced many fractions into the rates of pitch, and an irre gularity of strength in the screws themselves The formation of these taps was rendered comparatively easy, after he had intio duced the true original screw and the system of change wheels, as a common practical apparatus, many copies of these screw threads have found their way to other workshops, and have served to influence the construction of similar tools of various proportions

Indeed, I believe it may be fairly advanced, that during the period from 1800 to 1810, Mr Maudslay effected nearly the entire change from the old, imperfect, and accidental practice of sciew making referred to at page 635 to the modern, exact and systematic mode now generally followed by engineers, and he pursued the subject of the screw with more or less ardour, and at an enormous expense, until his death in 1835. The results have been so important, and are so well appreciated amongst mechanical men generally, that they may be considered fully to deserve the short digression to which they have led

In 1816, M1 Allan was rewarded by the Society of Aits for his method of cutting micrometer screws with dies—the reple sentation and description of the instrument will be found at page 582, where it is shown in the act of cutting an original screw with an inclined knife—Micrometer screws are cut in this apparatus much in the same manner, except that about one third of the thread is cut with the large die, fig 535 the inner curvature of which agrees with the curvature of the blank cylinder and the screw is finished with the smaller die, 536, cut by an original of the same drameter as the finished screw—The piece prepared for the screw must always have two cylindrical ends to


fit the semicircular bearings b b this arrangement prevents the sciew from being bent in the piocess of cutting but which latter operation is accomplished entirely with the dies *

About the year 1820, Mr Clement devised and put in practice a peculiar mode for originating the guide screw of his screw-lathe, the steps of which plan will be now described

- I He produced from Scotland some hand screw tools cut over a hob with concentric grooves and to prevent the indges or points of the screw tools, from being cut square across the end the rest was inclined to compensate for the want of angle in the hob or cutter
 - 2 A brass screw was struck by hand, or chased with the tool 1
- 3 The screw 2, was fixed at the back of a traversing mandicl, and clipped between two pieces of wood or dies to serve as a guide, whilst
- 4 A more perfect guide sciew was cut with a fixed tool, and substituted on the mandrel for 3 as Mr Clement considered the movement derived from the opposite sides of the one sciew became the mean of the two sides, and corrected my miegularities of angle or of drunkenness
- 5 A large and a small master tap m, fig 613, were cut on the traversing mandrel with a fixed tool, the threads were about an inch long, and situated in the middle of a shaft eight or ten inches long the small master tap was of the same diameter as the finished screw, the large master tap measured at the bottom of the thread the same as the blank cylinder to be screwed, as in figs 572 and 576, page 600. The master taps m, were used in cutting up the rectangular dies required in the apparatus shown in fig 613, and now to be described
- 6 On the puallel bed of a lathe, were fitted two standards or coll u heads $h\ h'$ intended to receive the pivots of the screw to be cut, on the extremity of which was placed a winch handle or sometimes an intermediate socket was interposed between the

^{*} Mr A Ross considers that the friction of Mr Allan's appuratus is apt to retard the traverse of the screw and therefore to cut the bottom of the thread too wide or rounding. In his practice he uses the large and smill dies for ushort period at the commencement and conclusion of the process but he cuts out the principal bull of the material by a fixed tool inserted within a radial mortise in a semicicular copper due, the copper is indented more and more with the progress of the work and serves as an efficient guide whilst the cutting is accomplished with considerably less friction and in a superior manner by the cutter or turning tool

screw and the winch, to carry the latter to the end of the bed The bed had also an accurate slide plate $s\,s'$ running freely upon it, the slide plate had two tails which passed beside the head h and at the other end a projection through which was made a transverse rectangular mortise for the dies, the one end of the

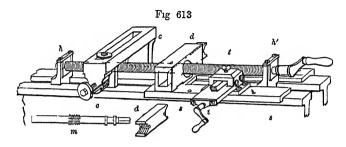

mortise is shown by the removal of the front die d and the back die d' is seen in its proper situation—one extremity of each die was cut from the large master tap m, and the other from the small—The clamp or shackle c c'—was used to close the two dies upon the screw simultaneously—it is shown out of its true position in order that the dies and mortise may be seen, but when in use the shackle would be shifted to the right, so as to embrace the dies d d—The plane extremity c' rested against the back die, whilst the screw c bore against the front die, th rouh the intervention of the washer loosely attached to the clamp to save the teeth from injury, the pressure screw c had a graduated head and an index, to denote how much the dies were closed

- 7 A cylinder about two feet long, prepared for the screw, was placed between the heads $h\,h'$, and the large dies whose inner edges were of the same diameter as the cylinder were closed upon it moderately tight, and the screw was turned round with the winch to trace a thread from end to end, this was repeated a few times, the dies being slightly closed between each trip
- 8 A screw tool was next fixed on the slide s s', in a chamfer slide t t' with appropriate adjusting screws so as to follow the dies and remove a shaving, much the same as in turning, the dies having arrived at one end of the screw the same screw tool, or a second tool, was placed on the opposite side of the slide plate, so as to cut during the return movement. With the progress of the screw the screw tool was applied at a

variety of distances from the pair of dies, as well as on opposite sides of the screw so that the metal was cut out by the tool, and the dies were used almost alone to guide the traverse. Of course the dies were closed between each trip and when the screw was about half cut up, the small dies were substituted for the large ones used at the commencement of the process

- 9 The screw thus made, which was intended for a slide rest was found to be very uniform in its thread, and it was used for some time for the ordinary purposes of tuning. When how ever it was required to be used for cutting other screws, it was found objectionable that its rate was nearly nine, whereas it was required to have eight threads per inch. It was then used in cutting a new guide screw by means of a pair of change wheels of 50 and 56 teeth, which upon calculation were found to effect the conversion with sufficient precision.
- 10 From 9, the sciew of 24 inches in length, one of 8 feet in length was obtained, the thread was cut one third its depth, with the wheels, successive portions being operated upon, and the tool being carefully adjusted to the termination of the part previously cut. The general truth of the entire length was given by a repetition of the tedious mode of correction represented in the figure, with the dies and tool applied upon a bearer rather exceeding the full length of the screw *

Although the processes 7 and 8 will produce a most uniform screw, Mr Clement attaches little importance to the use of the dies and guide frame alone when several screws are wanted strictly of the same length. Of some few thus made, as nearly as possible under equal circumstances, two screws were found very nearly to agree, and a third was above a tenth of an inch longer in ten inches. This difference he thinks to have arisen in marking out the threads, from a little variation in the friction of the slide, or a difference in the first penetration of the dies.

The friction of the slide, when sufficient to cause any retard

^{*} Mr Clement also made a very superior steel screw of about five feet in length and three inches diameter precisely by the method 10 before he had completed the screw lathe he now commonly uses and Mr Whitworth followed precisely the same method in obtaining his standard screw of about the length of 24 feet and half inch pitch except that a clasp nut was used instead of the dies. It was produced from a short screw cut by Mr Clements the correctional process occupied two months and was carried on with a most strict regard to avoid the linequal expansion of the screw and apparatus employed upon it

ation, he considers to produce a constant and accumulative effect, first as it were, reducing the screw of 15 threads per inch say to the fineness of $15\frac{1}{4}$ —then acting upon that of $15\frac{1}{4}$ reducing it to $15\frac{1}{2}$ and so on, and that to such an extent, as occasionally to place the screw entirely beyond the correctional process—This cannot be the case when the thread is first mailed out with the change wheels, instead of the dies

One very important application of the screw, is to the graduation of mathematical scales, the screw is then employed to move a platform, which slides very freely, and carries the scale to be graduated, and the swing frame for the knife or diamond point is attached to some fixed part of the framing of the machine Supposing the screw to be absolutely perfect, and to have fifty threads per inch successive movements of fifty revolutions would move the platform and graduate the scale exactly into true inches but on close examination, some of the graduations will be found to exceed and others to fall short of the true inch

The scales assume of course, the relative degree of accuracy of the screw employed. No test is more severe and when these scales are examined by means of two microscopes under a magnifying power of ten or twenty times the most minute errors become abundantly obvious, from the divisions of the scales fulling to intersect the cross wires of the instrument, the result clearly indicates corresponding irregularities in the coarseness of the screw at the respective parts of its length. An accustomed eye can thus detect, with the microscope, differences not exceeding the one thirty thousandth part of an inch, the twenty five thousandth part being comparatively of easy observation.

From Mr Donkin's investigation of the subject, he was led to conclude that it is quite impossible to produce a screw which shall be absolutely free from error, when micrometrically proved, and in 1823, he was in consequence led to consider that as Mr Maudslay's method of the bent lever and inclined straight bar would compensate the error of total length in a nearly perfect screw a similar mode might be applied to all the intermediate errors, by the employment of a curve experimentally obtained by the method of continual bisection employed in hand dividing

It having been explained in reference to the diagram on page 644 that the inclination given to the but 22 would induce the effective length of a screw, and the reverse inclination would

increase it, Mi Donkin considered that from the observed fact of one half of the sciew, (as estimated by counting the number of threads) being generally too coarse, and the other half too fine, the compensation would require the one half of the bar ii, to be inclined to the right as in the diagram, and the other half to the left in fact thus bending the right line into an obtuse angle

Extending this mode, upon the presumption that the quarters, eighths, or sixteenths, of the sciew were also dissimilar, the bar would require many flexures instead of the one only, giving to it a more or less zig zag character, or rather that of a gently undulating line. The undulations being proportioned experimentally to effect such compensations, as should add to the movement of the upper platform or supplementary table, where the sciew was too fine, and subtract from its motion, where the sciew was too coarse, so as, from a screw known to be slightly irregular, to produce the divisions of a scale, or the thread of another sciew considerably nearer to equality

He carried out this project in 1826, and he has satisfactorily proved the existence of a correctional method, which is within reach of any clever workman who will devote sufficient patience to the adjustment of the engine, and which latter will be now briefly explained

Mr Donkin's dividing machine consists first of a table or platform moving on a railway, the platform being supported by four or any greater number of wheels that may be required for preventing flexure and for diminishing friction The upper edges of the two rails on which the wheels turn, are made as perfectly straight as possible, the rails lie in the same horizonal plane, and they are placed at any convenient distance from The table or platform is guided laterally in its course upon the rails by four wheels, of which two are placed on each side of one of the rails, two wheels turn on fixed axlcs on one side of the rail, whilst the two on the other side are held tight to the 1ail by means of springs, thus preventing any deviation from the rectilinear course in which the platform ought to travel To the under side of the platform is attached a clasp nut, the two parts of which are so constructed, as to be applied to, or separated from the main sciew, which lies below the platform, and is exactly parallel with the rails, or with the line in which the platform is made to move

To effect the compensation, the platform or table consists

of an upper and lower plate which are capable of a small inde pendent motion. The lower plate carries the fulcrum of the bent lever, whose aims are at right angles and as fifty to one, the lever moves in the veitical plane, so that its longer arm lies by gravity alone on the curvilinear edge of the compensation bar the upper platform is pressed endlong against the shorter aim of the bent lever, by a spring which always keeps them in close contact

The attachment of the two platforms is peculiar—the upper, rides upon four rollers or rather sectors, and the two plates are connected by two slight rods placed transversely between them, the ends of the rods are fixed over the one rail to the lower, and over the other rail to the upper platform, the bars consequently fulfil the office of the radius bars of a parallel rule, and suffice by their flexure alone, for the very limited and exact motion required in the upper table

The compensating bar which is of the length of the screw or 24 inches, has 48 narrow slips of metal placed like the keys of a piano forte, each having an appropriate adjusting and fixing sciew, by which the ends of the pieces may be placed in a continuous line or any of them may be placed above or below the line as required in the following mode of compensation. For change of total length and adjustment for temperature the curved but is more or less inclined, as in the former example except that it is placed edgeways or vertically, it is attached to the out side of one of the rails, by a pivot which intersects the one end of its curvilinear edge, and the other end is raised or depressed by a screw, which effects the adjustment for temperature

Conceiving the length of the guide sciew divided into 48 equal parts denoted by the figures 0 to 48 it would be first ascertained by two fixed microscopes if the halves of the screw, measured from 0 to 24, and from 24 to 48, were absolutely equal quantities—if not, the central slip or finger would be raised or lowered until on repeated trials the due correctional movement was applied to the table—The two halves would be similarly bisected and corrected in the points 12 and 36, and the quarters again bisected in 6, 18–30, and 42 and the cighths when also bisected, would extend the examination to the points 0, 3–6, 9 &c, to 48—The easiest method is to compare the path of the slide, with the divisions of a superior scale, fixed upon the slide or platform of the machine

It would now be needful to divide the whole into three parts,

by the comparison of the spaces from 0 to 16 from 16 to 32, and from 32 to 48, the points 16 and 32 being adjusted until exactly equal, which is the most difficult part of the work and then these three distances being bisected four times, every point of the 48 would have been examined, and some of them twice over. These adjustments having been repeatedly verified, during which a very frequent recurrence to the total length is imperative, the concluding step is to file off the corners of the 48 slips very carefully, so as to convert them into a line with undulations, slight it is true, but which represent fifty fold the actual errors in the guide screw, and therefore shift the table simultaneously with its general traverse so as to apply the exact corrections for inequality, at every point examined and found to be in error.

But the term error must be received in a very restricted sense, as it deserves to be noticed, that Mr Donkin first used a sciew made by Mr Maudslay, and the maximum deflection of the curved edge of the compensation bar from a straight line was very nearly the eighth of an inch, indicating the maximum error of the screw to have been about the 400th part of an inch and as the curve was nearly limited to a single undulation or a hill at one end, it may be presumed this minute error was in part attributable to a difference in the material, a source of perplexity from which no care is a sufficient protection. The dividing engine was employed as a traversing lathe in cutting a new screw, and which although it had the advantage of the compensation, only reduced the error of the new screw to about one third the quantity of that of the first, as shown by the new curve assumed by the compensation bar its deflection being $\frac{1}{\sqrt{0}}$ of an inch, when re adjusted in the tedious and anxious method described *

Having at length concluded the remarks on some of the most

^{*} In the year 1842 Mr Donkin made a similar but enlarged dividing engine. The length of traverse of the new machine is 42 inches the screw has 40 threads in the inch the compensation bar is as 60 to 1 and the value of one single tooth in the counting wheel is equivalent to the 60 000th part of an inch that of the first machine having been the 30 000th part

It is to be regretted that Mr Donkin did not complete his labours by publishing a detailed account of these machines the latter of which in particular calculates throughout its structure a most refined contrivance and execution of which no adequate idea can possibly be conveyed within the limits of this slinder notice nor without exact drawings of the details to the arrangement of which great attention has been bestowed

refined and scientific efforts that have been employed in producing and perfectioning the sciew, I shall in the next and concluding section of this already extensive chapter, proceed to the discussion of a variety of important considerations and conditions which practically influence the proportions, forms, and general character of screws, to adapt them to multifarious purposes in the mechanical and constructive arts

SFCT IX —SCREW THREADS CONSIDERED IN RESPECT TO THEIR PROPORTIONS, FORMS, AND GENERAL CHARACTERS

The proportions given to screws employed for attaching together the different parts of work, are in nearly every case arbitrary or in other words, they are determined almost by experience alone rather than by rule, and with little or no aid from calculation, as will be shown

In addition to the ordinary binding screws, which although arbitrary, assume proportions not far distant from a general average many screws either much coarser or finer than usual, are continually required for specific purposes—as are likewise other screws of some definite numbers of turns per inch, as 2, 10–12–20, &c., in order to effect some adjustment or movement having an immediate reference to ordinary lineal measure. But all these must be considered as still more distant, than common binding screws, from any fixed proportions, and not to be amenable to any rules beyond those of general expediency

Neither the pitch, diameter, nor depth of thread, can be adopted as the basis from which to calculate the two other measures, on account of the different modes in which the three influence the effectiveness of the screw, nor can the proportions suitable to the ordinary $\frac{3}{4}$ inch binding screw, be doubled for the $\frac{1}{2}$ inch screw, or halved for that of $\frac{3}{8}$ inch, as every diameter requires its individual scale to be determined in great measure by experiment, in order to produce something like a mean proportion between the dissimilar conditions, which will be separately explained in various points of view

The reasons for the uncertainty of measure in the various fixing screws required in the constructive acts, are sufficiently manifest, as first, the force or strain to which a screw is exposed, either in the act of fixing, or in the office it has afterwards to

perform can rarely be told by calculation, and secondly, a knowledge of the strain the screw itself will safely endure with out breaking in two, or without drawing out of the nut is equally difficult of attainment nor thirdly can the deduction for friction be truly made from that force the screw should other wise possess, from its angle or pitch, when viewed as a mechanical power, or as a continuous circular wedge


The force required in the fixing of screws takes a very wide range, and is faintly indicative of the stiain exerted on each. The watchmaker, in fixing his binding screws employs with great delicacy a screw driver the handle of which is smaller than an ordinary drawing pencil—while for screws, say of five inches diameter, a lever of six or seven feet long must be employed by the engineer, with the united exertions of as many men—But in neither case do we arrive at any available conclusion, as to the precise force exerted upon, or by each screw, nor of the greatest strain that each will safely endure

The absolute measures of the strength of any individual screw being therefore nearly or quite unattainable all that can be done to assist the judgment, is to explain the relative or comparative measures of strength in different screws as determined by the three conditions which occur in every screw, whether it be light or left handed, of single or of multiplex thread or of any section whatever, and which three conditions follow different laws, and conjointly, yet oppositely determine the fitness of the screw for its particular purpose, and therefore tend to perplex the choice

The three relative or comparative measures of strength in different screws are first the mechanical power of the thread, which is derived from its pitch secondly the cohesive strength of the bolt, which is derived from its transverse section, and thirdly, the cohesive strength of the hold, which is derived from the interplacement of the threads of the screw and nut

These conditions will be first considered, principally as regards ordinary binding screws and screw bolts and nuts, of angular threads, and which indeed constitute by far the largest number of all the screws employed, screws of angular and square threads will be then compared

The comparative sections, figs 614 to 617 represent sciews of the same diameters, and in all of which the depth of the thread is equal to the width of the groove, figs 615 and 617 show the ordinary proportions of $\frac{3}{4}$ inch angular and square thread screws, 614 and 616 are respectively as fine and as coarse again as 615



Various measures of the sciews which require little further explanation are subjoined in a tabular form, and the relative degrees of strength possessed by each sciew under three different points of view, are added

MDASURDS AND RELATIVE STRENGTHS OF THE SCREWS	F1g 614	F1g 615	Γιg 616	Fig 617
External diameters in hundredths of an inch	75	75	75	75
Internal diameters in hundredths of an inch	65	55	35	55
Number of threads per inch or rates of the screws	20	10	5	5
Depths and widths of the threads in hundredths	05	10	20	10
Angles of the threads on the external diameters*	1 16'	2 33	5 5	5 5
Angles of the threads on the internal diameters*	1 28	3 28	10 4,	6 55
Relitive mechanical powers of the threads	20	10	5	5
Relative cohesive strengths of the bolts	4	3	1	3
Relative cohesive strengths of hold of the screws	65	55	35	271
Relative cohesive strengths of hold of the nuts	75	7.5	75	37 1

* The angles of the threads of screws are calculated trigonometrically the circumference of the bolt being considered as the base of a right angled triangle and the pitch as the height of the same

The author has adopted the following mode which will be found to require the fewest figures namely to divide the pitch by the circumference and to seek the product in the table of tangents decimal numbers are to be used and it is sufficiently near to consider the circumference as exactly three times the diameter

For the external angle of fig 616 say 20-2.25=0888, and this quotient by Hutton's lables gives 5 deg 5 min

For the internal angle of fig 614 say 05-195=02564 and by Hutton's Tables 1 deg 28 mm

In this method the pitch is considered as the tangent to the angle and the division effects the change of the two sides of the given right angled triangle for two others the larger of which is 1 or unity, for the convenience of using the tables

Square thread screws, have about twice the pitch of angular threads of similar diameters and 617 estimated in the same manner as the angular will stand by comparison as follows. The square thread 617 will be found to be equal in power to 616, the pitch being alike in each. In strength of bolt to be equal to 615, their transverse areas being alike. And in strength of hold to possess the half of that of 615, because the square thread will from necessity break through the bottom of the threads or an interrupted line exactly like the dotted line in 616, that denotes just half the area or extent of base, of the thread of 615, which latter covers the entire surface of the contained cylinder, and not the half only

The mechanical power of the thread, is derived from its pitch. The power, or the force of compression is directly as the number of threads per inch, or as the rate so that, neglecting the friction in both cases, fig. 614 grasps with four times the power of 616, because its wedge or angle is four times as acute.

When however the angle is very great, as in the sciews of fly presses which sometimes exceed the obliquity of 45 degrees, the sciew will not retain its grasp at all neither will a wedge of 45 degrees stick fast in a cleft. Such coarse screws act by impact they give a violent blow on the die from the momentum of the fly, (namely, the loaded lever, or the wheel fixed on the press screw,) being suddenly arrested, they do not wedge fast, but on the contrary, the reaction upwards, unwinds and raises the sciew for the succeeding stroke of the fly press

Binding screws which are disproportionately coarse, from leaning towards this condition, and also from presenting less surface friction, are hable to become loosened if exposed to a jairing action. But when, on the contrary, the pitch is very fine, or the wedge is very acute, the surface friction against the thread of the screw is such, as occasionally to prevent their separation when the screw bolt has remained long in the hole or nut, from the adhesion caused by the thickening of the oil, or by a slight formation of rust


The cohesive strength of the bolt, is derived from its transverse section. The screw may be thus compared with a cylindrical rod of the same diameter as the bottom of the thread and employed in sustaining a load, that is, neglecting torsion, which if in excess may twist the screw in two. The iclative strengths are

represented by the squares of the smaller diameters in the screws of 20, 10, and 5 ingular threads, the smaller diameters are 65, 55, and 35, the squares of these numbers are 4225 3025 and 1225, which may be expressed in round numbers as 4, 3, 1, and therefore the consest screw, 616, has transversely only one fourth the area and consequently one fourth the strength of the finest, represented in the three diagrams

The cohesive strength of the hold, is derived from the helical ridge of the external screw, being situated within the helical groove of the internal screw. The two helices become locked together with a degree of firmness approaching to that by means of which the different particles of solid bodies are united into a mass, as one or both of the ridges must be in a great measure torn off in the removal of the screw, unless it be unwound or twisted out

A slight difference in the diameter or the section of a screw and nut, is less objectionable than any variation in the coarse ness or pitch, as the latter difference, even when very minute, will prevent the screw from entering the hole, unless the screw is made considerably smaller than it ought to be, and even then it will bear very imperfectly, or only on a few places of the nut

To attempt to alter a screwed hole by the use of a tap of a different pitch, is equally fatal, as will be seen by the annexed diagram fig 618. For instance the upper line a contains exactly 4 threads per inch, and the middle line or b, has $4\frac{1}{3}$ threads they only agree at distant intervals. The lowest line c, shows that which would result from forcing a tap of 4 threads such as a, into a hole which had been previously tapped with the $4\frac{1}{3}$ thread screw b, the threads would be said to cross, and would nearly

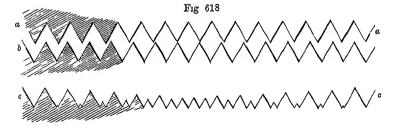

destroy each other the same result would of course occur from employing 4 or 5 thierd dies on a screw of 1; threads per meh. Therefore, unless the screw tackle exactly agree in pitch with

the previous thread, it is needful to remove every vestige of the former thread from the screw or hole, otherwise the result drawn at c must ensue in a degree proportionate to the difference of the threads, and a large portion of the bearing surface, and con sequently of the strength and the durability of the contact would each be lost. Some idea may thence be formed of the real and irremediable drawback frequently experienced from the dissimilarity of screwing apparatus, nearly to agree will not suffice, as the pitch should be identical

The nut of a $\frac{3}{4}$ inch screw bolt is usually $\frac{3}{4}$ inch thick, as it is considered that when the thierds are in good contact, and collectively equal to the diameter of the bolt, the mutual hold of the threads exceeds the strength either of the bolt or nut and therefore that the bolt is more likely to break in two or the nut to burst open rather than allow the bolt to draw out of the hole from the thread stripping off

When screws fit into holes tapped directly into the castings or other parts of mechanism, it is usual to allow still more threads to be in contact even to the extent of two or more times the diameter of the screw, so as to leave the preponderance of strength greatly in favour of the hold, that the screw, which is the part more easily renewed may be nearly certain to break in two, rather than damage the casting by tearing out the thread from the tapped hole

Should the internal and external sciews be made in the same material, that is both of wood, brass or iron, the nut or internal screw is somewhat the stronger of the two. For example, in the sciew fig. 615, the base of the thread is a continuous angular ridge which occupies the whole of the cylindrical surface represented by the dotted line. Therefore the force required to strip off the thread from the bolt, is nearly that required to punch a cylindrical hole of the same diameter and length as the bottom of the thread, for in either case the whole of the cylin drical surface has to be stripped or thrust off laterally, in a manner resembling the slow quiet action of the punching or shearing engine.

But the base of the thread in the nut is equal to the cylindrical surface measured at the *top* of the bolt, and consequently, the materials being the same, and the length the same, considering the strength of the nut for 615 to be 75 the strength of the bolt

would be only 55 or they would be respectively as the diameters of the top and bottom of the thread although when the bolt protrudes through the nut the thread of the bolt derives a slight additional strength, from the threads situated beyond the nut, and which serve as an abutment

It is however probable that the angular thread will not strip off at the base of the threads either in the screw or nut, but will break through a line somewhere between the top and bottom but these results will occur alike in all, and will not therefore materially alter the relation of strength above assumed

Comparing 614, 615, and 616, upon the supposition that the bolts and nuts exactly fit or correspond, the strengths of the three nuts are alike, or as 75 and those of the bolts are as 65, 55, and 35 and therefore the advantage of hold lies with the bolt of finest thread, as the finer the thread, the more nearly do the bolt and nut approach to equality of diameter and strength

Supposing however, for the purpose of explanation, that instead of the screws and nuts being carefully fitted, the screws are each one tenth of an inch smaller than the diameters of the respective taps employed in cutting the three nuts 614 would draw entirely out without holding at all the penetration and hold of 615 would be reduced to half its proper quantity and that of 616 to three fourths, and the list two screws would strip at a line more or less elevated above the base of the thread and therefore the more easily than if the diameters exactly agreed

The supposed error, although monstious and excessive, shows that the finer the thread the greater also should be the accuracy of contact of such screws, and it also shows the impolicy of employing fine threads in those situations where they will be subjected to frequent screwing and unscrewing, and also to much strain. As although when they fit equally well, fine threads are somewhat more powerful than coarse, in hold as well as in mechanical power, the fine are also more subject to wear, and they receive from such wear, a greater and more rapid depreciation of strength, than threads of the ordinary degrees of coarseness

In a screw of the same diameter and pitch, the ultimate strength is diminished in a twofold manner by the increase of the depth of the thread, first it diminishes the transverse area of the bolt, which is therefore more disposed to break in two, and secondly, it diminishes the individual strength of each thread,

which becomes a more lofty triangle erected on the same base, and is therefore more exposed to fracture or to be stripped off

But the durability of machinery is in nearly every case increased by the enlargement of the bearing surfaces and therefore as the thread of increased depth presents more surface bearing the deep screw has consequently greater durability against the friction or wear, arising from the act of screwing and unscrewing. The durability of the screw becomes in truth a fourth condition, to be borne in mind collectively with those before named


It frequently happens that the drameters of screwed worls are so considerable that they can neither break nor burst after the manner of bolts and nuts and if such large works yield to the pressures applied the threads must be the part sacrificed. If the materials are crystalline the thread crumbles away, but in those which are malleable and ductile, the thread, instead of stripping off as a wire sometimes bends until the resisting side presents a perpendicular face, then overhangs, and ultimately curls over this disposition is also shown in the abrasive wear of the screw before it yields

Comparing the square with the angular thread in regard to friction, the square has less friction, because the angular edges of the screw and nut, mutually thrust themselves into the opposed angular grooves in the manner of the wedge. The square thread has also the advantage of presenting a more direct thrust than the angular because in each case the resistence is at right angles to the side of the thread, and therefore in the square thread the resistance is very nearly in the line of its axis, whereas in the angular it is much more oblique.

From these reasons the square thread is commonly selected for presses, and for regulating screws especially those in which rapidity of pitch, combined with strength is essential but as regards the ordinary attachments in machinery the grasp of the angular thread is more powerful from its pitch being generally about as fine again, and as before explained, angular screws and nuts are somewhat more easily fitted together

The force exerted in bursting open a nut depends on the angle formed by the sides of the thread, when the latter is considered as part of a cone, or as a wedge employed in splitting timber. For instance, in the square thread screw the thread forms a line at right angles to the axis, and which is dotted in

the figure 619 it is not therefore a cone, but simply compresses the nut, or attempts to force the metal before it. In the deep thread fig. 620, the wedge is obtuse, and exerts much less

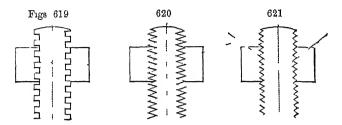

bursting effort than the acute cone represented in the shallow thread screw fig 621, therefore the shallower the angular thread, the more acute the cone, and the greater the strain it throws upon the nut. The transverse measure of nuts, whether they are square or hexagonal, is usually about twice the diameter of the bolt, as represented in the figures, and this in general suffices to withstand the bursting effort of the bolt.*

Those nuts however, which are not used for grasping but for the regulating screws of slides and general machinery, are made much thicker, so as to occupy as much of the length of the screw as two, three, or more times its diameter, this greatly increases their surface contact, and durability

Should it be required to be able to compensate the nut, or to re adapt it to the lessened size of the screw when both have been worn, the nut is made in two parts and compressed by screws, or it is made elastic, so as to press upon the screw. The nuts for angular threads are divided diametrically, and re-united by two or more screws, as in fig. 622, in fact, like the semi-circular bearings of ordinary shafts, as then, by filing a little of the metal away from between the two halves of the nut, they may be closed upon the angular ridges of the thread


The nuts of square threads, by a similar treatment, would, on being closed fit accurately upon the outer or cylindrical surface of the square thread screw, but the lateral contact would not be restored, these nuts are therefore divided transversely, as shown

^{*} In the table of the dimensions of nuts in Templeton's Ingineer's Pocket Companion the transverse measures decrease in the larger nuts the breadth of the nut for a k meh bolt is stated as I meh that for a 2½ such bolt as 4 inches

in fig 623 or they are made as two detached nuts placed in contact. When therefore a small quantity is removed from between them with a file, or they are separated by one or more thicknesses of paper, the one half of the nut bears on the right hand side of the square worm the other on the left

Either of these methods removes the "end play," or the "loss of time" by which expression is meant that partial revolution to and fro, which may be given to a worn screw without producing any movement or traverse in the slide upon which the screw acts. It is usual before cutting the nuts in the lathe or with screw taps to divide the nuts, and to re unite them with soft solder, or it is better to hold them together with the permanent screws whilst cutting the thread

But the screws of slides are very apt to become most worn in the middle of their length, or at the one end, leaving the other parts nearly of their original size at it is then best to replace

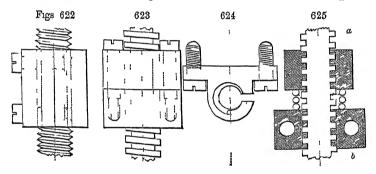

them by new screws, as the former method of adjusting the nuts cannot be used although recourse may occasionally be had to some of the various methods of springing, or the elastic continuances commonly employed in delicate mathematical and astronomical instruments. Although these should be perfectly free from shake or uncertainty of motion, they do not in general require the firm, massive, unyielding structure of engineering works and machinery

Two kinds of the elastic nuts alone are shown, in fig. 624 the saw cut extends throughout the length of the nut but sometimes a portion in the middle is left uncut, the nut is usually a little set in, or bent inwards with the hammer, so as to press upon the sciew. In fig. 625, the two pieces a and b bear against opposite

sides of the thread, and b only is fixed to the slide as in fig. 623, the correction is now accomplished by interposing loosely around the sciew, and between the halves of the nut, a spiral spring sufficiently strong to overcome the friction of the slide upon the fittings, the same contrivince is variously modified, sometimes two or four spiral springs are placed in cavities parallel with the sciew

The slide resists firmly any pressure from a to b, as the fixed half of the nut lies firmly against the side of the thread presented in that direction but the pressure from b to a is sustained alone by the spiral spring, when therefore the pressure exceeds the strength of the spring the slide nevertheless moves endways to the extent of the misfit in the piece b, and which, but for the spring, would allow the slide to shake endways. In absolute effect the contrivance is equivalent to a single nut such as b alone which although possessing end play, if pulled towards b by a string and weight, would always keep in contact with the one side of the worm, unless the resistance were sufficient to ruse the weight. The method is therefore only suited to works requiring delicacy rather than strength, and the spring if excessively strong would constantly wear the two halves of the nut with injudicious friction and haste


The several threads represented in figs 626 to 638 may be considered to be departures from the angulu thread fig 636 and the square thread fig 635, which are by fur the most common

The choice of section is collectively governed. First, by the facility of construction, in which the plain angular thread excels. Secondly, by the best resistance to strain, which is obtained in the square thread. Thirdly, by the near equality of strength in the internal and external sciew. For similar materials, the space and thread should be symmetrical, as in the square thread and in figs. 626 to 630, which screws are proper for metal works generally, whereas in dissimilar materials, the harder of the two should have the slighter thread, as in the iron sciews figs. 631 to 634, intended to be screwed into wood, the substance of the sciew is supposed to be below the line, and the head to the right hand. Fourthly, by the resistance to accidental violence either to the sciews, or to the screwing tools, which is best obtained by the rejection of shup angles or edges as in the several rounded

threads This fourfold choice of section, like every other feature of the screw, is also mainly determined by experience alone

Fig 626, in which the angle is about 60 degrees, is used for most of the sciews made in wood whether in the screw box or

Sections derived from the

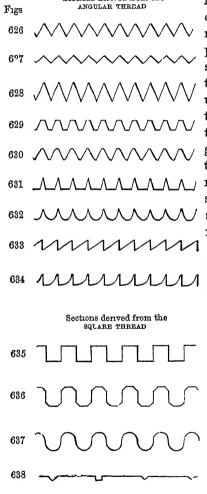

the turning lathe and also for a very large proportion of the screw bolts of ordinary mechanism. Sometimes the points of the screw tool mea sure nearly 90 degrees as in the shallow thread fig 627, used for the thin tubes of telescopes or at other times they only measure 45 de grees as in the very dcep thread, 628, used for some mathematical and other in struments, the angles repre sented may be considered as nearly the extremes

In originating accurate screws, the angular thread is always selected, because the figure of the thread is still maintained, whether the tool cut on one or on both sides of the thread, in the course of the correctional process

Fig 629 is the angular thread in which the ridges are more or less truncited, to increase the strength of the bolt, it may be viewed as a compound of the square and angular thread

Fig 630 is the angular thread in which the tops and bottoms are rounded, it is much used in engineering works, and is frequently called a round thread *

^{*} See foot note on p 670

In 631 the thread is more acute, and truncated only at the bottom of the sciew this is used for joinery work, and greatly increases the hold upon the wood 632 is obviously derived from 631, and is used for the same purpose

In 633 which is also a screw for wood the face that sustains the hold is rectangular as in the square thread the other is bevelled. Fig 634 is the form of the pitent wood screw some times called the German screw, it is hollowed to throw the advantage of bulk in favour of the softer material or the wood the head of which is supposed to be on the right hand. In the last four figures, the substance of the screw is imagined to be situated below the line and that of the wood above

The screws which are inserted into wood are generally made taper, and not cylindrical in order that they may cut their own nut or internal thread, some of them are pointed so as to pene trate without any previous hole being made they merely thrust the fibres of wood on one side. Screws hold the most strongly in wood when inserted horizontally as compared with the position in which the tree grew, and least strongly in the vertical position.

Fig 635 represents the ordinary square thread screw, the space and thread are mostly of equal width, and the depth is either equal to the width, or a trifle more say one sixth

Fig 636 is a departure from 630 and has been made for presses and 637 has obviously grown out of the last from the obliteration of the angles various proportions intermediate between 637 and 630 are used for round threads

In some cases where the screw is required to be rapid one single shallow groove is made of angular, square, or circular section, leaving much of the original cylinder standing as in fig 638. I or very slight purposes, a pin only is fitted to the groove, to serve as the nut—should the resistance be greater many pins—or a comb may be employed, and this was the earliest form of nut, otherwise a screwed nut may be used with a single thread—But when the greatest resistance is required, the surface bearing of the nut is extended, by making the thread, double triple, &c—by cutting one or more intermediate grooves and a counterpart nut

The nuts or boxes of very coarse sciews for presses are now mostly cut in the lathe, although when the screwing tools were less perfectly understood the nuts were frequently cast Sometimes lead, or alloys of similar fusibility, were poured in

betwirt the sciew and the framework of the machinery (see note, p 293, also 322 3, vol 1) but for nuts of brass and gun metal, sand moulds were formed. The screw was always waimed, to avoid chilling the metal, and for brass it was some times heated to redness and allowed to cool, so as slightly to oxidize the suiface, and lessen the disposition to a union or natural soldering of the sciew and nut. It was commonly necessary to stretch the brass by an external hammering to counteract the shrinkage of the metal in the act of cooling, and to assist in releasing from the sciew the nut cast upon it in this manner. The mode is by no means desirable, as the sciew is exposed to being bent from the rough treatment, and to being ground by particles of sand adhering to the brass.

I he tangent crews used for screw wheels, have mostly angular or truncated angular threads, fig 629, as screws absolutely squire cannot be fitted with good contact and freedom from shake between the thread and teeth, and probably the same rules by which the teeth of ordinary wheels and racks are reciprocally set out, should be also applied to the delineation of the teeth of worm wheels, and the threads or teeth of their appropriate screws

Tangent screws are occasionally double, triple, or quadruple, in order that 2, 3 or 4 teeth of the wheel may be moved during each revolution of the screw In the Piedmont silk mills this principle is carried to the extreme, as the screw and wheel become alike, and revolve turn for turn, the teeth supposing them to be 20, are then identical with those of a 20 thread sciew, the angular coils of which cross the axis at the angle of 45°, that is when the shafts lie at light angles to each other, other proportions and angles may be adopted In reality they fulfil the office of beyel wheels, or rather of skew bevel wheels, in which latter also the axes, from being in different planes, may cross each other so that the skew-bevel wheels may be in the center of long shafts, but which cannot be the case in ordinary bevel wheels, the teeth of which lie in the same plane as the axis of the wheel The Predmont wheels act with a very reduced extent of bearing or contact surface, and a considerable amount of the sliding action of screws, which is disadvantageous in the teeth of wheels, although inseparable from all those with inclined teeth, and which are indeed more or less distant modifications of the screw *

^{*} When the obliquity of the teeth of worm wheels is small, it gives a very

Having treated somewhat in detail the different forms of screws and the circumstances which adapt them to their several purposes I have now to consider some of the inconveniences which have unavoidably arisen from the indefinite choice of pioportions in ordinary screws, and also some of the means that have been pioposed for their correction. I he slight discussion of the more important of these topics will permit the introduction of various additional points of information on this almost inexhaustible subject, the screw

No inconvenience is felt from the dissimilarities of screws, so long as the same screwing tools are always employed in effecting repairs in, or additions to the same works. But when it is considered how small a difference in either of the measures will mar the correspondence of the screw and nut, and further the very arbitrary and accidental manner, in which the proportions of screwing apparatus have been determined by a variety of individuals to suit their particular wants, and without any attempt at uniformity of practice (sometimes on the contrary with an express desire to be peculiar) it is perhaps some matter of surprise when the screws made in different establishments properly agree. Indeed the agreement can be hardly expected, unless they are derived from the same source, and that some considerable pains are taken not to depart from the respective proportions first adopted

In a few isolated cases this inconvenience has been partially remedied by common consent and adoption, as in the so called an pump thread, which is pretty generally used by the makers of pneumatic apparatus, and to a certain degree also in some of the sciews used in gas fittings and in gun work. But the non existence of any common standard or scale, enhances both the delay and expense of repairs in general mechanism, and leads to the occasional necessity for making additional sizes of tools to match particular works, however extensive the supply of screw apparatus

This peoplexity is felt in a degree especially severe and costly, as regards marine and locomotive engines, which from necessity, have to be repaired in localities far distant from those in which they were made and therefore require that the packet station

smooth action but at the expense of friction but in ordinary toothed wheels the teeth are exactly square across or in the plane of the axis and the aim is to employ rolling contact with the greatest possible exclusion of sliding from amongst the teeth

or railway depot, should contain sets of screwing tackle, coiles ponding with those used by every different minufacturer whose works have to be dealt with otherwise both the delay and expense are from necessity aggravated

Mr Whitworth has suggested that for steam machinery and for the purposes of engineering in general "an uniform system of screw threads—should be adopted, and after having used some prior scales he has proposed the following table, which may be justly considered as a mean between the different kinds of threads used by the leading engineers

Mr Whitworth & Table for Angular Thread Screws *

Diameters in inches Nos of threads to the inch	1 20	1 18	์ 16	表 14	‡ 12	s 11	3 10	3	1 Ծ	1 ¦ 7	1 <u>1</u> 7	1 ફ 6	1 ¹	1 § 5	1 ₄ 5	1 g 1 l,	2 13
Diameters in inches Nos of threads to the inch	$2\frac{1}{4}$	2분 4	2월 3봉	ვ კ	3 <u>1</u> 3 <u>1</u>	31 3}	39 3	4 3	4년 2절	4 ! 2 ह	14 24	5 9]	5] 28	,¹, 25) <u>}</u>	6′ 2 ዓ	

As regulds the smaller mechanism made principally in brass and steel, such as ma hematical instruments and many others,

Above the diameter of 1 inch the same pitch is used for two sizes to avoid small fractional parts. The proportion between the pitch and the diameter varies throughout the entire scale

Thus the pitch of the $\frac{1}{4}$ inch screw is the of the drameter—that of the $\frac{1}{2}$ inch of the 1 inch $\frac{1}{8}$ th of the 1 inch $\frac{1}{8}$ th of the 4 inches—th and of the 6 inches—th

The depth of the thread in the various specimens is then illuded to—In this respect the variation was greater than in the pitch—The ingle mide by the sides of the thread being taken as an expression for the depth—the mean of the angle in I inch sciews was found to be about 55—which was also nearly the mean in screws of different diameters. Hence it was adopted throughout the scale—and a constant proportion was thus established between the depth—and the pitch of the thread. In calculating the former—a deduction must be made for the quantity rounded off, amounting to 3rd of the whole depth—a c—3th from the top and 3th from the bottom of the thread. Making this deduction the ingle of 55 gives for the actual depth rather more than 3ths and less than 3rds of the pitch—Quoted from the Abstract of Mi Whitworths Paper—given in the Proceedings of the Institution of Civil Engineers 1841—p—15, 160—The entire paper—is also printed separately

^{*} In selecting this scale the following judicious course was adopted — An extensive collection was made of screw bolts from the principal workshops throughout Figland and the average thread was carefully observed for different diameters. The $\frac{1}{4}$ inch $\frac{1}{4}$ inch $\frac{1}{4}$ inch $\frac{1}{4}$ inch were particularly selected and taken as the fixed points of a scale by which the intermediate sizes were regulated avoiding small fractional parts in the number of threads to the inch. The scale was afterwards extended to 6 inches. The pitches thus obtained for angular threads were as above

the sciews in the above scale below half an inch diameter are admitted to be too coarse, and the acute angular threads which are not rounded, are decidedly to be preferred from their greater delicacy and durability, that is when their strengths are proportioned to the resistance to which they are exposed. In these respects the following table may be considered preferable

Diameters in vulgar fractions of the inch	1/2	15 8	7,	33	38	ै 34	5	9	1	7 32	1 5
Diameters in hundths of the inch nearly	50	47	44	41	3,	34	31	28	25	22	20
Number of threads to the inch				20	20	ი4	24	28	28	32	36
Diameters in hundredths of the inch	18	16	14	12	16	09					
Number of threads to the inch	36	4(40	4	48	56	56	64	72	80	100

Table for Small Screws of Fine Angular Threads *

* This table was arranged by Mr Chidson, of Liverpool, who made first a set of coarse angular thread taps from 4 to 1 inch agreeably to the terms of Mr Whitworth's table giving to the screw tool the angle of 55 degrees and also a set of square thread taps of the same diameters and as usual of twice the pitch This led Mr Chidson to set out and construct a series of finer and deeper threads from 1 inch to 14 hundredths diameter agreeably to the arrangement in the second table and with screw tools of the angle of 45 degrees

I have great pleasure in stating my individual opinion of the suitability of the table to its intended purpose and on comparing the screws with those of similar diameters used by Holtzapffel and Co. I found about one third to be nearly identical in pitch one third to be slightly courser and the others slightly finer. As regards the workmainship of these taps in all by Mr. Chidson for his own use and principally with his own hands by means of the change wheels and single point tools it gives me great pleasure to report most favourably.

The tables above given and which have been selected and not calculated will serve to explain the inapplicability of the mode of calculation proposed in various popular works namely for angular thread screws to divide the diameter by 8 for the pitch when it is said such screws will all possess the angle of $3\frac{1}{2}$ degrees nearly and for square threads to divide by 4 thus giving an angle of 7 degrees nearly therefore

```
Angular thread screws of 8 6 4 2 1 \frac{1}{2} 4 nohes diameter would have pitches of 1 \frac{1}{4} \frac{1}{2} \frac{1}{4} \frac{1}{3} \frac{1}{3} \frac{1}{3} inches rise or rates of 1 \frac{1}{3} 2 4 8 16 32 threads per inch which differ greatly from 2 \frac{1}{4} 3 4 \frac{1}{4} 8 12 20 Whitworth's observational numbers
```

By the use of the constant divisor 8 the one inchesive agrees with Whitworth's table the extremes are respectively too coarse and too fine as instead of 8 being employed the actual divisors vary from about 5 to 16 and therefore a theoretical mode would probably require a log withmic scheme. But were this followed out with one the adjustment of the fractional threads so obtained for those of whole numbers would completely invalidate the precision of the rule and the result would not be in any respect better than when adjusted experimentally as at present

There is little doubt that if we could entirely recommence the labours of the mechanist or if we could sweep away all the screw ing tools now in use, and also all the existing engines machines. tools, instruments, and other works, which have been in part made through their agency these proposed scales or others not greatly differing from them (as the choice is in great measure arbitrary), would be found of great general advantage the former for the luger, the latter for the smaller works But until all these myriads of objects are laid on one side, or that repairs are no longer wanted in them the old tools must from absolute necessity be retained. in addition to those proposed in these or any other schemes would be of course highly judicious in new manufacturing esta blishments to adopt such conventional scales, as they would to that extent promote this desirable but almost impracticable end, namely that of unity of system but which although highly fascinating and apparently tenable is surrounded by so many interferences, that it may perhaps be considered both as needless and hopeless to attempt to carry it out to the full or to make the system absolutely universal and some of the circumstances which affect the proposition will be now briefly given

First agreement with standard measure although convenient is not indispensable. It may be truly observed, that as regards the general usefulness of a screw such as 615 which was supposed to measure 3 inch diameter and to have 10 threads per inch, it is nearly immaterial whether the diameter be three or tour hundredths of an inch larger or smaller than 3 of an inch. or whether it have 9, $9\frac{1}{16}$ $9\frac{3}{4}$ $10\frac{1}{2}$, or 11, threads per inch, or my fractional number between these or whether the thread be a trifle more or less acute, or that it be slightly truncated or rounded so long as the threads in the sciew and nut are but truly helical and alike in order that the threads mutually bear upon each other at every part that is, as regards the simple purpose of the binding sciew or bolt, namely, the holding of separate parts in firm contact And as the same may be said of every screw namely, that a small variation in diameter or pitch is commonly immaterial it follows that the good office of a screw does not depend on its having any assigned relation to the standard me suie of this or any other country

Secondly, I he change of system would cause an inconcenient

increase in the number of screwing tools used —Great numbers of excellent and useful screws, of accidental measures, have been made by various mechanicians, and the author hopes to be excused for citing the example with which he is most familiar

Between the years 1794—1800 the author's father made a few varieties of taps, dies hobs, and screw tools after the modes explained at pages 635 and 636, these varieties of pitch were ultimately extended to twelve kinds of each of which was formed a deep and shallow hob or screw tool cutter. These when measured many years afterwards, were found nearly to possess in each inch of their length, the threads and decimal parts that are expressed in the following table.

Approximate Values of I I Holtzapffel's Original Sciew Threads

Number	1	2	3	4	5	6	7	8	9	10	11	12
Threads in 1 inch	6 58	8 25	9 45	13 09	16 5	19 89	22 12	2571	28 8 8	36 10	39 83	55 11

The angle of the deep threads is about 50 degrees of the shallow 60 degrees

This irregularity of pitch would not have occurred had the sciew lathe with change wheels been then in use but such was not the case. For a long series of years I I Holtzapffel (in conjunction with his partner, I G Deyerlein from 1804 to 1827) made as occasion required, a large or a small screw a coarse or fine, a shallow or deep thread, and so forth. By which accumulative mode, their series of working taps and dies, together with screw tools, gages, chucks carriers, and a variety of subordinate apparatus, became extended to not less than one hundred varieties of all kinds

About one third of these sizes have been constantly used, up to the present time, both by H & Co, and by other persons to whom copies of these screw tackles have been supplied, and consequently many thousands of screws of these kinds have been made this implies the continual necessity for repairs and alterations in old works, which can only be accomplished by retaining the original sizes

Since the period at which H & Co made their screw lathe, they have employed the aliquot threads for all screws above half an inch indeed, most of these have also been cut in the screw lathe. To have introduced the same method in the small binding screws which are not made in the screw lathe, but with the die stocks and chasing tools, would have doubled the number of

then working sciew tackle, and the attendant apparatus—with the lisk of confusion from the increased number, but without commensurate advantage as regards the purposes to which they are applied

Doubtless the same reasons have operated in numerous other factories, as the long existence of good useful tools has often lessened if not innulled, the advantage to be derived from a change which refers more immediately to engineering works, and in which a partial remedy is supplied, as steam engines, &c are frequently accompanied with spare bolts and nuts, and also with corresponding screw apparatus to be employed in repairs, the additional cost of such puts being insignificant, compared with the value of the machinery itself

Thirdly Unless the standard sizes of science become inconveniently numerous, many useful kinds must be omitted, or treated as exceptions. For instance, in ordinary binding sciences more puticularly in the smaller sizes, two if not three degrees of coarseness should exist for every diameter and which might be denominated the coarse, medium, and fine series, and again, puticular circumstances require that threads should be of shallow or of deep angular sections, or that the threads should be rounded square or of some other kinds, in this way alone, a fitness for all conditions would inconveniently augment the number of the standards

In many cases besides, screws of several diameters are made of the one pitch. In order for example that the hole when worn may be tapped afresh, and fitted with screws of the same pitch or thread but a trifle larger * or that a partially worn screw may be corrected with the dies or in the lathe and fitted with a smaller nut of the same pitch. A succession of taps of the same pitch also readily permits a larger screw to be employed, when that of smaller diameter has been found to break, either from an error of judgment in the first construction of the machine, or from its being accidentally submitted to a strain greater than it was intended ever to be in !

^{*} This is done in some of the patent screws for joinery work so that when the thread in the wood is deteriorated from the frequent removal of the screw another of the same pitch but larger diameter may be substituted

[|] Mr Clement has screw taps of \(\frac{3}{3} \) \(\frac{1}{3} \) 1\(\frac{1}{3} \) 8cc inch diameter and all of seven threads per inch. Holtzapffel and Co have taps &c for screws of ten threads per inch of fifteen different kinds which are used for slides and adjust ments besides less extensive repetitions of other threads

It is also in some cases requisite to have right and left hand sciews of the same pitch, that amongst other purposes they may effect simultaneous yet opposite adjustments in machinery, as in some universal chucks and also some few sciews, the threads of which are double triple, quadruple, and so forth, for giving to sciews of small drameters considerable rapidity of pitch or traverse, or a fixed ratio to other sciews associated with them, in the same piece of mechanism

Fourthly Friction prevents the strict maintenance of standard gages for screws. The universality of system, to be perfect, should admit that a bolt made this year in London, should agree with a nut made ten or fifty years hence in Manchester, which is not called for, nor perhaps possible, if an absolute fit be required in reference to this we must commence by a small digression

In comparing the Exchequer Standard Yard Measure with the copies made from it, friction in no way interferes, as the two measures are successively observed through two fixed micro scopes, as before adverted to—But we cannot thus measure a cylinder, as either callipers or a counterpart cylinder placed in contact, must be employed as the test—ind each time of trial the cylinder is absolutely, although very slightly worn by the traverse of the surfaces against each other—the form of the cylindrical gage being simple, to increase its durability, it is worked to the figure after having been hardened

In measuring a sciew, the callipers are insufficient and the one sciew must be sciewed into the other from this trial much more motion, friction, and abiasion arise. Further, the sciew gage cannot from its complex form be readily figured after the material has been hardened, and if hardened subsequently to the helical form having been given, the measure becomes in some degree, altered, from the action of the fire and water, which is a fatal objection

Under ordinary and proper management, the production of a number of similar pieces may be obtained with sufficient exactitude, by giving to the tool some constant condition. For example, a hundred nuts tapped with the same tap will be very nearly this in their thread, and a hundred screws passed through the hole of a screw plate, will similarly agree in size, because of the nearly constant dimensions of the tools, for a moderate period


In practice, the same relative construcy is given to the dies

of die stocks and bolt screwing engines, and partly so to the tools of the screw cutting lathe. Sometimes the pressure or adjusting screw has graduations or a micrometer, and numerous contrivances of eccentrics, cams, and stops are employed to effect the purpose of bringing the die or turning tool to one constant position for each succeeding screw, these matters are too varied and general to require more minute notice. Part of such modes may serve sufficiently well for ten, or a hundred screws provided that no accident occur to the tool, but if it were attempted to extend this mode to a thousand, or a hundred thousand pieces the same tool could not, even without accident, endure the trial it would have become not only unfit for cutting, but also so far worn away as to leave the last of the works materially larger than the first

In respect to screws the instrument, the size of which claims the most importance, is perhaps the plug tap or that which removes the last portion of the material, and therefore deter mines the diameter of the internal thread but as the tap is continually, although slowly wearing smaller, the first and last nut made with it unavoidably differ a little in size. It is on account of the wearing of the tap, amongst other circumstances, that when sciews and nuts are made in large numbers, and are required to be capable of being interchanged, it becomes needful to make a small allowance for error, or to make the sciews a trifle smaller than the nuts

In order to retain the sizes of the taps used by Holtzapffel & Co





they some years ago made a set of original tips exactly of the size of the proposed sciews, and to be called A, these, when two or three times used to rub off the buirs where employed for cutting regulating dies B of the form of fig 639, with two shoulders, so that the dies could be absolutely closed, and yet leave a space for the shavings or cuttings. In making all their plug taps they are first prepared with the ordinary shop tools until the taps are so nearly com

pleted, that, grasped between the regulating dies B, the latter close within the fortieth of fiftieth of an inch, therefore leaving the dies B next to nothing to perform in the way of cutting but only the office of regulating the drameter of the working

plug taps Should the dies B meet with any accident, the taps A, which have to this stage been only used for one pair of regulating dies exist for making repetitions of B. This method has been found to fulfil its intended purpose very effectually for several years, but at the same time it is not proposed to apply this or any other system universally

In conclusion, it may be said that by far the most important argument in favour of the adoption of screws of aliquot pitches applies to steam machinery and similar large works, and that, principally, because it brings all such screws within the province of the screw lather with change wheels which has become, in engineering establishments and some others, a very general tool. This valuable tool alone, renders each engineer in a great measure independent of his neighbour, as screws of 2, $2\frac{1}{4}$, $2\frac{1}{2}$, 3, 10, or 20 threads in the inch, are readily measured with the common rule, and copied with the screw wheels, and a single pointed tool, or an ordinary comb or chasing tool with many points

And therefore, with the modern facility of work were engineers severally to make their screw tackle from only the written mea sures of any conventional table, they would be at once abundantly within reach of the adjustment of the tools and that without any standard gages, the strict introduction of which would almost demand that all the tools made in uniformity with them should emanate from one center, or be submitted to some office for inspection and sanction,—and this would be indeed to buy the occasional advantage at too dear a rate

It must, however, be unhesitatingly granted, that the argument applies but little, if at all, to a variety of screws which from their smaller size are not made in the screw lathe, but with dic stocks and the hand chasing tools only, and which are employed in branches of art that may be considered as almost isolated from one another, and therefore not to require uniformity

For instance, the makers of astronomical, mathematical, and philosophical instruments, of clocks and watches, of guns, of locks and ironmongery, of lamps, and gas apparatus, and a multitude of other works, possess, in each case an amount of skill which applies specifically to these several occupations, so that unless the works made by each are returned to the absolute makers for reparation, they are at any rate sent to an individual engaged in the same line of business

Under these circumstances it is obvious that the gunmikers, watchmakers, and others would derive little or no idvantage from one system of threads prevailing throughout all their trades, in many of which, as before noticed partial systems respectively adapted to them already exist. The means employed by the generality of artizans in matching strange threads are in addition entirely independent of the screw lathe and apply equally well to all threads whether of iliquot measures or not as it is usual to convert one of the given screws if it be of steel, into a tap, or otherwise to file a screw tool to the same pitch by hand wherewith to strike the thread of the screw or two, and when several screws are wanted a pair of dies is expressly made

But at the same time that, from these manifold considerations, it appears to be quite unnecessary to interfere with so many existing arrangements and interests it must be freely admitted that advantage would ultimately accrue from making all new screws of aliquot measures, and which, by gradually superseding the old irregular threads, would tend eventually although slowly, to introduce a more defined and systematic arrangement in screw tackle, and also to improve their general character

The author has now concluded the various remarks he proposes to offer on the formation of the sciew for the general purposes of mechanism on the modes pursued by various celebrated mechanicians for its improvement and on various practical considerations which influence the choice of sciews but he is desnious briefly to advert to some few peculiar interesting and practical methods of producing this important element of construction

The threads of wrought iron screws have been forged whilst red hot between top and bottom swage tools having helical surfaces like those of screw dies screws have been twisted whilst red hot out of rectangulu bars, by means of the tail vice and hook wrench, as in making screw augers. Screws intended for ordinary vices, have been compressed whilst cold, somewhat as with die stocks, the lever is in this case very long, and the die is a square block of hardened steel with an internal square thread screw, left smooth or without notches. The thread is partly indented and putly squeezed up, the diameter of the

iron cylinder being less than that of the finished screw this
action severely tests the iron *

A patent was taken out in 1839 by Mr Wilks for making both the boxes and sciews of tail vices and presses in malleable cast iron. The peculiarities in the moulding processes are that the core for the hollow worm or box, is made in a brass core box, divided longitudinally into three parts, which are filled separately, and closed together with a stick of wood in the center to stiffen the core and serve for the core print. The core box is then connected by rings like the hoops of a cask, this completes the core, which is removed, dired, and inserted in a mould made from a model of the exterior of the box constructed as usual

In moulding the solid screw, the moulding flisk is a tube with a cap having an internal thread, exactly like that of the sciew, the tube is filled with sand, and a plain wooden rod, nearly equal in diameter to the axis of the screw, is thrust in the sand to form a cavity. The screwed cap is then attached to the flask, and a biass sciew exactly like that to be cast, is guided into the sand by means of the screw cap, and taps a thread in the sand mould very accurately. The screw cap is then removed and the second part of the flask in which the head of the vice sciew has been moulded, is fitted on, and the sciew is poured.

After having been cast, the screws and boxes are rendered malleable in the usual way except that they are placed vertically, in general the box is slightly connected with a screw tap

Large quantities of sciews have been produced by Mr Warien's patent process for manufacturing screws of malleable cast non for joinery work a most ingenious plan is employed therein for winding the models into and out of the solid sand mould, which is thereby made beautifully smooth and accurate. After the last description the general method will be readily understood, if it be considered that the first side of an ordinary flask is rammed full of sand on an iron plate having conical projections like the heads of sciews, in regular lines half an inch asunder, and ribs to form the channels by which the metal is to be admitted. The flask when filled is placed in a machine, beneath a plate of metal

^{*} Applied by the Wrights Vice makers of Limingham See Technological Repository, vol vi p 289 Lor the mode of soldering the thread in the box or the hollow sere w of the vice see the same paper and also vol 1 p 443 of this work

with screwed holes also half an inch asunder and each fitted with a pattern screw, terminating above in a crank like a winch handle say of $\frac{1}{4}$ inch radius

Any of these screws on being turned by its crank with the fingers, would pierce the sand as in Wilks's process—but by employing a crank plate pierced with a like number of holes to receive the pins of all the cranks—the whole of the sciew models are twisted in at once, and removed with the same ficility

The notches of the screws are cut by a cucular saw, if large they may be moulded. The cast iron sciews are subsequently rendered malleable, by the decarbonizing process described in the former volume, pages 259 260 *

Mi Peikins's patent cast iron water pipes, with screw joints, may be considered as another example. The patent pipes are connected with right and left hand screws and loose sockets, which draw the ends of the pipes into contact, or rather against a thick greased pasteboard washer interposed between them. The pipes are made entirely by foundry work, and from patterns and core boxes divided in halves in the ordinary manner. Mr Peikins says that although the patent pipes possess several advantages over ordinary cast iron pipes with the spigot and faucet joint, they are produced at the same price, and save much ultimate expense in fixing †

In Mr Scott's subsequent patent for joining cast non and other pipes for various fluids, the method commonly known is the 'union joint' is employed and which offers additional facility in the removal of one pipe from the midst of a series. Each pipe has at one end a projecting external screw, and at the other a projecting fillet or flange—the socket is cast loosely around the pipe, but is prevented from being removed or lost by the projections at each end of the same—The inside screw of the socket cast upon the first pipe a, screws upon the external screw of the next pipe b, until the socket comes in contact with the fillet on a, and thus draws a and b into close contact with the washer that is placed between them—One cast non pipe and its appro-

^{*} Date of Mr Warren's patent for an improved machine for making screws 4th August 1841 described in Rep of Patent Inv for March 1843, also in the Glasgow Mcchanics and Engineers Mag same date. The machine was constituted by Mr Ingram of Birmingham and is successfully worked by him

[|] Date of patent, 21st Sept 1841, described in Rep of Patent Inv Oct 1841

priate socket are moulded at one operation which is curiously accomplished by the use of two sand cores, the inner of which is of the length of the pipe, and solid as usual the outer core is made as a loose ring around the inner. The union joint is differently produced by Mr. Scott in wrought iron and soft metal pipes.*

A peculiu method of making screw joints is employed in Mi Rand's patent collapsible tubes for preserving paints provisions, &c The tin whilst at the ordinary atmospheric tempe rature, is forced, almost as a cement, into the screwed recesses of brass or iron moulds and the threads are thus made to assume the helical form, with great rapidity, uniformity, and perfection †

Indeed it is difficult, nay impossible to find the limit of the methods employed in producing, or those of subsequently employing this interesting object, the screw, which not only enters in endless variety into appliances and structures in metal, wood, and other miterials, but is likewise rendered available in most difficient yet important modes, as in the screw piles for sandy foundations, screws for raising water, for blowing furnaces ventilating apartments, and propelling ships

Should it appear that the formation of the screw has been treated in greater detail than the other subjects with which it is associated, either as regards the modes of proceeding of the mechanism employed, the author would observe that it appeared to him that by this mode alone he could introduce in something like order, a variety of interesting particulars, which although they have occupied very many pages, are but as a fragment of what might be said on a subject which has engrossed so much attention

^{*} Date of patent 6th July 1842 See Mechanics Magazine 1843 page 104

[†] Rand s second prient for making collapsible vessels 29th Sept 1842 Under the first patent the tin was drawn into tube (see vol 1 p 431) and the convex and screwed ends were east and soldered in by the improved method the entire vessel is made from a small thick perforated disk of tin by one blow of a fly press. The lower part of the mould has a shallow cylindrical cup concave and tapped at the base the upper part of the mould is a cylinder as much smaller than the cup as the intended thickness of the metal which on the blow being given, is compressed into the screw and ascends four or five inches up the cylinder or ram. For large sizes a hydrostatic press is employed.

CHAPTER XXVII

SAWS

SECTION I -DIVISION OF THE SUBJECT-IORMS OF SAW TITH

THE saw is the instrument which is almost exclusively em ployed for converting wood, ivois, and vinous other substances from their original forms to those shapes required in the arts, and in general, the thin seriated blade proceeds along the super ficies of the required object whether they be plane, circular, or irregular and effects its office with considerable speed and accuracy, and comparatively insignificant waste Unless a tree is felled with the axe, the siw is employed, first, in the forest in separating the tice from its roots, and cutting it into lengths convenient for transport, the saw is next used at the saw pit in converting the timber into plank and scantling, of various dimen and the saw is subsequently employed in the workshop, by the joiner, cabinet maker, and numerous other artisans, in reducing the plank or board into smaller pieces, ready for the application of the plane, the file, and other finishing tools some elaborate and highly ornamental aits, the saw, as will be shown, is nearly the only instrument used

Many of the machines now employed in sawing are, as it will be seen, derived from similar processes before executed, and in many cases less perfectly so, by hand labour. The saw is but little used for similar preparatory works in metal, the figuration of which is for the most part, accomplished by the furnace, the hammer or rollers, matters that have been described in the first volume.

It is proposed to consider saws in two groups, namely rectilinear saws, and circular saws—the precedence will be given to the more simple kinds, or those rectilinear saws used by hand, and generally without additional mechanism, conditions which do not apply to the circular saw, which is always combined with some portion of machinery—And for the perspicuity of the whole subject it has been thought best to place the general remarks on the forms of teeth of saws, at the beginning of the chapter,

from which arrangement many advantages appear to arise notwithstanding that it implies the necessity for adverting to various saws before their specific or particular descriptions have been given and which objection will be in part removed by the previous inspection of the table on page 699

The blade of the rectilinear saw is usually a thin plate of sheet steel which in the first instance is rolled of equal thickness throughout the teeth are then punched along its edge, previously to the blade being hardened and tempered, after which it is smithed or hammered, so as to make the saw quite flat. The blade is then ground upon a grindstone of considerable diameter and principally crossways, so as to reduce the thickness of the metal from the teeth towards the back. When by means of the hammer, the blade has been rendered of uniform tension or elasticity, the teeth are sharpened with a file and slightly bent, to the right and left alternately, in order that they may cut a groove so much wider than the general thickness, as to allow the blade to pass freely through the groove made by itself. The bending or lateral dispersion of the teeth is called the set of the saw.*


The circulu saw follows the same conditions as the rectilinear saw if we conceive the right line to be exchanged for the circle, with the exception that the blade is, for the most part, of uniform thickness throughout, unless, as in the circular veneer saws, it is thinned away on the edge, as will be explained

It is to be observed that the word pitch when employed by the saw maker almost always designates the inclination of the face of the tooth, up which the shaving ascends, and not the interval from tooth to tooth, as in wheels and screws

In the following diagrams of teeth, which, for comparison, are drawn of equal coarseness or size, some kinds are usually small and seldom so distant as $\frac{1}{2}$ an inch asunder—these are described as having 2, 3, 4, 5, to 20 points to the inch—and such of the other teeth represented as are used by hand, are commonly from about $\frac{1}{2}$ to $1\frac{1}{4}$ inch asunder and are said to be of $\frac{1}{2}$ or $1\frac{1}{4}$ inch space—although some of the circulu saws are as coarse as 2 to 3 inches and upwards from tooth to tooth

^{*} For the mode of hardening and tempering saws the reader is referred to vol 1 pp 249—250 of this work and for the principles upon which they are flattened and rendered of uniform elasticity to the same volume pp 414—427

The usual range of size or space for each kind of tooth is accordingly expressed beside the diagrams as are also the angles of the faces, and of the tops of the teeth measured from the line running through the point of the teeth, or the edge of the saw

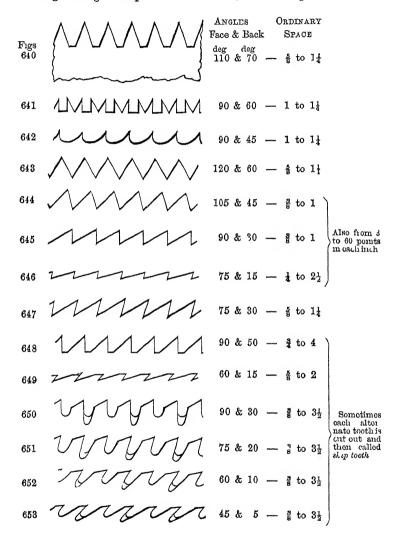

The angle of the point itself will be found by subtracting the angle of the back from that of the face of the tooth, or the less from the greater of the first two numbers

The four varieties of teeth at the commencement of the an nexed group from presenting the same angles in either direction also cut in both directions in fact the face and back may be considered to change places in each alternate cut These teeth are used for such cross cutting saws as have a handle at each end and are worked by two or more men, as in cutting down trees and dividing them when they have been felled, and similar saws are used for the soft building stones when they are first raised from the quarry Fig 610 is called the peg tooth, or the fleam tooth, and is much used in North America and clsewhere fig 641, the M tooth which is so named from its resemblance to the letter, is now but very rarely employed, fig 642, the half moon tooth, is used in South America for cross cutting, and fig 643 is that commonly described as the cross cutting tooth, although in England the peg tooth or 640, the hand saw tooth or 645, and the gullet tooth 650, are also used for cross cutting timber, more especially the last form when sharpened more acutely than usual, and used to cut in one direction only

Referring to the preliminary remarks on cutting tools, pages 457 to 463 of the present volume, it will be seen that saws were considered to belong to the group of scraping tools, and that e and f fig 316 were viewed as the generic forms of the teeth, the angle of which is commonly 60 degrees from the circumstance of the simple angular teeth being mostly produced by angular notches filed with two of the sides of an equilateral triangular file, and therefore the points assume the same angle as the spaces, or 60 degrees

But the angle of 60 degrees is variously placed, for instance, the teeth in fig 643 are said to be upright, or to have no pitch and the teeth in fig 646 to be flat, or to have considerable pitch these may be considered as the extremes of this kind of tooth between which every inclination or pitch is more or less used but for the sake of definition, four varieties have been assumed the straight lines of which are 15 degrees as under

Fig 643 as already explained, is the ordinary tooth for cross cutting, and which, from presenting equal angles on each side, is said to be of upright pitch. The tooth that is, however, more generally used for small cross cutting saws is fig 644 which is inclined about 15 degrees from the last. This form of tooth, called slight pitch, is used for the cross cutting saws for

firewood, those for joiners use, and also for those employed in cutting up ivory in which latter case the blade is stretched in an uon frame

Fig 645 is the tooth in most general use it is known as ordinary pitch of the hand saw tooth. The face is perpendicular and the back inclines at an angle of 30° from the edge of the saw, or the line of work. Most of the saws used by cabinet makers and joiners are thus toothed or rather at an inclination intermediate between figs 644 and 645

The tooth, fig 615 is likewise generally employed for saws used for metal, for circular saws used for fine work, including veneer saws, and for many of the circular saws for cross cutting

In fig 646 the fice of the tooth is 'set forward or stretches beyond the perpendicular at an inclination of 15 degrees this kind is employed in mill saws used abroad for soft woods, and they are the most inclined of those teeth formed by the two faces of the triangular file at the one process

Nearly the same tooth as fig 646 is also used for circular saws and cutters for metal. The object is then to assimilate the points to those suitable to tools for turning the metals, therefore, the angle of separation betwit the end of the tooth and the plane to be wrought is made small. The hook form of the point is incidental to the employment of the triangular file, and is also proper for the material to be cut

Fig 647 is a form of tooth that is set forward like 646, but the point is more acute than the last five, or it is about 45 degrees instead of 60. It is used for some circular saws, and occasionally also for pit saws and cross cut saws, and is frequently employed for cutting soft Bath stone.

Sometimes the acute angular notch is not continued to an internal angle a method adopted in some mill saws, both those of ordinary or perpendicular pitch, fig. 648, and those of greater pitch or inclination, fig. 649, the former being more common for rectalinear, the latter for circular saws. Various intermediate forms are met with

The three kinds of teeth, figs 617, 618, and 619, from being more acute than 60 degrees, cannot be sharpened with the ordinary three square or equilateral file, as it will not reach to the bottoms of the teeth. The mill saw file is then used, namely, a thin flat file with square or round edges, as the definition

of the internal angle is not needful although given by the punch in the formation of the tooth. The angular mill saw teeth are employed, partly because they are more easily sharpened than the gullet teeth which conclude the series of diagrams.

The teeth, figs 650 to fig 653, are called gullet teeth, on account of the large hollow or gullet that is cut away in front of each tooth in continuation of the face and they are also known as briar teeth. The tooth is in general cut by one punch filling the entire space, but two punches an angular and a gulleting punch have been occasionally used

The gullet is adopted to allow the tooth to be sharpened with a round or half round file, by which the face of the tooth becomes concave when viewed edgeways, and acquires a thin and nearly knife like edge, as will be explained — The increased curvilinear space allows more room for the sawdust, and is less disposed to retain it than the angular notch

For the facility of explanation, the faces of the teeth differ fifteen degrees in pitch, and the tops of the tooth are variously inclined to the edge of the saw as tabulated. The medium kinds figs 651 and 652 are perhaps more common, although the saw maker forms the teeth originally more acute for the facility of first sharpening and the sawyer sometimes neglects to file the gullets in the same proportion as the tops, by which the advantage attending the gullets is in a measure lost. Each alternate tooth appears to be deeper than the others, but this only arises from the peculiar mode of sharpening the gullet with a round or half round file, which makes a broad chamfer, the edge of which is elliptical

If or the general purposes of pit saws, and also for straight and circular mill saws, the medium teeth, 651 and 652, are suitable, but for hard woods, as mahogany, rosewood, and others and also for cross cutting, the form should lean towards fig 650 and for soft woods and ripping with the grain, towards the more inclined tooth, fig 653. The whole of the forms of teeth may be materially diverted from those originally given by the saw maker, in the important process of sharpening, and which will be now described, as the most proper way of concluding the remarks respecting the angles or bevels given to the edges of the teeth, independently of their simple profiles.

SECT II -SHARPENING AND SETTING SAWS

The processes denominated sharpening and setting a saw consist as the names imply, of two distinct operations the first being that of filing the teeth until their extremities are sharp the second, that of bending the teeth in an equal manner and alternately to the right and left so that when the eye is directed along the edge, the teeth of rectilinear saws may appear exactly in two lines, forming collectively an edge somewhat exceeding the thickness of the blade itself

Circular saws require exactly similar treatment, if we consider the tangent of the circle to be substituted for the right line, and therefore the sharpening of straight saws will be first described, and those peculiarities alone which attach to the sharpening of circular saws will be then separately noticed

Setting the teeth which in practice is always subsequent to the sharpening, will also be placed subsequently in the section, the commencement of which will be devoted to the modes of holding the saw in the operation of sharpening and the description of the files used


In sharpening the saw it is mostly fixed perpendicularly, and with its teeth upwards various modes being adopted according to circumstances. The tail vice used by the saw maker in sharpening the saw measures from nine to twelve inches wide in the chops, and also nine to twelve inches high, or above the screw, proportions exceeding those of tail vices used by mechanicians generally. Slips of wood, or clamps of sheet lead bent to the figure of the jaws of the vice, are interposed between the saw and the vice so that the elasticity of the wood, or the inelasticity of the lead may give a firm hold, and prevent the disagreeable screeching noise that accompanies the action of the file when the saw is insecurely held, and the greater the noise the less the amount of work that is done

The joiner employs a wooden vice resembling that of the saw maker as to proportions, but it is fixed in the screw chops of his work bench

In sharpening pit saws the sawy a soldom finds it necessary to remove the handles or frames. The long or whip saw, and others not having frames, we supported in the sawing horse, a trestle about five feet long and two feet high, with four or five

uprights or wooden pegs, sawn half way through to receive the back edge of the blude, the horse ruses the edge of the saw about three feet from the ground

A more convenient mode is to have a jointed horse, fig 654, the two halves of which open somewhat like the jiws of a pair of pliers, when the saw has been inserted, the legs of the horse are distended by the stretchers at the ends and fix the blade

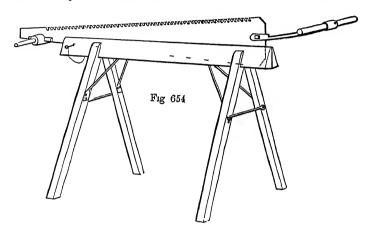

The files used in sharpening says are triangular, round half round, and mill say files. The equilateral triangular files, commonly designated as three square files, vary from about three to nine inches long, for small saws they are generally taper, for large, sometimes nearly parallel when they are called blunts, a term applied to other nearly parallel files. The triangular file is exclusively used for the teeth of figs 643 to 646, and more or less for all the rectilinear teeth. For small teeth, the double cut Lancashire files are the most used, on account of the keen ness of their edges, and the common size is $4\frac{1}{2}$ inches long. The generality of other saw files are single or float cut, that kind of file tooth being considered to 'cut sweeter, and do more work

Round files from 5 to 8 inches long are used in saw mills for the gullets of the teeth, figs 650 to 653, and flat files for the tops but the pit sawyer and some others always employ half round files, as the one instrument may be then applied to both purposes—these files are always blunt or parallel

Mill saw files are in general thin, flat and parallel, from 6 to 11 mehes long float cut on the sides, and with smooth, square

edges Sometimes, however, they have round and cutting edges, and are of taper figure

The five ordinary modes of sharpening saws will be explained and illustrated by enlarged diagrams in three views, which denote the ways in which the teeth are bevelled and set but a few general observations that apply to each mode will be first given

In general the angles of the points of the saw teeth are more acute, the softer the material to be sawn, agreeably to common usage in cutting tools, and the angles of the points, and those at which the files are applied, are necessarily the same. Thus in sharpening saws for metal, the file is generally held at 90 degrees both in the horizontal and vertical angle, as will be shown, for very hard woods at from 90 to 80 degrees and for very soft woods at from 70 to 60 degrees, or even more acutely. The vertical angle is about half the horizontal.


In general the horizontal angle of the file is alone important, (that is, considering the saw blade vertical and with the teeth upward) although to assist the action of the file it is customary to depress the handle a little below the point of the file, and only to file on those teeth which are bent from the operator. When the tooth that is bent towards the individual is filed, it vibrates with much noise and is disposed to strip off the teeth from the file, instead of being itself reduced

To insure the action of each tooth, the edge of the saw should be quite straight, it is therefore occasionally topped, by laying the file divested of its handle, lengthways upon the teeth, and passing it along once or twice, to reduce these few points which may be above the general level. The file is pressed haid at the two ends of the saw, where the blade is less worn and is applied lightly in passing the middle, the file should be held perfectly square to reduce the edges alike. The new point of each tooth is then made to fall as nearly as possible upon the center of the little facet thus exposed by the process of topping or ranging the teeth, and the faces or fronts of the teeth are always filed before the tops of the same

When the file is perfectly square to the saw plate, every tooth is sharpened exactly alike, and in direct succession, that is, in the order 1, 2, 3, 4 Whenever the file is inclined, the teeth 1, 3,

5 7, 9, are sharpened, say to the light, and the teeth 2, 4, 6, 8 to the left after which they are set in the same order, so as collectively to form a double line of points somewhat resembling the tail of a bird, when the section is coarsely magnified and exaggerated as in the several diagrams to be given The teeth are the mole set the softer or the wetter the wood


The first diagram on sharpening saws, fig 655, represents in plan and two elevations the saw teeth that are the most easily sharpened namely, those of the fiame saw for metal commonly used by the smith, the teeth of this saw are not set or bent in the ordinary manner, owing to the thickness and hardness of the blade, and the small size of the teeth

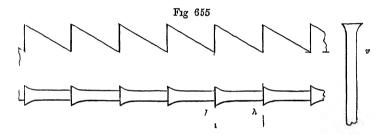

The smith's saw blade, when dull is placed edgeways upon the jaws of the vice, and the teeth, which are placed upwards, are slightly hammered, this upsets of thickens them in a minute degree, and the hammer face reduces to a general level those teeth which stand highest. They are then filed with a triangular file held perfectly square, or at ninety degrees to the blade, both in the horizontal direction h, and the vertical v, until each little facet just disappears so as to leave the teeth as nearly as possible in a line, that each may fulfil its share of the work

The most minute kind of saws, those which are made of broken witch springs have teeth that are also sharpened nearly as in the diagram, fig 655, but without the teeth being either upset or bent as in very small saws the trifling burr, or rough wiry edge thrown up by the file, is a sufficient addition to the thick ness of the blade, and is the only set they receive

Three modes of spacing out the teeth of fine saws will be now described, and which modes, although not employed by the six maker, may assist the amateur who is less accustomed to the use of the file Fine saw teeth are sometimes indented with a double chisel, fig 656, the one edge of which is inserted each time in the notch previously made, and the other edge makes the following indentations—the intervals thus become exactly alike, and the teeth are completed with the file—For still more delicate saws recourse may be had to a little bit of steel bent at the end as a minute rectangular hook, which is magnified in fig—657, the hook or filing guide, being inserted into each tooth as it is successively formed, regulates the distance of the file for the next tooth, as the file is allowed to bear slightly against the blunt and hardened end of the hook




The third mode is used for piercing and inlaying saws, these measure about one one thirtieth of an inch wide one one hun diedth thick, and have about twenty points to the inch for wood, thirty for ivory, forty for ebony and peail, and sixty for metals. They are made from pieces of watch spring, which are straight ened by rubbing them the ieverse way of their curvature through a greasy rag, after which they are cut into strips with shears. When the saw is either being made, or shripened it is kept distended in its frame and is laid in a shallow groove or kerf in a plate of brass embedded in the wood block, fig. 658 which is clamped to the table. First, the back of the blade is filed smooth and round the edge is then smoothed, after which the teeth are set out, beginning near the handle of the frame

The spaces between the teeth are determined, in this case, by the facility with which the hand appreciates any angular position to which it is accustomed. Thus in the act of filing the teeth,—the file is always used, say at an horizontal angle of twenty degrees with the blade—the file is sent once through the first tooth, and allowed to rest for an instant without being drawn backwards, the file still resting in the first notch of the blade as shown in elevation is then placed two to five degrees nearer square in the horizontal angle, or at fifteen degrees with the

blade, instead of twenty—It is then supported for an instant on the edge of the wood block, and raised out of the notch, the file, whilst supported on the block, as in the dotted line is replaced on the saw at twenty degrees, its first position—By the two lateral movements it is shifted a trifle to the right, and a second notch is made at the spot thus determined—The routine is continued, and after each traverse of the file the stepping process is repeated, during which the file rests alternately on the saw blade, and on the edge of the block, by which curious yet simple mode the spaces of the teeth are given with great rapidity and exactness


In this first range each notch has only received one stroke of the file, but three or four ranges commenced from the other end of the blade are required to bring the teeth up sharp

The second diagram, fig 659, illustrates the peg tooth, but it may also be considered to apply to 641 the M tooth, and, in part, to the mill saw tooth, 648. The points of the cross cutting saws for soft woods are required to be acute or keen, that they may act as knives in dividing the fibres transversely

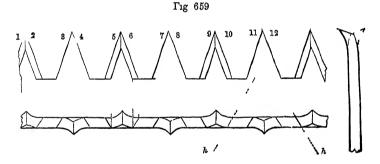

The sides 1, 5 9, that is, the left of each alternate tooth, are first filed with the horizontal angle denoted by h, and then the opposite sides of the same teeth, or 2, 6, 10, with the reverse inclination or h'. The other teeth are then treated just in the same manner, from the other side of the blade, that is, first the sides 12, 8, 4 and then 11, 7, 3, are successively filed, the work being thus completed in four ranges. The first and second ranges are accomplished, a few inches at a time, throughout the entire length of the saw, after which the third and fourth are completed in the same interrupted order.

The third diagram, fig 660, may be considered to refer gene rally to all teeth the angles of which are 60 degrees (or the same as that of the triangular file,) and that are used for wood. The most common example is the ordinary hand saw tooth but teeth of upright pitch, such as the cross cut saw fig 643, or of considerable pitch, as in 646, are treated much in the same manner.

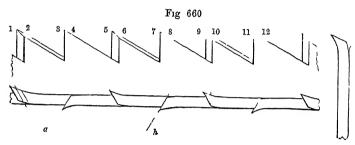


The teeth having been topped, the faces 1, 5, 9, are first filed back, until they respectively agree with a dotted line a supposed to be drawn through the center of each little facet produced in the topping, the file is then made to take the sides 2 and 3 of the nook until the second half of the facet is reduced, and the point of the tooth falls as nearly as may be on the dotted line a. The two sides 6 and 7, those 10 and 11, and all the others, are similarly filed in pairs. The latter process reduces the second series of faces 3, 7, 11, to their proper positions, and therefore when the saw is changed end for end, it only remains to file the tops or sloping lines 4, 8, 12

The first course takes the face only of each alternate tooth the second course the back of the former and face of the next tooth at one process and the third course takes the top only of the second series, and completes the work. This order of proceeding is employed that the faces of the teeth may be in each case completed before the tops or backs


The fourth diagram, fig 661, which follows next in order, exhibits also in three elevations a somewhat peculiar form of tooth, namely, that of the pruning saw for green wood. The blade is much thicker on the edge than the back, so that the teeth are not set at all. The teeth are made with a triangular file, applied very obliquely as to horizontal angle, as at h, sometimes exceeding 45 degrees, but without vertical inclina

tion as at v, and the faces of the teeth are nearly upright, as in the hand saw

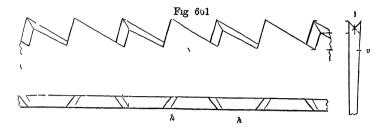

Looking at the pluning saw in profile it appears to have large and small teeth alternately—this only arises from the excessive bevil employed, the large sides of the teeth are very keen, and each vertical edge is acute like a knife and sharply pointed in consequence of which it cuts the living wood with a much cleaner surface—and less injury to the plant, than the common hand saw tooth

The fifth diagram fig 662, explains the method employed in sharpening gullet or briar teeth, in these, as before explained, there are large curvilinear hollows, in the formation of which the faces of the teeth also become hollowed so as to make the projecting angles acute

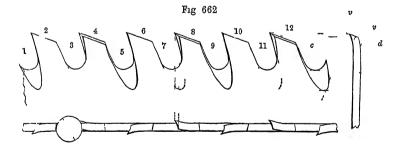


The gullets, 3 7 11 are first filed and from the file crossing the tooth very obliquely, as at vv in the section, the point of the tooth extends around the file and gives the curvature represented in the plan. The file should not be so large as the gullet it is therefore requisite that the file be applied in two positions, first upon the face of the one tooth, and then on the back of the preceding tooth. The tops of the teeth, 4, 8, 12

are next sharpened with the flat side of the file the position of which is of course determined by the angles c and d—the former varies with the material from about 5 to 40 degrees with the edge and the latter from 80 to 60 degrees with the side of the blade, the first angles in each case being suitable for the hardest and the last for the softest woods. The alternate teeth having been sharpened, the remainder are completed from the other side of the blade, requiring in all four ranges.

The gullet tooth accomplishes, in a different manner, and in one possessing some peculiar advantages, that which occurs from the horizontal inclination of the file in most other cases, and although the position may seem difficult, it will be found very manageable, as the hollow forms a convenient bed for the file—See Appendix, Note B L, page 1011


The saw having been sharpened it is afterwards set, or as before explained, the teeth are bent. The best mode is that which is almost always adopted by the saw maker, who fixes in the tail vice a small anvil or stake with a rounded edge, such as fig 663. The saw is held with its teeth along the center of the ridge, and the teeth are bent upon, or rather around the curve of the stake with two or three light blows of a small hammer also shown, the face of which is at right angles to the handle, and narrow enough to strike one tooth only

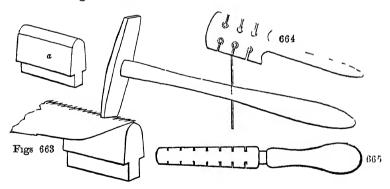

The set, or lateral curve, given to each alternate tooth, is in great measure determined by the curve of the stake, the edge of which for fine saws has a ridge like a pointed gothic window Half the teeth having been bent, the saw is changed and for end, and the intermediate teeth are similarly treated

Those who are less used to the treatment of the saw employ the saw set for bending the teeth it consists of a narrow blade of steel with notches of various widths for different saws, fig 664 is for large, and fig 665 for small saws. In using the saw set the saw is allowed to remain in the clamps after having been filed, and the alternate teeth are inserted a little way in that notch which fits the blade the most exactly, and they are bent over by applying a small force to the handle, which is either rused up or depressed equally for each tooth

In some few cases saw set pliers, fig 666 are used Two adjustments are required, respectively to determine the quantity of the tooth which shall be bent, and the angle that shall be given to it. The quantity is adjusted by shifting the stop b, which is held by the thumb sciew c, that passes through a mortise in b the angle of the part bent is adjusted by the sciew d. The tooth is first grasped between the jaws of the pliers, which are then rotated until the sciew d touches the blade a

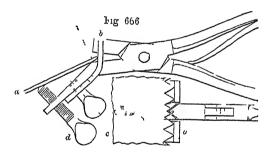


In which way soever the saw is set it iequiles to be accomplished with great uniformity, so that the two series of points may form two exact lines. It is proper to change ends with the blade in order that each side may have as nearly as possible, the same treatment, as unless the two sides of the saw are very nearly in the same condition, or set alike, the saw is apt to run, or cut a crooked instead of a straight path it cuts most rapidly on the side that is most set, and consequently glances off in a curve from its too rapid encroachment.

The only changes in treating the circular saw arise from the difference between the right line and the curve, that is, the files are applied in the same relation to the tangent of the circle, that

they are to the rectilinear edge of the straight saw. When the teeth of circular saws are topped a small lump of guindstone is held upon the saw bench and against the revolving saw and moved continually sideways, the highest teeth are soon rubbed down, indeed almost in a moment, as only a very small quantity is thus removed from them, sometimes a file is used instead of the stone.

In sharpening circular saws with angular teeth, and the tops of gullet teeth, they are clamped between two upright boards, connected by a sciew passing through the center of the saw For saws of small diameter the three are nipped in the vice but for large saws the boards are shaped like the letter T and are screwed against an upright post or the side of the bench, by a sciew bolt and nut

In gulleting circular saws the two boards grasping the saw are often fixed at an angle of about 30 degrees, by which the file is brought to the horizontal position, and the saw is turned over when the gullets on one side have been finished



In setting the teeth of the circular saw, all the former modes may be employed and also one other little instrument which is represented in fig 667. It consists of a bed or anvil of steel, which is held in the vice at a it has an axis c, placed at such a distance from the sloping plane on a, as suits the radius of the saw, and the end b of the upper piece, which is somewhat elastic, is filed to a corresponding angle, and is besides pointed so that the blow of the hammer may only bend or set one tooth at a time, as shown by the dotted lines in the inverted plan b'. The axis, shown detached and in the other view at c', is a turned block of brass having a shoulder to fit the hole in the saw, two diametrical mortises for the pieces of steel a and b, and also five binding sciews to retain the several parts in position

SECT III -RECTILINLAR SAWS USED BY HAND

Rectilinear saws used by hand, are divisible into three groups, as arranged and tabulated on the next page

TABLE OF THE DIMENSIONS OF RECTILINEAR SAWS

The first column refers to the pajes where the saws and their uses are described. The last column refers to the Birmingham non wie and sheet iron ga e-the comparison of which with ordinary linear measure is given in the table on page 1013 of the Appendix

	The state of the s			yev		ne i	avie on	page 10.	3 0	f the A	ррепа	lix ———
D		APER	SAV	ws :	MOSTL	Y W	TTHOU!	T FRAME	3			
Pr e	With a handle at i i h end	Length of Blade			Width it wile and		ılth it Howend			pace of looth	Gage of Metal	
700		4 t	10 ft	6	to 12	3	to 7 1	610 t 643 1 670	3 4	to 1 in	12 t	1.
701	- and Lys or with pass	6	8	9	12	31	5	650 & 65	1 3	ī	12	16
703		4	6	7	11	3	41		2017	34	15	18
101	*helloe or pit turning saw	4	6	3	4	2	3		1/2	8	13	15
	With a handle at one end	Length of Blade		Wi	Width at wile end		idth at rowend	Form of Tooth		onts inch	Gage of Metal	
708	Rip saw	25 t	30 m	7 (9 i	3	to 4 n	044 & 64.	-	<u> </u>	10	
_	Hilf rip saw	26	28	6	8	3	3 1	04+0004	'	3} 4	18	
-	Hand saw	22	26	5	7 1	124	$3^{\frac{1}{2}}$		1	5	18 to	
	Broken space or fine hand	2)	26	5	71	ρį	3		1	6	18	19 10
-	Panel saw	20	24	41	74	2	24		ŀ	7	1.)	10
	Fine pinel siw	٥٠	24	4	6	2	21		Ì	8	19	20
	Chestsaw (fortoolchests)	10	20	21/2	3}	14	2		6	to 8	18	21
711	*Table saw	18	26	14	$2\frac{1}{4}$	1	11		7	8	16	19
710	*Compass or lock saw		18	1	14	ł	ᅾ		8	9	18	19
712	*Keyhole or fret saw		10	3,	<u>8</u>	1	1		9	10	19	2()
_	Pruning saw	10	24	2	3	1	14	644 661	4	7	13	16
	(2) PARALLEL SAWS WITH BACIS With a handle at one end I cn, th of Width of I om of I om the per in h											
713	7 on on					-			!			
11,	Tenon saw Sash	16 t			:04 in	1		611 & 645	5	10	2	1
	^	14 10	16) Î	3}				1	11	2	
_	I)ovetail	6	$\begin{array}{c} 14 \\ 10 \end{array}$	$\frac{2}{1}$	2 j				١	12	23	-
722	Smith s screw head saw	3	8		$_1^2$				14		24	
723	Comb cutter s saw	5	8	11	21				12 10		15 to	
				- 2	27				10	20	18	25
	(3) Parallel Saws used in Frames											
	Stretched lengthways	I eng Bla	th of de		Ith of la le			Form of Looth		omts m h	Gr. of Mc	re tal
725	Mill saw	4 to	8 ft	4 to	5 in			648 & 651	å t	o 1i	10 to	1/
-	Mill saw webb	4	6	3	4		!		- 5	î	17	20
	Veneer saw	4	5	4	5			645	$\overset{\pm}{2}$	4	19	21
70		2011	301	Ιį	9 <u>1</u>				3	4	19	22
726			36	2	31			644	3	4	19	2
720	Continental frame saw		36	1	3			645	4	19	19	24
148	*Iuming or sweep saw		22]]	8		- 1		10	20	19	24
729					3			614	4	6	22	14
	Smith s frame saw *I recing saw	3 :	12	ł	8			616	10	14	20	26
, 201	*Inlaying or buhl saw	3	5	30			1	645	40	60	00 11	.
102									1 M			
132	Thiaying of outil siw		9	3	ō				15	10	o to	

^{*} Those Saus marled with an Asterial are used for Circular and Currelinear Works

The first kind of saw is usually taper, and if long it has a handle at each end as in the pit saw but if short, or not exceeding about thirty inches in length it has only a handle at the wide end as in the common hand saw

The second kind of saw is stiffened by a 11b placed on the back of the saw, and parallel with the teeth, the rib or back is generally a cleft bar of iron or biass as in the tenon saw, dove tail saw, and others

The third kind of saw is provided with an external skeleton, by which the saw blade is strained in the direction of its length, like the string of a bow, as in the turning or sweep saw for wood, and the bow saw or frame saw for ivory

These three classes of saws differ much in proportions and details, as will be seen by the inspection of the foregoing table, and the subsequent remarks. The longest saws are placed at the beginning of each group, and the maines mostly denote the ordinary purposes of the respective instruments.

Immediately subsequent to the description of the several saws, some account will be given of the general purposes of each instrument, and of its manipulation. The numbers prefixed to the table, refer to these respective remarks, which are expressed somewhat in detail owing to the importance of the instruments themselves, and the circumstance that many of the topics will not be resumed. Whereas the turning, boring, and series cutting tools, the subject matters of the previous chapters, will be more or less returned to, in speaking of the practice of turning.


The saw which claims priority of notice, is that used in felling timber, when the axe is not employed for the purpose

The felling saw mostly used of late years in this country, is a taper blade about five feet long, with ordinary gullet teeth, closely resembling the common pit saw, except that the teeth are sharpened more acutely

The handle of the wide end, fig 668, is fixed by an non bolt and wedge, that at the narrow end, fig 669, is calculated for two men, and is made of wood, except a plate of non at the bottom attached by rivets or screws to the wood, so as to make a crevice for the saw, which is fixed therein by a wooden wedge on the upper surface of the blade


When the saw has entered a moderate distance wedges are

driven in to prevent the weight of the tree from closing the sawkerf and fixing the blade—and it is needful the handles should be removeable, that one or other may be taken off, to allow the saw to be withdrawn lengthways, which could not be done, were the handles liveted on

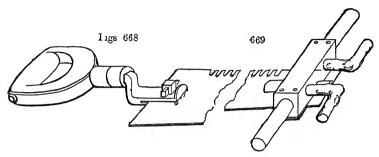

In cross cutting saws the straight handles are sometimes attached as in fig 670, by a piece of sheet non serving as a feirule, and extending in two flaps which embrace the saw, and are riveted to it


Figs 671 and 672 represent two other kinds the former is attached by a bolt and key, and the spike is riveted through the wooden handle. In the latter the handle is perforated for the reception of a slender rod of iron, slit open as a loop to receive the saw blade, and which is drawn tight by means of the nut and washer above the handle

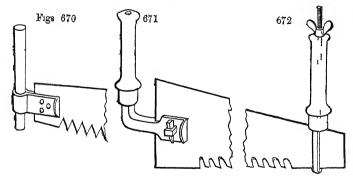

Some of the crossing cutting saws used in the colonies for very large logs, are made as long as twelve, fourteen and sixteen fect, nine to cleven inches wide in the center and six or seven inches at the ends. The peg tooth is commonly used for them The long saw, put saw, or whip saw, which follows in the table,

is also the next saw that is commonly applied to the piece of timber, which is then placed over the saw pit, in order that the saw may be used in the vertical position by two men called respectively the top man and the pit man, the former of whom stands upon the piece of timber about to be sawn. The positions of the men are highly fivourable, as they can give the saw a nearly perpendicular traverse of three or four fect, and in the up or return stroke the saw is removed a few inches from the end of the saw cut to avoid blunting the teeth, and to allow the sawdust free escape.

The long saw varies from about six to eight feet in length, according to the size of the timber. To adapt it to the hands of the sawjers, it has at the upper part a transverse handle or tiller, fig. 673, and at the lower a box, fig. 671. The

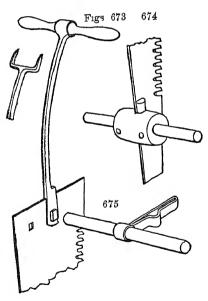

tiller consists of a bar of non, divided at the lower part to receive the blade, to which it is fixed by a square bolt passing through the two and fastened by a wedge, and at the upper end, the tiller is sometimes formed as an eye for a wooden stick or else it is made as a fork, and the handle is riveted on

The handle at the lower part, fig 6/1 is simply a prece of wood four or five inches di uneter, and twelve to sixteen long, turned as a handle at each end, a dia metrical notch is made half way through the center to


admit the saw blade, which is fixed by a wooden wedge. Some times the bottom handle of the long saw is a flat from loop, as in fig 675, with a space for the fixing wedge, and an eye for the wooden handle. Occasionally a screw box is used, or one like fig 674, but with the one handle screwed in, so that its point may bear upon the saw, in place of the wedge. In all cases it is desirable the lower handle should be capable of being easily removed.

The prt frame saw, fig 676, is commonly used for deals and for such pieces of the foreign haid woods as are small enough to pass between its frame, which is about two feet wide

The frame saw blade has two holes above or at the wider end.

and one below and is attached to the wooden frame by two non buckles or loops, which are split about half way round The upper buckle fits squarely and firmly to the top head, and re ceives, above its lower side, two pins passing through the holes in the The lower buckle SOW is similarly cleft, and ie ceives one pin only, this buckle is driwn tight by a pair of equal or fold ing widges, beneath the bottom transverse piece

The blade is usually five or six feet long, and thinner than that of the whip saw, which latter

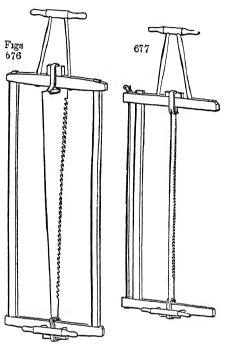

although it may be used for the widest timbers is more wasteful In some few cases, where the double frame, fig 676, is mapplicable, as in removing a plank from outside a very large log, the single frame, 677, is used, but this latter is generally narrow, and employed alone for small curvilinear works

It is now proposed to give some few particulars of the sawpit, and the modes employed by the sawyers in marking out the timber preparatory to sawing

The sawpit values from about twenty to fifty feet in length, four to six feet in width and five to six feet in depth, it has two stout timbers running the whole length called side strakes, and transverse pieces at each end, called head sids, upon which the one and of the timber rests, whilst the other end is supported

on a transome, or a joist lying transversely upon the strakes a second transome, is used in case of the first breaking, this is called a trap transome

Sometimes holdfasts or L formed iron brackets are added to the head sills by which thick pieces of plank are fixed horizon tilly screw chops are also used for fixing short pieces of hard wood vertically or edgeways, for slitting them


In cutting deals into thin boards three deals, which from being as many as the frame of the saw will include, are called a pit full, are placed vertically against the stake and are securely attached to it by a rope passed once round the deals and the lower end of the stake and strained by a binding stick

Foreign timbers and hard woods are mostly squared with the axe or adze, for the convenience of transport and close stowage on shipboard and such square pieces are readily marked out with the chalk line into the scantling, or the planks and boards required. More skill is called for in setting out the lines upon our native timbers, which are mostly converted into plank, or the various pieces, without being previously chopped square

The converter determines in which direction the tree can be cut most profitably into plank and the section chosen is usually that, which when opened shows the greatest curvature or irregularity, this section is supposed to be shown longitudinally by a b, c, d, fig. 678 and, on a larger scale and transversely, by e' e' e fig. 679, the central points a and b and the line b c being given by the converter who also gives instructions as to the thicknesses desired in the planks. The sawyer's first object is accurately to mark the margins of the inegular central plane, a b c d, so truly that when the lines are followed with the saw the surface shall be true and thoroughly out of winding or twist

The sawyer gets the timber on the sawpit, with the hollow side upwards—that being always first marked—it is plumbed upright or, so that the plumb line, suspended by the hand at z, exactly intersects the line b c which has been marked on the end—The butt is then secured from rotating, by dogs or staples, s s, fig. 679 driven both into the end of the timber and into the vertical face of the head sill, for which purpose the two ends of the dogs are bent at right angles both to each other and to the intermediate put of the dog the extremities of which are pointed with steel, made chisel form, and hardened

A chalk line is now stretched in the dotted line from a to b, and pulled vertically upwards exactly in the plane in which it is desired to act the string is then let go, as in discharging an arrow and striking the timber, it leaves thereupon a portion of the white or black chalk with which the line was rubbed

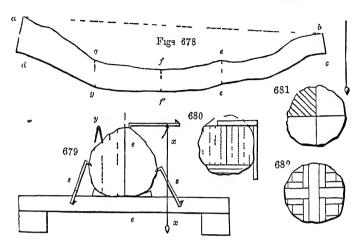

Should the curvature of the timber be such that, as in the example, the chalk line would scarcely reach the hollow it is strained on the dotted line a b and left there, the plumb line is held in the hand at z, and an assistant holds a piece of chalk on the top of the timber at the point e. The principal then observes in the same glance that the plumb line z intersects the string a b the line b c, and also the point of the chalk, showing them all to be in the plane of vision, a mark is then made at e. Marks are similarly made at f and g, or as many places as may be required, and, lastly, the points a g, q f, f e, and e b, are connected by short lines struck with the chalk line around the curve

The required thickness of the planks is then taken in the compasses, with a little excess for the waste of the saw, and two, thice or more planks are pricked off on each side the center ϵ , fig 679, until, from the circular section of the timber, its surface becomes so inclined that the compasses would measure a slanting instead of a horizontal distance, and which would diminish the thickness assigned to the boards

The sawyer then holds the compasses as it y, and fixing his eye on the part of the wood perpendicularly beneath the off leg of

the compasses, he removes the instrument and picks a mark therewith, after which the compasses are replaced as at y to see that the mark is correct. This is repeated at different points in the length, and the chalk line is stretched from point to point thus set out with the compasses, and marks the edges of the intended saw cuts with sufficient certainty.

The timber is now turned over, or with c to d, fig 678, upper most and the end line exactly perpendicular as before. Should the piece be very crooked or high backed the sawyer may be unable to see over it, and observe the central marks at the ends of the timber, such being the case, the points e, f, g, are transferred to e', f', g on the top of the timber, by the mode explained by the figure 679 supposed to be a section through the plane e e'. A dog is driven into the timber near e' and from the dog a plumb line e e, is suspended, the distance e e, is then measured with a common rule and measured backwards from e to e', by which process e' becomes exactly perpendicular to e, the points e' and e' are similarly treated to obtain the points e' e', after which the central line is made at four operations through e', e', e', e', e', e', e', e', e', the plank lines are set out with the compasses as before explained

Large timber is usually cut into plank as in fig 679 the planks are sometimes flatted or their irregular edges are sawn off and for the most part wasted, but this is not generally done until the wood is seasoned and brought into use

When many planks are wanted of the same width, it is a more economical mode, first to leave a central parallel balk, as in fig 680, by removing one or two boards from each side and then to flat the balk, or reduce it into planks. The central line is in this case transferred from the lower to the upper side, by aid of the square and rule, instead of by the plumb line.

According to Hassenfratz, the setting out shown in fig. 681 is employed in large wainscot oak, in order to obtain the greatest display of the medullary rays which constitute the principal figure in this wood, and the same author strongly advocates the method proposed by Moreau, and represented in fig. 682, in which he says one sixth more timber is obtained than by any other mode, and also that the pieces are less hable to split and waip, but on examination there does not appear to be any

inducement to incur the increased trouble in marking and sawing the timber on this method *

When the timber has been properly marked out the sawyers take their respective places upon the timber and in the pit the saw is sloped a little from the perpendicular, that is supposing the piece about eighteen inches through or deep, the saw when it touches the top nigle, is held off about two inches from the bottom. A few short trips are then very carefully made as much depends on the saw entering well, and should it fail to hit the line, the blade is sloped to the right or left at about the angle of 45 degrees, to run the cut sideways and correct the incision in its earliest stage. It is usual to take all the cuts as in figs 679 and 680 to the depth of three or four feet, and then the whole of them a further distance, and so on

When the saw has penetiated three or four feet, a wooden heading wedge is driven into the cut to separate the timber, for the relief of the saw, and when from the length of the cut, the timber is sufficiently yielding, the hanging wedge is used, which is a stick of timber about twelve to twenty inches long and an inch square, with a projection to pievent the wedge from falling through. The wedges lessen the friction upon the saw but if too greedily applied they split the wood, and tear up the loose parts sometimes observed in planks.

In sawing straight boards, it is advantageous that the saw should be moderately wide, as it the better serves to direct the rectilineal path of the instrument, but for curvilinear works, as the felloes of carriage wheels, the sawyer employs a much narrower saw to enable him to follow the curve. The blade of one kind of felloe saw is about five feet long, and it tapers from nearly four inches at the wide, to two inches at the narrow end, it is used with a tiller and box, exactly the same as the ordinary long saw, and also without a frame


The more general felloe saw, or pit turning saw, has a blade about $1\frac{1}{4}$ inch wide, and is stretched in a frame exactly like those represented in figs 676 and 677. The turning saw with two side rule is the best where it can be applied sometimes the

Traute de l'irt du Charpentier par J H Hassenfratz 4to Paris 1804 Plute 12

frame is obliged to be made single, and with a wire and screw nuts, by which the saw is strained as in fig. 677, page 703

In cutting out very small sweeps as in the small wheels or trucks for wooden gun carriages, no fiame whatever can be used and slender blades about five or six feet long, five eighths of an inch wide, with a handle at each end were employed for this purpose during the late war. In using the various pit turning saws, the thick plank having been sawn out in the ordinary manner, the work is marked off on one side from a pattern or templet and then held down, upon the head sill of the saw pit and one transom, by means of the holdfast before noticed

The rip saw, half rip, hand saw, broken space, panel saw and fine panel, which in respect to appearance are almost alike, may be considered to be represented by fig 683, then differences of size will be gathered from the dimensions in the table, the chest saws are merely diminutives of the above and such as are used for small chests of tools, whence their name



This kind of saw is made taper in order that the blade may possess a nearly equal degree of stiffness throughout, notwith standing that it is held at the one end, and receives at that end, as a thrust, the whole of the power applied to the instrument, the greater width also facilitates the attachment of the handle. Were the blade as wide at the point, as at the handle or heel, it would add useless weight, and instead of being a source of strength, it would in reality enfecble the saw, which from the increased weight at the far end, would be more flexible near the handle than at the point

It will be seen that the saws in this group are progressively smaller and finer. The rip saw has the correct teeth and which are of slight pitch or mid way between the upright or cross cutting teeth, fig. 613 and those of ordinary pitch, fig. 615 the half rip is similar, but a little finer, these two are used in carpentry for appeng or cutting fir timber rapidly with the grain

The hand and fine hand saws are somewhat finer in the teeth, which are of ordinary pitch or the face of the tooth is perpendicular the hand saws are much used by the joiner for ordinary purposes, and also by the cabinet maker for cutting mahogany and other hard woods with the grain

The panel and fine panel are still finer saws of the same kind which probably derived their name from having been made for cutting out panels when oak and other wainscotting were more common in our houses than plastered walls and they may be considered as intermediate between the handsaw by which most of the work is done, and the tenon or back saw hereafter to be described

The same workman does not require each of the six saws but commonly selects the two or three most suited to his particular class of work, they are principally used for still further preparing the woods to their several purposes, after they have been cut at the sawpit into planks and boards. The outlines of the works are marked out upon the surface of the plank by aid of the rule compasses and chalk line or the straight edge and square, with much greater facility than setting out the round timber into planks, which has been already explained. The board having been marked is rested upon a sawing stool or trestle, the height of which is about 20 inches, if the work be long two stools are employed. The workman commonly places his right knee upon the board to fix it, and applies the saw on the portion that over hangs the end of the stool.

The saw is grasped in the right hand, and the left is applied to the board, in order that the end of the thumb may be placed just above the teeth and against the smooth blade of the saw, to guide it to the line, the saw is then drawn backwards a few inches, with light pressure to make a slight notch, a short gentle down stroke is then made almost without pressure. In the first few strokes the length and vigour of the stroke of the saw are gradually increased, until the blade has made a cut of two to four inches in depth, after which the entire force of the right arm is employed, the saw is used from point to heel, and in extreme cases the whole force of both aims is used to urge the saw forward. The blade is occasionally greased to lessen the friction, the end of a tallow candle being mostly used, or else log 5 laid 5 me u ed on a piece of thuck leather.

In most instances little or no piessure is directed edgeways or on the teeth, and when the effort thus applied is excessive the saw sticks so forcibly in the wood that it refuses to yield to the thrust otherwise than by assuming a bow or curved form, which is apt permanently to distort the saw from the right line. The fingers should never be allowed to extend beyond the handle or they may be pinched between it and the work

In order to acquire the habit of sawing well or in fact, of performing well most mechanical operations, it is desirable to become habituated to certain defined positions. Thus in sawing it is better the work should, as often as practicable, be placed either exactly horizontal or vertical, the positions of the tools and the movements of the person will also be then constantly either horizontal or vertical, instead of arbitrary and inclined

In sawing the top of the sawing stool should be homzontal, the edge of the saw should be exactly perpendicular when seen edgeways, and nearly so when seen sideways, the eye must watch narrowly the path of the saw to check its first disposition to depart from the line set out for it If however the eye be directed either so far from the right or left side of the blade as to form a material angle with the line of the cut the hand is liable almost unconsciously to lean from the eye, and thence to uncline the saw sideways. It is therefore best to look so fir only on the right and left of the blade alternately, as to be just able to see the line, and thence to detect the smallest deviation of the instrument at the very commencement of its departure And then, by twisting the blade as far as the saw keif will allow, the back being somewhat thinner than the edge, the true line may be again retuined to, indeed, by want of caution, the saw may be made to cross the line and err in the opposite direction It is however best to make it a habit to watch the blade so closely as scarcely to require any application of the correctional or steering process at all The saw, if most set on the left side, or having teeth standing higher on the left side cuts more freely on that side, and has a tendency to run or arcuate to wards the left, and under the reverse cucumstances the saw is disposed to run to the night

Thick works are almost always marked on both sides the plank, and the piece is turned over at short intervals, so that a portion of the work is performed from each side, the saw cut

will then assume a series of slight bends to the right and left alternately, and will depart less from the true line, than if these disturbances had effect from the one side only, and thus produced an accumulating error, or a line swerving in one direction alone, or as a sweep of a large circle. The practice of changing sides with the work will, under most circumstances, be found to lessen the errors incidental to the process, and the practice is therefore especially desirable for beginners.

The work is not always placed on the sawing stool as in some cases it is laid on the bench, and fastened down upon the same with the holdfast or hand screws, and with the intended cut situated beyond the edge of the bench, the workman then stands erect and uses the saw with both hands, placing the back of the saw towards his person, and sawing from it, this with many is a favourite position. In some cases, especially in small and thick works the wood is fixed perpendicularly in the screw chops of the bench, and the saw is applied horizontally. These modes are both good, masmuch as they relieve the individual from the necessity for holding the work with the knee, and he is less restrained in the action of the limbs.


In using the hand saw for preparing hardwood for turning, the log is either laid on the common X form sawing hoise or else it is fixed in the jaws of the tail vice, which latter mode is gene rally more convenient. In speaking of sharpening the saw, it was shown that the points of saw teeth proper for hardwoods, are somewhat less acute than those for deal and ordinary timber

The remarks on the hand saws have been given in greater detail than those which follow, because it is considered these instructions will assist in the manipulation of all the other saws used by hand

Figs 684 and 685 represent the narrow taper saws used for cutting curves and sweeps, especially those required in wide boards. Compared with the generality of saws, these are made thicker on the edge and are ground thinner on the back, to allow them more freedom in twisting round curves, the smallest of which require the narrowest blades.

The table saw, and the compass or lock saw fig 684, which only differ in size, resemble the hand saws in their general structure and in the forms of their teeth, except that the blades are smaller and narrower, to allow them to be as a tangent to the curve


The key hole or fret saw blade, 685 which is drawn to the same scale as the last, is held in a saw pid or a hindle having a stout ferrule with a mortise and screws so that the blade may be strongly grasped and as the handle is perforated throughout its length either the whole or part only of the blade may be allowed to project. The key hole saws are sometimes fixed in a hindle like that for a file, which is less proper



The table, compass and key hole saws all require care in their use, for if much pressure is thrown on the teeth they stick fast in the material, and a violent thrust is hable to bend and permanently injure, or indeed, to break the saws and be sides, their paths are the less easily guided, the more vigorously they are used. It would be desirable, if in the narrow taper saws with only one handle, we more frequently copied the Indian, who prefers to reverse the position of the teeth so that the blade may cut when pulled towards him, instead of in the thrust, this employs the instrument in its strongest instead of its weakest direction, and avoids the chance of injury. The inversion of the teeth, which in India is almost universal, is with us, nearly limited to some few of the key hole and pruning saws.


Pruning saws are often made exactly like the table and compass saws fig 684, recently described, but with teeth which are coarser, thicker, and keener than those for dry wood. The forms of teeth, figs 644, and 645, namely the hand saw tooth, and slight pitch, are used, and also the double teeth, fig 661, which are rarely employed but for living timber. An excellent modification of the pruning saw is to mount the blade at the end of a light pole 4 to 6 feet long, so that the edge of the blade may form an angle of about 150 degrees with the handle. This saw may be applied to branches eight or ten feet from the ground, the inclination of the blade just suffices for the onward pressure,

and the teeth being inverted, the saw cuts in the pull instead of in the thrust, which is both more commodious to the individual, and free from the risk of accident to the blade



Many pruning saws are made with blades nearly parallel in width, but as thick again on the edge as on the back, and with double teeth, fig 661. The larger pruning saws of this kind, fig 686, are mounted as carving knives or with straight handles of buck horn, such blades measure from 8 to 10 inches long, and $\frac{5}{8}$ to $\frac{3}{4}$ inch wide, the smaller kind are made as clasp or pocket knives, and are of about half the dimensions given

The next group of saws enumerated in the table, are Parallel Saws with Backs those most commonly known are in some measure particularised by their names as tenon saws sash saws, carcase saws, and dovetail saws they only differ in size, as already shown, and they are represented by fig 687




The blades of the back saws are thin, and require to be very carefully hammered, the handle of the saw is affixed to the blade itself by the sciews. The back is either a piece of stout sheet iron or brass folded together, first as an angle between top and bottom tools, and then closed with the hammer upon a parallel plate thicker than the saw. When the inside of the groove has been filed to remove the irregularities, the two edges of the back are grasped in the tail vice, and the ridge is hammered to make the edges spring together almost as a pair of forceps. The back is held upon the blade by this elasticity or grasp alone, and the blade only penetrates about half way down the groove

The general condition of the blade depends in great measure upon that of the back, which should not be exposed to rough

usage, as a blow on the middle of the back tends to throw the blade more in that part, and make it crooked on the edge, a fault that may be in general corrected by tapping slightly upon the back near the ends in order to drive the blade as much inwards at those parts as in the center, and balance the first error. When the blade itself is buckled, which is less liable to occur than with hand saws, from the more careful manner in which the back saws are used, the saw must be taken to pieces and the blade corrected on the anvil as in other cases.

The back saws, which are much employed for accurate works, are often assisted or guided by sawing blocks in which one or more saw kerfs, that have been very carefully made, serve to guide the blades, consequently this method saves a part of the trouble in marking out the lines to be cut, and also of the risk of making incorrect mersions. The sawing block fig 688,




which is of the ordinary form, is a trough made parallel both inside and out, and having three saw kerfs, which are all exactly vertical. The one kerf is at right angles to the side of the block, and serves for cutting

off pieces, the ends of which are required to be perfectly square, the two other saw kerfs are at angles of 15°, and slope opposite ways these serve for cutting mitres or the beyilled joints always employed for uniting mouldings at right angles to each other, as in picture frames and panels. The work is simply held close to the further side of the box, and with the line of division opposite the saw kerf, the saw is then allowed to pursue the direction given by the saw kerf, and when many pieces of similar length are wanted, stops are added to the block. The joiner frequently uses the shooting boards represented on page 502, for sawing as well as planing, especially when the work is to be planed immediately after on the same shooting board, the saw is then applied parallel with, but slightly in advance of, the face against which the sole of the plane rubs

Before concluding the remarks on saws with backs, fig 687, it appears desirable to offer some particulars on the modes of constructing tenons and dovetails, from which most useful and general modes of uniting materials, two of these saws have derived their names

In a rectangular frame, represented partly finished in fig 689, the tenons are commonly made on the shorter pieces, called the rails, and the mortises on the longer or the styles, which are always left somewhat longer than ultimately required, to prevent them from breaking out, either in making the mortises or in wedging up the frame. In carpentry, the panel is fitted in a groove, as at a, and is inserted or planted before the frame is glued up, but in cabinet work the panel is fitted in a rebate, as at b, and is fixed by slips of wood after the frame is finished

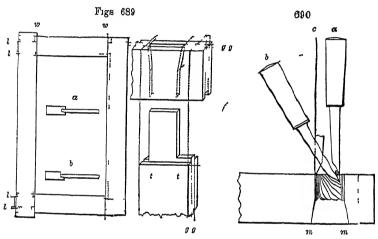

When the styles and rails have been planed up to their widths and thicknesses, (see pp 498 to 503), the internal length of the frame is marked on the styles at $l\,l$, and the width on the rails at $w\,w$, these lines are scribed on the four sides of each piece, with the square and scriber. The additional lines $l'\,l'$ indicating the ultimate length of the style, are also marked

The width of the enlarged tenon t t', is from one half to two thirds that of the entue rail, the inner haunch t, is required to be lower than the groove or rebate, and the outer haunch t', is generally about three times as wide as the inner, to leave room for the wedges, and the end wood of the style exterior to them. The thickness of the tenon is commonly about one third that of the style, but from the mode of work, its actual thickness, if not exceeding about $\frac{3}{4}$ inch, becomes exactly the same as the width of the mortise chisel employed

The appropriate chisel having been selected, the gage lines

gg, corresponding with its width are gaged on each edge of the styles and rails. Frequently the mortise chisel is slightly stuck into the work to imprint its own width by which to adjust the gages, and every piece is gaged from the face side so that when the whose are put together they may be flush with one another

The several styles to be mortised if small as in cabinet work, are placed side by side with their inner edges upwards and are fixed upon the bench with the holdfirst, the mortises are then commenced near the outer end, m' 690. The styles, if large as in carpentry, are placed upon the stout mortising stool—the workman sits upon them—and begins near the inner end m

The mortises are made half way through from the inner side of the rails, and are completed from the outer, and the operation is by no means difficult provided the mortise chisel which although narrow is very thick and strong, is kept exactly per pendicular to the side of the wood and truly to the gage lines. The chisel is mostly held with its face towards the operator and the first cut is perpendicular and about one sixth from the end of the mortise, as at a, fig. 690, the chisel is driven with two or three blows of a mallet of proportionate size, the second cut is inclined, as at b, and between each of the inclined blows the chisel is moved to loosen the chips. By the two cuts a trian gular portion of wood or a *core* is loosened, and which is prized up by thrusting the chisel backwards through the dotted arc, the bevil or bulge of the chisel then resting upon the angle of the wood as a fulcrum

The neighbouring lines in fig 690 show the successive cuts employed in making the mortise, some workmen prefer taking the cuts a and b alternately always prizing up the chips by thrusting the chisel from them, after each cut b others prefer taking most of the cut a, at an earlier stage of the work. When the triangular incision reaches half way through the wood, it is extended in length either by sloping cuts with the chisel, as at b, or with perpendicular cuts, as at c

At the completion of the inner half of the moitise, the face of the chisel must be applied exactly perpendicular at each end, as a and c, and in releasing the shavings, the handle is moved towards the center of the moitise using the cutting edge as the fulcrum, and not the angle of the wood, which would be thereby bruised. The style is now tuined over and the remaining half

of the mortise is completed but the outer ends are bevilled for the reception of the wedges, as marked in the diagram. The mortise is mostly left from the mortise chisel, although when the two incisions do not exactly meet it is needful to pare down the inequalities with an ordinary chisel

The cutting of the tenon is less difficult of explanation than the mortise. The shoulders of the transverse cuts of the tenon, are generally made with the dovetail or carcase saw, whilst the rail lies on the bench against the sawing stop or a peg near the coinci of the bench the rail may be held with the holdfast if preferred. The side or longitudinal cuts are usually made with the tenon or sash saw, the rail being then fixed perpendicularly in the bench screws

These cuts, which remove two thin rectangular pieces called cheeks, should be made with great accuracy and so as just to avoid encroaching on the gage lines, as the tenon is left from the saw, or at most the angle is cleared out with the corner of a chisel applied almost as a knife

The hounches are marked by laying the end of the rail in contact with the gage lines on the inner side of the style, and marking the tenon from its corresponding mortise

I enons and mortises do not in all cases extend through the wood and as they cannot be then wedged up, they have to depend exclusively on good fitting or surface contact, and the glue, in many cases also, sciew bolts, straps, and wooden pins are used to draw the tenon into the mortise in various ways, subjects that are too varied to be here particularized

In mortises that are wider or deeper than usual, it is a common practice to remove a portion of the wood with center bits, or nose bits, and to complete the mortises with firmer chisels

Dovetailed joints are employed for uniting the ends of boards at right angles to each other as in boxes, drawers and nume rous other works. The dovetails are made of several forms, thus fig 691 is a kind of factitious dovetail in which the boards are first miticd, or their edges are planed at the angle of 45 degrees, and slightly attached by glue or otherwise a few cuts leaning alternately a few degrees upwards and downwards are then made with a bick saw upon the angles, pieces of vencer are afterwards glued and drawn into the notches. This

method is principally employed in toys and very common works, which are then said to be mitred and keyed the hold is much stronger than might be expected

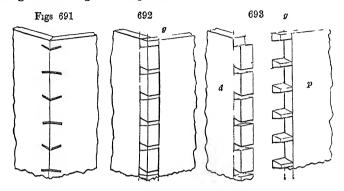



Fig 692 iepresents the oidinary dovetail joints p fig 693, the pins, and d fig 693 the dovetails of which the same is composed. In some cases the pins and dovetails are nearly alike in size, and this makes the strongest attachment, but in joinery and cabinet work, the dovetails are made on the front or more exposed part of the work, and the pins are cut of only one fourth or less the size of the dovetails in order that but little of the end wood may be seen. Usually the pins are the first made, as in making ordinary dovetails as well as tenons, the surfaces are left from the saw, this instrument must be well applied to produce the close joints met with in works of the best quality.

In setting out dovetailed works, the sides and ends of the box are first marked across on both sides with the gage or square at gg which lines indicate both the inside measures of the box and the bottoms of the pins and dovetails, the portions beyond the lines are left a trifle longer than ultimately required Very little care is taken in setting out the pins, indeed, their distances are usually marked with a pencil, without the rule or compasses, and the two external pins are always left nearly as strong again as the others

One of the ends, fig 694, is fixed upright in the bench screws, and the pins are sawn as shown at $a\,a$ These saw cuts are made exactly perpendicular, and terminate upon the gage lines, but horizontally they are sloped opposite ways, so that

very pin is about as wide again on the inner as on the outer ide of the front of the box. The wood between the dovetail bins is generally cut out with the bow or turning saw leaving the pace as at b fig 694, and the spaces are then pared out with he firmer chisel from opposite sides as at c, the chisel being placed exactly on the gage lines but slightly overhanging, so hat the insides are cut hollow rather than square, to insure the xact contact at the inner and outer edges of the dovetails

When the wood between the pins is removed entirely with he chisel, this instrument is driven with the mallet perpendicually into the wood just in advance of the gage line, and sloping uts are then made to form a notch half way through the wood sat f and when the space has been thus cleared, a more careful ertical cut is made exactly upon the gage line itself, as in the other case

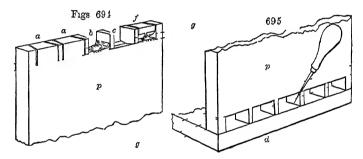

The dovetails are next marked from the pins and thus become hen exact counterparts. In marking the dovetails, the front piece l fig 695 is laid upon the bench and the pins in p are placed xactly vertical, and in their intended positions, and lastly, the criber is passed along the two sloping sides of every pin. The gage lines are followed with the dovetail saw, the waste of the ool being taken from the hollows, so as to leave the gage lines almost standing the hollows between the dovetails are now emoved with the chisel unless the work is very large, when, as in cutting away the wood between the pins, the frame saw may be previously employed

As the gage lines are almost left in sight the pins and dove ails are mutually a trifle too large so that in driving them ogether, they somewhat compress each other, and produce that lose accurate contact to be observed in good works, and which gives rise to so much surface friction that the glue might in some cases be nearly dispensed with between the joint but if the pins are left too large, they split the wood

Whilst the chisel is being employed in dovetuling it is usual to lay the several pieces of wood upon the bench with their ends slightly extending beyond each other, like a flight of steps, an arrangement that admits of every edge being readily seen and operated upon, the pieces are fixed in this position by the hold fast, and when they have been cut half way through, they are turned over and finished from the other side

Figs 696 to 701 represent in plan, and in one group, the several ways of dovetailing the edges of boxes and similar works fig 696 is the mitre and key joint, and fig 697 the common dovetail joint already spoken of in which the pins and dovet uls are both seen from the outside of the box. In the four other kinds the parts are more or less concealed, and they may be considered to increase in the difficulty of construction, in the order in which they are represented. It is supposed that the pins which are on the upper pieces marked p are made before the dovetails on the pieces d, and before scribing which latter from the pins, chalk is rubbed on mahogany and other dark woods, to make the lines more conspicuous

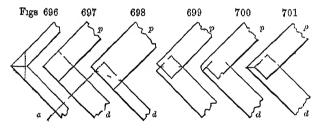


Fig 698 is the half lap dovetail which is much used for the front of drawers. The pins in p or the front of the drawer, are first marked, and the wood is also gaged at the end to denote how far the pins shall extend inwards—the saw can only be used obliquely, as shown by the dotted line, and the pins are finished with the chisel applied on the lines a and d—When, however the drawer front is to be veneered, the pins are often sawn quite through on the line d as the pins may be thus more easily cut and the veneer conceals the saw kerfs in the drawer front—The dovetails on the sides of the drawer, or d, are afterwards marked

and cut as in the first example, fig 697, but of their exact lengths

In fig 699, sometimes called the secret dovetail, the pins and dovetails he both concealed, as neither of them extend through the work the saw can be only used at the angle of 45 degrees, either for the pins or dovetails, and most of the work is done with the chiscl. The angle is filled in with a corner line

The lap dovetail fig 700 is often used for writing desks, and similar works with rounded edges, and not having corner lines the front of the desk or p, is first rebated out to leave the lap, the pins are then made in this piece, and the dovetails are after wards scribed on d, and made as in the last case, only a small portion of the end wood is then seen at the ends of the desk, and this is in great measure removed from observation when the angle is rounded

The mitre dovetail fig 701, requires each piece to be rebated out square, as in p fig 700, and after the pins and dovetails have been respectively made the square rebates are converted into a mitre joint with a rebate plane. When finished, neither the pins, nor the modes of their concealment are distinguishable, and the work appears to have a plain mitre joint.

When the lid of a box has a dovetailed 11m, or that the box and lid only differ in respect to depth, the box is technically said to have a tea chest top, and four pieces of wood, sufficiently deep to make both the box and its cover, are then dovetailed together in either of the ways before mentioned. When the top and bottom of the box are also added, the six pieces present the appearance of a rectangular block, and which is known as a carcase, a term also applied to other entire framings. The saw used in cutting open the carcase, or in separating the top of the box from the bottom, is thence called a carcase saw

This mode of work, besides saving much of the labour of dovetailing, ensures the exact agreement in size, and the general correspondence of the two paits, which it would be more difficult to obtain if they were separately made, especially in sloping works, such as portable writing desks and others of similar character

In every case where the box and the lid are made together, the line of division is gaged on the four sides exteriorly, and one of the dovetail pins is placed upon that line, but it is made fully as wide again as the others, to admit of division, and yet be of the ordinary size. If the joint pin were made as usual, or left square, the carcise, on being cut open would exhibit the rectangular lines of the pin and dovetail, to avoid which the joint pin and dovetail should be pared away to the mitre, and then the cover and the box will also exhibit a mitie joint

The top and bottom are fitted in various ways sometimes they are glued on the square edges of the sides but generally the sides and the top are both rebated, just as represented in fig 700 on the supposition that p is the top and d the side of the box or they are rebated and mixted as in fig 701

A box made as above described with mitred dovetails, with mitred joint pins and with the top and bottom rebated and mitted would not show any joint, either within or without the box except those constituting the margins of the twelve super ficies of the work in fact the joints would alone occur at the several angles, and escape observation, as will be apparent from the inspection of figure 701

Such a box if neatly made, would be a finished specimen of work, but so much care is seldom taken, and it is more usual to employ corner lines and lippings to conceal the joints or else to cover the box with veneers, and all of which are sometimes mitred. In these cases the interior frame or the carcase of the box is of common mahogany, and dovet uled in the manner of fig. 697 or in very inferior works, the fabric is of deal attached by glue and brads, the principal reliance being then placed on the veneer for uniting the parts and concealing the defects.

Having concluded this long but important digression, respecting the formation of tenons and dovetails the consideration will be now resumed of the saws enumerated in the table on page 699

The smiths screw head saw, fig 702, which, in the table follows the back saws last noticed, differs from them in proportions, and also in the handle, which resembles that of a file, the blade is generally also thicker and harder, to accommodate it to its work. Some of the sciew head saws are made considerably smaller than those noticed in the table, the blade being a prece of watch spring fixed in a brass back, but these little tools are generally made by the watch maker, or other artizan requiring them


In all screws that are made in the turning lathe, it is desirable, in separating them from the neighbouring metal, to use the turning tool and to nick them in rather small behind the head. The little neck that is left, is broken through, just



flattened with a file and then slightly notched with a triangular file, as an entry for the screw head-saw by these means the risk of notching the head otherwise than truly diametrical is avoided

The comb cutters double saw shown in profile in fig 704, and in section on a larger scale in fig 703, is called a "stadda and has two blades so continued as to give, with great facility and exactness, the intervals between the teeth of combs, from the coarsest to those having from 40 to 45 teeth in the inch

The blades of the saw or its plates, are made of thick steel, and are ground away on the edge as thin as the notches in the comb, either in the manner of a or b, and they have about 10 to 20 points in the inch, of slight pitch fig 644. The plates are fixed in the two grooves in the wooden handle or stock by means of the stuffing, either two long wooden wedges or folds of brown paper, the plates would rest in contact but for the introduction of the thin slip or tongue of metal l, called a langual, which is of the thickness of the teeth required in the comb, the one blade is in advance of the other from $\frac{1}{16}$ th to

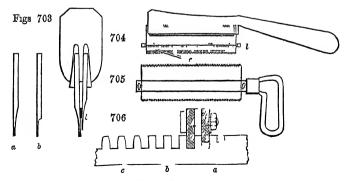

 $\frac{1}{4}$ th of an inch At the first process a notch nearly of the full depth is made in the comb c, and a second notch is commenced,

at the next process the notch in advance is deepened, and a third commenced, and so on consecutively

The gage saw or gage vid is used to make the teeth square and of one depth. The saw is frequently made with a loose back, like that of ordinary back saws but much wider, so that for teeth $\frac{1}{2}$ $\frac{5}{8}$ $\frac{3}{4}$ inch long, it may shield all the blade except $\frac{1}{2}$ $\frac{5}{8}$ $\frac{3}{4}$ inch of its width respectively and the saw is applied until the back prevents its further progress. Sometimes the blade has teeth on both edges and is fixed between two parallel slips of steel connected beyond the ends of the saw blade by two small thumb screws as in fig 705 the less common instrument is represented, because it is useful for other purposes

Double saws, fig 706, analogous to those of the comb maker have been also frequently applied to cutting metal racks similar to those used in an pumps. The blades, which in 706 are shided are as thick as the widths of the spaces, and are separated by a parallel slip of metal, represented white exactly equal to the thickness of the teeth, the separating slip also serves as the stop to make the teeth of one depth from the surface, the three parts are strongly united by two or more screws, or bolts and nuts. The rack saw if carefully made fulfils its work with considerable accuracy, the dotted lines at a, denote the succeeding step, those at b the square notches when completed, and c the teeth when rounded, which is done after wards with a file. In modern practice, however the teeth of wheels and racks are usually cut and rounded at the one process, which is performed in appropriate machines.

The third division of the table on page 699, refers to parallel saws used in frames, of which the measures are tabulated

The saw frames of these and other kinds keep the blades straight give them tension and enable the force to be applied viitually as in the Indian saws, or by pulling the blades, thereby avoiding the risk of buckling them. From these several reasons the blades of frame saws may be made very thin, consequently they act with less labour and waste, and may in general be used more vigorously than those saws having only a thrusting handle at the one end. The blades are sometimes left a trifle thicker where the pins are to be inserted and these parts are softened by being pinched between red hot tongs, prior to drilling the pin holes by which they are attached to their frames

The mill saw and mill saw ueb at the beginning of this group are used in vertical saw machines, which will be described in the fourth section of this chapter. It will suffice here to observe that the first or mill saws, which are the larger and stouter are employed for sawing round timber into thick planks, and the mill saw webs, for cutting deals into thin boards

The veneer saw formerly in use at the saw pit was excepting the blade, a copy of the pit frame saw, fig 676, p 703 and skilful sawyers would therewith cut about six veneers from the solid inch of wood. Smaller veneer saws more nearly resembling that shown in fig 708 were also used by cabinet makers who would cut seven or eight veneers in each inch from smaller pieces of wood, fixed upright in the chops of the bench, two individuals being mostly required. The hand veneer saws are now scarcely used in England.


The charmaker's saw is in general a diminutive of the ordinary pit saw and has a central blade strained by buckles and wedges. The work is fixed horizontally upon the bench by the hold fast, the saw is grasped by the side rails with both hands, and with the teeth from the operator, who stands in the erect posture. He can thus saw with great rapidity and accuracy all straight and slightly curved pieces not exceeding in width half the span of the frame, which is sometimes nearly as wide as the length of the blade. The wheelwright employs precisely the same saw for cutting the felloes of wheels, the timber, wide enough for two felloes, is then fixed in the ordinary tail vice.

The three following figures represent different kinds of frame saws, in which the blades are neither strained by buckles and wedges, nor placed centrally, as in those hitherto considered


There is a central rod or stretcher, to which are mortised two end pieces that have a slight power of rotation on the stretcher the end pieces are at the one extremity variously adapted to receive the saw, and at the other they have two hollows for a coil of string, in the midst of which is inserted a short lever. On turning round this lever the coil of string becomes twisted and shortened, it therefore draws together those ends of the cross pieces to which it is attached, whilst the opposite ends from separating, strain the saw in a manner the most simple yet effective. The tension of the blade is retained by allowing the lever to rest in contact with the stretcher, as represented,

but when the saw is not in use, the string is uncoiled one tuin to relieve the tension of the blade and frame, one or other of which may be broken by an excessive twist of the string

In the wood cutter's saw, fig 707 the end pieces are much curved, and one of them extends beyond the blade, which is

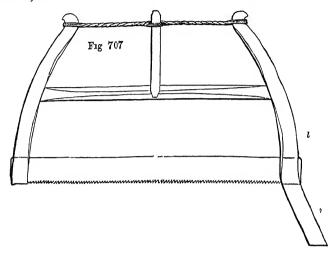


embedded in two saw kerfs, and held by a wire at each end the blade is therefore always parallel with the frame of the saw, which is mostly used vertically. The end piece alone is grasped at r and l by the right and left hands respectively, the wood is laid in an \mathbf{X} form sawing horse, and is sometimes held by a chain and lever or less frequently in a strong pair of screw chops

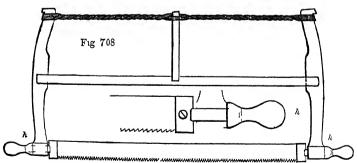

The Continental frame saw used abroad for the general pur poses of carpentry and cabinet making, is shown in fig 708, in the largest of these the blades are about three feet long, one and a half to three inches wide, and very thin and others as small as hilf those sizes are also used. The wooden handles h h shown also detached and of twice the size at h', have cylin discal stems, which pass through the end pieces, they are cut through longitudinally for admitting the sheet non T form clamps, which are each held by a rivet passing through the handle outside the frame—the blade is fastened between each pair of clamps by a pin or screw

The handles being cylindrical, the saw can be placed at all angles with regard to the frame, and may therefore be employed for cutting off pieces of indefinite length, provided they do not exceed the width from the blade to the stretcher, which latter is forked at the extremities to embrace the cross pieces, and this allows it to be shifted nearer to the string when required for wide pieces. Before using the saw it should be observed to place the blade exactly in a plane or out of winding

Most of the works performed in England with the hand saw, the tenon, dovetail, and similar saws, are abroad accomplished with frame saws of various sizes, the pieces are mostly fixed, either to or upon the bench, and the contrivance for holding long works, shown in fig 709, is also general on the Continent

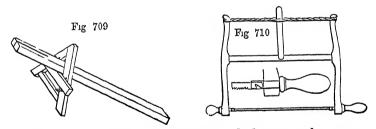

The work to be sawn is passed through the triangular opening in a wooden frame, nearly in the form of the letter A, when the frame and work he at an obtuse angle, they constitute a three legged stool. The upper edges of the board become wedged fast in the angular sides of the triangle, and the lower side of the board rests on the cross piece of the supposed letter, which may be placed at various heights, according to the size of the work, as it rests on two moveable pegs. In sawing small works the man rests his knee on the work near the top of the frame and the board is changed end for end when sawn through half its length. Triangular frames, with various modifications, are

also commonly used abroad instead of the saw pit, but our own occasional method namely, a pair of trestles about six feet high is much better as each of the sawyers is then far more favourably situated than when the timber is placed aslant *

The turning saw, or sweep saw, fig 710, which is also called the frame saw or bow saw, resembles fig 708 except in its smaller size and greater proportionate width of frame this will be apparent, as the figures are drawn to the same scale

Its handles have always cylindrical wires that pass through the end rails, the wires are sawn diametrically to admit the saw blade, and are drilled transversely for the pins frequently the one handle has an undercut notch, as represented on a larger scale so that the saw may be removed sideways from the one handle, and allowed to move as on a joint upon the other, a provision that is often turned to a useful account

In using the bow saw the work is mostly fixed vertically, and therefore the blade is used horizontally, but the frame is placed at all angles, to avoid the margin of the work, and it is fre quently necessary to twist the handles or pins during the cut, to modify the position of the frame. It often happens that the cut has to be commenced from a hole or aperture, in which case the tension of the blade is relieved by a turn of the stretcher, and the saw is disconnected at one end for its introduction. The disunion of the blade is also convenient for withdrawing it side wavs without the tedious necessity for intracing the torthous course by which it may have entered the work.


It still remains to notice those saws, the frames of which may be considered to be slightly flexible, and to form the three sides of a rectangle. The wory saw, which has been already figured and described at pages 146 and 147 of the first volume, is the largest of this kind, and the full particulars have been there given, of its use in the preparation of ivory. Sometimes the frames of saws for ivory are made of non, and without the adjusting sciew clamp, the frame is then sprung inwards by means of a long hook whilst the saw is inserted.

^{*} These and relative matters are fully described and figured by A. R. I my in his Traité de l'Art de la Charpenterie. Puis, 1837 I lates 2 to 11

The smith's frame saw, fig 711 is nearly a copy of the saw last referred to, and it almost always possesses a sciew and nut for stretching the blade

The mode of using the saws, for metal, is the reverse of that in saws for wood, as for metal, the motion should be slow, and the pressure somewhat considerable, and the necessity for each of these conditions increases with the hardness of the material. The saw is almost invariably moistened with oil or tallow grease and in the back strokes the pressure on the blade is discontinued, but the saw is not raised from the bottom of the notch, in this respect the action resembles that of the file


The smith s frame saw is the common instrument used in metal works for the removal of pieces that are in excess, and in many cases instead of the whole substance being cut through, a notch is made on two sides of the work, and the center part is broken. This saw is also used for making notches and grooves, much the same as in cabinet work, but except in small works, pieference is given to the figuration of materials by casting, forging, and other modes already described



The side frame saw, fig 712, although far less common, is greatly preferred by some workmen, thus, in making the joints of drawing instruments, much depends on the correct use of the frame saw, by which the notches are made for the reception of the steel plates used in the joints, and fig 712, in which the blade is more immediately under observation, is preferred to fig 711. For routing out the concave part, a saw like fig 713 is used and inserted a little way into the joint, until the holes in the joint and tool are sufficiently opposite to admit the end of a taper pin, the joint saw or router is then moved to and fro, and as the concavity is cut away, the pin is set forward until its cylindrical part causes the two holes to be exactly opposite, and then the work is completed

PIERCING SAW AND PIERCED WORKS

Piercing saw blades commonly measure from 3 to 5 inches long, and they are fixed in very light frames, such as fig 714, which are from about 2 to 4 inches deep from the saw to the back, in some instances piercing saws exceed the depth of 8 inches, as in m, fig 716 The blades are fixed between small screw clamps, the inner sides of which are mostly cut like files Sometimes, as in fig 715, the clamp near the handle is extended as a wire through the handle, and is tightened by a nut at the extremity, somewhat as in a violin bow, but in general the slide is considered sufficient and preferable, as when it is loosened the tension of the saw can be appreciated with the fingers, and retained with the thumb screw



Some kinds of silversmith's works are pieiced with this institu ment, and embellished with the graver When the design is original, the engraving is usually first done, and the interstices are cut out with the saw But for the convenience of repetition recourse is had to brass pattern plates, pierced and engraved like the finished work, the brass pattern is laid on the work. and all its interstices are marked through with a fine scriber In copying designs from any article of silver, the new piece is laid upon the original the interstices of which are smoked through with a lamp and in curvilinear works that cannot be pierced while straight, the pattern is dabbed with printing ink. a paper is laid thereon, and rubbed on its upper surface with a the paper thus printed is then pasted upon the burnishei object to be pierced The under side of the original is printed from, to make the copy direct and not reversed

The outline having been obtained by one of the above modes a hole is made with the breast drill in every piercing, and where practicable, the holes form the circular terminations of the The several curves are then followed with the saw. which is used vertically, and with the handle downwards, whilst the plate is held horizontally upon the pin of the jeweller's bench with the fingers, in order that both the work and the saw may be freely twisted about in sawing out the several parts

The silver piercer sits at the silversmith's and jeweller's ordinary work bench, formed like a round table, with four or six semicircular scollops, about 18 inches diameter around it the pins of small filing boards, are about 3 inches square, and project inwards into the bottoms of the bays or scollops, each of which has a skin or a leather bag nailed around its edge, that serves to collect the filings removed from the work

This form of work table is adopted in order that a central lamp may serve for the four or six workmen, each of whom has a glass globe 6 to 8 inches diameter, filled with water, to act as a condensing lens, and direct a strong light to the spot occupied by his work. Spirits of wine are added to the water, to prevent it from freezing and bursting the globe. The benches are frequently made semicircular, and placed against a window, as the circular bench requires a sky light.

The amateur can employ in piercing, a small square filing board with a fillet beneath, by which it is fixed horizontally in the ordinary vice. Should he prefer fixing the work, it may be still held horizontally, provided he employs a hand vice, and pinches it by the half of its joint in the tail vice, so as to place its jaws horizontally. In passing round the small curves, the strokes of the saw must be short quick, and feeble, in the larger curves the full length of the blade may be more vigorously used

Some of the very minute pierced works are dialled and then finished with small files, as in the plates formerly used for covering the balances of watches, but in general the file is not used. The piercing saw is also employed for cutting out small escutcheons and other pieces for inlaying

From the pierced works, appear to have been derived those inlaid works consisting of curved and flowing lines, which are produced by a method that may be called counterpart sawing, and in which two plates of differently coloured materials, whether wood, metal, ivory, tortoise, or pearl shell, are temporarily fixed together, and then cut through at the same time with a fine hair like saw. By this process the removed pieces so exactly correspond in form with the respective perforations, that when the two colours are separated and interchanged, the one material forms the ground, the other the inlay or pattern, and

vice versa and the pieces fit so nearly together, that the route of the saw is only visible as a fine line on close inspection

These works receive the general name of inlaid or marquetry works and also the specific names of buhl works and reisner-works, from their respective inventors *

The saws used in piercing and inlaying scarcely differ but in size thus, the black line m, in fig 716 is drawn from a large piercing saw of metal, and the dotted line w, from an ordinary buhl saw of wood—the former measures eight inches from the blade to the frame—the latter twelve or sometimes twenty inches, to avoid the angles of large works—The wooden frames are made of three pieces of wood, halved and glued together to constitute the three sides of a rectangle, after which two pieces are glued upon each side, each at the angle of 45 degrees across the corners—the whole, when thoroughly dry, is cut round to the form represented—The screws for giving tension to the blade, although commonly added, are seldom used, as the frame is only sprung together at the moment of fixing the saw, and by its reaction stiffens the blade

The buhl cutter sits astride a horse, or a long narrow stool, fig 717, having near the one extremity two vertical jaws lined with brass at the top, the one jaw is fixed, the other is notched


Boule work and Reisner work are considered by the virtuosi to apply exclusively to the works of two celebrated ebenists of those names both settled in France the former an Italian in the reign of Louis XIV the latter a German in the time of Louis XIV to XV. Their cabinet works were as much celebrated for their graceful forms or outlines as for their embellishment with inlaying

Boule mostly employed dark coloured tortoise shell inlaid with biass in flowing patterns occasionally ornamented with the graver Reisner used principally as the ground tulip wood (called in France bors de rose) inlaid with flowers in dark woods grouped in a much less crowded manner than in ordinary marquetry Reisner occasionally combined therewith bands and margins in which the woods were contrasted as to the direction of the grain as well as colour

The terms buhl or bool work uppear to be corrupted from boule, and now refer to any two materials of contrasted colours inlaid with the saw, and which, in France would be called by the general name of marguetene

^{*} The term marquetry seems to be employed to designate all kinds of inlaid work known in France as marqueterie en bois and marqueterie en métal. It includes not only the works of counterpart sawing in which flowers animals, landscapes and other objects are represented in their proper tints, by inlaying and without the aid of the artists pencil but it also includes those geometrical patterns composed of angular pieces laid down in succession more after the manner of ordinary veneeing and amongst which the specimens of parquetage, or inlaid floors appear to claim a place

below, and springs open when left to itself, but is closed by a strut, which is loosely attached to the stool by a tenon and mortise, and rests in a groove in the moveable jaw. When the strut is pulled downwards, by a string leading to the treadle, it closes the flexible jaw of the vice. In the plan the jaws are inclined some twenty degrees, so as to be at right angles to the path of the workman's light hand

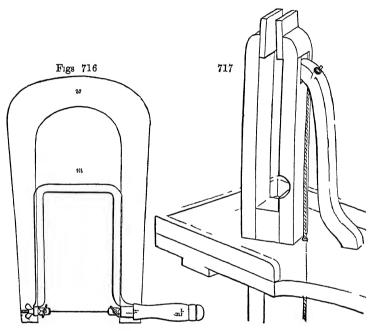

In the following descriptions of counterpart sawing, the several methods will be noticed in that order which appears to offer the most facility of explanation, regardless of other considerations

In buhl work the patterns generally consist of continuous lines, of which the honeysuckle ornament may be taken as a familiar example. To make this, two pieces of veneer of equal size, say of ebony and holly, are scraped evenly on both sides with the toothing plane, and glued together with a piece of paper between, for the convenience of their after separation. Another piece of paper is glued outside the one or other veneer, and on which

^{*} Veneers, like other thin plates, are pinched by one corner with a screw clamp to the table or bench—the tools are applied from the fixed end in order that they may pull the material and keep it straight instead of forcing it up in a wave

the design is sketched, a minute hole is then made with a sharp pointed awl or scriber, for the introduction of the saw, that spot being selected in which the puncture will escape observation

The buhl cutter being seated on the horse, the saw is inserted in the hole in the veneers, and then fixed in its frame, the work held in the left hand, is placed in the vice, which is under control of the foot, and the saw is grasped in the right hand, with the fore finger extended to support and guide the frame the medium and usual position of which is nearly horizontal and at right angles to the path of the saw

The several lines of the work are now followed by short quick strokes of the saw, the blade of which is always horizontal, but the frame and work are rapidly twisted about at all angles, to place the saw in the direction of the several lines. Considerable art is required in designing and sawing these ornaments, so that the saw may continue to ramble uninterruptedly through the pattern, whilst the position of the work is as constantly shifted about in the vice, with that which appears to be a strange and perplexing restlessness

When the sawing is completed, the several parts are laid flat on a table, and any removed pieces are replaced. The entire work is then pressed down with the hand, the holly is stripped off in one layer with a painter's palette knife, which splits the paper, and the layer of holly is laid on the table with the paper downwards, or without being inverted

The honeysuckle is now pushed out of the ebony with the end of the scriber and any minute pieces are picked out with the moistened finger these are all laid aside, the cavity thus produced in the ebony is now entirely filled up with the honey suckle of holly, and a piece of paper smeared with thick gluc, is rubbed on the two to retain them in contact. They are immediately turned over, and the toothings or fine dust of the ebony are rubbed in to fill up the interstices, a little thick glue is then applied, and rubbed in, first with the finger, and then with the pane of the hammer, after which the work is laid aside to dry

When thoroughly dry, it only remains to scrape the bottom with the toothing plane or, when the work is small, with its iron alone, and then the buhl is leady to be glued on the box

or furniture in the manner of an ordinary veneer, as already explained, when the work is again dry, it is scraped and polished Exactly the same routine is pursued in combining the holly ground and the ebony honeysuckle, and these constitute the counter or counterpart buhl, in which the pattern is the same but the colours are reversed

It is obvious that precisely the same general method would be pursued to make four satin wood honeysuckles at the respective ingles of a rose wood box, the veneers for which would be then selected of the full size and glued together with paper interposed. To ensure the exact similitude of the several honey suckles, one of them having been cut out would be printed from, by sticking it slightly to the table, dabbing it with printing ink, and then taking impressions, to be glued on the other angles of the box at their exact places. The counter would have, in this case, a satin wood ground, with the honeysuckles in rosewood.

To advance another stage, three thicknesses of wood may be glued together, as rosewood, mahogany, and satin wood, and a center ornament added to the group of four honeysuckles. The three thicknesses when cut through split asunder, and re combined, would produce three pieces of buhl work, the grounds of which would be of rose wood, mihogany, and satin-wood, with the honeysuckle and centre of the two other colours respectively. Such are technically known as works in three woods, and constitute the general limit of the thicknesses, but the patterns consist of many more parts than here supposed

In a series of three woods in the possession of the author, or three veneers, cut and interchanged as above explained, the three tablets each present forty eight different pieces and by the introduction of a broad arabesque band, the ground consists of a central panel of one colour, and a margin of another It is the general aim so to arrange the design as to have about an equal quantity of each colour, to make every combination effective, or without the predominance of any one colour

Before glueing such works together, it is sometimes required to take off a printed impression for future use in such cases one thickness is entirely stripped off, and those pieces of this thickness which best display the character of the pattern, are slightly glued on their corresponding places on the two thicknesses, and project therefrom in the manner of type, so that

they alone receive the printing ink and return it to the paper pressed upon them with the hand, or with a tool handle used as a burnisher

Brass borders, technically known as vandykes are worked in narrow slips, and in other respects as above except that unless a small hole is drilled through the brass and wood for the saw it is allowed to cut its own path from the outside edge of the materials and which is more usual. The true buhl or the wood ground with brass scrolls, is laid down in four or more pieces around one box or panel, and the counter, or the brass ground with wood scrolls, upon another

When the material is small and costly as pearl shell it becomes necessary to use two or several pieces, accurately placed edge to edge, to cover the entire surface to be ornamented, and the joints are placed where least observable in the pattern. The paper knife, from part of which fig 718 was drawn required eight pieces of pearl shell in using this material, a hold is made in the wood close against the pearl, and the saw is sent in from the edge of the same. The counter, when glued on another veneer, is not inlaid of the irregular angular form of the rough pieces of pearl but it is cut around the general margin of the pattern as at the one part of fig 719, which represents the counter to fig 718

Fig 718 the bull o true bull



Fig 719 the count or conterp think



Inlaid by ordin ry cutting


Inl id by internal cutting

Sometimes, to give additional elaboration and minuteness, the saw is made to follow all the device of the counter, and leave a

narrow line of pearl both within and without this is called internal cutting, and is represented in figure 719 but in general, the counter fails to present the same good effect as that of the true buhl, in which the drawing of the ornament is more effectually preserved, and in the internal cutting the pattern presents a thready or liny appearance

Before concluding this part of the subject, it deserves to be noticed that in the more minute buhl works, the parts are not cut exactly square, but slightly bevilled, so that the pearl may be left a trifle larger than the interstices in the wood to compensate for the saw keif, and make the fitting close as regards the true buhl. But this bevilling is prejudicial to the counter, as the line of junction in it becomes wider than usual, this defect is however, considered to be less observable in the counter, and which is also the less valuable piece. The stringings, or the straight and circular lines combined with pearl buhl work, are mostly of white metal such as tin or pewter, and are inlaid with the routing gage.*

In buhl works no part of the material is wasted and the whole of the work is cut at once. The circumstances are entirely different with the marquetry works now to be described, of which a slight specimen is represented in fig. 720,





^{*} Buhl works of brass and wood are sometimes made by stamping instead of sawing. As however the action of stamps and punches will be considered in a subsequent chapter it need only be here observed that the brass inlay whether a honeysuckle or other ornament is stamped out of sheet brass and the wood veneer is stamped with the same tools—the brass honeysuckle is then inserted into the cavity in the wood as before. This method produces so far as the nature of the materials will allow an absolute identity of form but it must be obvious the mode is not applicable to small patterns as the punches then inflict too much injury on the wood, neither does the stamping admit of the unbounded choice of design attainable with the saw as the punches are necessarily expensive and limited to their particular forms.

wherein the ground is ebony, and the flowers or other orna ments are made of coloured woods, as denoted by the annexed names. The dyewoods are used so far as they are available and the greens blues and some other tints are of holly, straned to those colours. Each different leaf or coloured piece is produced one at a time, and mostly requires two cuttings, which may be accomplished in three several ways

In the first mode, an engraving of the design is carefully pasted on the ground or counter, and cut out entirely after which the several leaves are sawn out from different veneers, by aid of another impression of the engraving cut into pieces, and the leaves are inserted in their respective places, this mode requires extreme exactness, but admits of complete success

In the second mode, the design is also pasted on the counter which is then left entire—the leaves are cut out from woods of appropriate colours, and are then glued on the respective parts of the paper pattern on the counter—The projecting leaves are cut in either singly of in groups, with the saw, which is just allowed to graze their external margins—The leaves are then all parted from the ground, and inserted in their respective apertures in the counter—By this, or the counterpart method, the fitting becomes more easy, and the cuts may be slightly bevilled, to improve the closeness of the joints

In the third mode, the separate leaves to constitute the inlay, are cut out from the different coloured veneers and glued in their appropriate positions on a sheet of paper. A sheet of white paper is also glued or pasted on the veneer to be used for the counter or ground, and further a sheet of the blackened or camp paper, such as that used in the manifold writers, is also required

The three are assembled together—at the bottom, the veneer with the piper upwards, then the camp paper, and at the top the leaves, the backs of which are then struck at every part with several blows of a light mallet, so as to print their own impressions on the white paper. The printed apertures are then cut in the counter one at time, so that the outer edge of the saw kerf falls exactly on the margin of every aperture

In this, or the third mode, the fitting of the parts may be made unexceptionably good, as the operation is not prejudiced by the unequal stretching of the paper, which is hable to occur when two copies of the engraved design are employed as in the first and second modes *

The ribs and markings of the leaves in marquetry work are made by cuts of the saw, or scratches of the graver, which become filled with the fine wood dust and glue

Occasional assistance is derived from the judicious disposition of the grain of the wood, and the shading of the leaves to give them roundness is obtained by scorching their edges by holding them near a heated iron before they are laid down. In this manner white roses and other flowers with many leaves are most successfully imitated in holly, the several leaves being cut out, scorched on the edge, and grouped together to form the flower before incision. Ivory is used for very white flowers, and ivory either white or stained and also pearl shell, and other materials are used for insects, and parts requiring additional brilliancy of effect.

SECT IV -RECILLINEAR OR RECIPROCATING, SAW MACHINES

Rectilinear sawing machines are for the most part derived from saws used by hand for similar purposes, and under these circumstances it appears desirable that the machines to be noticed should, so far as practicable be introduced in the order adopted in the last section, namely, machines derived from the felling cross cutting, and pit saws, and those from the frame, bow, and buhl saws


Few sawing machines have been made for felling timber, because the labour of removing the machines from tree to tree in general outweighs any mechanical advantage to be derived from their use. In the most simple machine of this kind, the saw is formed as the arc of a circle, attached to a wooden sector moving on its center, and worked with reciprocating motion by a horizontal level?

^{*} As a more expeditious mode of transferring the pattern than with the mallet the three parts above described have been squeezed in a flat screw press this fails to bring up the impression from the unequal thicknesses of the veneers—the hydro static press does not produce the required effect, and is liable to crush the wood from its enormous force—but the rolling press—such as that for copper plate printing was tried by Holtzapsfel and Co, and found to succeed in all respects in transferring the pattern

⁺ Another construction for a felling and cross cutting saw which is more elaborate, is described in the Mechanics Mag vol ii p 49 50 and at vol iii p 1 of the same Journal is a proposition for a pit saw, which, as well as the above, it

In cross cutting saw machines erected in the Portsmouth Dock yard and Woolwich Arsenal, the timber is laid as through a doorway, the posts of which are double so as to form two nar row grooves for the guidance of the saw this resembles the ordinary cross cut saw, except that it has two guide boards riveted to it, in continuation of its length, and the boards work freely through the grooves in the posts. The saw is actuated by a vertical lever, or inverted pendulum, moved by the steam en gine, and the workman bears down the opposite end of the saw with any required degree of force, the saw is guided in its first entry by a board with a saw kerf, which then rests upon the timber and when not in use the saw is turned up on its joint, leaving the doorway free for the reception of other timber.*

A cross cutting saw machine of a more exact kind is erected at the City Saw Mills—the saw blade is strained in a rectangular frame, which both reciprocates and descends in a vertical planc. The machine has a large double cross, the two horizontal arms have grooves that receive the rails of the saw frame, and which is reciprocated by a crank and connecting rod, the vertical arms of the cross—fit in a groove formed by double vertical beams

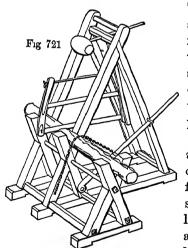

The cross and saw frame are almost counterpoised, so that a moderate pressure alone, and not their whole weight, falls on the saw teeth, and the timber is clamped on a railway or slide, which is at light angles to the plane of the saw's motion

A cross cutting saw machine worked by hand, that is much used on the Continent and in America, for cutting firewood, is represented in fig 721. The wood is laid in an X form sawing horse, and fixed by a chain and wooden lever, which latter is brought

under a peg The frame saw is suspended by its lower angle in

is proposed to work by means of the oft repeated scheme of a heavy pendulum put in motion by manual power

^{*} See Reess Cyclopædia Art Machinery for Minufacturing Ships Blocks vol. xxii also Encycl Metrop Part Manufactures Art 532

the cleft of a lever that swings as a pendulum when the saw frame is moved. The lever supports and guides the saw frame, the action of which is assisted by the momentum of an adjust able weight, built out at right angles to the suspending lever. The saw always rests on the timber, and cuts both ways, and being guided in its required position, a person but little experienced in the use of the ordinary frame saw, can exert his whole strength in the act of cutting and accomplish the work expeditiously, especially as the saw is longer than that shown on page 726, and employed in the ordinary manner for the same purpose

Upright or reciprocating saw machines, are largely employed to perform that kind of sawing which is usually done at the saw pit, the larger upright or frame saws are used for cutting large round or square timber into thick planks and scantling, the smaller for cutting deals into boards. The earlier of these machines appear to have been those for round timber, they were mostly built of wood and driven by water power, these have been repeatedly described.*

The vertical saw mills now used in England are made almost entirely in iron, and driven by steam power, and as the several constructions differ but little either in respect to principle or general arrangement, the modern frame saw for deals fig 722,


In Besson's Instrumentarum published in 1578 at Plates 13 and 14, are two very curious and graphic drawings of saw machines driven by manual power—the one by a crank and winch handle—the other by a pendulum pulled as a church bell and acting through the medium of a right and left handed screw, and a system of diagonal links, as in the so called 'lazytongs' One of the saws has currilinear teeth, of which 1 3 5,7, cut during the descent—and 2 4 6 8, during the ascent of the blade

In the saw invented by Lieutenant J W Hood for cutting through ice the blade is suspended from the end of a lever like that of an ordinary hand pump and has a heavy weight beneath the ice—lihe axis of the lever is in a wooden frame or sledge the progression of which is caused by the end of a rod or paul that sticks into the ice—the rod being jointed to the lever a little in advance of its pivots, thrusts the frame and saw some three or four inches forward during the act of cutting. This ice saw is worked by two to four men whereas the previous methods used in the Greenland fisheries with a triangle and pulley blocks, required from twenty to thirty men—Trans Soc of Aits, 1827, vol xlv—p 96

^{*} The reader interested in the practical details of the earlier saw mills is directed to Gregory's Mechanics 1807 vol in p 324 and in addition to the authorities there quoted, he will find useful matter on the subject in Hassenfratz's Traité de l'Art du Charpentier Paris 1804 in Lvan's Young Millwright, and Miller's Guide, Philadelphia 1821 and more particularly in the reprint of Belidor's work Architecture Hydraulique avec Notes par M. Navier Paris, 1819

will be principally spoken of In this diawing the whole of the mechanism has been brought into view, by supposing the floor to have been removed, and some unimportant alterations to have been made, in reality the pedestils F F rest upon the floor, and the machine occupies considerable length

The stationary frame work in fig 722 consists of two standards or vertical beams, in front of which are fixed two accurate square

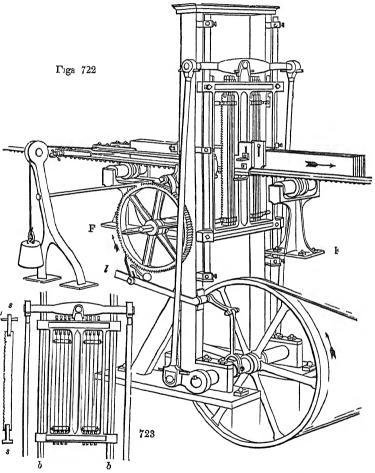

bars, by means of six loops. The sliding saw frame shown geometrically in fig 723 has four vertical and two horizontal bars and is cast in one piece, or as a rectangular frame, which is attached to the stationary square bars b b, by appropriate bear

ings at the four angles. One central crank is in general used, but for greater distinctness the drawing is made from a machine having two exterior cranks although one only is represented, the crank rods are not attached directly to the saw frame, but to a floating lever, which is jointed at its center to the saw frame, so that even supposing the two cranks to be a little dissimilar in length or angular position, they nevertheless move the platform equally without straining or racking it

When only one crank placed beneath the floor is employed, it is needful, both to avoid excessive height in the machine, and the disadvantage attending the action of a short connecting rod, that the latter should pass fieely through an oval loop in the lower cross rail of the saw frame, and be united to the upper rail, sometimes the crank shaft is fixed to the ceiling of the building, but this construction is the least in estimation. The crank shaft, in addition to the driving pulley, has always a heavy fly wheel to equalise the action of the machine, but which is not shown in the drawing

Two deals are usually sawn at once, the parts now to be described are therefore in duplicate, although in the figure one deal is supposed to be removed for the purpose of showing the mechanism more distinctly. Generally each deal has to be cut into three boards, and two saws are then employed on each side of the frame, but sometimes as many as eleven thin saws or webs are used, then producing twelve thin boards or leaves from each deal. The saws, of which one is shown at ss, have buckles riveted to them, and these pass through mortises in the top and bottom rails of the sliding frame, the buckles at the bottom are solid and shaped like an inverted T, those at the top have mortises and thin steel wedges, the T pieces and wedges bear on the outsides of the frame

The distances between the blades are adjusted by interposing pieces of wood, and pressing the whole together by the side screws, after which the saws are separately tightened by the steel wedges these details are sufficiently manifest in the geometrical view, fig 723. It is to be further observed that the edges of the saws are not quite perpendicular, but have a little lead, or their upper ends overhang the lower about $\frac{1}{4}$ or $\frac{2}{3}$ inch, to extend the cut throughout the descent of the blade, and to carry the saws a little distance $\int rom$ the cuts, in the ascending or back stroke

The two deals he on a series of rollers built on pedestals, of which two only are shown at F F the rollers also support a long rack which at the left of the figure, has dogs or nippers, that grasp the end of the deal by means of a side sciew. The weight to the left of the figure pulls the longer end of a horizontal lever, the shorter end of which (not seen), has a roller that presses the part of the deal contiguous to the saw, against a fixed vertical plate or fince, so that the cuts become exactly parallel with the side of the deal, whether it be straight or crooked

The deal is advanced by means of the rack and pinion, which are actuated by a ratchet movement as follows an eccentric on the main shaft alternates the shorter end of the lever l, and to the longer end of the same is fixed the ratchet or paul, which according to its distance from the center, slips over two or three teeth in its descent, and in rising thrusts the ratchet wheel round the same distance, and by its connexion with the pinion for the rack, advances the rack and wood a proportionate quantity. The retaining pauls or detents on the top of the wheel pic vent its retrogression, when they are turned back, the wood ceases to advance, and the slide may be run quickly back by a winch

The plank frame by the late Mr Benjamin IIIck, of Bolton, (of which a model is deposited in the Museum of the Inst Civil Engineers) has no long rack. Each deal is grasped between two grooved feeding rollers, the one fixed to the framing of the machine, the other pressed up by a loaded lever, and moved a small step at a time, by a ratchet as usual

The single saw frames above described make about 100 to 120 strokes, of 18 or 20 inches long, in the minute, and cut two 12 foot deals in from five to ten minutes, the saws require to be sharpened about every tenth round, or journey, for hard deals, and every twentieth for pine. Similar frame saws are made double, so as to operate on four deals at a time, the crank is then double, and so contrived that the saws in one frame descend, whilst those of the other ascend. By this arrangement the vibrations of the machine are somewhat lessened, so that the velocity may be increased to about 160 or 200 strokes in the minute, but the time occupied in fixing and adjusting is also greater, so that but little if any real advantage is obtained


Sawing machines for round timber are larger, stronger und somewhat different from the deal frames. The timber slide moves on fillets or V V's, which are fixed to the floor, and passes between the standards of the saw frame, the timber slide has strong vertical end plates, through mortises in which stout iron spikes or dogs are driven like nails, into the ends of the required planks. The dogs are then secured by side screws or wedges in the dog plates, from which they project sufficiently, to allow the saw blades to stand between the end of the timber and the dog plate at the commencement of the sawing

The sliding frames carrying the saws for timber frames are longer than for deal frames, and those in the Government saw mills at Woolwich rest in contact with rectangular fillets on the standards, against which they are pressed by powerful springs so that the square bars b b, fig 723, are dispensed with. In these machines the blades are strained one at a time by a loaded lever like a Roman steelyard which gives to each the tension of about one ton, and whilst under this tension, the wedges are driven just home but without violence, each blade becomes therefore tense alike. Various contrivances are added to vertical saw machines driven by power, so that, when the saws have arrived at the end of the timber, the motion of the wood or that of the entire machine may be arrested automatically

Rectilinear sawing machines are not much used for those kinds of work that are performed with the ordinary hand saws back saws, and frame saws used in carpentry, but two useful scress mécaniques suited to works of this scale are described in the Manuel du Louineur and fig 724 is reduced from one of these

The saw frame has a central wooden rod, and a blade on each edge, which are stretched by clamps, screws and nuts, much as usual. The saw is guided perpendicularly by fixed wries, these pass through holes in the cross heads of the saw frame which are sometimes fitted with rollers to relieve the friction. The saw frame is suspended from a bow spring attached to the column erected on the bench and the lower end communicates by a double ended hook with a light treadle. The spring, when left to itself raises the saw frame and treadle some 8 or 10 inches, and the pressure of the foot gives the cutting motion.

For straight pieces a wide saw is used, and the work is guided against a square fence, which overlaps the front edge of the bench, and is fixed by a binding sciew passing through a mortise. For bevilled pieces a chamfered bar c, is fixed to the right hand side of the bench, and carries a square sliding block, surmounted by an angular fence, with graduations and a clamping screw, the work is laid against the angular fence, and moved upon the chamfer slide past the saw. For circular works a narrow blade is employed, and the popit head or center point connected with the stationary frame work, serves as the axis of motion for the piece of wood to be cut

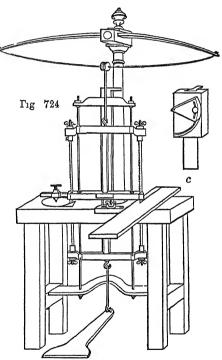


In order to leave the bench unobstructed, so that large pieces may be sawn, the guide rods upon which the saw frame works are discontinuous, the lower parts terminate beneath the bench, the upper are fixed to cross pieces connected with a dovetail bar, itself attached in front of the column, so that the group of pieces carrying the upper wires may be fixed at a greater elevation to

admit of thicker work. The back edges of the blades run in saw kerfs in the lower rail of the guide frame *

Three small reciprocating saw machines, fitted up as adjuncts to the lathe will now be described their constructions are entirely different and they were planned by their respective inventors quite independently of each other. The one first described was especially contrived for buhl cutting this appears however to be far the least valuable application of these machines, as they may be much more efficiently used for various works similar to those done by the slender bow or sweep saw. The extreme delicacy of buhl work as incompatible alike with the encumbrance arising from the mechanism, and the friction of the work upon the supporting platform.

In Mr Mac Duff's buhl cutting machine the saw is stretched in a frame about 4 to 6 inches high and 10 to 14 inches wide

the frame reciprocates vertically upon small fixed wries, by the modification of the crank shown in fig 725. The pulley e beneath the lathe bearers b receives continuous motion from the foot wheel the lower end of a cord c is fixed to a pin about an inch from the center of e passed around the fixed pulley p, then between the bearers to the saw frame, which is raised by a spiral spring by this arrangement, the purillelism of the cord is obtained. The work is supported upon a table or platform midway between the path of the saw frame.



^{*} A machine on a somewhat larger scale was elected by Mr Brunel at the Woolwich dockyard and worked by the peculiar but expensive parallel movement of the interior epicycloid. There is a fixed which say of 16 inches diameter with internal teeth, and a corresponding pinion of 8 inches diameter carried round by and revolving upon the end of a crank of 4 inches radius, the pinion carries a stud by which it is connected with the saw frame. The velocities of the crank and pinion are as 2 to 1 and in the same direction, the stud if attached to the center of the pinion would move in a circle of 8 inches but when attached to the edge or pitch line of the pinion it reciprocites in a right line 16 inches long, the stud if placed in any intermediate position would travel in an ellipsis.

A accept ocetting saw machine for sawing boring and manufacturing bevilled and curvilinear works in wood was patented in 1833 by Mr. Samuel Hamilton and is briefly noticed in the foot note following the application of the circular saw to curvilinear works p. 805

[|] Mac Duff's bull saw received the prize of 101 awarded by Di Fellowes and is fully described in the Mech Mag 1830 vol and p 129 at p ge 235 of the same volume Mi Mac Duff' has described a larger and more simple machine of the same kind


In the two following machines the saw is unprovided with the frame, by which, under ordinary circumstances, it is stretched and guided these functions being fulfilled by the motive parts of the respective apparatus

Mi Lund s vertical saw machine, which is represented from the back in fig 726 consists of a bench with foot wheel and treadle, surmounted by a rectangular frame, the lower rail of which is rebated to fit the bearers—the center rail is extended into a plat form about three feet square—which, for the sake of portability, consists of two wide flaps with hinges and brackets, somewhat as in an ordinary pembroke table—To—the extremities of the upper rail are fixed two long and narrow springs, made of ham mered steel, that spring downwards when left to themselves. The ends of the saw are grasped in screw clamps, formed at the ends of square wires—working rather freely in the two outer rails, within holes fitted with metal—The lower saw clamp is connected by a cat gut with an eccentric and guide pulley—as in Mac Duff's but the eccentric shown detached in fig 727 has more range, the traverse being sometimes 4 or 5 inches

The upper saw clamp is connected with the straight springs by means of a catgut line, reeved in the manner shown more at large in fig 728 (one of the side frames being removed), the catgut proceeds from the springs, over the two fixed pulleys, and under the pulley on the top wire or clamp, this arrangement equalises the actions of the springs, and gives a parallel motion to the blade, the back edge of which lies towards the operator, and works in a notch on the edge of a hardened steel disk, inlaid in the platform. One end of the catgut has a small circular button, which is passed through a round hole in the spring, and then sideways into a notch so as to be readily detached for the removal of the saw

Mr Lund's machine is simple and effective for inlaid and fret works, and a variety of thin curvilinear pieces which occur in cabinet work and pattern making. For cutting parallel and bevilled pieces, appropriate guides are added to the platform, similar to those elsewhere described. For circles, a brad awl is passed through the center of the work into the platform, or rather into a subsidiary and common platform then added. And to shorten the length of stroke during the working of the machine as required in sawing around small curves and rounded angles, a sliding bolt beneath the platform, is thrust across the path

of the saw so that the ascent of the saw to the full height is then prevented by the temporary increase of thickness in

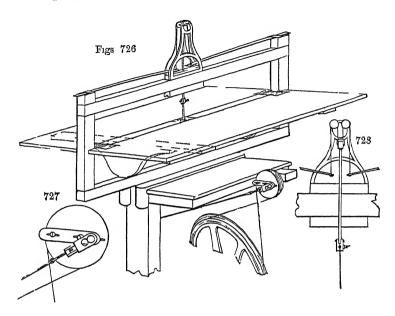

the platform, as the saw clamp strikes against the sliding bolt or slide *

Fig 729 is copied from Professor Willis's sketch of a vertical saw for curvilinear works, constructed by himself in 1837. The frame of the machine is elevated above its true position to show the details, and is clamped on the bed of a lathe or

Mr Lunds saw machine was constructed and used in 1828


^{*} Mr Lund makes an ingenious use of this machine for inlaying the instruments in dressing cases lined with velvet. The bottom of the trays are glued up in three thicknesses the grain of the inner piece being crossways of the outer lengthways a piece of white paper is added to receive the outlines of the instruments the spices for which are then cut in the saw machine with a saw thinned away at the back and very much set to cut a wide path.

The inner pieces having been removed are split through the joint and glued flat down on a piece of velvet—each inner piece is then cut round with a penknife leaving the face alone covered. The principal piece or skeleton is then glued and laid on another piece of velvet which covers the holes as in a drum—the velvet is cut through at virious parts of each aperture and folded round the edges of the holes and lastly every removed and covered inner piece—is pushed into its place which stretches and smooths the edges of the volvet—and completes the work. As the central pieces are in three layers the cells may be either of one third or two thirds the entire depth—at pleasure

grinding frame, and the saw derives its motion from an eccentric carried by one of the ordinary grindstone spindles. This eccentric is a pulley of hardwood cut in half and sciewed against the face of the mahogany pulley. A loop of wire embraces it, and connects it with the lower spring so that when the spindle revolves the spring is thrown into rapid vibration, the springs are of wood 21 inches long and 21 inches broad

The saw is clamped at each end in a small non-clump, the lower clamp is joined to the lower spring by the same steel pin that carries the loop of wire. The upper clamp has several hooks filed in its edge any one of which can be hooked on a steel pin fixed to the upper spring. Thus the saw is curred and stretched at the same time by the two springs, and can be readily disengaged, either by unhooking the upper clamp or by unclamping either end. The lower spring is fixed to the frame, the upper is fixed to a separate piece of wood that can be adjusted to different heights, and the platform is 12 inches above the bearers.

The only point that requires further consideration is the adjustment of the saw in the springs, so that it may traverse as nearly as possible through one and the same point of the platform, notwithstanding that the ends of the springs nearly describe arcs of circles, and therefore carry the extremities of the saw slightly

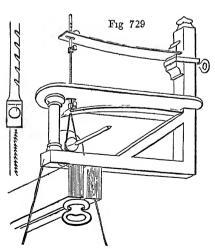

to and fio during its move

The vertical distances between the springs at their roots where they are fixed to the framing, and at their pins where they carry the saw, must be so adjusted that when the saw is at the top of its stroke, the lower spring is horizontal, and when at the bottom of its stroke the upper spring must be horizontal, and the platform indiway between the two horizontal lines.

In this condition with a range of two or even three inches, the one curvature will neutralise the other at the platform, as in

some of the parallel motions, which may be proved by a diagram carefully drawn on paper

Professor Willis has used this machine extensively for cutting out in thin wood, models of Gothic tracery also mathematical curves in illustration of the teeth of wheels and other elements of mechanism. To adapt the machine to take either short or long strokes as required in buhl cutting without discontinuing the motion of the foot wheel. Prof. Willis proposes to apply a contrivance to the eccentric, analogous to that explained in his Treatise on the Principles of Mechanism, 2nd Ed. p. 386

A 11bbon sawing machine, the connecting link between rectilinear and circular saws, was patented by Mr Newbury in 1808 and is thus described - "Mr Newbury sengine is formed by a long and very flexible blade of a similar nature to a clock spring, which passes over two rollers of considerable diameter, placed in the same plane, and whose extremities are united so as to form a band round the two rollers When this blade is intended to act as a saw, one of its edges is cut into teeth of the usual shape and the substance to be sawed as placed on the stage, through which the blade passes, and is pressed against the blade with the necessary force and in the direction proper to produce the shape required for it * Guides for cutting rectilinear curvilinear, and cucular pieces are alluded to The arrange ment was however rarely used until brought into notice by M Peirin in the Exhibition of 1851 since which time it has met with extensive employment

SECT V —COMMON AIPIICATION OI CIRCULAR SAWS TO SMALL WORKS

The remainder of the present chapter will be devoted to the consideration of machinery for circular saws, and in treating

^{*} See Retrospect of Philosophical Discoveries, 1808, vol iv p 222 The following paragraph respecting Newbury's flexible saw appears on page 527 of the last edition of Belidor's Architecture Hydraulique, acce Notes, par M Navier Paris, 1819 —

^{&#}x27;Scie a lame flevible et sans fin — Cette invention a été proposée en Angletine mais il paralt qu'on y doutait de son succès Llle a été employée avec avantage en Irance par M Touroude pour refendre les liteaux qui composent les tuyaux des vis d'Archimède (Bullitin de la Société d'Encouragement Juillet 1815) Le modèle de sa machine est dépose au Conservatoire des Arts et Metiers

this extensive subject it is proposed to present the matter in the following sections

- V Common applications of cucular saws to small works
- VI Common applications of circular saws to large works
- VII Less common, or specific applications of circular saws
- VIII Circular saws and machinery for cutting veneers

It is further to be observed that in the present or fifth section, in speaking of the construction and application of small sawing machinery, or that which may be conveniently used by the amateur, the matter will be arranged under the following subdivisions

- 1 Lathe chucks for very small saws
- 2 Spindles for saws of medium size
- 3 Platforms, or tables and benches, for saws of medium size
- 4 Stops to prevent the vibration of flexible saws
- 5 Parallel guides
- 6 Sawing the sides of rectangular pieces
- 7 Sawing grooves, rebates and tenons
- 8 Sawing or cross cutting the ends of pieces either square or bevilled or those works in which the angular variations are in the horizontal plane
- 9 Sawing bevilled edges, and prismatic pieces, or those works in which the angular variations are in the vertical plane
- 10 Sawing geometrical solids and irregular pieces or those works in which the angular variations are in both the horizontal and vertical planes

The sub divisions 1 to 10 when a little modified, denote also the arrangement followed in sections VI and VII


1 Lathe chucks for very small saws—Circular saws not exceeding one or two inches diameter are occasionally mounted on lathe chucks, similar to that represented in fig 730, which is not only the most simple, but probably one of the earliest modes in which the circular saw was used. The chuck should be of moderate length, with a tenon to fit the hole in the saw, and a central screw or nut to fit the same, as represented

Opticians use this mode for the small thin saws with which they cut the notches in the tubes serving as springs in pocket

telescopes Carvers in ivory and similar materials employ small but thick saws, the edges of which are of round angular, or other sections In each art the objects are mostly applied by the hands alone

For cutting the notches in the heads of screws for mechanical construction thick saws are similarly employed. The screw is held in a socket fig. 731, the end of which is tapped to receive the thierd of the screw and in cutting the notch, the socket is supported an inch or more from its extremity, upon the edge of the rest for the turning tool. The socket is wriggled up and down as a lever, to make the bottom of the notch tolerably straight, instead of concave and the precautions to make the cut diametrical will be found at the beginning of page 723

The gas burners designated as bat's wing burners have a narrow slit through which the gas issues these are cut in a similar manner by thin circular saws and Mr Milne, gas-fitter of Edinburgh, seriates such saws with a sciew cutter or tap as in making the teeth of a worm wheel (see pages 591 2), but the cutter should for the present case have one side of the thread perpendicular, to produce saw teeth of the customary form

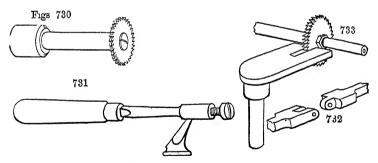


In cutting the knuckles and tenons for joints fig 732, the work is usually supported on a small iron platform, fig 733, the surface of which is horizontal, with a notch to receive the saw, and a cylindrical stem to adapt the platform to the bed piece of the common rest. The platform is fixed a little below the axis, to place the knuckles exactly central to the saw, so as to make the notches equally deep on both sides, and if the surface of the platform is parallel with the axis of the spindle, the notch is sure to be perpendicular or square to the side of the work

Sometimes two saws are used upon the same chuck or spindle,

to ensure parallelism in the sides of the middle piece or tenon and similar methods are commonly used in sawing notching and drilling the small wooden mechanism of piano fortes. For some of these works, especially those in metal the saws are not always mounted on lathe chucks but occasionally on small spin dles similar to that drawn in the next figure


2 Spindles for circular saws of medium size—For sawing ordinary works in wood, the above arrangements are mostly insufficient, as the saw should be further removed from the pulley or lathe head, to enable pieces of moderate width to be cut off, and also larger in diameter to serve for thicker pieces. The saw is then mounted on a spindle such as that shown in section in fig. 734—the saw plate fits upon the cylindrical neck of the spindle, and is grasped between the two flat surfaces of the flange and loose collar, (which latter is shaded) and pressed forward by the nut—A steady pin, or a small wire (represented black) is inserted obliquely in the spindle, and passes through a corresponding notch in the saw—The steady pin constrains the saw always to travel with the spindle, without depending on the grasp of the nut alone

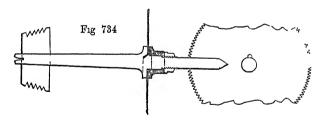

The saw spindle, fig 734, is frequently squared at one end, and has a center at the other, to admit of being supported in the lathe at its extremities, by the square hole chuck and popit head respectively, so as to revolve together with the mandral. When the saw spindle is used independently of the lathe, it has a center at each end for the center screws then employed, and also a pulley to receive the band from the foot wheel or other motive apparatus. In regard to the proportions of circular saws and some other particulars concerning them, the reader is referred to the table on page 784, near the commencement of the following or sixth section of this chapter

3 Platforms or tables and benches—Wooden platforms employed for supporting the work have sometimes from stems, and the in fact, extensions of fig 733, except that they are placed above the center, so that one third the saw plate protrudes perpendicularly through the center of the platform. But a large platform thus constructed is very weak from being attached only at one point, and every time the platform is fixed there is the trouble of placing the saw leaf exactly parallel with the saw otherwise great friction ensues

The saw platform and apparatus in fig 735 are made almost entirely in wood, they are applicable to the ordinary turning lathe, and to saws not exceeding about 8 to 10 inches in diameter. The wooden platform is supported at the front and back, nearly throughout its width, upon the edges of the wooden box, the position of which is defined by a tenon fitting between the lathe bed, and secured by a bolt passing through the same. The platform is hinged to the back of the box, thus constituting is it were, a large and overhanging cover. The last process in the construction of the apparatus, is to fix it upon the lathe bearers, and to allow its own circular saw to cut the saw kerf or slit in the platform which thence becomes exactly parallel with the saw

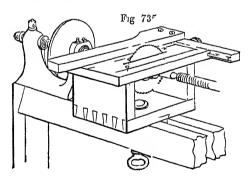


In refixing the apparatus leady for work, the wood frame is first placed loosely on the bearers, and the platform is turned up the saw spindle is then adjusted between the centers, and lastly, the platform is shifted sideways until the saw enters the kerf, the entire wood frame is then secured by its bolt and nut, but owing to the tenon beneath, there is no risk of the groove being other wise than par illel with the saw. Occasionally that part of the

platform which is contiguous to the saw, is covered with a thin plate of brass to increase its durability

The sawing apparatus fig 735 although made principally in wood, will be found a very convenient appendage to the turning lathet or the same parts may be used independently of the lathe, upon a wooden bench or frame with a wheel and treadle, much the same as that partly represented in the succeeding figure except that the wooden standards are then required to extend above the bearers so as to carry the center screws for the saw spindle. The back board for receiving any parts of the work under progress, and the drawer for the saws, are convenient for their respective purposes, but by no means important

The sawing machinery represented in fig 736, although generally similar to the last, is made entirely in metal, except the wooden frame. The principal piece in fig 736, or the bed piece, is planed flat on its underside, and has a fillet to adapt it to the lathe beavers or other frame, the ends of the casting are formed as popit heads, and are tapped for the reception of the center screws, which support the saw spindle. The middle of the bed piece is formed as the box or trough, to which the plat form is hinged by two center screws, tapped into projections on the underside of the platform, the front part of which rests upon the supporting screw, fitted into the bed piece.

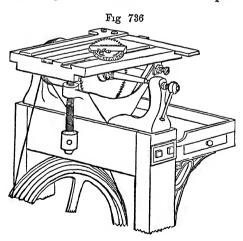

In general construction the iron machine fig 736 is a great improvement on that in wood, fig 735, in respect to stiength

and permanent accuracy, and as the supports for the spindle and platform, are all united in one iron casting the mechanism is not subject to derangement, and is quite independent of the frame or bench which may be either that partly represented in the figure or the frame of an ordinary foot lather after the removal of the headstocks or on any bench whatsoever, provided motive power from any source can be conveniently applied to the saw spindle. And in the course of the following descriptions it will be seen, that the latter machine, with certain additional mechanism, is capable of performing within the limitation of its size, almost any kind of work to which the circular saw is applied

4 Stops to prevent the vibration of flexible saws—When the diameter of the circular saw is considerable compared with the diameter of the flange on the spindle, the blade becomes very flexible and may be easily diverted sideways from the true plane—the prevention of this is accomplished in many ways

The saws used for slitting the thin wood of which cedar pencils are made, are from about 4 to 6 inches diameter and very thin so as to act rapidly and with little waste such saws have fre quently supplement my collars, or thick flat plates of brass fitted to the cylindrical neck of the spindle, and extending to within $\frac{1}{2}$ or $\frac{3}{4}$ of an inch of the edge of the saw which thereby nearly acquires the stiffness of the collars themselves. But as saws are in general required for thicker wood, such large flanges are mostly madmissible, and other methods must be employed

For small saw machines having wood platforms, it is generally considered sufficient, that the saw should work in a narrow cut or groove made by the revolving blade in the platform, and which allows the saw but very little lateral play, as the teeth can no longer cut when the smooth part of the blade rubs against the slit. The friction will in time wear away the wood until the slit becomes inconveniently wide, but a fresh piece of wood can be then inlaid, and another notch made by the saw as at first

Metal platforms are sometimes made in two parts for the convenience of forming the sht for the saw but friction against the metal would blunt the teeth, and should be avoided. In such cases, the inner edges of metal platforms made in two pieces are usually tapped for small screws which are adjusted very nearly to grasp the smooth put of the saw, just within the

line of its teeth. The platform fig 736 is made in only one piece, with a wide shallow groove in its upper surface which is again filled up flush with a bar of non in the end of which is a deep notch to admit the saw and it night angles thereto the stop screws are inserted laterally in the bar. The latter can be adjusted in the groove to place the stop screws just within the line of the teeth after which they are twisted by their capstan heads until they nearly touch the saw plates

But stop sciews howsoever constructed give lise to hoise, and are somewhat hable to wear the saw into grooves. A preferable mode for small saws is to inlay a piece of ivory or hard wood in the groove on the top of the platform and allow the saw to cut its own slit or else to fit two pieces of ivory into dovetail grooves, made transversely in the under sides of the platform and to advance them to the saw by adjusting sciews but which although a more costly method, is no better as in every case the stop should be as nearly as possible flush with the platform, various other stops will be described in speaking of large sawing machinery

5 Parallel guides for small circular saws—Saw machines of every kind, depend very materially for their usefulness on the various guideprinciples introduced into their several constructions, and upon the advantage of which principles, as applied to cutting tools generally, some preliminary observations were offered in pages 463 to 471 of the volume now in the reader's hands

In circular sawing michinery the table of platform being a flat surface, and the saw blade, at right angles thereto all pieces that he tolerably flat on the saw bench are sure to be so quided as to be cut out of winding, and square with the face on which they he But to guide them across in a right line it is requisite to have some kind of rectilinear guide parallel with the saw the width of the piece sawn off then becomes equal to the distance between the saw and guide, and any number of succeeding pieces may be produced exactly of the same width

The guides for parallelism are constructed in many ways, three of which, available for small sawing machines, will be noticed at this place—the jointed parallel rules are also used and will be described in subdivision 5 of the next section

The most simple parallel guide, is a straight bar of wood fixed

to the platform by a screw clamp at each end, or by two screws passing through transverse mortises in the ends of the bar, but two sets of graduations are then required on the platform, to place the straight fence or bar exactly parallel with the saw

Sometimes a shallow groove, inclined 30 to 40 degrees with the saw, is made in the top of the platform, and fitted with a slide, the overhanging edge of which is also inclined 30 to 40 degrees, so as to be always parallel with the saw, the variation of width arises from placing the guide in different parts of the groove. This may be considered a modification of the principle employed in the Marquois scales and parallel rule, but as a saw guide the range is rather too limited.

A more convenient guide was suggested by Professor Willis of Cambridge, and is shown in figs 735 and 736 The first is simply a square the two bars of which are not in the same plane as the one bar lies upon the platform, the other is flush with it, and fitted to the back edge of the platform by a groove and tongue joint a screw clamp is there situated, to fix the one bar of the square to the platform, after the position of the other bar has been adjusted to the width required in the works This parallel guide may be allowed to extend altogether beyond the sides of the platform so as to have fully twice the range of the jointed parallel rules, to be described hereafter, and is besides steady alike in every position, provided the surfaces by which the two bars are united are sufficiently large, and firmly joined The parallel guide in fig 736 is made in iion, and also after Professor Willis's plan, but the back bar, then lies in a rebate in the platform, and is secured by a small clamp and screw, partly seen

Round wood is in general too large to be cut up with the

⁶ Sawing the sides of rectangular pieces—Before commencing to saw a piece of wood with the circular saw, it is desirable, in order to ensure accuracy in the result, that two neighbouring faces of the work should be moderately straight, to serve as the basis from which to commence, otherwise as the work is thrust past the saw with the hand, it may assume different positions in its course, and thereby give rise to enormous friction against the saw, and may also present, when finished, curved instead of flut surfaces

small saw machines here referred to, but particulars of the mode adopted in large machines are given in the corresponding subdivision of the next section. It may however be observed, that when the first cut is diametrical small round wood may be held with tolerable facility to the saw, and it is sometimes sawn at twice or with two radial cuts, from opposite sides, but which cannot be expected exactly to meet. When the first cut is required to be on one side the center, it is much the best plan to flatten some part of the wood with the hand saw or plane, to serve as the bed on which the work may rest upon the platform

In sawing up pieces of plank wood the broad surfaces left by the pit saw will in general be found sufficiently accurate for their guidance in that plane, so that the edges alone then require examination and one of these is sometimes corrected with a jack plane for greater exactness

When the saw has been put in rapid revolution, and so that the teeth near the operator descend, the work is laid flat on the platform and against the parallel guide and is then gradually advanced towards the saw. If the work be thrust forward too quickly the saw may be altogether stopped from the excessive work thrown upon it, and if it be not advanced at an uniform rate, the markings left by the saw will present corresponding irregularities.

In dividing a piece of wood that is long compared with its width, it occasionally springs open as a fork when sawn, so that the outside or guiding edge of the work, from having been originally straight becomes a little concave. This is sometimes allowed for by making the face of the parallel guide to consist of two straight lines a little distant one from the other instead of one continuous line, by fixing a thin plate to the principal piece by countersunk screws. The set off in the guide usually occurs a little behind the cutting edge, and allows the work to escape the saw, so as not to be scored by the ascending teeth at the back part of the plate and which are otherwise apt to catch up the work, if small, and throw the pieces in the face of the operator

It usually happens that many similar pieces are cut in immediate succession, in such cases, the succeeding piece is frequently made to push forward that which is nearly sawn through, by which mode the risk of hurting the fingers with the saw is avoided otherwise the piece is thrust towards the conclusion with a stick of wood, having a rectangular notch at the end


The jointed platforms are very convenient, as they can be turned up to shoot off any accumulation of work or sawdust, and also for the removal of any little pieces of wood, which may occusionally become wedged in the cleft beside the saw

7 Sawing grooves, rebates, and tenons—When the plutform of a circular saw machine does not admit of any change of elevation, as in that shown on page 789 and many others, the quantity the saw projects through the table can only be varied by selecting saws of different diameters, or by placing supplementary beds of different thicknesses upon the platform—the latter method generally interferes with the action of the parallel rule—But in the machine, fig 736, constructed in iron, the hinged plat form may be adjusted by the regulating screw in front so that the projection of the saw through the table may, if required, barely exceed the thickness of the wood to be operated upon or the saw may be only allowed to cut to a limited depth, and to form a groove either in the side or edge of the work

By making two incisions on the contiguous faces of the wood, the solid angle may be removed, as in the formation of a rebate fig 737, the same cuts again repeated would form the tenon, fig 738 but this process requires that the end of the wood should have been previously cross cut exactly square in the mode explained in the following subdivision of this chapter

⁸ Sawing or cross cutting the ends of pieces, either square or bevilled or those in which the angular variations are in the horizontal plane. The most general guide for cutting the ends of work either square or oblique, is shown in fig. 736, and also in plan in figs. 740, 741, and 742, it is applicable to every angle. An undercut groove is made in the platform parallel with the saw, for the reception of a slide that carries a semicircular protractor, which latter is graduated, and may be fixed at any angle by the thumb screw passing through its semicircular mortise into the slide beneath. The slide has sometimes V grooves made in its two sides, and the platform is then in two parts with bevilled edges, corresponding with the V grooves. The work to be sawn is held by the fingers in contact with the straight fence of the guide, and the two thus grasped are slid together past the saw

The guide for angles is represented in fig. 740 in the position for cutting rectangular pieces from the end of a long bar, and the edge p p of the parallel guide, then serves as a stop for the width of the blocks thus removed. By the similar employment of an oblique position, such as that shown in fig. 741 inhomboidal pieces of any angle and magnitude, may be as readily produced

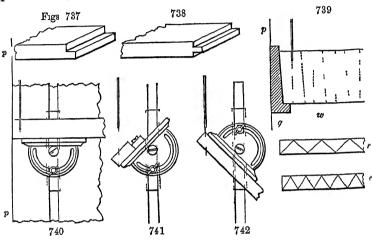

When the pieces are not cut from the end of a long 10d but are small, and only require to be reduced to any exact size, it is more convenient to affix the stop for width upon the fence or the semicircular protractor, as in fig. 741, and in this manner small pieces can be easily sawn into regular or irregular polygons of any particular angles and numbers of sides

In cutting mitres, as for picture frames, the one piece would be cut by placing the semicircular fence in the position, fig 741, but for the other piece of the mitie, it is necessary to place the semicircle as in fig 742, so that the guide may precede the work that is to be sawn consequently unless the slide will admit of being withdrawn from the groove, and replaced the other oud foremost, there should be two holes for the thumb screw, and two indexes for the graduations

Although the oblique fence may be placed at the smallest angle and even parallel with the saw yet when the pieces are required to be thin and acute, it is more generally convenient to prepare with the apparatus, fig 740, a wooden guide of the particular angle and of the form shown in fig 739, p, being the

parallel rule g, the guide or bevilled block, and w the work A separate wooden block is necessarily required for every angle, and the parallel guide is still available in determining the general width or thickness of the works

When pieces are parallel in one direction and bevilled in the other they may be cut out without any waste beyond that arising from the passage of the saw. In such cases the work is prepared as a parallel piece equal in thickness to the parallel measure of the objects, and the work is turned over between every cut so as to saw the pieces "heads and tails, or the wide end of the one from the narrow end of the other, as shown by the dotted lines in fig 739. This mode is employed for ivory knife-handles, and for the thin slips for covering the keys of pianofortes, which are made thicker in front, where the principal wear occurs


Triangles may be sawn out of parallel slips in a similar manner, thus, by using guides at the angle of forty five degrees and turning the work over each time, right angled triangles r are produced exactly of one size, with sixty degrees, equilateral triangles, e and so on for all others having two equal sides a half triangle at each end being the only waste. In manufactories where large quantities of bevilled works are sawn, it is usual to employ a wooden bevil guide for every different angle required both from motives of economy, and also to prevent the accidental misadjustment of variable guides, and sometimes the unchangeable guides are made in metal

⁹ Sawing berilled edges and oblique prisms or those in which the angular variations are in the vertical plane —In cutting pieces with bevilled edges, a supplementary bed of metal, the hinge of which is quite close upon the saw platform and against the saw, is occasionally employed this may be set at all angles by a stay and binding sciew. But the more simple and usual plan is to employ supplementary wooden beds planed to the definite angles icquired, and through which beds, the saw is allowed to cut a thin keif as usual

A pretty example of the use of inclined saw beds is seen in the so called mosaic works, consisting of groups either of triangles, rhombuses, or of squares, cut in different coloured woods, and arranged so as to constitute various patterns, which it is proposed to distinguish as triangular mosaics and square

mosaics Mi James Burrowes of Tonbridge Wells, informs the author that nearly every sort of wood is used, both English and foreign, and also many sap woods but principally holly and ebony for white and black, and bar wood barberry, beech, cam wood, cherry, deal, fustic, green ebony king wood, laurel laburnum, hlac, mulberry, nutmeg, orange, partridge, plum, purple yew, and walnut, for various colours Mr Burrowes adds, that he was the first to introduce this work in I onbridge ware turnery, boxes, and toys, although striped, feathered, and tesselated works somewhat of the same kind, were used long prior, in the bandings and stringings of ornamental cubinet work

For the triangular mosaics, beds of the angles of 45 and 22 \(\) degrees are principally used, but others of 15, 30, 60, and 75 degrees are also occasionally employed, they require guides for parallelism, either to be applied to the inclined beds themselves, or to be added to the parallel rule, with the power of adjustment vertically as well as horizontally, very thin saws are used, and they project but little through the beds

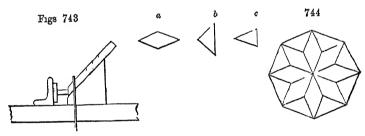


The wood is cut in pieces six or seven inches long first into veneers of appropriate thickness the formation of which into slender squares requires no explanation. Figure 743 shows that a bed of 45 degrees, will at one cut for each piece, convert the veneer into rhombuses figured separately at a, the acute angles of which measure 45, the obtuse 135 degrees each and when the wood is turned over between each cut, right angled triangles b, are produced, with the same bed. When, as in the dotted line fig. 743, the bed measures $22\frac{1}{2}$ degrees, and the work is also turned over, triangles are produced such as c, and from which three figures, a, b, c, almost all the work is compounded

Such of the pieces as are required to form the pattern are selected and carefully arranged in groups on the bench one

man picks up a small group brushes them over quickly with thin glue, and hands them to another workman who dexterously arranges them in their required positions, and further quantities of the pieces are handed up by the first workman until all that constitute the first glueing are arranged. The stick, or faggot, is then tightly bound with string and before the last coils are strained around the mass any pieces which stand out beyond their true positions, are rapped with the hammer along the side of the faggot

Generally eight rhombuses a, constitute the central group as in fig 744 and the eight angles are then filled up by right angled triangles, b thus producing an octagon which is allowed to dry. At other times the eight rhombuses, a, are combined for the central star, the hollow angles of which are filled in by eight squares, which themselves produce eight new angles A B fig 745, each measuring 135 degrees. Sometimes each angle

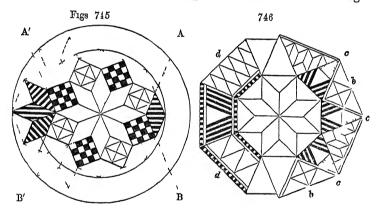

A B, is filled by the obtuse angle of one rhombus, a, and this also produces an octagon. At other times, each angle, A B' is filled by the three acute angles of three rhombuses a, which together measure 135 degrees also (one group being striped the others only dotted), and afterwards 16 right angled triangles, b complete a nearly circular figure. The whole of the latter group would be combined at one glueing by dexterous workmen, except when the squares or other pieces are themselves compounded of little bits, which is a preparatory process.


The central octagon, fig 744 when dry, is often surrounded by other sectional groups, as in fig 716, either eight compounded

triangles, such as c, with the new spaces filled by eight right angles b, to reconstitute the octagon or else eight wedge form pieces, d, are alone used. The edges of the sections are glued, and quickly placed around the octagon il nucelus after which the whole is sometimes fixed between powerful clamps or wedged within external rings, at other times, string is again used to bring the parts together

The blocks, when finished are allowed to dry for some weeks, and are ultimately cut into thin veneers and glued upon 10 ind boxes. Octagons of different patterns are united side by side, and the spaces filled in with right angled triangles, so as to constitute straight patterns for the centers and boilders of rectangular boxes. Small round sticks are occasionally turned into little ornaments, and the curvilinear surfaces so obtained, present various pretty effects when the intersections are accurate

The compounded sections of the wooden mosaics are generally prepared beforehand of small triangles, as a distinct process, and are frequently screwed fast in cauls of their appropriate angles, or they are built up as laminated sheets, and cut into form with the saw

The chequered squares are prepared from slips of veneer one inch or more wide, so as to avoid handling the little squares, which could scarcely be tied up in true rectangular arrangement. I he pieces of veneer are glued together, either white and black alternately, or in any arrangement that the pattern may require strips cut off the edges of the laminated pieces and reversed as at a fig 747, produce the chequered squares, cut obliquely and alternated they produce rhombuses b and striped rhombuses c, triangles d and squares, can be also readily obtained, and the author suggests that b, c, d and similar pieces, should as in the diagrams, figs 745 and 716 be mingled with the present patterns,



many of which are much elaborated, principally from small triangles alone, without a sufficient regard to the general design or drawing of the figure. The author possesses however, a very good specimen of mosaic work composed throat entirely of triangles, which in a drameter of 3½ inches, contains no less than 808 separate pieces of wood, combined with very good effect.

The square wood mosaics, called also Berlin mosaics, from their assimilation to worsted works, are more recent than the triangular. Figures of vases, animals, and running patterns are composed entirely of little squares of various coloured woods, which are glued up like the chequered works. Supposing the entire pattern to constitute a rectangle composed of 20 squares in width, and 30 in length 30 slips of veneers of appropriate colours and an inch wide, are first glued together and this is repeated 19 times, making one laminated block a for every line of the figure. A veneer B, is then cut off from each of the 20 blocks a and these striped veneers B are glued side by side to constitute the group c, of 600 slender squares, the thin leaves cut off from the end of this last constitute the mosaic pattern D

The accuracy of the work greatly depends on the exact similitude of the veneers as to thickness, and as the blocks A, will each produce some 15 or 20 repetitions of B and C the perse vering care required in the formation of a single specimen, will also effect a vast extent of repetition of the same pattern of D

The small square mosaics for boiders and other works are usually inlaid in slips of holly as running patterns, by aid of the buhl saw. Very large mosaics are usually made in 6, 9, or 12 sections, glued up separately into squares, and then combined. One example thus formed by Mr. Burrowes, represents the Prince of Wales's feathers, arms and motto, it measures $3\frac{1}{2}$ by $2\frac{1}{2}$ inches, and consists of between 8000 and 9000 squares, the block was prepared in 12 sections, that were afterwards united *

^{*} From the researches of Winkelmann Wilkinson and others there appears to be no doubt but that, 3300 years ago the ancient Egyptians were wonderfully successful in making mosaics of minute cylinders squares and filaments of glass united by partial fusion and pressure and that from the end of the mass slices about one sixth of an inch thick were cut off and polished much the same as above described


Various specimens are referred to, in which the pictures are said to be very perfect and exactly alike on opposite sides showing them to run through the mode of construction is apparent from the joinings being just visible in a strong light and from the colours having in some places run into one another from the partial excess of the heat employed in uniting them

The I gyptime also appear to have made other mosaics by cementing pieces of glass stone and gems on backgrounds just the same as since practised by the ancient Pomains and by the artists of Italy and other countries in our own times—See Wilkinson's Manners and Customs of the Ancient I gyptians 1835. Vol in pages 91—97, %

In sawing the regular prisms of from 3 to 12 sides, it is neces sary the inclined beds should meet the saw plate at the same angle as that at which the sides of the polygon meet or their exterior angles. It is therefore proposed as an example for all prisms to trace in fig 748 the formation of the hexagon, or 6 sided prism, from a round or irregular piece of wood, upon which, as a preparatory step one plane surface has been cut in any manner, either by the saw or plane. The following table contains the several angles required

In regular prisms of	3	4	5	6	7	8	9	10	11	12 sides
Their external angles	60	90	108	120	128 ₁	135	140	144	147,	150 deg
measure The supplements to the external angles or what they fall short of 180 de grees are	1	90	72	60	51 ₄	45	40	36	32 8	30 deg

Referring to the above table it is seen the external angle of the hexagon is 120 degrees (represented by the dotted are A),



and that the supplement to the latter is 60 degrees, therefore the inclined bed should also meet the saw at an angle of 60 degrees (represented by the dotted arc, B) by means of this bed alone, the second side of the prism would be cut on the prece of wood But in cutting the icin uning four sides, it would be required to introduce some guide, to ensure the parallelism and equality in width of the sides, and this is done by laying a second angle upon the first also equal to the supplementary angle of 60 degrees (represented by the dotted are, C) Then B and C', which are of the same angle, together constitute a trough, and the width of the side of the trough near the saw, must be equal to the side of the required hexagon, but the second piece C is not adjusted to its position, until after the first two sides of the prism have been sawn. The angle of the inclined beds must be very exact, as any error that may exist, becomes accumulated, or is six times multiplied in producing a hexagon

Irregular polygons have frequently the angles alike but the sides dissimilar, thus it may be considered that in a, fig 749 a parallel piece is added between the halves of the regular hexagon whereas in b, a piece is abstracted and in c two of the sides dis appear. These and the entire group, a to g, fig 749, may be sawn with the bed B, fig 748, of 60 degrees

It is most convenient especially when many pieces are wanted, to prepare for a, a rectangular prism, and then to cut off the four dotted triangles at four cuts, leaving the stop s, in the same position throughout b may be treated in the same minner as a or else as in c, the two exterior cuts may be made on the edge of a wide piece of board, and then two interior cuts remove the rhombus c, and leave a hollow angle of 120 degrees, as explained by the dotted lines

The several inveited angles of the piece g, may be also produced in this manner by two cuts each, two of the cuts in g are however made on the horizontal table, and not the inclined bed, B. The inverted angles are convenient as troughs to support prismatic pieces on their angles, instead of their surfaces

Pieces analogous to those a to g, may be cut on beds of any other angles but when the prismatic pieces have dissimilar angles, unless they are complementary one to the other, separate inclined beds are generally required for every angle *

which the angular variations, are in both the horizontal and vertical planes—It is proposed to illustrate this part of the subject, by some remarks on the formation of various solids illustrative of geometry, and crystallography, such as erect and oblique prisms, pyramids, double pyramids, the five regular solids or platonic bodies (namely, 1st, the tetrahedron, 2nd the hexahedron 3id, the octahedron, 4th the dodecahedron, 5th the icosahedron,) and some other polyhedra. And, although in the formation of the models of these solids, various modes are employed, those methods will be selected, in which all, or nearly all the work,

^{*} It will be shown in the succeeding section that in some cases prismatic works he mounted upon in axis placed at various angles by a dividing plate and then applied to the saw. And in the subsequent volumes it will be likewise explained that most lathes for ornamental turning possess very ready means of producing both in wood and metal an infinite variety of polygonal and polyhedial works, with giret precision and smoothness.

may be performed by the saw machine alone, independently of the various other means

The models above referred to, are generally made in sycumore, maple, or horse chestnut and in the majority of cases, the wood is prepared as prisms, the sawing of which has been fully described. Sometimes, before the subsequent processes, the prisms are very carefully plined in angular beds, mostly so arranged, that the surface to be planed is horizontal

A long prismatic rod, carried to the saw at right angles, is readily cut into short erect prisms of various heights, and the same prisms carried obliquely to the saw, become oblique prisms

For pyramids of 3 to 12 sides long prisms should be first pre pared also of 3 to 12 sides, the sections of which are exactly equal to the bases of the required pyramids


The prisms are usually cut into short pieces equal to the vertical height of the pyramids and one guide block suffices for making all pyramids the sides of which meet at the same angle. The ordinary guide or gage block, is simply a piece of wood having at the end a rectangular and perpendicular notch BCD, fig. 755 which may be made at the saw machine by aid of the protractor. For pyramids the sides of which meet at 60 degrees, as in fig. 750 the side BC, of the notch in fig. 755, measures 30 degrees with the principal edge AB, of the guide, for pyramids of 40, 50, or 70, the angle of the guide is respectively 20, 25, and 35 degrees, or half the angles at which the sides meet.

The side A B, of the guide is placed in contact with the puallel rule and the short prism is placed in the nook so that in every case the base of the prism rests against the face C D, and one of its sides uhatsoever then number, touches the vertical face B C, the parallel rule is then adjusted to direct the saws s, through the dotted line proceeding from the apex to the base of the pyramid. One cut having been made, the guide and work are quickly withdrawn, the waste piece removed by the saw, is thrown away, and the block is shifted round until the succeeding face of the prism, (or so much of it as remains) touches the face B C, and so on to the last face of the pyramid

Sometimes as in fig 751, a pyramid is cut at each end of a prism, the method is almost the same, but the wood and guides are each longer, as in fig 756. The square end of the prism is

placed against the stop, and the first pyramid having been cut the piece is changed end for end, and the process is repeated, in cutting the second pyramid, the point of the first touches the stop, or a notch may be made in the stop to prevent the extreme point of the piism from being bruised

When the pyramids meet base to base, as in fig 752, other methods are pursued dependant on the parallelism of the opposite sides or angles of equal pyramids. Sometimes the prism is cut off to the exact length of the double pyramid and the first pyramid having been cut as shown in fig 756, the second pyramid is produced as is fig 753 by laying the sides of the first pyramid against the parallel rule, and placing a wedge beneath the point of the first pyramid, to support the axis of the piece horizontally

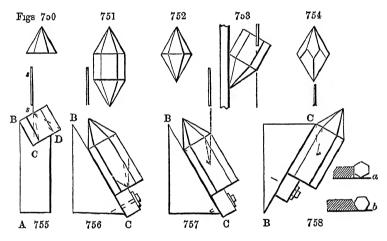

A much easier and more accurate way of cutting the second pyramid, is suggested by the author in figs 757 and 758. The prism is in all cases to be left longer than the two pyramids the first of which is cut as in fig 756. Then leaving all matters is before for pyramids of 4, 6, or 8 sides, simply to remove the parallel guide sideways, so as to change the position of 756 into 757, in order that the saw may enter the opposite side of the prism at the base of the first pyramid, and proceed into the solid prism as far as its center. In a 4, 6, or 8 sided prism, the 4-6, or 8 cuts release the double pyramid in 757 from its hollow bed, or inverted pyramid, or that which is sometimes termed, by

mineralogists its pseudo morphous crystal. It is needful the saw should penetrate slightly beyond the apex and the crystal will jump out of its bed when the last side is nearly cut through, leaving a trifling excess on the last side just it the point, but if the inverted cuts are extended much beyond the apex, the model will be released before the last side is completed


For double pyramids of 3, 5, or 7 sides, meeting base to base, as in fig 752, the position of the saw in fig 757, cannot be employed in cutting the second pyramid because in a pyramid with uneven sides, the saw then would enter at one of the angles instead of at one of the faces of the first pyramid. Conse quently the angular guide fig 756, is changed end for end as in fig 758 and all the sawing is done on the same side of the axis of the pism. The position fig 758 might be used for all second pyramids whether of odd or even sides, but for the latter the guide fig 757 is more conveniently placed.

Sometimes, however, it is required that the face of one pyra mid should meet the edge of the opposite, as in fig 754, thus producing what is teimed in mineralogy a macled or twisted crystal. Macled double pyramids with 3, 5 or 7 sides are cut by pursuing throughout the method prescribed for ordinary double pyramids with 4, 6, or 8 sides, namely, using the one guide, after the mode fig 756 for the first and after the mode fig 757 for the second pyramid, and then with pyramids of uneven sides the required displacement is obtained

Macled doubled pyramids, with 4,6, or 8 sides require the face B C of the first guide, fig 757 to be perpendicular as in the reduced figure a 758 and the face B C 757, for the second pyramid, to be inclined 22½ 30, or 45 degrees respectively as at b or half the supplement to the external angle of the respective polygons. For macled hexagonal pyramids the side B C, may continue perpendicular, provided that in sawing the second pyramid, the edges and not the faces, of the 6 sided prisin are placed against B C, fig 757

Irregular prisms may be sawn into arregular pyramids, but certain corrections are sometimes required. Thus, the prism beneath fig. 759, which is more, and fig. 760, which is less than a regular hexagon, produce the irregular pyramids respectively annexed the sides of each of which meet on one base line. In the first pyramid, fig. 759, the plain ridge is equal to the central

piece added to the hexagon in the second pyramid, fig 760, the central face that corresponds to the narrow side of the hexagon, terminates below the extreme point. The six fixes might in either case be mide to converge exactly to one point, by the employment of a second guide adapted to the irregular side.



Irregular pyramids, having as in fig 763, equal sides, but un equal angles, produce pyramids, that converge exactly to a point

I hus fig 761 shows the result when the rhombic prism is cut into a pyramid, the bases of the side also meet on one plane, and when the piece is released by cutting the inverted pyramid by the method shown in fig 757, the solid that results is an irregular octahedron, the section of which is rhombic in both planes

To produce an *irregular* octagonal pyramid from a *regular* octagonal prism, a wedge is placed beneath the prism, as in fig 762, which now represents the guide—the point of the wedge is to the left, in cutting the sides 1-3, 5, 7, of the octagon, and the point of the wedge is to the right, in cutting the sides 2, 4, 6, 8—By this *twisting* of the axis, the *regular* prism yields an *irregular* pyramid of the section shown at fig 763, and the departure of the latter from the true polygon, is shown by the angular space, between the true polygon, and the vertical face in fig 762, which space represents the piece removed in virtue of the subjacent wedge, the angle of the two being alike

When the inverted in egular pyramid is similarly cut, the line of junction of the two is in one plane when the more obtuse edges of both pyramids meet, but the line of junction becomes zig zag or macled, when the more obtuse angles of the one octagon meet the less obtuse of the other

The same method pursued with the 4 or 6 sided prisms produces similar results, subject however, to certain displacements of the edges and points, the modes of correcting which will be sufficiently manifest to those who take up these matters practically

It is now proposed to show how by pursuing the methods of cutting various pyramids, the five regular solids and many others can be obtained with the saw machine

The tetrahedron with 4 planes each an equilateral triangle, is cut from a regular triangular prism inclined $19\frac{1}{2}$ degrees,* and it is best to cut it at the end of a long piece, as in fig 756, and then to remove it by one cut of the saw at 90 degrees which at any distance between the apex and base produces the true tetrahedron


The hexahedron or cube, with 6 planes each a square, is cut off from a square prism held at 90 degrees, the length of the piece removed, must necessarily be the same as that of the sides of the prism

The regular hexahedron or cube, may be also viewed as two triangular pyramids, the faces of which are interposed or macled, or so placed, that the face of the one pyramid meets the angle of the opposite, as before explained in fig 754. And pursuing this method, the cube may be sawn from a triangular prism by the positions figs 756 and 757, provided the prism is inclined exactly 85½ degrees to the saw † The cube, when produced in this manner from the triangular prism is however very small as viewed diagonally, (and in which direction it is cut,) the cube appears as a hexagon, three angles of which touch the centers of the triangular prism. It is better to use the hexagonal prism, and to place its alternate sides, 1, 3, 5, successively upon the plat form, both for the first and second processes figs 756 and 757, in which case the hexagonal outline of the cube, may be as large as the section of the hexagonal prism from which it is sawn

Any other inclination than $35\frac{1}{4}$ degrees produces an oblique hexahedron, or rhomboid, with six equal thombic faces. For instance, the very dissimilar figures 764, 765, and 766, were cut from hexagonal prisms of the same size and respectively as large as the prisms would permit. In fig. 764, which is an acute or elongated thomboid, the angle at which the prism met the saw was 10 degrees, and in fig. 766, an obtuse or compressed rhomboid the angle was 80 degrees. Viewed along the dotted line or through their common axis, the three figures all appear as equal hexagons, and show the three pyramidal planes of each solid as equal thombuses, as in the figure 767 but the axis of

^{*} Mathematically 19 28 17

fig 764 is about four times as long as that of the cube, 765, the axis of 766 is only about one eighth as long as the cube, and its edge is acute like a knife



The octahedron, with 8 planes, each an equilateral triangle, may be viewed as a double square pyramid cut off at an angle of $35\frac{1}{4}$ degrees * and is produced in that manner with very little difficulty from a square prism. When the prism meets the saw at a smaller angle than $35\frac{1}{4}$ degrees, the octahedron is said to be acute or elongated and when the angle is greater, the octahedron is obtuse or compressed, as recently explained in regard to the rhomboids figs 764 and 766

It has been considered unnecessary to represent the regular tetrahedron, hexahedron, and octahedron, which are simple, and familiarly known, and the subsequent figures 768 to 771, of the dodecahedron the icosahedron, and trapezohedron, are to be viewed as explanatory diagrams and not as faithful representations of these respective polyhedra

The dodecahedron, fig 768, with 12 planes each an equilateral pentagon may be viewed as frusta of two pentagonal pyramids, the sides of which are interposed or macled, and the pyramids being truncated form the two remaining pentagons. The double 5 sided pyramids, are first cut at the angle of 26½ degrees † and discontinuously, by means of the positions shown in figs 756 and 757, the sides of the pyramids will then be found to meet at 36°, the angle made by the first and third sides of a pentagon. The outer plane is obtained by cutting off the point of the pyramid at right angles to the prism, and extending it by trial, until the terminal pentagon itself and the 5 pentagons near it, become equilateral. The second pyramid, not having been cut so far as the center the solid is now removed from its matrix or prism, by one cut at right angles to the prism, and so far removed from


^{*} Mathematically 35 15' 52' or half the supplement to 109 28 16 the angle at which the pyramidal planes of the octahedron meet See Brooke's Crystallography page 116

[†] Mathematically 26 33 54

the angles of the zig-zag line on which the pyramids join, as the corresponding pentagon, at the outer end of the solid

The above, or the pentagonal dodecahedron, is also called the Platonic dodecahedron but there is another kind named the rhombic dodecahedion, which is more referred to by minei alogists The rhombic dodecahedron fig 769, has 12 faces, each an equilateral rhombus and may be viewed as a hexagonal prism with a shallow triangulu pyrumid at each end

The rhombic dodecahedron may be therefore sawn from the hexagonal prism, provided that first three pyramidical planes are cut at the angle of 54% degrees,* and that the solid is then released from the pusm by three similar but inverted cuts on the intermediate angles of the hexagon, so much of the central piram being left as will make six ihombuses equal to those terminating the original prism

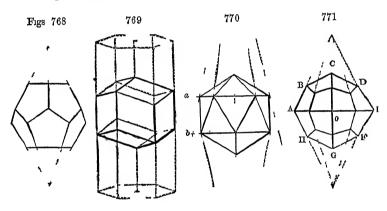

The rhombic dodecahedron may be also viewed as a square prism terminating in two square pyramids cut off at an angle of 45° but as these planes run on to the angles of the plism, it is needful the bed should be inclined 45° houzontally for the pyramids, and also 45° vertically, for their displacement

The icosahedron fig 770, with 20 planes each an equilateral triangle, may be viewed as two obtuse pentagonal pyramids, united by fiusta of two other pentagonal pyramids a to b, the sides of which are very acute and interposed. The icosahedron may be sawn from the pentagonal prism nearly in the manner of

^{*} Mathematically, 54 44 8'

the last, the first guide is the angle of $10\frac{3}{4}$ degrees * and suitable to cutting the two central frusta. This guide is first employed as in fig 756, and then shifted as in fig 757, the 10 cuts produce the 10 angles, each of 60° , constituting the central zone of the figure. The extreme end of the piece is then sawn at five cuts on a bed of $52\frac{1}{2}$ degrees † so that the five planes of the outer pyramids constitute equilateral triangles exactly terminating on the line a, or on the sides of one series of five triangles and the points of the other scries constituting the central zone of the solid. The icosahedron is removed from the prism by placing the guide block as in 757, and cutting the second pentagonal pyramid, which similarly to the first, falls on the line b and just meets both the sides and angles of the 10 central triangular faces, when the work is accurately performed every point is the center of a group of five equilateral triangles

The solid fig 771, with 24 equal trapezoidal planes may be viewed as two frusta of octagonal pyramids joined base to base with continuous edges, and surmounted by two obtuse four sided pyramids. This solid belongs rather to mineralogy than geometry, and occurs with various angles—its usual name is an icositessei a hedron—but it has been sometimes termed a trapezohedron from the shape of its faces—three of its varieties will be noticed—In the first, the three quadrantal sections—namely, through A o E through C o G, and through A B C D E F G H, are all regular octagons, and the angles of the solid are throughout alike—this variety may be therefore called the regular trapezohedron—In others the three sections are irregular octagons, and the alternate angles dissimilar, these may be called irregular trapezohedra and two of these varieties that occur in mineralogy are referred to in the annexed table

The regular trapezohedron may be sawn from the regular octangular prism, by means of two beds, one of them inclined in two directions. The first bed for the frusta of the two central pyramids, is inclined 21 degrees horizontally, or on, the line B C, fig 756. The second bed for the two exterior four sided pyra mids, is inclined 59½ degrees horizontally on the line B C, fig 756 and 22½ degrees vertically, as at b, in the same group in order to twist the prism on its axis, because the four terminal planes run on to the angle of the octagon

^{*} Mathematically 10 48 44

The four planes of the terminal pyramid produce trapeziums, and which are increased by trial, until they just equal the eight trapeziums formed by the partial obliteration of the central pyramidal faces. The second four sided pyramid, which completes and releases the solid, is merely an inversion of the first

The irregular or mineralogical trapezohedra, may be produced from the regular octangular prism, nearly in the manner just explained, by the employment of different angles, that are stated exactly in the annexed table which shows the comparison of the three varieties of this solid selected for illustration *

	Alternate angles of the solids				Beds for the central parts			Beds for the terminal parts				
	A C	ΕG	вр	FΗ	Hor angles		Wo	dge	Hor angles		Vert angles	
Reg Trapezohedron Irreg	135 126 143	52	135 143 126	0 8 5 2	90 24 17	56 6' 33	8 8	ne 8 8	59 54 64	38 44' 46	22 22 22	30 30 30

The table supposes the regular octangular prism to be in every case used, but to produce the *irregular* pyramid from the *iequilar* prism, requires the use of a wedge, as explained in page 773, and the angle of the wedge is half the difference between the two external angles of the prisms, which are simply the reverse one of the other. The wedge becomes unnecessary if prisms are prepared, having the same *irregular section* that occurs in the second and third solids, and which is the preferable mode. If the lathe with revolving cutters and dividing plate is used for preparing the prisms as hereafter recommended instead of stopping the lathe at eight equal spaces, or taking 45° each time the angles taken alternately are the supplements to the two external angles of the prism, common to the second and third solids, namely 53° 8, and 36° 52', which together are equal to 90° | When

1—53 8 3—143 8 5—233 8' 7—323 8 2—90 4—180 6—270 8—360

Unless the lathe has an index with an adjusting screw the 8' must in each case he neglected but it is an admissible error

^{*} The irregular trapezohedron in another of its sections is a regular hexagon, as illustrated by the figure 77° six of the trapeziums then constitute parts of the original prism three trapeziums at an obtuse angle form the summit of the crystal and three paris of trapeziums are situated more acutely and intermediately. The trapezohedron might be therefore also worked from the hexagonal prism by aid of two beds of the particular angles, one of them having a double inclination

[†] The angles for the dividing plate are consecutively as follows

the wedge is thus dispensed with, the vertical angle 22° 30′ suitable to the regular prism, becomes 18° 26′ for the second and 26° 34′ for the third solid in the table, or half the supplements

The order of proceeding given, in reference to producing the various solids with the circular saw namely first to saw the central parts of the solids and then the terminal planes or pyramids, is in all cases advisable when only one or two solids of a kind are made as the equality of the faces is then arrived at by two adjustments in place of four. The two central portions are simply inversions one of the other, and necessarily agree without trial, the central part thus produced, serves as the base from which to determine the two adjustments for the terminal parts

As however, every step of this process depends on the primary accuracy of the prism, which serves as the means both of guiding and holding the pieces, whilst under formation, it is desirable as regards the more complicated polyhedra, that those who possess the lathe with revolving cutters, for ornamental turning, should make or at any rate finish the prisms therewith, which will thence acquire an unexceptionable degree of accuracy. The trouble of preparing the wooden prisms, may be entirely saved, if metal prisms of the several sections each with a conical hole to serve as a driving chuck, are prepared. The pieces of wood for the solids are then roughly turned as cylinders with conical stems which are driven into the prisms for their attachment. The metal prisms may be used for an indefinite number of pieces, they save much trouble and uncertainty, and are especially desirable in the more complex polyhedra.

There are other and very different ways of making the geometrical and crystallographical solids. Sometimes the wood is prepared with the plane alone, into prisms of unequal sides and angles, so arranged, that two or four of the sides of the solid, may be parts of the surfaces of the original prism, and that some of the edges of the solids may fall on the remaining faces of the prism. The plane is then used subsequently to the saw machine, in perfecting and smoothing all the faces.

These modes do not admit of the same generalisation of facility of method as that described, which the author believes to be original, and that may be called the method of double pyramids and which he was led to work out practically to the extent set

forth, morder to show how much may be done by the saw machine and various simple adjuncts

The author has now the pleasing duty to acknowledge the kindness of Professor Willis, who has examined the several details mathematically, and furnished the corrected angles that are given in the notes and table

Many crystals that occur in mineralogy are considered to be derived from the primary solids, especially from the tetrahedion, cube, octahedron and the rhombic dodecahedron, by the oblitera tion of some of their edges and angles in various ways, or as it is said in mineralogy the edges are bevilled or replaced, the points or angles are truncated By way of general illustration of the method of producing these secondary crystals from their primaries, a few of those derived from the cube are demonstrated by figs 773 to 778 but numerous other crystals, from this and other primary solids, might be advanced

The cubes are first prepared as described on page 774, and their faces are rubbed smooth, in cutting their edges and angles, beds similar to fig 779 are required. The latter may be made entirely with the saw, for example, the rectangular block is supported on the face A, and two incisions a b, each at 45 degrees, are made by means of the saw and protractor, then the piece being placed with B downwards, and with the face A, against the parallel rule, the perpendicular notch c, is sawn, the three cuts release a piece of wood, leaving a cubical matrix




Fig 773, the cube with bevilled edges, requires that the edges of the cube should be parallel with the saw, and the guide is then placed, as in fig 781, that is, before the protractor, which is set at zero, and s is the stop for the quantity each of the 12 cdges is Cubes with two bevils or planes on each bevilled or truncated edge, may be bevilled with the position 781, provided the guide is tilted up some 20 degrees, by fixing a wedge of 90 degrees beneath the guide, as dotted in fig 779, or otherwise by making a similar bed fig 780, with the angles 25 and 65 instead of 45, which will make a rectangular notch, inclined 20 degrees, as in fig 780, so that the wedge may be dispensed with




Fig 774, the cube with three bevilled planes at each angle of the cube, (one angle only being shown) is obtained with the position of fig 781, but the protractor is then set about 10 degrees from 90, so as to cut off every edge of the cube by two cuts slightly inclined. The square face of the cube then becomes an octagon, if the facets meet as represented in dotted lines or a dodecagon when the bevils do not meet. The bed, if also inclined vertically, as by the wedge in fig 779 will duplicate the angular chamfers, and it is clear this elaboration may be carried systematically to any required extent.

Fig 775, in which the angles of the cube are truncated on the diagonal require that the bed fig 781, should be placed at $35\frac{1}{4}$ degrees * and then the angles of the cube will be cut off nearly at $54\frac{5}{4}$ degrees to every plane, or at right angles to the diagonal, and this little facet, in like manner to the above, may be converted into three planes, somewhat after the manner of fig 774, if so required

When, as in fig 776, the angles of the cube are so fai oblite rated, that the eight little triangular planes exactly meet, the cube is converted into the cubo octahedron, a solid having six square faces and eight triangular faces, the whole of which are equilateral one only of each is represented to avoid confusion

By pursuing the last method a little further, so that the trian gular faces encroach upon each other, they first produce a little ridge intermediate to the neighbouring facets, and carried to the proper extent, convert each of the triangular faces in fig 776

^{*} Mathematically 35 15' 52' the same angle as that employed to produce the cube from the regular prism with 3 or 6 sides, by six pyramidal cuts, and also the regular octahedron from the square prism

into equilateral hexagons, in fig 777 the six little square faces are all that remain of the original cube, and these squares are united by eight hexagons, all equilateral. The name of fig 777 when perfected is the ex octahedron and which implies that this solid may be also obtained from the regular octahedron, by obliterating its six points, which develope the six squares and the hexagons are then consequently parts of the octahedron

If, as in fig 778 all the angles of the cube could be truncated by planes extending from angle to angle, the cube would descend to the octahedron. With the circular saw this is impracticable to the full extent, although some of the planes may be developed but the mineralogist produces the octahedron from cubes of fluor spar, which splits diagonally from every point of the cube with great facility

When the octahedron is produced by the cleavage of fluor, further reduction only makes a smaller octahedron, which form is thence described as the primary crystal of this mineral. In other minerals, the cube is the primary to the octahedron

It is expected that enough has been said to show that, with a little contrivance in the carrying out of the methods advanced, a vast number of even the most complex models of geometrical and crystallographical solids, with plane surfaces may be produced with comparative facility and great exactness, by the saw machine, and the mechanical amateur will find it a some what fascinating study, especially if he be likewise interested in geometry or crystallography

The circular saw should be rather stiff, and have fine teeth, as then the planes developed by the instrument will be tolerably smooth, and merely require to be rubbed slightly on a sheet of fine glass paper, I ud on a flat board or metallic surface they are sometimes cleaned off on a wooden face which, on which powdered glass or flint is glued after the manner of glass paper

In concluding this section, the author begs to add that the whole of the various works described, subsequently to page 760, may be executed by the amateur with the machine represented on that page, aided by the simple additions described. The remainder of the chapter refers to larger sawing machinery, principally used by manufacturers

SECT VI —COMMON APPLICATIONS OF CIRCULAR SAWS TO LARGE WORKS

In the present section it is proposed to describe the principal points of construction in large circular sawing benches, such as are in general driven by steam power and used for various manufacturing purposes. Some remarks are first offered on the conditions and proportions of the circular saws themselves, and the subsequent matter is arranged under the sub divisions employed in the last section and enumerated on page 752

1 Conditions and proportions of circular saws—It appears to be uncilled for to enter into particulars on the manufacture of circular saws especially after the remarks already offered (pages 683—698 of this Volume,) on the modes of constructing sharpening and setting rectilinear saws, as the methods are nearly similar for both kinds, and some remarks on the circular saw in particular, are given on the first and last of the pages quoted

As regards the methods of hammening and blocking circular saws, to give them the right degree of flatness and tension, a point of considerable importance, the reader is referred to the section 'On the principles and practice of flattening thin plates of metal with the hammer, (vol 1, p 414—122) and particularly to the remark, (p 419—20) on the propriety of keeping the edge of the saw 'rather tight or small prior to its being set to work So that the heat communicated to the edge in the course of work may by stretching the edge, render the blade tense alike throughout, whereas had the saw been at first rather large or loose on the edge, the expansion at that part would render it so loose or flaccid on the edge, as to cause it to vibrate when at work, which is a great disadvantage

The teeth of both circular and rectilinear saws have been considered at some length, both as regards their outlines, (pages 683—687,) and in respect to the modes of sharpening and setting them (pages 688—698), but on the whole it may be said that the teeth of circular saws are more distant, more inclined, and more set, than those of rectilinear saws

The teeth of circular saws are more distant than those of straight saws, because their greater velocity causes the teeth to follow in such rapid succession, that their effect is almost continuous, the distance is called to the extreme in Mi R Lastman's circular saw,

TABLE OF THE DIMENSIONS OF CIRCULAR SAWS

he columns Gage of Plate refer to the Brimingham sheet is on gaye for the comparison of which with ordinary linear measure see Appendix period 1013 The columns Form of Tooth refer to the drag ams on page 684 required for the The columns Γ Revolutions per Minute and Horses Power

maximum of effect are from the experience of Mr Orid Topham I nymer The columns

(1) SINGLE PLATES OF EQUAL THICKNESS THROUGHOUT

Generally called Bench Saws and used either for thick or thin Wood Intermediate sizes used and also thick Saws for cutting Grooves

Intermediate sizes discu										
Diameter	Gage of Plate	Form of Tooth	Space of Tooth	Revelutions per Minute	IInses Lower					
2 mch 3 4 6 9 12 15 18 24 36 48 60	23 to 28 21 27 20 26 19 24 17 22 15 21 14 20 13 18 12 16 10 14 8 12 6 9	644 to 646	to voin	2000 1800 1600 1400 1200 1100 1000 900 750 500 340 3 30	1 11 2 2 3 3 31 4					

(2) SINGLE PLATES BEVILLED ON THE FDGE

Generally called Bevilled Saws and used for Veneous The largest medium and smallest of the ordinary sizes alone are given

	U						CONTRACTOR OF THE CONTRACTOR O
Diameter	Wilth of Bevils	Gage of Plate	Gago of Edge	Form of Tooth	Space of Footh	Rovs por Minute	Horses Lower
8 inches	2 to 3 in 3 5 4 6	10 13	22 to 28 20 25 18 22	644 or 645	to la in	1300 800 550	1 2

(3) SECMENIS FIXED TO A DISK AND BEVILLED ON THE I DOES

Generally called Segment or Veneer Saws and used for Veneers and thin Wood The largest medium and smallest of the ordinary sizes alone we given

_								r	
Dit	N f Seg ments	Wilth f Sogments	Width f Bovil	(ing.) ol 11 rto	I dre I dre	l cim of I oth	Since of Tooth	Rovs por Min	Hernes I wer
5 ft 12 18		51 9	2 to 3 m 2 4 2 3 5	10 11	21to 28 22 26 20 21		to in	370 130 85	3 5 6

Bench saws below about one foot diameter are usually mounted on spindles running on conical steel centers and driven by cateut bands those above one foot on spindles running in cylindrical bruss bearings and driven by leather straps

Compared with the diameter of the saw and speaking generally the hole or eye may be considered to measure from \(\frac{1}{2} \) to \(\frac{1}{12} \) part of the diameter that of the flange of the spindle from \(\frac{1}{2} \) to \(\frac{1}{6} \) part of the diameter of the pulley for letther straps about $\frac{1}{3}$ and for the catgut $\frac{1}{2}$ the diameter of the saw


The velocity of the edge of the saw varies from about 4500 feet to 5000 feet per minute and the greatest thickness of work done can scarcely exceed 4 the diameter

of the saw and is generally below the diameter

with only eight sectional teeth (see fig 791, p 797). The teeth of circular saws are more inclined, because such teeth cut more keenly, and the additional power they require is readily applied by the great velocity and momentum that may be given to circular saws. The teeth of circular saws are more set, to make a wider kerf, which is required, because the large circular plate can neither be made nor retained, so true as the narrow straight blade. The general proportions of circular saws are given in the annexed table.

It is generally politic, to use for any given work, a saw of as small diameter as circumstances will fairly allow as the resist ance the surface friction and also the waste from the thickness, rapidly increase with the diameter of the saw But on the other hand, if the saw is so small as to be nearly or quite buried in the work the saw plate becomes heated the free escape of the dust is prevented, and the rapidity of the sawing is diminished

Hassenfiatz, Emy and other French writers on carpentry, have described the mode of cutting thick logs of timber, as in fig 782, by means of two comparatively small saws each extending alone to the center of the log. The saws are in the same plane, but one above and the other below the log, and a little removed to avoid the contact of their teeth, but from the reasons above stated, and some others, the plan is but rarely if at all adopted



Under most circumstances, it is best to employ that part of the saw which is nearest to the center, and it may be stated generally that, as in fig. 783, the diameter of saw s, should be about four times the average thickness of the wood w, and that the flange on the spindle, should be as nearly as practicable flush with the saw table or platform p p

In addition to various other particulars in the table on circular saws in attempt his been made to tabulate the velocities proper for difficient saws and the amount of power severally required, but these numbers must be received with some latitude, because

they are very much influenced by accidential circumstances. Amongst these are the particular quality of the wood or other material, as to its hardness and grain, its greater or less freedom from moisture, or from gummy or resinous matters also its magnitude, and the degree of smoothness desired in the surfaces left by the saw all these circumstances demand certain variations in the proportions and conditions of the saws used. A few words will be therefore added respecting each of these conditions

The harder the wood, the smaller and more upright should be the teeth, and the less the velocity of the saw, hence it follows that the rate of sawing is proportionally slow

In cutting with the grain or lengthways through the fibres the teeth should be coarse and inclined, and the speed moderate, so as rather to cut the removed wood into shreds than to grind it into powder, as the more minute the sawdust, the greater the power that must be expended in its production

In cutting across the giain, the teeth should be finer and more upright, and the velocity should be greater than in the last case so that each fibre of the wood may be cut by the passage of some few of the consecutive teeth, rather than be torn as under by one tooth only

Wet wood is softer than diy, and is therefore more easily cut, but the saw is required to be keener and more coarsely set, the waste is consequently greater

For gummy or resmous materials, and for wory, the saw teeth are required to be very keen, and the velocity comparatively slow, to avoid the dust becoming softened and rendered adhesive, as it will then stick to the blade. I his disposition is lessened by lubricating the saw either with a tallow candle, solid tallow, laid, or oil applied with a brush


When the object is to get through as much work as possible, the rapidity with which the wood is then advanced, will prevent regularity in its progress, and consequently likewise in the saw marks on the wood. The saw is then liable to be overloaded, if so it vibrates rapidly sideways with great noise, requires greater force, but nevertheless proceeds through the wood slowly and leaves it full of coarse ripple marks

Smooth sawing requires the work to be regularly advanced towards the saw, and the latter must be keen and very uniformly set, as one tooth projecting beyond the general line, is sufficient

to score or scratch the work It is a proof that the saw was in most excellent order and well applied, when the portion cut in every revolution of the saw, cannot be detected by the corresponding marks left on the wood or other material

Spindles for circular saws exceeding about one foot diameter—Saws of this magnitude we seldom used on spindles mounted between pointed centers as represented on page 754 but on those resembling the sections figs 784 and 785. These spindles revolve in bearings or brasses b b, made in halves, and securely united to the stationary framework of the saw bench. The end play, or end long motion of the spindle, is usually prevented alone by the two collars or projections c c, which embrace the one bearing, sometimes, however, the one collar c', fig 785, is screwed on the spindle to admit of adjustment, and has a side screw to retain its position, or else the collar c', is in the solid, as usual, and a fixed screw s exterior to the pulley, is made to bear on the end of the spindle

Each spindle has a wooden or non pulley of about one third the diameter of the saw for the driving strap, but in mills driven by power a fast and a loose pulley of equal diameter are placed on each spindle, as in fig 786, so that the spindle may be dis connected with the engine by throwing the strap on the loose, free, or live pulley

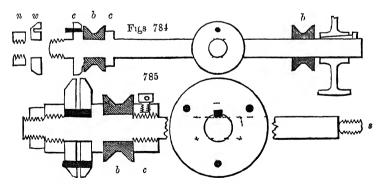

Saws below about 20 inches diameter, are commonly held like those previously described, between the flat surfaces of the collar or projection c, that is forged in the solid with the spindle, and the surface of the loose collar or washer w, is in fig 784, one

steady pin then suffices, and which is fixed near the periphery of the flange. Large saws require flanges say from 5 to 10 inches diameter, and which are then added to the spindle, as in fig 785, the one is fixed by a feather or parallel key and car ries three steady pins all the steady pins are represented black in the figures

The loose flange is sometimes pressed up by only one screwed nut n, but it is preferable to have two, of different threads, that the second may prevent the first from being accidentally loosened, as the two then unwind at different rates and check each other's motion. Either the one nut is right and the other left handed as in Collinge's patent axletrees or else both nuts have right handed threads which differ in pitch as well as diameter.


3 Benches and platforms for large circular saws — These are in general fiamed together very strongly in wood, in the ordinary manner of carpentry, they measure from about 4 to 12 feet long 2½ to 4 feet wide, and 2½ to 3 feet high. The bearings for the saw are placed close beneath the platform, and at about the middle of its length, the central part of the bench is represented in plan in fig. 786

To arrive at the saw spindle for the purpose of changing the saw, there is frequently inlaid in the platform a rectangular frame of cast iron with a rebate on the inner edge, fitted with a loose iron panel in two pieces to form the cleft for the saw. The panel is supposed to be removed to show the nuts and stops for the saw, and before the saw can be changed it is also needful to lift out the wooden bar, which lies across the end of the spindle and against the saw—the bar is added for the purpose of carrying the stops s s, to be explained

Sometimes the bench is nearly covered with plates of non to lessen the friction of the timber upon it and in benches for heavy work, the half of the platform in front of the saw is occasionally made as a slide, with a rack, pinion and winch handle, by which it is moved endlong. The work is in such cases placed against a ledge or cross piece on the slide, and is carried to the saw with great facility. A few saw benches for some specific kinds of work, are constructed entirely in non

⁴ Stops to prevent the vibration of large saws —These are in

many cases inlaid in the wooden bed of the machine, beneath the iron plate by which access is obtained to the saw, as shown in fig 786. The two grooves ss, nearest the periphery of the saw are in some instances each entirely filled with a block of hard wood, kept in position by the top plate, and set forward from time to time by pieces of card or veneer placed behind them to compensate for the portion worn away by the saw. At other times, the grooves are fitted with blocks of wood or metal which have mortises for fixing screws, as shown on a larger scale at s's these admit of adjustment and fix ition. Screwed holes are also used, especially in the iron framings, cylindrical wooden plugs from $\frac{3}{8}$ to $\frac{3}{4}$ inch diameter are then screwed into the holes and set forward to meet the saw

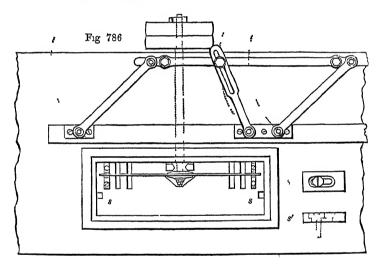

Large saw machines have sometimes wedge form pockets beside the saw plate, which are filled with greasy hemp, the downward motion of the saw carries the hemp into the narrow part of the pocket, and pressing it against the saw checks the vibration. This method, although it causes more friction is nevertheless much approved of as the elasticity of the packing enables the saw to be at all times closely gripped, which on account of its small irregularities cannot be the case when rigid metallic or wood stops are used but hemp is less suitable than wood for small saws. Frequently the stops are applied to both the front and back edges of large saws, as shown in the figure

5 Parallel Guides for circular saws—The parallel guide mostly added to large saw benches closely resembles the ordinary parallel rule used for drawing, as will be seen on the inspection of fig 786. The principle requires that the four centers of the parallel rule should constitute the four angles of a parallelogiam, or that the four sides should be exactly two pairs, with which view the two radius bars are clamped together and drilled as a solid bar and so likewise are the long bars. Unless the centers or pins fit accurately it will be found that when the bars he very obliquely, that the front bar or fence will have a rolling motion, as on a center, instead of being firm and parallel

In some few cases the long metal bars are dispensed with, iron ears or plates, for two of the centers are then fixed to the wooden fence or rail and the back centers are similarly attached to the platform itself, through which a circular mortise, parallel with the paths of the radius bars, is sometimes made for the clamping sciew that fixes the rule. It is, however, better the rule should be constructed as in the figure 786, and quite independently of the platform, to admit of ready detachment. The long back rod is then essential, and also a fixing bar, placed as a chord to the arc described by the radius bars, and retained by a screw and nut passing through a mortise in the bar

In the above construction, the long fence moves in an arc. like those described by the radius bars, and shown by the dotted lines, but the three bar parallel rule is sometimes employed, because it may be opened in a right line and therefore moves simply sideways to the saw its path is directed by a pin in the long bar or fence, which enters a straight groove made trans The construction of the three bar versely in the platform parallel rule is nearly a duplication of the former, and as it is equally important that the centers of the similar parts should be equidistant the four radius bars are drilled together, to ensure their similitude, and so are also the three long bars In the two and three bar parallel rules, two slit clamping bars are occasionally used, which entirely restrain any wriggle, as they secure both ends of the fence, the perpendicular height of which varies from two to ten inches, according to the nature of the work to be sawn

6 Sawing the sides of rectangular pieces—In both small and large sawing machines, the work is applied much in the same manner, but in saw mills two individuals are commonly employed, one to hand up and thrust forward the work, and another to assist by dragging and afterwards removing the work from the bench. When the pieces are short, the person who pulls commonly uses a tomahawk, which is like the half of a small pickaxe, the point of which is struck into the wood to serve as a handle

When a log or round piece of wood is applied by the hands alone to the circular saw, it is difficult to get the first cut exactly true, as the wood is apt to roll on the two or three points at which it may touch the platform, but when the saw has pene trated a little way, the blade itself materially assists the holding of the work. One cut having been made the flat side is placed downwards, and a second cut is made from either of the edges, and provided the first side is moderately true, the second will become at right angles to the first, the third and fourth sides will be found to present no difficulty

As a ready means of adapting the parallel guide to works of different widths, a parallel piece of wood is often placed along side the object to be sawn. Thus in cutting the blocks for wood-paving, the round larch timber is first cut into pieces about 3 feet 6 inches long and these are for the most part, sawn into pieces six inches square but should any of them fail to hold that size, a parallel board half an inch thick, is placed alongside the work, which is then reduced to the next following size, or $5\frac{1}{2}$ inches square. And in the same manner pieces of two dimensions, as of 2 by 1 inch in section, are in some cases cut by setting the parallel rule to 2 inches, and packing the work the thin way, with a piece 1 inch thick.*

^{*} In reality the standard size of the squared timber for the blocks of the Metropolitan Wood Paving Company, is $5\frac{1}{2}$ by 6 inches but the round \log s are cut as large as they will respectively hold the one measure being always half an inch more than the other. The wood is used very soon after it is felled and is so wet that the men find it needful to suspend a board over the saw and at right angles to it this arrests the saw dust which if allowed to drive against the attendant soon wets him to the skin

In some wood cutting processes a screen of wire gauze is placed between the work and the workman that he may be enabled closely to witch the operation without risk of the shavings entering his eyes

SECT VII —LESS COMMON OR SPECIFIC APPLICATIONS OF CIRCULAR SAWS TO LARGE WORKS

It may be considered that in the last section, the remarl s on the structure and use of the circular saw bench, were concluded so far as concerns its ordinary application to the conversion of timber into scantling, or squired pieces of various sizes it still remains to notice, in continuation some of the miscella neous and large applications of circular saws, which so far as admissible will be introduced in the order formerly adopted, as the subdivisions 7, 8 9, and 10, will be repeated, to which will be added the sawing of curvilinear works, and some other less classifiable matters

Part of the contrivances for these works, are mercly additions to the ordinary saw bench others are machines expressly con structed for their respective purposes, but to save unnecessary subdivision they will be collectively and briefly noticed, as the principles rather than the mechanical details will be advanced, together with references to such published descriptions of them as have come under the author's notice I wo contrivances for obtaining an accurate base to work from in pieces not originally straight, will be first refeired to

The late M1 Smart, in obtaining the first true side in irregular pieces three or four feet long, intended for the staves of casks, attached the pieces to an external fence or guide The wood was grasped by its extremities, somewhat as between the centers of a lathe in a kind of trough made of two boards united at right angles one end of the trough had a solid block of wood, that could be fixed at variable distances the other and had an non bar, roughened at its extremity, and brought up by a rack and pinion so as to stick into the ends of the wood, the grasp being secured by a ratchet

The trough was considerably longer than the length of the wood to be sawn and two studs projected from its extremities beyond the side of the work These projections were made to rub against the face of the parallel rule, and avoiding the saw, to direct the cut exactly in a right line, and produce, on the irregular wood one flat surface that might serve as the base for the subsequent operations * The same end is

^{*} See Trans Soc of Arts Vol 47, plate 8

differently obtained, and on larger pieces of timber, in the following method

In the Ravensbourne wood cutting mills at Deptford, battens 10 or 12 feet long, and intended to be sawn and planed for flooring boards are grasped by their upper and lower edges and without strain by screw teeth or dogs built out from a carriage which runs in V bearings—the slide is carried by a self acting rack and pinion movement, past a circular saw revolving in a vertical plane, which skims the side of the batten and leaves it as straight as the V slide itself. The traversing carriage or drag of this machine, is closely analogous to that of the veneer saw to be hereafter noticed.

7 Sawing grooves rebates, and tenons—These works may be accomplished in the large way, in the modes already described on page 761. The flooring boards of the warehouses in the St Katherine's Docks London, were grooved on each edge upon an ordinary saw bench, for the reception of strips of hoop iron used as tongues to prevent dust falling through the joints and the frames for doors are occasionally grooved for the panels in the same manner, but with thick saws. The still wider rectangular grooves in the blocks for wood pivement are cut out with two ordinary saws on the same spindle having two or more intermediate chisels, to cut the bulk of the removed wood into chips

The mortises in the shells of ships blocks, for the reception of the sheaves are cut by small double circular saws a hole is first bored through the shell at each end of the mortise, and the saws are then made to penetrate from each side, and nearly complete the mortise, in a less expensive manner than with the mortising engines in Portsmouth Dockyard

The squares or tenons of the steel pins for harps, by which the strings are tuned, are also cut by means of two thick saws, sepa rated to the extent of the side of the square, the pin is presented twice to the saws the second position being at light angles to the first. The equality in size of the squares is also ensured by this method, so that they all fit the same tuning key

Rebates may of course be cut upon the ordinary saw bench at two processes, as before explained, but they are also made by two saws mounted on separate spindles, and placed in the exact

directions of the two cuts required, one saw spindle is a little before the other, to avoid the contact of the teeth. The angular grooves or rebates in the blocks for wood pavement, are thus made at one operation, in a machine with two saws at right angles to each other

The combination of two saw spindles was first employed by the late Mr Smart in cutting the tenons for the construction of his patent hollow mast. The small pieces of wood were first squared on all sides to the proper measures, each small block was then rebated, first on the one angle, it was then turned over, and the formation of the second rebate completed the tenon Another part of the same machine carried a mandrel and center bit, so that by the aid of a guide, the holes in the tenons could be also made exactly true and alike *

Two saws mounted on the same spindle are used in cutting the teeth of combs, which may be considered a species of grooving process. One saw is in this case larger in diameter than the other, and cuts one tooth to its full depth, whilst the smaller saw separated by a washer as thick as the required teeth, cuts the succeeding tooth part way down, on the same principle as in the stadda, and rack saws figs 703 to 706, page 723

A few years back, Messrs Pow and Lyne invented an inge nious machine for sawing box wood and ivory combs plate of ivory or box wood, is fixed in a clamp suspended on two pivots parallel with the saw spindle, which has only one saw By the revolution of the handle, a cam first depresses the ivoly on the revolving saw, cuts one notch, and quickly raises it again, the handle in completing its circuit, shifts the slide that carries the suspended clamp to the right, by means of a sciew and ratchet movement The teeth are cut with great exactness, and as quickly as the handle can be turned, they vary from about 30 to 80 teeth in the inch, and such is the delicacy of some of the saws, that even 100 teeth may be cut in one inch of ivory the saw runs through a cleft in a small piece of ivory, fixed ver tically and radially to the saw, to act as the ordinary stops, and prevent its flexure or displacement sideways Two combs are usually laid one over the other and cut at once, occasionally the machine has two saws, and cuts four combs at once

^{*} See Gregory's Mechanics, 1807, vol n page 328 plate 26

8 Sawing or cross cutting the ends of pieces, either square of bevilled or those in which the angular variations are in the horizontal plane—The saw bench is not much employed in cross cutting the ends of long timber for the general purposes of carpentry, but short pieces are sometimes guided to the saw, as in the small machines, by the intervention of either a wooden square of bevil, the one edge of which rests against the parallel rule, the other thrusts forward the work. In cutting the square scantling for wood pavement into oblique prisms, a wooden slide is sometimes added to the saw-bench, with a trough exactly at the required angle, and in this case, as well as the last, the parallel rule serves as the guide for the length of the blocks

The Metropolitan Wood Paving Company employ for this purpose an iron machine which has a slide running in V bearings or angular grooves, planed in the bed of the machine and parallel with the saw—the cast iron slide is constructed to serve as the inclined trough to receive the squared wood, and as an adjust able stop to determine the length of the blocks *


The three following diagrams are intended to show the principles of different circular saw machines for cross cutting the wood is shaded in each of the examples, and the arrows denote the movements for following up the cuts of the revolving saws

In cross cutting the round logs of lignum vitæ for the sheaves of ship blocks Messrs Esdailes use a wooden saw bench, the sliding platform of which is inclined and has at its lower end a perpendicular iail, as in fig 787. The log of wood is laid in the nook, and the entire platform is then thrust by the hands past the saw which revolves on a fixed axis as usual, and thus the log is sliced into pieces their thickness being determined by a wooden stop, but it is necessary, in this machine, that the saw should have rather more than twice the diameter of the log

In the block machine y at Portsmouth a somewhat elaborate machine is used for the same purpose, which is so constructed that the saw s, need only be large enough to penetrate to the

^{*} The angle specified in the Count de Liles s Patent is 63 26 6 every block is afterwards chamfered on three edges grooved on the face and drilled with four holes for the dowels in appropriate machines nearly the whole of which are constructed in iron and driven by two steam engines each of twelve horses power. The thirteen various machines are managed by sixteen men and fifteen boys and in one week of seventy two working hours produce on the average 30 000 blocks or 800 square yards of paving

center of the log, as explained in fig 788. A short log of lignum vitæ is mounted on a kind of lathe mandrel, the saw spindle is then traversed sideways until the teeth cut to the center of the wood and the mandrel is afterwards rotated once on its axis by a wheel and pinion, to extend the cut around the log. One slice having been removed, the saw is withdrawn sideways to the dotted position s', and the mandrel and wood are set for ward through the collars, as much as the thickness of the sheave, by a screw at the back of the mandrel, preparatory to the next slice being removed

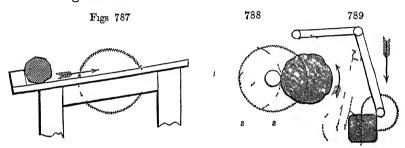


Another cross cutting machine, after the manner of fig 789, and also contrived with a view of using a saw for work of nearly its own diameter, is used at Portsmouth, for cross cutting the butts of round elm timber, into short pieces used for the wooden In this latter case, the timber is fixed hori shells of the blocks zontally and immoveably, and the saw is carried in one plane, first down the one side of the timber and then the other To accom plish this the saw spindle is mounted at the end of a double swing frame, near the centers of which are placed guide pulleys, for the strap that connects the saw with the steam engine parts of the wooden swing frame, are double and strongly braced with iron bars, and the angular movements of the frame are governed by racks and pinions, but the various details are alto gether omitted in the diagram *

9 Sawing berilled edges and prismatic pieces, or those works in which the angular variations are in the vertical plane—The most

^{*} The two machines figs 788 and 789 were invented by Mr (now Sir M I) Brunel and are fully described and figured in Rees's Cyclopadia article "Machinery for Manufacturing Ships Blocks" and also in Frieyel Metrop part Manufactures, articles 533 and 535

simple and usual method of accomplishing this class of work, is by the employment of oblique supplementary beds, as explained in fig 748, page 768, the hexagonal blocks for wood paving have been cut on the common saw bench, precisely in the mode there described for small hexagonal and other prisms—indeed, the whole of the remarks already given on bevilled or prismatic works, are applicable alike to the small saw machines and the full sized saw benches

In the sawing machine invented by Mr Robert Eastman, of America, for cutting feather edged or weather boards, &c, (as in fig 790) the round log of timber is held horizontally, between centers inserted in the end of a long rectangular frame or carriage, which has rollers that run on fixed bars or rails The round timber is placed above the revolving saw, which makes a vertical and radial incision into the timber, the slide then runs quickly back, and the wood is afterwards shifted on its axis for a new cut, by means of a dividing plate and appropriate The machine is automatic, or self acting, so that, mechanism the primary adjustments having been first made, the entire tree is cut into radial feather edged boards without further atten The rough exterior edges of the board are also cut away by sappers, or chisels c, screwed near the center of the saw plate, which cut away the sap or waste wood, and reduce the tree to the cylindrical form, sometimes, if the tree is large, two series of radial boards are cut

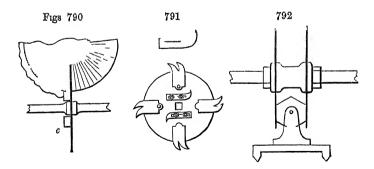


The account further states that ordinary steel saws, toothed all round as usual, were found to heat and choke when thus em ployed, on account of their being so deeply buried in the wood the inventor, therefore, contrived what he termed sectional teeth,

shown in fig 791 An iron plate of one eighth of an inch thick had four dovetail notches fitted with four pieces of steel, each of which constituted two teeth in the form of the "hawk's bill," the paucity of teeth was compensated for by giving the spindle a velocity of 1000 to 1100 turns per minute, and the saw is said to have penetrated with facility eight inches deep into white Canada oak The radial boards are described to be, (as explained in the former volume,) much less liable to split in shrinking than those cut out in the ordinary way *

A mode, somewhat resembling the above, for cutting hexago nal blocks for wood pavement, has been recently proposed by Messis Randolph, Elliot, & Co, of Glasgow, and is illustrated In this case, two saws are employed on the same by fig 792 horizontal spindle, and the headstocks, which are of iron and just like those of a lathe, pass exactly between and beneath the saws, which thus produce two parallel cuts at once The round timber being shifted twice and one third of the circle each time, becomes an exact hexagonal prism three or four feet long, and is after wards cross cut into the proper lengths !

Professor Willis was in the habit of using the circular saw for

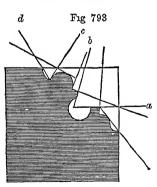

blocking out Gothic and other mould ings, for the illustration of architec tural science For example, if in the moulding, fig 793, the several cuts are made that are denoted by the surrounding lines the fillet and cham fers are definitively produced, and the maigins of the curvilinear parts are accurately blocked out or defined, so that the mouldings may be easily and faithfully finished by moulding planes

The wood in such cases, is marked at one end with the sectional and formation lines, as in the figure, and then mounted between centers in a species of lathe, with a dividing plate, so that the line a, first becomes horizontal The saw, which is also horizontal,

^{*} The full description of this machine with figures is transcribed from Pro fessor Silliman's American Journal of Science and Art into Gill's Technological Repository 1822 vol 11 page 217

[†] Practical Mechanic and Engineer's Magazine Glasgow 1843, p. 57

is attached to a kind of slide rest, with three adjustments, a vertical and a lateral adjustment, to adapt the saw also to the line a, and a longitudinal adjustment, by which the saw is then traversed the entire length of the moulding. The work is then adjusted on its axis by the dividing plate until b becomes horizontal and the saw having been as before adjusted to b, is swept the length of the moulding, and the two incisions remove the angle of the square block. The cuts c and d similarly treated, remove another portion of the wood that is in excess, and so on to the end all the cuts thus made become strictly parallel, or in prismatic relation to one another


When the mouldings run on to a chamfered base or plinth, which commonly occurs in Gothic architecture, the plinth is first of all removed by a transverse and oblique incision of the saw, after which the mouldings are made, and finally the removed plinth is replaced without alteration, and the work is complete

10 Sawing works, in which the angular variations are in both the horizontal and vertical planes—All the observations and instructions given in the former and corresponding subdivision, are in truth applicable to large saw benches—but the machine now to be described is more suitable to large works of this class

In Mr Donkin's saw bench, fig 794, the half of the platform in front of the saw is hinged like the flap of a table and has quadrants, somewhat after the manner of the sketch, by which it may be fixed for cutting any bevils within its range. The parallel rule is available for setting out the widths of the works and the saw is mounted upon a swing frame of cast iron, shown separately in fig 795. So that the quantity the saw projects through the table, as for sawing rebates, can be regulated by a cam c, upon which the one end of the swing frame rests

In cutting small bevilled works, such as those for the wooden cogs of cast iron mortise wheels, and various other pieces, Mr Donkin employs a supplementary carriage, running upon three non rollers and guided by the hands against the parallel rule An idea of the carriage is also conveyed by fig 794. It is made in cast iron, and rectangular, but deficient of the half of the lower side, and carries a center screw, a dog or prong chuck and a dividing plate, much as in a lathe, but the axis of these parts, although sometimes horizontal, is generally vertical

The small pieces of wood are cut out square as usual, but somewhat too large they are then grasped between the dog and center screw. If the pieces are parallel or prismatic the saw table remains horizontal as usual, if the pieces are taper or pyramidal, the table is inclined, and which throws the guiding carriage to any required obliquity. The parallel rule is next adjusted to enable the saw to cut the first side, and should the object have four, six or more sides, the dividing plate is brought into requisition, for giving the four or more angular positions. The parallel rule determines the respective distances of each side from the axis on which the work is shifted.

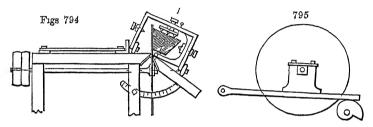

In this ingenious manner, by the changing of the horizontal and vertical angles by the adjustment of the parallel rule, and by the projection of the saw through the platform, almost any piece, having plane surfaces may be sawn, and the setting once adjusted, an unlimited number of similar pieces may be produced as it is only necessary to make the first cut, throughout every piece of the entire number, then the second cut throughout the whole, the third and so on. This is accomplished by leaving every adjustment undisturbed whilst the first cut is repeated throughout all the pieces, except the removal of the one block of wood from between the centers and the insertion of the next, and so on with each of the succeeding cuts. The indentations made by the center sciew and dog ensure the similitude of position throughout the entire operation.

11 Sawing Curvilinear Works—The trephine saw used in surgery, and represented nearly full size in fig 796 appears to have been by far the earliest of the circular saws of this kind. It consists of a thin tube of steel, with teeth cut on the edge, of the peculiar form represented, and at the opposite end of the tube is fixed, by small side screws, the stem by which it is attached to the mechanism whereby it is worked.

The motive apparatus of the trephine saw, is usually a cross handle like that of a corkscrew, or a revolving brace like that used in carpentry. To guide the first entry of the trephine saw, the shaft is drilled and fitted with a drill point p p, which is fixed by a side screw s. In the commencement, the point makes a small central hole and when the saw has once fairly penetrated the point is loosened and allowed to fall back into the stem of the saw

In another modification the center of the trephine saw is dispensed with, as the "guide principle" is effectually introduced. The saw is fixed at the one extremity of a cylindrical stem, which at the other has a winch handle, the stem works freely in a vertical tube or socket with three legs constituting a tripod stand, therefore the axis is kept steady and vertical by the left hand, and whilst the teeth fulfil their office, the saw advances through its fixed collar by the pressure of the right hand, with which the winch handle is turned *

The amputating saws set forth in this work as having been contilled or used by var ous eminent surgeons are modifications of the bow frame, and piercing saws for metal and the tenon and dovetail saws for wood they vary from about 14 to 4 inches in length. Some of the small saws analogous to the dovetail saw have edges more or less curved and the smallest of these dwindle down to a nearly circular plate of steel less than one inch in diameter seirated around the edge except where a slender wire terminating in a wooden handle is rivetted to the edge of the saw plate. These last are known as Heys saws and are principally used for the crimium and the metacarpal bones.


A saw intended for dividing deeply seated bones, is formed like the chain of a table clock but with the one edge serrated it is worked with two cross handles by the alternate motion of the two hands. One of the handles is detached whilst the end of the chain saw is passed beneath the bone by a kind of semicircular needle. The chain saw was invented by Dr. Jeffiey of Glasgow.

A nearly similar chain saw is arringed as an endless band passing around the grooted edge of a taper staff like the blude of a poniard but terminating in a small semicircle. There are guards to cover up portions of the edge and a prop or struct to steady the instrument whilst the endless than is put in motion by a winch hundle attached to a pin which around which also the when circulates. This

^{*} The art of surgery has given rise to an enormous variety of instruments a most complete collection of the representation of which both of the earliest and latest times was published by A W H Seerig in a work entitled Armamentarium Charungicum oder moglichste vollstandige Sammlung von Albildiungen chinungischer Instrumente alterer und neuerer Zeit. The work contains 145 large and crowded lithographic plates and was published at Breslau in 1835

It appears from plate 75 of this collection that the trephine saw was known in the time of Hippocrates and that both the blades and the mechanism for moving them have since assumed numerous varieties of form

The trephine saw has given rise to various larger applications of the same kind of instrument, having teeth of the ordinary form, and known as crown saws, annular, curvilnear drum and even as washing tub saws, the respective merits of which names it would be useless to discuss. Small saws of this kind, when mounted upon the lather are often employed for cutting out disks of metal and wood the material is in general thrust against the saw, by a block of hardwood fitted to the front center of the lather, and frequently, as in making buttons, the cutting out is combined with the shaping of the two faces of the button

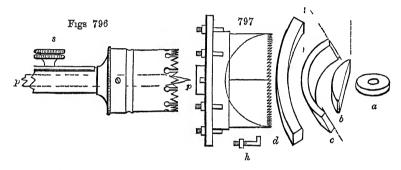

In the block machinery at Portsmouth the crown saw is used for rounding the sheaves, which are cut out of transverse slices of lignum vitæ, the wood is held at rest by its margin whilst the

singular instrument is ascribed to S. Heine and is figured on plate 60 of Seerig's work which also contains several schemes for using small circular saws but some of the mechanical arrangements are not clearly defined in the figures

A circular saw proposed for cutting deeply seated bones and as an occasional substitute for the trephine saw was invented by Mr Thomas Machell of Durham surgeon and is accurately described in the Trans Soc of Arts for 1812 Vol xxx, page 150 In Mr Machell's saw the axis of rotation is constituted within the third ness of the blade so that two thirds the area of the circular saw may be depressed in the saw cut. The saw is worked by a pin wheel the pins of which enter notches in the edge of the saw blade the pin wheel has teeth and is itself moved by a larger and more distant toothed wheel having a small winch handle

The great difficulty encountered in almost all the surgical saws arises from the removed particles of bone becoming mixed with the fluids and forming a thick paste which clogs and nearly stops the action of the blades. To remedy this inconvenience Mr Weiss suggested that slits terminating in round holes should be cut in the edges of such blades as admit of these receptacles being made.—See Weiss on Surgical Instruments page 10 plate 18 and figure 796 in the text Small bones are now more frequently cut by strong nippers than by saws and many nippers are drawn on Seeris s plate 134

revolving mandrel, which carries the crown saw and also a drill, is advanced through its collars and rounds and bores the sheaves a at the one operation, ready for the coaking engine, turning lathe, &c *

Crown saws, as large as 5 feet diameter and 15 inches deep, constructed somewhat after the manner of fig 797, are employed at Messis Esdailes saw mills. The three or four pieces of steel then constituting the hoop, are rivetted to the outside of a strong ring, and very carefully hammered, so that the plates exactly constitute one continuous cylinder, although the ends of the plates are not united, but simply make but joints. The ring is fixed to the surface chuck of a kind of lathe mandrel by means of hook bolts h, and the work is grasped in a slide rest, which traverses within the saw, and parallel with its axis


The saws of about 2 feet diameter are used for cutting the round backs of brushes b, and the larger saws are employed for felloes of wheels d, and similar curved works. If the wood is applied obliquely, the piece also becomes oblique, in the manner explained by the diagram c which represents the sloping and hollowed back of a chair thus produced. It is, however, much more usual to saw curvilinear works of the kinds referred to, with the felloe or pit turning saw (see page 707) the chair maker and wheelwrights saw (p. 725), and the turning sweep or bow saw (p. 728), the applications of which have been already noticed at the pages referred to. See Note B, O, p. 1022

Mr Trotter proposed for curvilinear sawing, the employment of a saw plate s fig 798, which instead of being a flat plate, as usual, was dished as the segment of a large sphere. The fence f, which was made as the arc of a circle had a conductor c, to receive the work w the circular fence was attached to a three bar parallel rule, so as always to keep the curvatures of the fence, conductor and saw, which were equal, truly parallel with each other. The construction of the spherical saw blade is difficult and its advantage questionable, especially as the edges of the pieces when left from the saw, would be curvilinear in width as well as length or part of a spherical surface, of the same radius as the saw. This form is seldom required in the aits, and its conversion into the simple aich like form with square edges (proposed to be

^{*} Ress Cyclopedia art Machinery for Manufacturing Ships Blocks — Lineye Metropolitana vol Mechanics art 376

approached by inclining the work), would fully cancel the intended economy of the spherical saw, which is however curious, as one of the links in the chain of contrivances under consideration *

Much ingenuity has been displayed in cutting the curvilinear and bevilled edges of the staves of casks by circular saws. The late Sir John (then Mi) Robison, proposed many years back that the stave should be bent to its true curve against a curved bod, shown in two views in fig. 799, and that whilst thus restrained its edges should be cut by two saws ss, placed as radii to the circle, the true direction of the joint, as shown by the dotted circle representing the head of the cask. The principle is perfect, but the method has been found too troublesome for practice

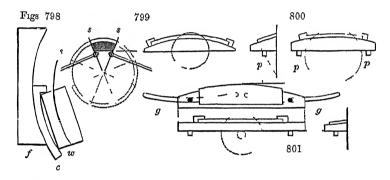

Mr Smart cut the edges of thin staves for small casks on the ordinary saw bench, by fixing the thin wood by two staples of hooks to a curved block, fig 800, the lower face of which was bevilled to give the proper chamfer to the edges. One edge having been cut the stave was released, changed end for end, and refixed against two pins which determined the position for cutting the second edge and made the staves of one common width. The curved and bevilled block, was guided by two pins p p, which entered a straight groove in the bench parallel with the saw

This mode of bending was from various reasons found map plicable to large staves, and these were cut, as shown in three views in fig. 801 whilst attached to a straight bed, the bottom of which was also bevilled to tilt the stave for chamfering the edge. To give the curve suitable to the edge, the two pins on the under side of the block then ran in two curved grooves g g, in the

^{*} Trans Soc of Arts, 1805 Vol xxiv p 114

saw bench, which caused the staves to sweep past the saw in the arc of a very large circle, instead of in a right line, so that the ends were cut nailower than the middle. Mr. Smart observes, that in staves cut whilst straight the edges become chamfered at the same angle throughout, which although theoretically wrong, is sufficiently near for practice, the error is avoided when the staves are cut whilst bent to their true curvature.*

SECT VIII —CIRCULAR SAWS AND MACHINERY FOR CUTTING VENEERS

Valuable and beautiful woods are seldom used in the solid state for decorative furniture, but are cut into veneers or thin plates, to be glued upon fabrics made of less expensive woods, an art successfully practised by the Romans, as formerly adverted to (Vol 1, page 64). Until of late years the cutting of veneers was generally accomplished, either at the saw pit with very thin plates strained in the ordinary pit saw frame (see Vol 11, page 703), or by the cabinet maker with the smaller frame saw, (page 726). In this latter mode which is still much practised on the continent the wood is fixed perpendicularly, and the saw is also guided by two men. Expert pit sawyers could cut six veneers out of each inch of wood, and cabinet makers seven or eight from smaller pieces, but the difficulty of these methods rapidly increases with the size of the veneers.

Small veneers for the backs of brushes and other works, have been split or planed from small pieces squared to the respective sizes Pine, willow, and other woods, are planed into thick con

^{*} See the original paper Trans Soc of Arts Vol xlvii, pp 1217 In the year 1833 Mr Samuel Hamilton took out a patent for certain machinery for sawing boring and manufacturing wood for various purposes such as bevilled timber for ship building tenon cheeks, felloes of wheels the circular rails of chair backs, chair legs and other works of the same description either square on the face or bevilled to any required angle or in any required radius or diameter of a circle

The specification is very complex but it may be said briefly that the felloes are cut by a vertical reciprocating saw worked by a crank and the edge of the work is guided either by a fixed circular fence or by radius bais for bevilled works the table of a similar machine is tilted to any angle. For other classes of work the saw frame is jointed and may be brought down by a swing frame in the arc of a circle to penetrate to any assigned depth. The work is grisped by numerous arrangements of parts that hold any successive number of pieces exactly in the same position—See Newton's London Journal and Reperton y. &c. Vol. vii. p. 1

tinuous shavings called scale boards, for making hat and bonnet boxes (Vol 11, p 504) And of late years oak, when softened by steaming has been split into staves for casks (foot note, Vol 1, page 32) All these processes are accomplished without waste of the materials, but they are only applicable to pieces of limited dimensions

In 1806, Mr Brunel took out a patent for splitting veneers, of considerable size, by means of a horizontal knife, the length of which exceeded the length of the block to be converted. The knife was composed of several pieces of steel, placed exactly in a line on their lower surfaces, but with edges faintly rounded and very keen. The compound knife received a short recipio cating or sawing action and the block of mahogany or other wood was carried slowly sideways and beneath the knife by a strong screw slide, worked with a spoke wheel like that by which a ship is steered. After one veneer had been cut off, and the log brought back again to its first position, it was raised in exact parallelism, by a system of two right and two left handed screws at the four angles of the frame, which were simultaneously moved with one winch handle, by aid of appropriate mechanism.

This machine for cutting or splitting wood into veneers, the precursor of the segment veneer saw is said to have answered moderately well with straight grained and pliant woods, such as Honduras mahogany, but there were serious objections to its use for woods of irregular, harsh, and brittle grain, such as rosewood, as the veneer curled up considerably on removal, and the wood if harsh and brittle had a disposition to split and become pervious to the glue † This is to be regretted, as the splitting machine converted the whole of the wood into veneer without waste, whereas the veneer saw, on the average, cuts one third of the wood into saw dust


As already explained, the ordinary circular saw will not, in general, serve for work exceeding in thickness about one third the diameter of the saw, and the larger the saw, the thicker it is required to be to give a proportionate degree of stability. These two conditions, joined to the impracticability of obtaining

^{*} See the drawing and description in the Rep of Arts for 1810 Vol xvi, p 257

[†] The Russian machine for cutting the entire tree into one spiral veneer (see Vol 1 p 154) seems open to the same objection in regard to builtle woods neither does it expose the most ornamental section of the tree

plates of steel exceeding some 4 or 5 feet diameter limit the application of the circular saw under ordinary circumstances

But when this instrument is employed for veneers, advantage is taken of the pliancy of the thin leaf or veneer, and the saw is con sequently made thick and strong towards the center, to give it the required stability, but towards the edge it is thinned away almost to a feather edge, as at s s, in the diagram, fig 802 Therefore



the solid block of wood or ivory w, which is unyielding, can pass along the parallel guide g, and across the flat face of the saw s s, whilst the thin plant veneer v, separates so much as to form an opening that admits the wedge formed edge of the blade, and the veneer proceeds along the conical back of the saw without frac ture or interruption, circumstances that would be impracticable were both parts of the material when sawn, alike unyielding

In the small application of this principle, as for sawing blocks of ivory into leaves for miniatures, and small square pieces of wood into veneers for brushes and small works, the veneer saw is made as a single plate of steel, from 6 to 36 inches diameter. In the large application of the principle, as for cutting logs of square or round wood into veneers, the saw is composed of many segments or plates, and commonly varies from about 5 to 18 feet diameter. But as the segment saws are occasionally made as small as 20 inches diameter, the two kinds constitute an unbroken series, and their principal applications will now be described, beginning with the smallest

The single plate veneer saw (described in section 2 of the table, on page 784) is thick and parallel at the center for about one half its diameter, the edge is ground away, as a cone, almost to a feather edge, at other times the edge is thin, and nearly parallel for about an inch, and is then gradually coned, making the section somewhat concave. The edge is required to run exceedingly true, and the teeth must be sharp and very faintly set

Saws of six to ten inches are sometimes used in machines such as that shown on page 756 for very small pieces of ivory veneer and for slicing up wooden mosaic works but it is more usual to employ larger saws for miniature leaves, say those from fifteen to twenty inches diameter, and consequently larger machines are also required which are driven either by a hand fly wheel or other motive power The principal variations between veneer saw benches, and those for ordinary and thicker works is in the parallel guide, which for veneers is made fully as high as the width of the block to be sawn, by sciewing a parallel piece of wood or metal against the vertical face of the parallel rule, and cutting it off in a circular arc exactly to agree with the curvature of the saw and without extending at all behind it cases the parallel guide is constructed with a set screw, that it may be adjusted for distance very minutely, after which it is fixed When, therefore, the block of ivory or wood is placed against the parallel rule and pressed towards the saw by hand, the thin leaf bends away as cut from the block, or yields sufficiently to pass behind the saw without impediment

In bevilled or veneer saws for ivory, the teeth should be finer, and the rate of motion slower than for wood say, three fourths the speed, as when a considerable velocity is used the saw becomes heated and this, from the gelatinous nature of the material, causes the sawdust to adhere to it, the heat also tends to split the thin leaves of ivory. These sources of mis chief are avoided by giving to the saw blade a subdued rate of motion, and keeping it inoderately anointed with tallow or lard

Some idea of the delicacy of veneer saws for ivory, will be given by the inspection of the annexed scale which shows the average numbers of veneers or leaves cut from each solid inch of ivory —

When the width of the ivory is 1 2 3 4 5 6 7 inches Each inch of ivory is cut into 30 27 24 22 20 18 16 leaves

The leaves from 1 to 2 inches wide and 2 to 3 inches long, are used for memorandum books, the larger sizes for miniature leaves, the lengths of which are about one third more than their widtns. When scraped and prepared ready for the artist, the 30, 27, or 16 leaves respectively measure about half an inch in total thickness, showing the waste in sawing and scraping to be equal to about one half the original material. The leaves might

be cut still thinner, but this would be objectionable as regards their intended purposes

The bevilled or veneer saws, when used for wood have greater diameter, coarser teeth are used without grease, and at a higher velocity than for ivory, but the single plate veneer saws are not frequently made of the full size named in the table nor are they used for wood exceeding about six inches wide, or that has not been previously squared into small pieces *

In the larger applications of the veneer saw it is built up of segments or separate plates of steel, screwed to the edge of a metal disk or chuck. Some few of the smallest segment saws are even less than two feet diameter, and those not exceeding about four feet diameter are generally used in the ordinary saw benches with fixed horizontal platforms, the work being then fed by hand as usual

But when the segment veneer saw exceeds about four feet diameter, the horizontal platform or table is rejected, and the guidance of the wood is entirely effected by machinery, called the drag the airangement of this construction, which is known both as the veneer mill and the segment saw is shown in the perspective figure 804, page 812. The veneer almost always proceeds from the edge of the saw, through a curvilinear trough parallel with the back of the saw but in the figure the veneer is represented as if bent almost at right angles, so as to quit the


^{*} A manufacturer experienced for thirty years in cutting miniature leaves generally employs single plate saws from sixteen to twenty inches diameter. He also uses a segment saw measuring the larger diameter, when new and composed of six segments attached to a gun metal chuck the edge of which is very thin and the center enlarged into a boss cut with a hollow screw for its attachment to the saw spindle which runs in a collar and center exactly after the manner of a lathe mandrel. He prefers about eight to ten points per inch, and an average velocity of about 600 to 700 revolutions per minute, in topping the teeth he uses a steel turning tool, and sets the teeth before sharpening them.

He adds that when the blocks of ivory are cut into lengths prior to being sawn into veneers loss occurs because the central and wider leaves require to be longer than those from the same block which are exterior and narrow. Sometimes the entire tooth or a large portion of it, is cut into veneers with the large segment saws having the drag (to be described)—this is better as regards the cutting of the leaves into squares—but the apparent economy is again lost as these saws being intended for wood—have coarser teeth and will not leave such smooth surfaces as the saws exclusively used for ivory—neither will they produce more than about fourteen or fifteen—veneers from each inch of ivory

saw in front, this construction is fai less common, but was selected for the present illustration, as it affords a more conspicuous view of the entire process

In the veneer saws furnished with the drag, the axes run in massive brass bearings, which are fixed on brick or stone piers, the edges of the larger saws dip below the ground into a pit lined with brickwork or masonry

The axis of the saw is connected or disconnected with the steam engine at pleasure, by means of a fast and loose pulley, and in bringing the saw to a state of rest, the brake wheel at the end of the axis is strongly grasped by a friction hoop, as in some cranes. Between the driving pulleys and the cone for the saw is placed a bevilled pulley for a catgut band or rope that is used in feeding the cut as will be hereafter explained. The saw, which is the all important part of the machine, is made of great strength and consists of three parts, shown in the section of the edge fig. 803, of which the shaded part c to c is of cast iron, the white part s to s of soft steel, and the black h to h of hardened steel

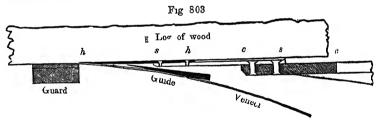

The saw is composed, first, of a cast iron wheel or chuck, with from six to eighteen arms, which are taper, so as to constitute a cone, the thickness of which at the center is about one twelfth the diameter. The rim of the wheel $c\,c$, is flat and turned smooth on the face to receive a series of 6 to 18 segments of soft steel, about one quarter of an inch thick marked $s\,s$, which are fixed to the cast iron by strong rivets, the segments project from 5 to 8 inches beyond the cast iron, and are chamfered at the edge. To the soft steel segments $s\,s$, are affixed a second series $h\,h$, consisting of about twice the number, these are hardened and serrated so as to constitute the cutting edge of the saw

The tempered plates are technically called the *hard*, and are attached to the soft segments by numerous countersunk copper

screws, tapped into s s When new, the haid segments project from 4 to 6 inches beyond the soft so that the angle then formed by the three parts h to c considered collectively, is only about 4 to 6 degrees with the flat face of the saw, and the veneer will readily yield to more than that extent from the log without splitting. To prevent the risk of accident from the exposed spokes of the wheel or chuck, and also the current of wind caused by their rapid rotation the spaces intervening between them are filled up on the face with wood, and an entire cone of thin boards is attached to the back of the chuck


The log to be sawn sometimes requires to be previously adzed all over, to remove the sand and dirt that would soon blunt the saw, it is then partially levelled with the adze or plane, to adapt it to the vertical face of the drag. The drag has three long bars of wood, in order that the revolving saw may cut or prepare for itself the surface against which the log is fixed. The sharp ends of the iron dogs are driven a little way into the log, and the dogs are then drawn down by screw-bolts as represented

Sometimes the log is only temporarily held by the iron fasten ings or dogs, whilst its surface is partially levelled with the saw, after which it is glued on a wooden frame, that is full of trans verse and oblique bars, and has been also levelled with the saw, the log and frame are afterwards bolted to the drag. In this case the entire body of the wood can be cut into veneer without interruption from the fastenings, and the glue joint is safe so long as the log does not project more than the width of the glued surface

The timber requires two motions to be impressed upon it, the one motion, longitudinal to carry it across the face of the saw the other motion, lateral, to advance it sideways between each cut, the exact thickness of the intended veneer

For the first or cutting motion, a long railway extends across the face of the saw, and supports the drag, which is carried past the saw by means of a rack and pinion, actuated by a cord proceeding from one of the grooves of the cone pulley on the man drel, down to the pinion axis, which is beneath the surface of the ground, and not represented. On the pinion axis there is a double train of toothed wheels, and a clutch box, by the three positions of which latter the drag is left at rest, or it is carried slowly past the saw in the act of cutting, or quickly back preparatory to the succeeding cut. The gearing lever, by which the

three positions of the clutch box are given, is perpendicular, and passes downwards through a trap door, situated close behind the little stool on which the attendant is seated

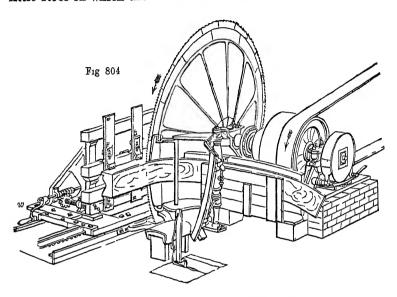

The second motion of the log, or its lateral adjustment, is thus effected. The slide that runs on the railway has a horizontal plate, which carries three or more triangular standards, like but tresses, to the perpendicular faces of which are fixed the three wooden bars against which the wood is clamped

The horizontal plate that cairies the triangles, is united at each end to the lower piece of the drag by a chamfer slide with an adjusting screw and nut, one of each alone being seen. The adjusting screws have worm wheels at the one end, and are simultaneously moved by means of a winch handle w at the extremity of a long rod, having two worms taking into the two worms wheels fixed on the adjusting screws. From 50 to 60 turns of the handle are required to advance the log of wood one inch, the attendant can therefore determine with great facility, the number of veneers cut out of each inch of wood or he can cut the veneers to any particular pattern for thickness

There is no impediment to the passage of the log across the rectilinear face of the saw, but for the guidance of the veneer around the back of the cone, some particular arrangements are

required To enable the veneer to avoid the edge of the soft steel segments, to which the senated blades are fixed, a feather edged guide plate usually of brass and extending around about one sixth or eighth of the circle, is fixed almost in contact with the blade by screw bolts and nuts which, as seen in fig 804 unite it to the stationary framing of the machine the guide is represented black in the sectional view fig 803 As the veneer is sawn off, the attendant leads the veneer on to the guide by means of a spud, or a thin blunt chisel, the veneer then slides over the guide, as shown, and proceeds through a curvilinear wooden trough, usually extending round the back of the cone, and the veneer is pulled out on the other side by an assistant, and stacked on the heap Sometimes the veneer is bent nearly at right angles, and quits the saw in front as in the figure this arrangement is less usual, but was selected for the illustration, as it offers a more comprehensive view of the several parts

Before running back the drag, preparatory to a new cut, the handle w, is unwound two or three turns to remove the log beyond the reach of the saw, and prevent its being scratched by the saw teeth, these turns are afterwards moved in addition to those required for the new thickness the handle is managed by a boy, who stands outside the railway

Whilst the saw is in the act of cutting the principal attendant applies a soft deal freeing stick on the right and left of the blade beneath the timber, in order to clear the sawdust out of the teeth. The speed at which the table is fed is easily adjusted, by the selection of an appropriate groove of the cone pulley on the main shaft, which communicates with the driving pinion beneath the floor, and this adjustment of the feed is jointly dependent on the condition of the saw as to sharpness, and the general quality, hardness, and size of the wood

The veneer saw may be used for logs of wood measuring as much as 24 feet in length and 5½ feet in breadth, but which sizes are rarely or never met with in the same log. It may be added, that the number of veneers cut out of each solid inch of wood, varies with the width and the intended purpose of the veneers, but that on the average—

When the width of the wood is 6 12 18 24 30 36 48 60 inches, Each inch of wood is cut into 15 14 13 12 11 10 9 8 veneers and, as about one third of the wood is wasted in sawdust, the

respective veneers are about two thirds the 15th, 14th, &c of an inch in thickness

The veneer saw is also applied to cutting cedar wood for making pencils bead stuff, or thin wood for making the beadings in cabinet work quarter stuff, or wood $\frac{1}{4}$ inch thick, and occa sionally also to wood nearly $\frac{1}{2}$ inch thick, and this may be con sidered the point of meeting, between the veneer saw and the upright frame saw, page 742, in which ten or a dozen saw blades are occasionally used for deals. But the veneer saw works with greater accuracy and is almost always used for such thin boards of mahogany as are not cut by hand at the saw pit

For sawing thin boards, the segments should be nearly new or very wide in order that the angle made by the removed board may be slight. But as the board in riding over the guide, (page 810,) near the edge of the saw, is nevertheless somewhat strained open, it becomes needful to apply a contrivance called a guard, to prevent the thin board from being at all split off instead of being entirely separated by the saw. This is accomplished by a curvilinear arm equal in size and form to the feather edged guide which lies against the haidened saw plates, but the guard is very much thicker and stronger, and is covered with a thin plate of brass

It will be further perceived in the perspective figure, page 812, that the guard is attached to a column, and is represented turned back, or out of work, which is the case whilst veneers are being cut, but in sawing bourds, the guard is placed parallel with the edge of the saw just external to its teeth (as dotted) and is ad justed by set screws to rest in haid contact with the face of the wood which is sliding past it the removed board is consequently held securely unto within half an inch of the saw teeth, or the line of separation, as shown by the diagram, fig 803

In sharpening the veneer saw, the workman first applies a lump of grindstone very cautiously upon a proper support, against the edge of the teeth as the saw revolves so as to reduce the few points extending beyond the circle. The saw having been stopped he then stands on a stage and rests his left arm, which is guarded by a wooden board, or leather shield, upon the teeth of the saw, whilst he manages the triangular saw file with both hands. The saw teeth are afterwards set by a hammer and a small flat stake held in the left hand. The necessity for the

recurrence to sharpening and setting depends much on the hard ness of the wood, but it is commonly needed several times each day that the saw is in constant work

When the edge becomes too thick and wasteful it is ground by means of revolving laps of lead or iron fed with emery, one lap on the face, another on the back of the saw, the laps are placed one below the other, to prevent their faces touching, and are kept in rapid motion, whilst the saw traverses between them, as in cutting so that all parts of the circumference, of this most stupendous and accurate of saws, may be ground alike *

Notwithstanding the very considerable length to which the chapter on saws has been extended, the subject may be considered as very far from exhausted. Thus the great majority of the applications of the saw hitherto noticed have been for manufac tures in wood, but toothed saws are also employed for many other purposes, and different materials, some few of which will be glanced at by way of conclusion

Both reciprocating and circular saws are occasionally employed in cutting off piles beneath the surface of water, when to draw them (by the aid of the hydrostatic press) would endanger the safety of the foundations. Two methods of thus using rectilinear saws have been described, to which the reader is referred †

The cucular saw, when used for piles, is commonly placed at the bottom of a long vertical shaft, the top of which is driven by a winch, through the medium of a pair of mitre wheels. The shaft is attached to a swing frame, like a gate, or to a traversing platform, connected with such of the piles as may with safety be ultimately drawn up, in every case the election of machinery for sawing piles is troublesome, and the process tedious

In the American steam pile driving machine, intended principally for constructing the toundations of railways, two piles are driven at the same time, in the respective track. After which, they

^{*} The author is greatly indebted to Messrs Esdale and Margrave of the City Saw Mills for the free access they permitted him to their establishment which contains eleven veneer saws from 17 ft 6 in to 5 feet diameter and also nearly every kind of machine saw and shaping engine for wood that is extensively used

Many of the practical details on sawing ivory veneers were derived from the experience of Mr Donald Stewart

[†] See Encycl Metro Part Mechanics article 536 also, Civil Eng and Arch Journal, 1813, vol vi, page 439

are sawn off by a circular saw four feet in diameter the spindle of which is mounted on the end of a strong horizontal frame moving on a joint, so as to cut first the one pile and then the other Notwithstanding the irregularities of the ground, the piles may be cut either to a dead level or to any particular inclination *

Circular saws are used in cutting sheets of slate into rectangular pieces, many of which are afterwards planed by machinery (vol 1 page 165). Slate is also grooved with thick circular saws for making a particular kind of roofing, the joints for cisterns, and other works, and more frequently two thinner saws are used and the intermediate substance is chiselled or tooled out. Recti linear toothed saws, driven both by hand and machinery are likewise used for blocks of slate and soft building stone.

A saw machine is used at the Butterley Iron Works Derby shire, in cutting off the ends of railway bars whilst red hot, in fact, the moment they leave the rollers. The two saws are exactly like those for wood, of three feet diameter, with flanges of two feet, they travel at upwards of 1000 revolutions per minute, and their lower edges dip into water. The bar is brought up to the saws by machinery, and both ends are cut off simul taneously, in twelve to fifteen seconds, to the precise length required †

If the customary applications of the saw machine to works in metal had been touched upon in this chapter they would almost inevitably have trenched upon the fifth volume—as it would have been difficult, to avoid proceeding from the circular saw, used simply for dividing works—to circular cutters with plain edges, used in cutting glooves—and to cutters with curvilinear or figured edges used for the teeth of wheels, and various other analogous works, subjects that are for the present held in reserve

By analogy it might also have been shown, that in some of the various apparatus employed in ornamental turning, revolving cutters of all kinds with plain or figured edges, are likewise used. But in reference to these, it will be explained in the fourth volume that the many teeth of the circular saw, or figured cutter, dwindle down to a single radial tooth, and that the solitary cutting edge makes up for its apparent deficiency, by the extreme rapidity with which it is in general driven

^{*} Civil Eng and Arch Journal vol v page 1

[†] Trans Inst Civil Engineers vol 111, p 197

CHAPTER XXVIII

FILES

SECT I—GENERAL AND DESCRIPTIVE VIEW OF FILES OF USUAL KINDS

The file is a strip or bar of steel, the surface of which is cut into fine points or teeth, that act by a species of cutting, closely allied to abrasion. When the file is rubbed over the material to be operated upon, it cuts or abrades little shavings or shreds, which from their minuteness are called *file dust*, and in so doing, the file produces minute and irregular furrows of nearly equal depth, leaving the surface that has been filed more or less smooth according to the size of the teeth of the file and more or less accurately shaped, according to the degree of skill used in the manipulation of the instrument. In treating this subject, it is proposed to divide the matter into the following sections.—

- I General and descriptive view of files of usual kinds
- II General and descriptive view of files of less usual kinds
- III Preliminary i emarks on using files, and on holding works that are to be filed
- IV Instructions for filing a flat surface under the guidance of the straight edge, and of the trial plate, or planometer
 - V Instructions for originating straight edges and trial plates, or planometers
- VI Instructions for filing rectilinear works in which several or all the superficies have to be wrought
- VII Instructions for filing curvilinear works, according to the three ordinary modes
- VIII Comparative sketch of the applications of the file, and of the engineer's planing machine, &c

The files employed in the mechanical aits are almost endless in variety and which is to be accounted for by there being some four, five, or six features in every file that admit of choice, in order to adapt the instrument to the several kinds of work for which the file is used and most of the names of files express

these different features, for instance the three following files are in common use —

6 mch	${f blunt}$	single cut	Sheffield		saw file
9 inch	taper	${f smooth}$	Lancashire		half round file
12 inch	parallel,	rough	Sheffield,	safe edge	cotter file

From the perusal of these compounded names it will be seen that six sources of variation have been noticed and upon which several characters a few observations will be offered

1 Length — The length of files is always measured exclusively of the tang or spike by which the file is fixed in its handle, and the length and general magnitude of the file require to be pro portioned to the work to be performed. When the works are both large and coarse, the file should be long and strong, that the operator may be able to exert his entire muscular force in using the instrument, when the works are minute and delicate the file should be proportionally short and slender, so that the individual may the more delicately feel the position of the file upon the work, as the vigorous employment of force, and the careful appreciation of position or contact, are at opposite ex tremes of the scale Thus, it may be said, the watchmaker frequently uses files not exceeding three quarters of an inch in length, and seldom those above 4 or 5 inches long artisans in works of medium size, such as mathematical instrument makers and gunmakers, employ files from about 4 to 14 inches long, and machinists and engineers commonly require files from about 8 to 20 inches long, and sometimes use those of 2, 3, feet and upwards in length

The lengths of files do not bear any fixed proportion to their widths, but, speaking generally, it may be said the lengths of square, round, and triangular files, are from 20 to 30 times their widths, measured at the widest parts—and the lengths of broad files, such as flat files, half round files, and many others, are from 10 to 12 times their greatest widths

& 2 Taper, blunt, and parallel files —Almost all files are required to be as straight as possible in their central line and are distinguished as taper, blunt, and parallel files—a very insignificant number of files are made curvilinear in their central line, as in the rifflers used by sculptors and carvers, and some other files

The great majority of files are made considerably taper in their length, and to terminate nearly in a point, such are called taper files, others are made nearly parallel, and known as "blunt pointed, or simply as blunt files, but in each of these kinds the section of the file is the largest towards the middle so that all the sides are somewhat arched or convex, and not absolutely straight. A very few files are made as nearly parallel as possible, and have, consequently, nearly straight sides, and an equal section throughout, such are designated as parallel files, and by some, as dead parallel files, just as we say "dead level" for a strictly level surface but it is very far more general for the so called parallel files to be slightly fuller in the middle

3 Lancashire and Sheffield files—In England the principal seats of the manufacture of files, are Sheffield and Warrington, those made at the latter place being more generally designated as Lancashire files—The Sheffield files are manufactured in very much the larger quantity, and for nearly every description of work, both large and small—The Lancashire files are less used for large than for small works, including watch and clock work, some parts of mathematical instruments—and the finer parts of machinery

Formerly all the Lancashire files bore a great pre eminence over the Sheffield, in respect to the quality of the steel from which the files were made their greater delicacy of form, the perfection and fineness of their teeth, and the success with which they were hardened, these circumstances rendered the Lanca shire files more expensive, but also much more serviceable than the Sheffield Of later years, this superiority is generally considered more particularly to apply to the smaller Lancashire files, not exceeding about 8 or 10 inches in length, as from the steady improvement amongst the best of the Sheffield file manufacturers, in respect both to the quality of the steel, and the workmanship, it now results, that the larger files made both in Lancashire and Sheffield, assimilate much more nearly in their respective qualities than formerly

4 The teeth of files — Many files that are in all other respects alike, differ in the forms and sizes of their teeth. Three forms of teeth are made, those of double cut files, those of floats, or single cut files, and those of rasps. The floats and rasps are scarcely used but for the woods and soft materials, the double cut files are used for the metals and general purposes, and when the file is spoken of, a double cut file is always implied, unless a single cut file, or a risp, is specifically named

In a double cut file, the thousands of points or teeth occur from two series of straight chisel cuts crossing each other in a single cut file or float the ridges occur from the one series of chisel cuts which are generally square across the float and in a rasp the detached teeth are made by solitary indentations of a pointed chisel or punch, a subject that will be further noticed when the cutting of files is adverted to

Double cut files are made of several gradations of coarseness, and which are thus respectively named by the Lancashue and Sheffield makers —

LANCASHIRE FILES	SHEFFIELD FILES
1 Rough	1 Rough
2 * Middle cut	2 Bastard
3 Bastard	3 Second cut
4 * Second-cut	4 Smooth
5 Smooth	5 * Dead smooth
6 Superfine	

The sizes marked with asterisks are not commonly made and this reduces each scale of variety of cut to four kinds, of which the Lancashire are somewhat the finer. The above names afford, however, but an indifferent judgment of the actual degrees of coarseness which, for all the denominations of coarseness, differ with every change of length but the numbers in the annexed table may be considered as pretty near the truth —

Approximate 1	Vumbers of	f Cuts a	n the	Inch .	of $oldsymbol{L}$ ancash $oldsymbol{n}$ re	Files*
---------------	------------	----------	-------	--------	--	--------

Lengths in Inches	4	6	8	12	16	20
Rough cut Bastard cut Smooth cut Superfine cut	56	52	44	40	28	21
	76	64	56	48	44	34
	112	88	72	66	64	56
	216	144	112	88	76	64


Of floats and rasps, but two denominations are generally made, and which are simply distinguished as coarse and fine, the fine are also called cabinet floats and rasps—and as with the files, the

One of the smallest and finest Lancashire files was found by the author to con tain from 290 to 300 cuts in the inch, which is confirmatory of the above numbers

^{*} The numbers in the Table were counted from the engravings of the teeth of files in Mr Stubs pattern book These engravings were laid down with great care from the files themselves and it is somewhat currous the numbers should so nearly fall in regular series The second courses of teeth were in each case counted and which are somewhat finer than the first course as explained on page 829

two nominal sizes of the teeth of floats and rasps, differ for every variety of length in the instruments

- 5 Safe edges—Some files have one or more edges that are left uncut, and these are known as safe edges, because such edges are not hable to act upon those parts of the work against which they are allowed to rub for the purpose of guiding the instrument. The safe edge file is principally required in making a set off, or shoulder, at any precise spot in the work and in filing out rect angular corners, as whilst the one side of the notch is being filed, the other side can be used to direct the file. Occasionally the edges alone of files are cut, and the sides are left safe or smooth, as in some warding files, which nearly resemble saws
- 6 The names of files These are often derived from their pur poses as in saw files, slitting, warding, and cotter files the names of others from their sections as square, round and halfround files

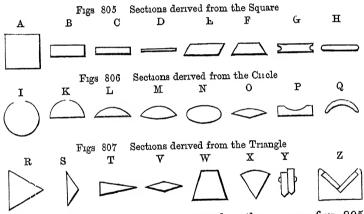

Files of all the sections represented in the groups figs 805, 806, and 807 are more or less employed, although many of them are almost restricted to particular purposes and more especially to the art of watchmaking for which art indeed very many of the files have been originated. The sections may be considered to be derived from the square, the circle, and the equilateral triungle, as will be detected by the eye without description.

To avoid wearying the reader by attempting to describe all the various files that are made, the eight or nine kinds which are of most extensive application, will be briefly adverted to and these will be placed in the supposed order of their usefulness as derived partly from the author's observation and partly from the relative quantities considered to be manufactured of each kind in two large establishments. After this, a few remarks will be given on some of the files to which the sections 805 to 807 refer, and this, or the first division of the chapter, will be con cluded by a short account of the mode of forming the teeth of files, and some other particulars of their construction

It may be considered that in nearly every branch of art in which the file is used, that the following constitute the basis of the supply, namely, taper files, hand files cotter and pillar files half round, triangulu, cross, and round files, square, equalling knife and slitting files, and rubbers, a short explanation will be given of all of these varieties, in the course of which, reference will be occasionally made to the sections A to Z just given

Taper files or taper flat files, are made of various lengths from about 4 to 24 inches and are rectangular in section as in B fig 805 they are considerably rounded on their edges, and a little also in their thickness, their greatest section being towards the middle of their length or a little nearer to the handle, whence these files are technically known to be "bellied, they are cut both on their faces and edges with teeth of four varieties, namely rough, bastard, second cut, and smooth cut teeth. Taper flat files are in extremely general use amongst smiths and mechanics, for a great variety of ordinary works.

Hand files or flat files resemble the above in length, section, and teeth, but the hand files are nearly parallel in width, and some what less taper in thickness than the foregoing. Some few of them are called parallel hand files from having a nearer equality of thickness, and parallelism of sides. Engineers, machinists, mathematical instrument makers and others give the preference to the hand file for flat surfaces and most other works, except in filing narrow apertures and notches, as then the small end of the taper file, first described, may be employed in the commence ment gradually the central and wider part, and then the entire length of the instrument, as the space or notch to be filed becomes wider, the taper form thus enables a larger and stronger file to be used in the commencement, but for other and accurate pur poses the hand file is esteemed preferable to the taper

Cotter files are always narrower than hand files of the same

length and thickness, they are nearly flat on the sides and edges, so as to present almost the same section at every pair of their length, in which respect they vary from 6 to 22 inches. Cotter files are mostly used in filing grooves, for the cotters, keys or wedges, used in fixing wheels on their shafts, whence their name

The taper cotter files, or as they are also called entering files, are entirely different from the above, as they are taper both in width and thickness, and almost without any swell, or pyramidal, in which respect alone they differ from ordinary taper files that are usually much swelled or belied

Pillar files, also somewhat resemble the hand files, but they are much narrower, somewhat thinner, as in C, and are used for more slender purposes, or for completing works that have been commenced with the hand files Pillar files have commonly one

safe edge, and vary from 3 to 10 inches in length

Half round files, are nearly of the section L, notwithstanding that the name implies the semicircular section, in general the curvature only equals the fourth to the twelfth part of the circle, the first being called full half round, the last flat half round files. The half round files vary from about 2 to 18 inches in length, and are almost always taper. The convex side is essential for a variety of hollowed works, the flat side is used for general purposes.

Triangular files, commonly misnamed "three square files, are of the section R, and from 2 to 16 inches long they are used for internal angles more acute than the rectangle, and also for clear ing out square corners One of the greatest uses of triangular files from 3 to 6 inches long, is the sharpening of saws, the greater number of which have teeth of the angle of 60 degrees, an angle doubtless selected, because it appertains to all the angles of the equilateral triangular file, the three edges of which are therefore alike serviceable in sharpening saws. In the southern parts of England, saw files with single cut teeth, are in more general use, from the idea that they "cut sweeter" in the midland and northern counties, the double cut files of the same dimensions are more in vogue, being esteemed more durable Small saws for metal, which are harder than those for wood, are always sharpened with double cut files, the Lancashire being preferred

Cross files, or crossing files, sometimes called double half rounds, are of the section M, or circular on both faces, but of

two different curvatures, they are used for concave or hollowed forms the same as the convex side of the half round, but crossing files are on the whole shorter and less common than half round files and are probably named from the files being used in filing out the crosses of arms or small wheels as in clock work in which case the opposite sides present a two fold choice of curvature in the same instrument, which is convenient. Those cross files which are principally known as double half rounds, are fuller or more convex on both faces than ordinary cross files and are employed by engineers

Round files, of the section I range from the length of 2 to 18 inches they are in general taper, and much used for enlarging round holes. The round file is better adapted than the so called half round file, to works the internal angles of which are filled in or rounded as the round file is much stronger than the half round of the same curvature. Small taper round files, are often called rat tail files and the small parallel round files, are also called joint files as they are used in filing the hollows in the joints of snuff boxes and similar objects for the reception of the pieces of joint wire (vol 1 page 429), that are soldered in the hollow edges of the work for the joint pin or axis

Square files, are used for small apertures, and those works to which the ordinary flat files are from their greater size less applicable. The square files measure in general from 2 to 18 inches long and are mostly taper, they have occasionally the one side safe or uncut

Equalling files, are files of the section D, in width they are more frequently parallel than taper, in thickness they are always parallel. They are in general cut on all faces, sometimes as in the warding files for locksmiths, the two broad surfaces are left uncut or safe and they range from 2 to 10 inches long

Knife files, are of the section T, and in general very acute on the edge, they are made from 2 to 7 inches long and are as frequently parallel as taper. The knife files are used in cutting narrow notches, and in making the entry for saws and for files with broader edges, knife files are also employed in bevilling or chamfering the sides of narrow grooves

Slatting files called also feather edged files, resemble the last in construction and purpose, except in having as in section V, two thin edges instead of one, they are almost always parallel

Rubbers, are strong heavy files generally made of an inferior kind of steel they measure from 12 to 18 inches long from \(^3\) to 2 inches on every side and are made very convex or fish bellied they are frequently designated by their weight alone, which varies from about 4 to 15lbs. Rubbers are nearly restricted to the square and triangular sections A and R. Some few rubbers are made nearly square in section, but with one side rounded, as if the sections K and B were united these are called half thick. Rubbers are scarcely ever used by machinists and engineers, but only for coarse manufacturing purposes where the object is rather to brighten the surface of the work than to give it any specific form. Rubbers were formerly made only of bar or common steel, but are now also made of cast steel and in a more careful manner.

Many attizans and more particularly the watchmakers, require other files than those described, and it is therefore proposed to add the names of some of the files to which the sections refer premising that such names as are printed in *Italics*, designate small files especially used in watchmaking

Names of some of the Files corresponding with the Sections
A to Z (represented on page 821)

- A —Square files, both parallel and taper, some with one safe side also square rubbers
- B -When large, cotter files, when small verge and priot files
- C—Hand files parallel and flat files, when small, pottance files when narrow, pillar files, to these nearly parallel files are to be added the taper flat files
- D —When parallel equalling clock pinion and endless screw files, when taper, slitting, entering warding, and barrel hole files
- E—French pivot and shouldering files which are small, stout and have safe edges, when made of large size and right and left they are sometimes called parallel V files from their suitability to the hollow V V s of machinery
- F -Name and purpose similar to the last
- G —Flat file with hollow edges, principally used as a nail file for the dressing case
- H —Pointing mill saw file, round edge equalling file, and round edge joint file all are made both parallel and taper

- I —Round file gulleting saw file, made both parallel and taper K —Frame saw file, for gullet teeth
- L—Half round file Nicking and piercing files also cabinet floats and rasps, all these are usually taper. Files of this section which are small, parallel, and have the convex side uncut, and have also a pivot at the end opposite the tang are called round off files, and are used for rounding or pointing the teeth of wheels, cut originally with square notches. The pivot enables the file to be readily twisted in the fingers to allow it to sweep round the curve of the tooth to be rounded.
- M -Cross or crossing files, also called double half rounds
- N—Oval files oval gulleting files for large saws, called by the French limes a double dos Oval dial file when small
- O —Balance wheel or swing wheel files, the convex side cut, the angular sides safe
- P—Swaged files, for finishing brass mouldings, sometimes the hollow and fillets are all cut
- Q —Sır John Robison's curvilinear file, to be hereafter described
- R—Triangular, three square, and saw files also triangular rubbers which are cut on all sides. Friangular files are also made in short pieces and variously fixed to long handles, for works that are difficult of access, as the grooves of some slides and valves, and similar works
- S—Cant file, probably named from its suitability to filing the insides of spanners, for hexagonal and octagonal nuts or as these are generally called, six or eight canted bolts and nuts—the cant files are cut on all sides
- T —When parallel flat dovetail, banking and watch pinion files, when taper knife edged files. With the wide edge round and safe, files of the section T, are known as moulding files, and clock pinion files.
- V Screw head files, feather edge files, clock and uatch slitting files
- W—Is sometimes used by engineers in finishing small grooves and key ways, and is called a valve file, from one of its applications
- X —A file compounded of the triangular and half round file and stronger than the latter similar files with three rounded faces have also been made for engineers


- Y —Double or checkering files, used by cutlers, gun makers and others. The files are made separately and riveted together, with the edge of the one before that of the other in order to give the equality of distance and parallelism of checkered works just as in the double saws for cutting the teeth of racks and combs see p. 723
- Z —Double file made of two flat files fixed together in a wood or metal stock this was invented for filing lead pencils to a fine conical point and was patented by Mr Cooper under the name of the Styloxynon

The manufacture of files — The pieces of steel, or the blanks intended for files, are forged out of bars of steel, that have been either tilted or rolled as nearly as possible to the sections required, so as to leave but little to be done at the forge blanks are afterwards annealed with great caution so that in neither of the processes the temperature known as the blood red heat may be exceeded The surfaces of the blanks are now rendered accurate in form and quite clean in suiface, either by filing or guinding In Wairington, where the majority of the files manufactured are small, the blanks are mostly filed into shape as the more exact method, in Sheffield where the greater number are large the blanks are more commonly ground on large grindstones as the more expeditious method but the best of the small files are here also filed into shape and in some few cases the blanks are planed in the planing machine, for those called dead parallel files the object being in every case to make the surface clean and smooth The blank before being cut is slightly greased that the chisel may slip freely over it, as will be explained

The file cutter, when at work is always seated before a square stake or anvil and he places the blank straight before him, with the tang towards his person the ends of the blank are fixed down by two leather straps or loops one of which is held fast by each foot —See Note B P p 1022

The lugest and smallest chisels commonly used in cutting files are represented in two views and half size in figs 808 and 809. The first is a chisel for large rough Sheffield files the length is about 3 inches, the width 21 inches, and the angle of

the edge about 50 degrees, the edge is perfectly straight but the one bevil is a little more inclined than the other and the keenness of the edge is rounded off, the object being to indent rather than cut the steel, this chisel requires a hammer of about 7 or 8 lbs weight. Fig. 809 is the chisel used for small super fine Lancashire files, its length is 2 inches, the width j inch it is very thin and sharpened at about the angle of 85 degrees the edge is also rounded, but in a smaller degree, it is used with a

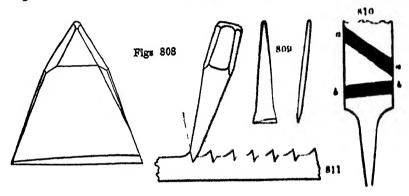

hammer weighing only one to two cunces, as it will be seen the weight of the blow mainly determines the distance between the teeth. Other chisels are made of intermediate proportions, but the width of the edge always exceeds that of the file to be cut.

The first cut is made at the point of the file, the chisel is held in the left hand, at an horizontal angle of about 55 degrees, with the central line of the file, as at a a fig. 810, and with a vertical inclination of about 12 to 4 degrees from the perpendicular as represented in the figures 808 and 800 supposing the tang of the file to be on the left hand side. The blow of the hammer upon the chisel, causes the latter to indent and slightly to drive forward the steel, thereby throwing up a trifling ridge or burr the chisel is immediately replaced on the blank and alid from the operator, until it encounters the ridge previously thrown up which arrests the chisel or prevents it from slipping further

^{*} A fewerian, experienced in the manufacture of Sheffield flies, considers the following to be nearly the usual angles for the vertical inclination of the chimic namely, for rough rasps, 15 degrees beyond the perpendicular; rough flies, 1; degrees bastand files, 10 degrees; second-out flies, 7 degrees; smooth out files, 5 degrees and desd-amooth out files, 4 degrees

back, and thereby determines the succeeding position of the chisel. The heavier the blow, the greater the ridge, and the greater the distance from the preceding cut, at which the chisel is arrested. The chisel having been placed in its second position is again struck with the hammer, which is made to give the blows as nearly as possible of uniform strength, and the process is repeated with considerable rapidity and regularity, 60 to 80 cuts being made in one minute, until the entire length of the file has been cut with inclined parallel, and equi-distant ridges, which are collectively denominated the *first course*. So far as this one face is concerned, the file if intended to be single cut would be then ready for hardening, and when greatly enlarged its section would be somewhat as in fig. 811.*

Most files, however, are double cut, or have two series or courses of chisel cuts, and for these the surface of the file is now smoothed by passing a smooth file once or twice along the face of the teeth, to remove only so much of the roughness as would obstruct the chisel from sliding along the face in receiving its successive positions and the file is again greased


The second course of teeth is now cut, the chisel being inclined vertically as before or at about 12 degrees, but horizon tally only a few degrees in the opposite direction of about 5 to 10 degrees from the rectangle, as at b b, fig 810 the blows are now given a little loss strongly, so as barely to penetrate to the bottom of the first cuts and from the blows being lighter they throw up smaller burrs, consequently the second course of cuts is somewhat finer than the first. The two series of courses, fill the surface of the file with teeth which are inclined towards the point of the file, and that when highly magnified much resemble in character the points of cutting tools generally, as seen in fig 811, for the burrs which are thrown up and constitute the tops of the teeth, are slightly inclined above the general outline of the file, minute parts of the original surface of which still remain nearly in their first positions

If the file is flat and to be cut on two faces, it is now turned over but to protect the teeth from the hard face of the anvil, a thin plate of pewter is interposed. Iriangular and other files

^{*} The teeth of some single cut files are much less inclined than 55 decrees those of floats are in general square across the instrument

require blocks of lead having grooves of the appropriate sections to support the blanks so that the surface to be cut may be placed horizontally. Taper files require the teeth to be some what finer towards the point, to avoid the risk of the blank being weakened or broken in the act of its being cut which might occur if as much force were used in cutting the teeth at the point of the file, as in those at its central and stronger part

Eight courses of cuts are required to complete a double cut rectangular file that is cut on all faces, but eight ten, or even more courses are required, in cutting only the one rounded face of a half round file There are various objections to employing chisels with concave edges, and therefore in cutting round and half round files, the ordinary straight chisel is used and applied as a tangent to the curve but as the narrow cuts are less difficult than the broad ones, half round and round files are generally cut by young apprentice boys It will be found that in a smooth half round file one inch in width, that about twenty courses are required for the convex side, and two courses alone serve for the flat side In some of the double cut gullet tooth saw files, of the section K, as many as 23 courses are sometimes used for the convex face, and but 2 for the flat The same diffi culty occurs in a round file, and the surfaces of curvilinear files do not therefore present, under ordinary circumstances, the same uniformity as those of flat files, as the convex files are from necessity more or less polygonal

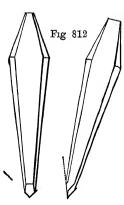

Hollowed files are raiely used in the arts and when required it usually becomes imperative to employ around edged chisel, and to cut the file with a single course of teeth. Sir John Robison's curvilinear file will be hereafter noticed, in which the objections alluded to in both hollowed and rounded files are nearly or entirely removed.

The teeth of rasps are cut with a peculiar kind of chisel, or as it is denominated a punch, which is represented also half size, and in two views in fig 812. The punch

for a fine cabinet 1 asp 1s about $3\frac{1}{2}$ inches long and $\frac{5}{8}$ square at its widest part. Viewed in front, the two sides of the point meet at

an angle of about 60 degrees, viewed edgeways, or in profile, the edge forms an angle of about 50 degrees, the one face being only a little inclined to the body of the tool. Different sized rasps necessarily require different sized punches, the ends of which would much resemble the ordinary point tools for turning wood or ivory, but that they are more obtuse and that the edge of the punch is rounded, that the tool may rather indent than cut

In cutting rasps the punch is sloped rather more from the operator than the chisel in cutting files, but the distance between the teeth of the rasp cannot be determined as in the file by placing the punch in contact with the built of the tooth previously made. By dint of habit the workman moves or, technically, hops the punch the required distance, to facilitate this move ment he places a piece of woollen cloth under his left hand, which prevents his hand coming immediately in contact with, and adhering to the anvil

The teeth of rasps are cut in rather an aibitiary manner, and to suit the whims rather than the necessities of the workmen who use them Thus the lines of teeth in cabinet rasps wood lasps and farriels rasps, are cut in lines sloping from the left down to the right hand side, the teeth of lasps for boot and shoe last makers and some others, are sloped the reverse way, and rasps for gun stockers and saddle tree makers are cut in cucular lines or clescent form These directions are quite immaterial, but it is important that every succeeding tooth should cross its piedecessoi, or be intermediate to the two before it as if the teeth followed one another in right lines, they would produce furrows in the work, and not comparatively smooth Considering the nature of the process, it is rather surprising that so much regularity should be attainable as may be observed in rasps of the first quality

In cutting files and rasps, they almost always become more or less bent and there would be danger of breaking them if they were set straight whilst cold they are consequently straightened whilst they are at the red heat, immediately prior to their being hardened and tempered

Previously to their being hardened the files are drawn through beer grounds yeast, or other sticky matter and then through common salt, mixed with cows hoof previously roasted and pounded, and which serve as a defence to protect the delicate teeth

of the file from the direct action of the file. The compound likewise serves as an index of the temperature as on the fusion of the salt the hardening heat is attained, the defence also lessens the disposition of the files to crack or clink on being immersed in the water, see vol 1 page 253

The file after having been smeared over as above is gradually heated to a dull red and is then mostly straightened with a leaden hammer on two small blocks also of lead, the temperature of the file is afterwards increased until the salt on its surface just fuses, when the file is immediately dipped in water. The file is immersed, quickly or slowly, vertically or obliquely according to its form that mode being adopted for each variety of file which is considered best calculated to keep it straight

It is well known that from the unsymmetrical section of the hilf round file, it is disposed on being immersed, to become hollow or bowed on the convex side and this tendency is compensated for by curving the file whilst soft in a nearly equal degree in the reverse direction, by this compensatory method the hardening process leaves the half round files nearly straight

It nevertheless commonly happens that with every precaution the file becomes more or less bent in hardening, and if so it is straightened not by blows but by pressure, either before it is quite cold or else after it has been partially reheated in any convenient mode as over a clear fire, on a heated iron bar, over a hooded gas flame, as in tempering watch springs, or in any other manner The pressure is variously applied, sometimes by passing the one end of the file under a hook, supporting the center on a prop of lead and bearing down the opposite end of the file at other times by using a support at each end and applying pressure in the middle, by means of a lever the end of which is hooked to the bench, as in a paring knife Laige files are always straightened before they are quite cooled after the hardening, and whilst the central part retains a considerable degree of heat When straightened, the file is cooled in oil, which saves the teeth from becoming rusty

The tangs are now softened to prevent their fracture, this is done either by grasping the tang in a pair of heated tongs, or by means of a bath of lead contained in an iron vessel with a per forated cover, through the holes in which, the tangs are immersed in the melted lead that is heated to the proper degree, the tang

is afterwards cooled in oil, and when the file has been wiped, and the teeth brushed clean, it is considered fit for use

The superiority of the file will be found to depend on four points—the primary excellence of the steel—the proper forging and annealing without excess of heat—the correct formation of the teeth—and the success of the hardening. These several processes are commonly fulfilled by distinct classes of work people, who are again subdivided according to the sizes of the files, the largest of these being cut by powerful muscular men, the smallest by women and guls, who thereby severally attain great excellence in their respective shares of the work


The manufacture of files, especially the cutting of the teeth has been entered into much more largely than was at first intended, but it is hoped this may not be without its use as notwithstanding the suitability of ordinary files to most purposes still occasions may and do occur in which the general mechanist or amateur may find some want unsupplied, which these hints may enable him to provide for although less perfectly than if the file in question had been manufactured in the usual course. The process of cutting teeth, is also called for in roughing the jaws of vices and clamping apparatus *

Means of grasping the file—In general the end of the file is forged simply into a taper tang or spike, for the purpose of fixing it in its wooden handle, but wide files require that the tang should be reduced in width either as in fig 813 or 814. The former mode, especially in large files is apt to cripple the steel and dispose the tang to break off, after which the file is nearly useless, the curvilinear tang, 814, is far less open to this objection, and was registered by Messis Johnson, Cammell, and Co, of Sheffield—Some workmen make the tangs of large files red hot, that they may burn their own recesses in the handles, but this is objectionable, as the chiried wood is apt to crumble

^{*} There is perhaps an equal mixture of philosophy and prejudice in the hardening of files—some attach very great importance to the coating or defence others to the medication of the water and all to the mode of immersion best calculated for each different file in order to keep it as straight as possible questions of opinion which it is impossible to generalize. Mr Stub's process of manufacture is pretty much as above described and although he has experimented with mercury at 8 h as the cooling medium as well as various fluids he has arrived at the conclusion that the salt principally acts as an antiseptic and that fresh spring water at 45 is as effective as any fluid

away and release the file at is more proper to form the cavity in the handle with coarse floats made for the purpose

In driving luge files into their handles it is usual to place the point of the file in the hollow behind the chaps of the tul vice,

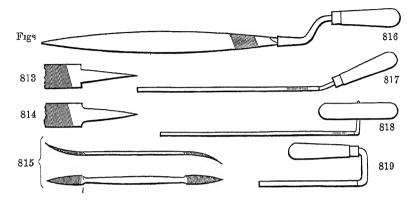

and to drive on the handle with a mallet or hammer — Smaller files are fixed obliquely in the jaws of the vice, between clamps of sheet brass, to prevent the teeth either of the vice or file from being injured, and the handle is then driven on — The file, it small is sometimes merely fixed in a cork, or in a small piece of hazel rod, but these are to be viewed as temporary expedients, and inferior to the usual wooden handles turned in the lathe Very small watch files are fixed in handles no larger than drawing pencils and some few of them are roughened on the tang after the manner of a float, and fixed in by sealing wax or shell lac


Several of the small files have the handles forged in the solid, that is the tang is made longer than usual and is either parallel or spread out, to serve for the handle as in a razor strop, many of the watch files are thus made. In the double ended rifflers, or bent files, fig. 815 used by sculptors and carvers, and in some other files, there is a plain part in the middle, fulfilling the office of a handle, and in several of the files and rasps made for dentists, farriers, and shoemakers, the tool is also double, but without any intermediate plun part so that the one end serves as the handle for the other

In general the length of the file exceeds that of the object filed, but in filing large surfaces it becomes occasionally neces sary to attach cranked handles to the large files or rubbers, as in fig 816, in order to raise the hand above the plane of the work Sometimes the end of the file is simply inclined, as in fig 817, or bent at right angles as in 818 for the attachment of the wooden handles represented, but the last two modes prevent the second side of the file from being used until the tang is bent the reverse way. The necessity for bending the file is avoided, by employing as a handle, a piece of round from $\frac{5}{8}$ or $\frac{3}{4}$ inch in drameter, bent into the semicircular form as an arch, the one extremity (or abutment) of which is filed with a taper groove to fit the tang of the file, whilst the opposite end is flat and rests upon the teeth, in this manner, both sides of the file may be used without any preparation

Fig 819 represents in profile a bload and short rasp with fine teeth, used by iron founders in smoothing off loam moulds for iron castings, this is mostly used on large surfaces, to which the ordinary hindle would be inapplicable, and the same kind of tool when mide with coarsel teeth will be recognised as the baker's rasp. For some slight purposes ordinary files are used upon large surfaces, without handles of any kind, the edges of the file itself being then grasped with the fingers.

Cibinet makers sometimes fix the file to a block of wood to serve for the grasp and use it as a plane. Thus mounted, the file may also be very conveniently used on a shooting board, in filing the edges of plates to be inlied.

Fig 820 represents a very good arrangement of this kind by Mi W Lund, a a is the plan and b the section of the file stock, c c

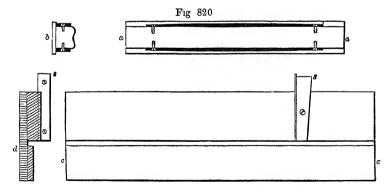


is the plan of the shooting board and d its section. Two files (that is represented black) are screwed against the sides of a strught

bar of wood, which has also a wooden sole or bottom plate that projects beyond the files, so that the smooth edge of the sole may touch the shooting board instead of the file teeth. The shooting board is made in three pieces so as to form a gloove to receive the file dust which would otherwise get under the stock of the file the shooting board has also a wooden stop s faced with steel that is wedged and screwed into a gloove made across the top piece and the stop being exactly it right angles, serves also to assist in squaring the edges of plates or the ends of long bars, with accuracy and expedition. Mr Lund piefcis a flat file that is fully curved on the face, as nearly half the file then comes into action at every strole

Short pieces of files (or tools as nearly allied to saws), are occasionally fixed in the ends of wooden stocks, in all other respects like the routing gages of carpenters as seen in two views in fig 821 the coopers croze, page 488, is a tool of this description

Files intended for finishing the grooves in the edges of slides, are sometimes made of short pieces of steel of the proper section,

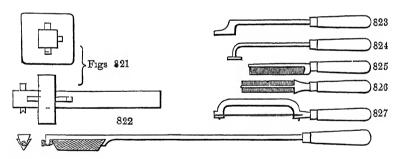

(see fig 822) cut on the surfaces with file teeth, and attached in various ways to slender iods or wires, serving as the handles, and extending beyond the ends of the slides. Or the handle is at right angles to the file and formed at the end, as a staple, to clip the ends of the short file, as in reaching the bottom of a cavity Files intended to reach to the bottom of shallow cavities are also constructed as in figs 823 and 824 or sometimes an inch or more of the end of an ordinary file is bent some 20 or 30 degrees, that the remainder may clear the margin of the recess

To stiffen slender files, they are occasionally made with tim or brass backs as in figs 825 and 826, such are called dove tail

files, evidently from their similitude to dove tail saws and thin equalling files, are sometimes grasped in a brass frame fig 827, exactly like that used for a metal frame saw, by which the risk of breaking the instrument in the act of filing is almost annulled

An equivocal analogy both to the file and saw, is to be observed in some of the delicate circular cutters, used in cutting watch wheels and other small works. The teeth of such cutters are in many instances formed by cuts of a chisel the same as the teeth of files, and the axis of the cutter becomes, by comparison, the handle of the circular file


SECT II —GENERAL AND DESCRIPTIVE VIEW OF FILES OF LESS USUAL KINDS

Notwithstanding the great diversity in the files alluded to in the foregoing section, it is to be remarked that all those hitherto noticed are made entirely of steel, and their teeth are all produced in the ordinary manner by means of the chisel and hand hammer in the present section, a few of the less usual kinds of rasps, floats, and files will be noticed, the teeth of which are for the most part, produced by means differing from those already described

The infflers, fig 815, used by sculptors, are required to be of numerous curvatures, to adopt them to the varying contour of works in marble. In general, the rifflers are made of steel in the ordinary mode, but they have also been made of wrought won, and slightly case hardened, in which case the points of the teeth become converted into steel but the general bulk of the instrument remains in its original state as soft iron consequently such case hardened rifflers admit of being bent upon a block of lead with a leaden mallet, so that the artist is enabled to modify their curvatures as circumstances may require

Several kinds of floats are made with coarse, shallow, and sharp teeth, which are in section like fig 646, page 684, these teeth could not be cut with the chisel and hammer in the ordinary manner, but are made with a triangular file. Figs a to l, 828, represent the sections of several of these floats, which have teeth at the parts indicated by the double lines for instance, a is the float, b the graille, c the found, d the carlet, e the topper, used by the horn and tortoiseshell comb makers, parts of the names of which floats are corrupted from the French language, indeed

the art was mainly derived from French artizans. The floats, f to i, are used by ivory carvers for the handles of knives, and in

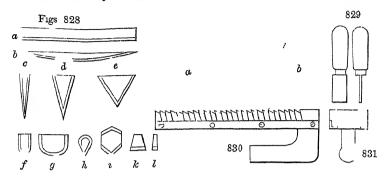

the preparation of works the carving of which is to be completed by scorpers and gravers, k and l are used in inlaying tools in their handles k is made of various widths, and is generally thin long, and taper l is more like a key hole saw. When the teeth of these floats have been formed with the trianguluifile, and made quite sharp the tools are first hardened and very slightly tempered, just sufficiently to avoid fracture in use, but when after a period the tools have become dull, they are tempered to a deep orange, or a blue, so as to admit of being sharpened with a triangular file

The larger of the floats, such as those a to e, used by the comb makers, are kept in order principally by the aid of a burn isher, represented in two views in fig. 829, the blade is about 2 inches long one inch wide, and $\frac{1}{16}$ inch thick the end is mostly used, and which is forcibly rubbed, first on the front edge of every tooth as at a fig. 830 and then on the back as at b, by which means a slight burn is thrown up, on every tooth, somewhat like that on the joiner's scraper, but in this ait the burnisher is commonly named a turn file. When the teeth of the floats have become thickened from repeated burnishing the triangular file is again resorted to, and then the burnisher for a further period, by these means the floats are made to last a considerable time

The quannet is a float resembling fig. 819, but having coarse filed teeth, of the kind just described at may be considered as the ordinary flat file of the horn and tortoiseshell comb makers, and in using the quannet the work is mostly laid upon the kine as a support. An ingenious artizan in this branch, Mr. Michael

Kelly, invented the quannet represented in figs 830 and 831. The stock consists of a piece of beech wood in which at intervals of about one quarter of an inch, cuts inclined nearly 30 degrees with the face, are made with a thin saw, every cut is filled with a piece of saw plate. The edges of the plates and wood are originally filed into the regular float like form, and the burnisher is subsequently resorted to as usual. The main advantage results from the small quantity of steel it is necessary to operate upon, when the instrument requires to be restored with the file. From this circumstance and also from its less weight the wooden quannet, fig. 830, is made of nearly twice the width of the teel instrument, fig. 819, and the face is slightly rounded, the teeth being sometimes inserted square across, as in a float, at other times inclined some 30 degrees as in a single cut file.

A more elaborate but less available, instrument was invented by Mr White, probably during his residence in Fiance, about the time of the Revolution (1793) It consisted of numeious parallel plates of steel, which were placed vertically and in con tact something like a pack of namow cards and were fixed in that position in an appropriate frame and as the edges of the plates were all bevelled, they constituted a single cut file most curious part of the contrivance was the ingenious mode of chamfering the edges is for this purpose the plates were loosened and arranged in a sloping direction, so that the chamfers then lay collectively in one plane, which was ground either on a gund stone, or a lead lap fed with emery the plates were replaced perpendicularly before use Means were also described for placing the steel plates square across the instrument as in a float, or inclined to the light or left as in a file, according to the material to be wrought and a drawing is also given of a cucular float of similar nature for cutting dye woods into small fragments White's ' perpetual file, with moveable plates, is however scarcely known, and it is very questionable if it ever obtained more than the experimental application which led to its description having been published *

The cutting of files by machinery is an operation that has engaged the attention of many persons, and the earliest attempt

^{*} Published in Descriptions des Machines et Procédés specifiés dans les Brevets d'Invention &c Par M Christian Paris 4to 1824 Tome 6 p 33 Patent dated 6 Jan 1795

at the process that has come under the author's notice is that of *Thiout aine* which was figured and described in a work by his son in 1740 and this machine being based on the manual process in all probability differs but little in its general features from most of those of more recent projectors

According to the drawings referred to, the file is attached to a screw slide, which is suspended at the ends by pivots and covered with a thin plate of tin, the slide rests upon a stationary anvil, and is actuated by a guide screw, which is moved at intervals, the space from tooth to tooth by a pin wheel for which the ratchet wheel would be now substituted. The chisel is held by a jointed aim, beneath which is a spring to throw up the chisel from off the file, the moment after a drop hammer, which is also fixed on a joint, has indented the tooth. The movements of the slide and hammer are each repeated at the proper intervals, in every revolution of the winch handle, by which I hiout's machine is represented to be worked.*

The practical introduction of machinely for cutting files appears to be due to a Frenchman of the name of Raoul, at about the close of the last century but the description of the machine has not been published, and the manufacture is now carried on by his son, some of whose files are in the possession of the author. They are certainly beautiful specimens of work manship being more strictly regular, and also less hable to clog or pin when in use than files cut by hand, as usual

His manufacture is principally limited to watch files with flat sides and measuring from \(\frac{1}{4} \) of an inch, to 5 or 6 inches long When magnified, the teeth of the files cut either by hand or machinery upper as nearly as possible of the same character!

Machines have been recently constructed in England for

^{*} See Thronts Traite de l'Horlogerie Paris 1740 Vol 1 page 81 plates 33 and 34

[†] Mr Raoul was rewarded for his files by the Lycéc dis Arts an institution that no longer exists but which was founded soon after the I rench Revolution for the reward of national di coveries and improvements. I rom the Report of the I yea um of Arts it appears that on the 10th Thermidor year 8 of the Republic (July 1800) an honorary crown was decreed to Citizen Raoul for the perfection of his files. And on a subsequent page of the report is given the opinion of a Committee appointed to examine into the comparative merits of Raoul's files from which report it appears they were pronounced by the Committee to be equal and even superior to the best English files.

cutting both large and small files, and half a dozen or more at a time. The details of the machines display great ingenuity and skill, especially in the arrangement for holding the blanks and the chisels, and also in the introduction of templets and other mechanism by which, in cutting taper files, the hammer is less raised in cutting the ends of the file than at the middle so as to proportion the force of the blow to the width and depth of the cut at different parts of the file. Two machines were used for double cut files the bed of the one inclined to the right, of the other to the left, to give the different horizontal inclinations proper to these teeth, and a machine with a straight bed was used for single cut floats and for round and half round files

Considerable difficulty was at first experienced in the manage ment of the chisels, which were then very frequently broken, but with more dexterous management it is ultimately considered that the chisels last for a longer time in the machines than when used by hand The machines make about 240 strokes in the minute, or three times as many as the file cutter, with the advintige of nearly incess int action, as unlike the aim of the workman, the machines are unconscious of fatigue, moreover, to save the delay of adjustment two beds for the files are employed, so that the one may be filled whalst the blanks in the other are being cut and two firmes for the chisels are also alternately used Taking all these points into account, each machine is considered by the proprietors nearly to accomplish the work of ten men butthere are various drawbacks that prevent under ordinary circumstances, any great commercial advantage in the machine over the hand process from which considerations. the pitent file cutting machines are not at present used

In concluding this section, there remain to be introduced, two propositions for the manufacture of files, suggested by a very talented and philanthropic member of the scientific world, the late Sir John Robison KH, FRSE, late President of the Royal Scottish Society of Arts, &c, namely, his methods of making curvilinear files, and of cutting flat files with very fine teeth. The subjects cannot be better stated than by quoting Sir John's correspondence with the author, speaking of the

^{*} Captum Enceson's Patent File Cutting Machines specified 1836 constructed by Messis Braithwaites of London and carried into practical effect by Messis Turton & Sons of Sheffield

curvilinear files of the section Q, page 821, he introduces the

subject as follows -

"I have just entered on a new project, of which I should be Having always found difficulty glad to know what you think in filing hollow surfaces from the scratches which the irregular cutting of even the best half round, or round files leave in the work, in spite of every care, I was lately led to consider whether half round, or even round files, might not be made as perfect in It has occurred to me, that this object their cutting as flat ones may be attained by cutting flat strips of rolled steel plate on one side, and then squeezing them into the desired curve by a screw press, and a block tin or type metal swage and in the case of the round file, by pressing the plate round a cylindrical mandrel

I do not think that the files made in this way should cost more than those now made, as the surface would be cut by two courses of cuts (as flat files are), instead of the numerous courses required to cover the surface of round files, the saving in this respect would make up for the time required in bending the plates

A valuable addition to Sir John's proposal occurred inciden tally, Messrs Johnson and Cammell, to whom the scheme was communicated in the haste of putting it to trial, took a thin equalling file that had been previously cut on both faces equalling file was softened, bent, and re hardened and this pro duced a file, the convex and also the concave surface of which were both useful additions to the tools of the general mechanician

But it was found that with a plate of equal thickness, the central part bent more easily than the edges, making the curve This was successfully obviated by making the blank thinner and more flexible at the edges, somewhat as a half round file, and in which case the bending was quite successful, and the section became truly cucular *

Sir John Robison's second project in respect to the manufac

^{*} The Society for the Encouragement of Arts of London bestowed its silver medal on Sir John Robison for his invention of the cuived file which distinction it is to be regretted arrived as a posthumous honour (See Trans Soc of Arts vol. liv p 128) And the Royal Scottish Society of Arts presented in November 1843 a silver medal to Messrs Johnson Cammell and Co for the skilful manner in which they had carried out and perfected the above scheme, and introduced the curved files as a regular article of manufacture (See the official report in the Edinburgh New Philosophical Journal for January, 1844 p 86)

tune of files, refers to a new mode of forming the teeth of very fine files, otherwise than by percussion, and without delaying the reader by referring to the earlier correspondence on the subject, the author gives a short extract from a letter received a few days before Sir John's death, and also the contents of the packet therein referred to

Lest my medical friends should be mistaken, and this malady increase so as to prevent my communicating my project for cut ting fine files, I shall now make out a memorandum of my ideas on the subject, and making a sealed packet of it shall enclose it to you—If I get better and reach—London, we can discuss the matter together, and if I am put hors de combat, you will consider it your own—*

* * * *

'It appears to me that the graver may be applied with good effect in cutting the teeth of the finer classes of flat files, and that if a number of steel blanks were firmly embedded on a platform similar to the bed of a planing table, and made to move forward in their own plane by a micrometer screw then if an equal num ber of gravers were to be fixed in a frame to lie over the plat form, so that each graver point should be in a certain relative position to one of the blanks on motion being communicated to the frame in a proper direction and to a distance a little exceeding the breadth of the blank a line would be ploughed out of the surface of each blank. If the frame were then brought back to its first position, and the platform advanced or receded by the micrometer screw, a second movement of the cutter frame would produce a line parallel to the first and so on in succession

"If the points of the gravers, instead of being set to cut

А ______В

equilateral grooves as at A, were inclined so as to cut them as at B, then, by a proper proportioning of the depth of the cut and the progressive movement of the platform a regular cutting tooth of great sharpness may be given to the file

"The movement to be given to the graver fiame may be an oscillating one round a distant center so that the short arc of the teeth may be sensibly a straight line

"It is evident that the sharpness and smoothness of the

engraving must depend mainly on the way in which the cutter is presented to the work and experience shows that the position of the tool in the hand of the engraver is the most favourable, both to the production of clean lines, and the preservation of the point of the tool, the graver must be supported endways and not alone by fastenings in its middle, like the tool of a planing machine, or a slide rest cutter

'The means of regulating the depth of the cut and the other arrangements of the parts of such a machine, would of course require consideration by engravers and practical mechanics

'(Signed) John Robison

'EDINBURGH 17th February 1843

The author much regrets that the multiplicity of his engage ments and especially those connected with these pages, should have prevented him putting the above project to experimental proof but he would be well pleased to hear that the subject had been brought to successful issue by any person more favourably situated for carrying out the suggestion *

SECT III—PRELIMINARY RIMARKS ON USING FILLS, AND ON HOLDING WORKS THAT ARE TO BL FILED

The use of the file is undoubtedly more difficult than that of the generality of mechanical tools and the difficulty arises from the circumstance of the file possessing, but in a very inferior degree, the guide principle the influence of which principle, in all tools from the most simple cutting tool used by hand, to the most complex cutting machine or engine, formed the subject matter of the introductory chapter of the present volume. The comparative facility of the manipulation of turning tools, was shown to depend on the perfection in which the guide principle exists in the turning lathe. It was further stated at page 468—

"The guide principle is to be traced in most of our tools, in the joiner's plane it exists in the form of the stock or sole of the plane, which commonly possesses the same superficies that it is desired to produce For instance, the carpenter's plane used for

^{*} Since writing the above the author learns that Captain Friceson tiled some experiments on cutting file teeth as with a graver but that he was led to con side the mode less practical than that of cutting teeth by percussion. The subject appears, however to deserve more extended trial

flat surfaces is itself flat both in length and width, and therefore furnishes a double guide. The flat file is somewhat under the same circumstances, but as it cuts at every part of its surface from thousands of points being grouped together, it is more treacherous than the plane, as regards the surface from which it derives its guidance and from this and other reasons it is far more difficult to manage than the carpenter's plane

These points are recalled not to impress the amateur with the idea that the successful use of the file will be to him unatt unable, but rather to call forth such a measure of perseverance as may enable many to arrive at a practice which is confessedly difficult. It is proposed in the present section to notice certain preliminary and general topics, before attempting, in the next three sections, to convey the instructions for manipulating the file

Commencing with the position of the work, it is in all cases desirable that the surface to be filed should be placed horizontally. and the general rule for the height of the work above the ground is that the surface to be filed should be nearly level with the elbow joint of the workman, and which may be considered to range with different individuals from forty to forty five inches from the ground Some latitude is however required in respect to the magnitude of the works as when they are massive, and much is to be filed off from them, it is desirable that the work should be a trifle lower than the elbow, when the work is minute and delicate, it should be somewhat higher, so that the eye may be the better able to add its scrutiny to that of the sense of feeling of the hand upon which principally the successful practice depends The small change of height is also in agree ment with the three diffcient positions of the individual in the act of filing, for instance

Firstly In filing heavy works, or those which require the entire muscular effort, the file varies from about 12 to 24 inches long, and the length of the stroke is from about 10 to 20 inches, or nearly the full length of the file. The operator stands a little distance from his work, with the feet separated about 30 inches which somewhat lowers his stature, he grasps and thrusts the handle of the file with his right hand, and bears for cibly near the end of the file with that part of his left hand which is continguous to his wrist, so as to make the file penetiate the work, or hang to it. The general movement of the person is then an


alternation of the entire frame upon the knee and ankle joints the arms being comparatively fixed to the body, the momentum of which is applied to the file

Secondly In filing works of medium size the file varies from about 6 to 12 inches, and the length of stroke is from about 4 to 9 the operator then stands nearer to the work and quite erect, with his feet closer together. The right hand grasps the file handle as before but the extremity of the file is now held between the thumb and the first two fingers of the left hand, and the general movement is that of the aims, the body being comparatively at rest

Thirdly In filing the smallest works the file is less than 6 inches long and the stroke does not exceed 3 or 4, and some times is not one tenth as much. When the work is fixed, the file is still usually held in both hands as last described, but frequently, in fact more generally, the file is managed with the right hand alone, the forefinger being stretched out as in holding a carving linife and the work is held upon the support or filing block with the left hand, as will be explained. The act of filing is then accomplished by the movement of the elbow, or even of the fingers alone, but so little is the body moved, that the workman is usually seated as at an ordinary table.

It is apparent and also true, that the most direct way of pro ducing a flat surface with the file, would be to select a file the face of which was absolutely flat, and that should be moved in lines absolutely straight, but there are certain interferences that prevent these conditions being carried out First although it is desirable to employ files that are as nearly straight as possible, and that are also fixed straightly in their handles yet very few files possess this exactitude of form and although in the attempt to attain this perfection, some files are planed in the engineer's planing machine before being cut with teeth, still the cutting and the hardening so far invalid ite this practice, that few even of these planed files can retain their perfect straightness, and either both sides become in a small degree irregularly tortuous, or the sides become respectively concave and convex Therefore, as for the sake of argument, it may be almost taken for granted that no files truly possess the intended for m, it is better purposely to adopt that kind of irregularity, which the least interferes with the general use of the instrument

The file, if concave or hollow in respect to its length, in the manner coarsely exaggerated in fig 832, might be used for works of corresponding convexity but it would be impossible to file a flat surface therewith, as the concave file would only

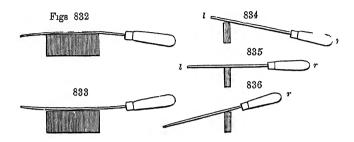

touch the surface at its edges, but the convex side of the same file might, as in fig 833, be made to touch any and every part of the surface if moved in a right line. On this account most files are made thicker and wider in the middle, or with both faces convex, and the error of hardening will then rarely make either side concave but will leave both faces convex, although differently so, and consequently, both sides notwithstanding some irregularity, are usable upon flat works, provided the operator can move them in a right line across the work

In reference to the manipulation of the instrument, it is to be observed that the most natural movements of the hand and arm are in circular lines, the several joints of the limbs being the centers of motion but, as in filing a flat surface, it is needful the hands should move very nearly in right lines, a kind of training becomes necessary

If, however, the file were carried quite straight across a wide surface, the central part of the file would be alone used, but as the continual effort of the individual is to feel that the file lies in exact contact with the surface being filed, the hands imperceptibly depart so much from the exact rectilinear path as to bring all parts of the file from point to heel into use

Again, it might be urged that the file, from being itself in the form of the arc of a large circle, would reduce the work to the counterpart form, or make it hollow in the opposite degree, it is true this is the tendency, and may by dexterity become the result, even on nairow pieces, but the contrary error is more

common, so that the surface of the work becomes rounded instead of concave or plane

If the surface to be filed is four or five inches or more in width the risk of departing from the true figure becomes reduced as the file has then a wide base to rest upon, and the pressure of the hands leadily prevents any material departure from the right position of the file, but the difficulty becomes greatly increased when the surface to be filed is narrow

The file held in the two hands upon the narrow work may be then viewed as a double ended lever, or as a scale beam supported on a propound the variation in distance of the hands from the work or propogrees a disposition to rotate the file upon the work, and which is only counteracted by habit or experience


Assuming, for the moment that in the three diagrams the vertical pressure of the right hand at τ and the left at l to be in all cases able, in fig. 834, or the beginning of the stroke the right hand would from acting at the longer end of the lever become depressed, in fig. 835 or the central position, the hands would be in equilibrium and the file horizontal, and in fig. 836, or the end of the stroke, the left hand would prepon derate, the three positions would inevitably make the work round in place of leaving it plane or flat

It is true the diagrams are extravagant but this rolling action of the file upon the work is in most cases to be observed in the beginner, and those practised in the use of the file have perhaps unconsciously, acquired the habit of pressing down only with the left hand at the commencement, and only with the right hand at the conclusion of every stoke, or negatively that they have learned to avoid swaying down the file at either extreme, and which bad practice will necessarily result, if the operator have not at first a constant watch upon himself, to feel that the file and work are always in true contact, throughout the variable action of the hands upon the instrument

When the work is fixed in the bench or table vice, the file is almost always managed with both hands, as above described, but when the file is held in the one hand only, all the circumstances are altered, except the continued attempt to keep the work and file in accurate juxta position, and to assist in this, the work when so small as to be filed with the one hand only is almost

invariably held on the filing block with the lefthand occasionally through the intervention of a hand vice, as in fig. 858 page 862. In this case the two hands act in concert the right in moving the file, the left in adjusting the position of the work, until the individual is conscious of the agreement in position of the two parts

Sometimes indeed the partial rotation of the work, in order to adopt the work to the file, is especially provided for, so as to compensate for the accidental swiying of the file—such is the case in the various kinds of swing tools, used by watchmakers in filing and polishing small flat works. A similar end is more raiely obtained on a larger scale, when the file is required to be held in both hands. For example, filing boards resembling fig. 837, and upon which the work is placed have been made



to move on two pivots, somewhat as a gun moves on its trunnions, consequently the works when laid upon the swinging board, assume the same angle as that at which the file may at the moment be held

A more common case is to be seen in filing a rectangular more tise, or key way, through a cylindrical spindle, as in fig. 838, the hole is commenced by drilling three or four holes, which are thrown into one by a cross cut chisel, or small round file, and the work, when nearly completed, is suspended between the centers of the lathe, so that it may freely assume the inclination of the file. At other times the cylinder is laid in the interval between the edges of the jaws of the vice, that are opened as much as two thirds the diameter of the object, which then similarly rotates on the supporting edges this mode is shownin fig. 839

These three applications are objectionable in some instances, is the file is left too much at liberty, and the works are liable to be filed hollow instead of flat, especially if the file be rounding because the unstable position of the work prevents the file from being constrained to act on any particular spot that may require to be reduced

Some general remarks will be now given on certain practices in respect to economising the wear of files, and these will be followed by other remarks on the modes of holding works that are to be filed prior to giving in the next sections, the practical instructions upon filing

The exterior surfaces of iron castings are usually more or less impregnated with the sand of the foundry moulds, which is very destructive to the tools, and this is in many cases removed by pickling them with dilute sulphune acid, which dissolves a little of the metal, and undermines and loosens the sand, as explained in vol 1, p 375. Iron castings become moreover superficially hard from coming in contact with the moist sand of the foundry mould, so that a thin but haid skin envelopes the entire object to the depth of the twentieth or thirtieth of an inch, and as this is very injurious to the files, it is usually chipped off with a chisel and hammer, the pickling is then less required

The ordinary chipping chisel is about six or eight inches long, and three fourths of an inch broad on the edge, which is a little convex, that the corners may not be liable to dig into the work The bevils are ground to meet at an angle of about 80 degrees, and the hammer used with the chipping chisel varies from about two to three pounds in weight Before commencing to chip the work it is usual to rub both the face of the hammer and the end of the chisel upon the bench or floor to remove any grease and leave them bright and clean, as were either of them greasy there would be risk of the hammer glancing off and striking the knuckles A blow is first given with the hammer upon the angle of the work, to make a little facet upon which the first chisel cut is made, about the thirtieth of an inch below the general surface of the casting the chisel being then only raised some 30 degrees above the horizontal line In continuing the cuts the chisel is elevated to about 45 degrees, the blows are given in quick suc cession, and the cuts are led gradually over the entire surface, the advance being always upon a line that is convex to the chisel

Provided the casting is moderately flat, the edge of the chiscl is kept at one uniform distance below the general surface of the work which is occasionally examined with the straight edge Should the surface of the casting piesent any lumps or niregularities of surface, a thicker chip or two thin chips are removed

from such high parts, to lessen the subsequent labour of filing, but which process is much less destructive to the file after the hard sand coat has been removed by acid from the iron

In some massive works, and also in cases where large quanti ties have to be chipped off certain parts of castings, much laiger chipping chisels are used, which are called flogging chisels, they commonly exceed one foot in length, and are proportionally stout, one man holds the chisel in both hands sometimes by means of a chisel rod for greater security, whilst another strikes with a light sledge hammer Where much has to be removed, it is also usual to employ cross cutting chisels, these are about seven or eight inches long, a quarter of an inch wide on the edge, and an inch broad in the other direction, the cross cut chisel is first used to cut furrows, half or three quarters of an inch asunder, to the full depth of the parts to be removed, and the intervening ridges are then easily broken off with the ordinary chipping chisel, but since the general employment of the planing machine and others of the engineer's tools, the chipping chisels are scarcely required When non castings are so near to their required dimensions, that chipping would remove too much, they are either cleaned with a nearly worn out file, or the outer coat is removed on the grindstone, means that are much less wasteful of the material

Wrought iron is but seldom pickled previously to being filed but is either cleaned with an old file, or is ground on a stone to remove the outer scale or oxidised surface—the chipping chiscl is only in general required when the nature of the work prevents it from being forged so nearly of the required form as to bring it properly within range of the file

Biass and gun metal are, as already noticed in the first volume, p 375, sometimes pickled but with intic acid instead of the sulphuric acid which is employed for non- and biass is commonly hammered all over to increase its density, unless a minute quantity of tin is added, say a quarter or half an ounce to the pound, which materially stiffens the alloy, so as to render ham mening is unnecessary as it is with good gun metal

After a file has been used for wrought iron or steel, it is less adapted to filing cast iron or brass, which require keen files, therefore to economise the wear of the instrument, it is used for a time on biass or cast non, and when partially worn, it is still available for filing wrought non or steel, whereis, had the file been first used on these harder materials it would have been found comparatively ineffective for biass and cast non

As a further measure of economy the pressure on the file should be always relieved in the back stroke, which otherwise only tends to wear down or break off the tops of the teeth as their formation shows that they can only cut in the ordinary or advancing stroke, the file should, in consequence, be nearly lifted from the work in drawing it back but it is not usual actually to raise the file off the work as it then becomes needful to wait an instant before the next stroke to ensure the true position of the file upon the work being resumed whereas if it is brought back with inconsiderable pressure the file is not injured, and the hand still retains the consciousness of the true contact of the file and work, without which the instrument is used with the less decision and correctness than it otherwise would be

Some workmen smooth the work by the method called draw filing or by drawing the file sideways along the work using it in fact as a spoke shave instead of a file—this certainly has the effect of smoothing the work—because in that position the file can only make slight and closely congregated scratches, but the teeth will not cut in this manner—Another mode sometimes employed is to cuil the work with the file, by describing small cricles with the instrument as in grinding or polishing but neither of these practices employs the file teeth in the mode in which they are legitimately adapted to cut and no great reliance should be placed upon them—When smooth surfaces are required, it is a better and quicker practice, as the work advances towards completion to select files that are gradually finer but always to use them from point to heel

When it is desired to make the smooth files cut wrought non steel, and other fibrous metals very smoothly, the file is used with a little oil to lubric ite the surface, so that it may not penetrate to the same degree as it would if used dry—the oil also lessens the disposition to the scritching and terring up of the particles which should it happen mostly produces a furrow or seratch, especially if the file be printy a circumstance now to be explained, but the oil should not be used on the coarser or preparatory files

The puticles removed from the miterials operated upon, ne

always more or less hable to clog the file but which, particularly when the instrument is dry, are partially removed by giving the edge of the file a moderately smart blow on the chaps of the vice or the edge of the bench but particles of wrought non, steel, and other fibrous metals are pt to pin the file, or to stick in so hard as to require to be picked out with a pointed steel wire, which is run through the furrow in which the pin is situated. The marking point used in setting out works is commonly employed for the purpose


Files are sometimes cleaned with a scratch brush, which is a cylindrical bundle of fine steel or bruss wire bound tightly in its central part, but allowing the ends of the wire to protrude at both extremities as a stiff brush. Occasionally also, a scraper is used, or a long strip of sheet bruss about an inch wide, a small portion of the end of which is turned down at right angles, and thinned with a hammer the thin edge is then drawn forcibly through the oblique furrows of the file, and serves as a rake to remove any particles of metal that lodge therein

But the best and most rapid mode of cleaning the file, is to nail to a piece of wood about two inches wide, a strip of the so called cotton card, which is used in combing the cotton wool pieparatory to spinning the little wire staples of the card that are fixed in the leather constitute a most effective brush, and answer the purpose exceedingly well. Some workmen to lessen the disposition of the file to hold the file dust or become pinny rub it over with chalk, this absorbs any oil or grease that may be on the file and in a considerable degree fulfils the end desired

To remove wood dust from files floats, and lasps, some per sons dip them for a few moments into hot water, and then blush them with a stiff blush the water moistens and swells the wood, thereby loosening it, and the blush entirely removes the particles, the heat given to the file afterwards evaporates the trifling quantity of moisture that remains, so as to avoid the formation of rust. This plan, although effective is neither general nor important.

The principal methods of fixing works, in order to subject them to the action of the file will be now noticed. Many of the massive parts of machinery are so heavy, that gravity alone is sufficient to keep them steady under the action of the file, and for such as these, it is therefore only needed to prop them up in any convenient manner by wedges trestles, or other supports so as to place them conveniently within reach of the operator. But the great majority of works are held in the well known implement, the smith's bench vice, or tail vice, the general form of which is too familiar to require description but the annexed figures represent the front and side views of a less known modification of the same, called a taper vice, which presents some peculiarities, and is occasionally employed by engineers

The typer vice, figs 840 and 841 is made principally of cast iron and to include within itself the base whereon it stands that has at the back two small non trucks or iollers, so that when the vice is supported upon them alone, it may be easily rolled from place to place notwithstanding its weight. The front limb of the vice moves on the joint a, the back on the joint b, so as to

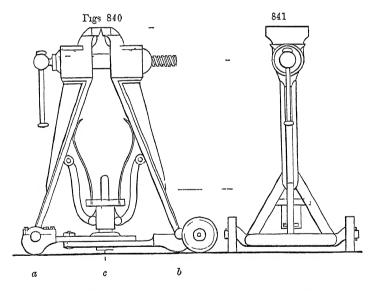

grasp either wide or narrow pieces but it is by this arrangement adapted alone to objects that are parallel, which condition, it is true is more usually required. But in the present apparatus, if the jaws are closed upon a taper object, a form that frequently occurs in steam engines and similar worls the two parts of the vice swivel horizontally on a joint, the axis of which is on the dotted line c so as to place the jaws at an angle corresponding

with that of the work, in fact the lower part or pedestal of the vice is jointed somewhat like the front axletiee of a carriage

Under ordinary circumstances, however, the screw and nut of such a vice would bear very imperfectly upon the moving parts. owing to their obliquity but this objection is met by cutting a spherical recess in the outside of each half of the vice, and making the collar of the screw part of a sphere to constitute a ball and socket joint, and also by making the nut a perforated sphere, adopted to a spherical cavity or seat, but with a feather to prevent it from turning round The two bearings of the screw thus accommodate themselves at the same time, both to the horizontal and vertical obliquities of the jiws To constrain the two parts of the vice to open in an equal degree, there are two links that are jointed to a collar that slides freely on a cylinder, which latter is in fact the continuation of the joint pin c and to the collar are also attached the two springs that open the limbs of the vice when the sciew is relaxed This useful apparatus is well adapted to its particular purpose, such as the larger pieces of steum engines, and similar machinery


The ordinary tril vices or standing vices for heavy engineering and large works sometimes exceed 100 lbs in weight but the average weight of tril vices, for artisans in general is from 40 to 60 lbs, and of those for amateurs, from 25 to 35 lbs

The bench for the vice usually extends throughout the length of the engineers shop or vice loft and is secured against the windows. The tail vice is strongly fixed to the bench at the required height, and the tail that extends downwards is fixed in a cleet nailed to the floor, or against one of the legs of the bench which latter mode is desirable as the vice is then in better condition to resist the blows of the chisel and hammer which give rise to much more violence than the act of filing

Amateurs sometimes employ portable vice benches, having nests of drawers for containing the files and other tools, or the vice is attached to the right hand side of the turning lathe, less frequently the tail vice is attached to the planing bench, but it is then requisite it should admit of ready attachment and detachment to leave the planing-bench at liberty for its ordinary application

Fig 842 represents a very convenient mode of mounting the tuil vice upon a tripod stand of cast iron, which indeed is in

many cases preferable to the wooden benches, as, although small, it is sufficiently heavy to ensure firmness, especially as, from having only three points of support, all are sure to touch the ground. The tripod readily admits of being shifted about to suit the light and also of temporary change of height by lifting

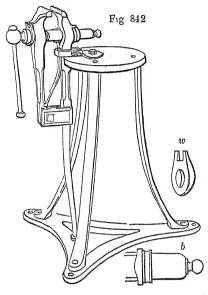


pieces added to the feet when the work is required to be nearer to the eye of the operator. The tripod pedestal serves additionally for the occasional support of a small anvil (when not required for forging) and also for a paring knife fig 8 page 26 Vol I), when an uppropriate wooden cutting block is added to the tripod

The table-vice mostly used by watch makers and similar artizans, resembles that shown in figs 813 and 814. It is attached to the table by a clamp and screw, which are

aimed with teeth to give a secure hold, but it is usual to glue a small piece of wood on the table to receive the teeth, and also to prevent the lodgment of small pieces of the work at that part, and the worl table has also a ledge around it, to prevent the worl or tools from rolling off. It will be also perceived, that the clump is surmounted by a small square projection a used as a stalle or anvil, and that the jaws of the vice have center holes on one or both sides for the employment of small center drills that are too delicate for the breast plate, after the mode described in 1 age 553 of the present volume.

It is in all cases desirable that the jaws of vices should be exactly parallel, both with the edge of the bench and with the ground in order that the position of the work may be instructively linown but the tail vice and bench vice are liable to various objections that arise from their opening on a center, or as a hinge for although the jaws are almost parallel when closed or then mip in preference at the upper edge, when opened widely,

the radial position of the jaws causes the lower edges alone to grasp the work, and as in addition, the front jaw moves in a

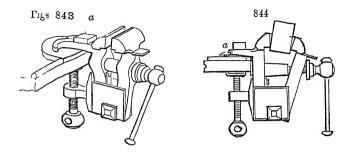


circular arc, a wide object, on being fixed is necessarily thrown out of the horizontal into an inclined position—each of which imperfect conditions is shown in fig. 844

The inclination of the two limbs of the vice, likewise depie ciates the contact of the screw and nut this is sometimes remedied by a modification of the ball and socket already de scribed A more simple mode is the employment of a washer of the form represented at w, fig 842, which is placed beneath the screw the fork embraces the lower extremity of the curved law of the vice, and the washer being thickest in the center rolls so that the flat side always touches the entire surface of the shoulder of the screw and the central and bulged part of the washer touches the limb of the vice and causes the pressure to be nearly central upon the sciew, instead of as in fig 844 against the upper edge of the collar of the screw, which is then liable to be bent and strained I he box or internal screw b fig 842 in which the screw pin works, has also a power of adjustment or hinge like rotation, which ensures, here likewise, centrality of pressure This mode is extremely simple, and worthy of general adoption

The inconveniences common to vices opening radially on a joint pin, are completely removed in those opening on straight slides, these are called parallel vices, because the surfaces of their liws or chaps, and also the bearings of their screws and nuts always retain their parallelism, consequently whether the work be wide or narrow, it is always firmly grasped by the chaps provided the work be itself parallel. One of these vices is represented in fig. 845. The front jiw is forged in continuation of the body of the vice the whole being of a rectingular form and

receiving at its upper parts the extremities of the pinching sciew, which has a semi cylindrical cover to protect it from the file dust. The back or sliding jaw of the parallel vice fits accurately upon the upper surface of the principal bar at a and ilso upon a square bar b, placed above it

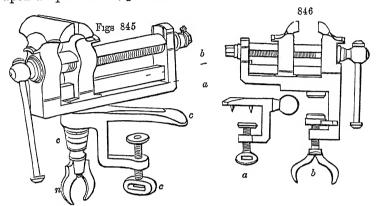


Parallel vices are sometimes attriched to the table or bench, by clamps that only allow them one fixed position, namely, with the jaws parallel with the bench as in the bench vice, fig 843 but more generally the clamp of a parallel vice c c c, fig 815 has a vertical socket or hole, and the principal piece of the vice terminates in a round stem that fits the socket, and has a nut n by which means any horizontal inclination may be given to the jaws they are represented inclined or they may even be placed at right angles to the bench

Some parallel vices are attached to the table by ball and socket joints, as shown detached in fig 846, and various similar schemes have been proposed. The screw clamp is attached to the table by a thumb screw a, and the clamp terminates in a portion of a sphere, the lower part of the vice has two shallow spherical cups adapted to the ball so that by turning the thumb screw b, the ball is grasped between the two cups. It is true this kind of parallel vice may be inclined both horizontally and vertically, and therefore offers much choice of position, but it is too unstable in any to serve for more than very light works which require but a small application of force

The jaws of vices are faced with hardened steel and cutlike files so as to hold securely but works that are nearly finished would

be injured by the indentation of the teeth, and are therefore protected by various kinds of shields or *aree clamps*, as they are generally called, several of these are shown in figs 847 to 857

Vice clamps, such as fig 847, are often made of two detached pieces of stout sheet iron, brass, or copper, of the length of the chaps of the vice and nearly as wide. The two pieces are pinched between the jaws and then bent closely around the shoulders of the vice to mould them to the required form and make them easily retain their positions when the work is removed from between them

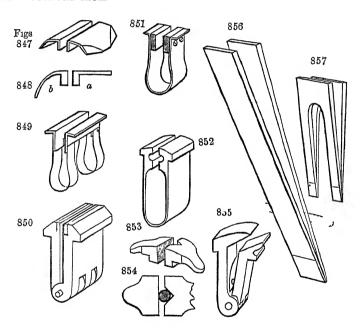

Sometimes sheet lead an eighth of an inch thick is used, but such clamps answer better when cast in the rectangulu form, as in a fig 848 and then bent as at b, the lead should be hardened with a little antimony, to resemble a very soft type metal (Vol I page 277) and, previously to bending the clamps, they should be heated to about 300° to 400° Fahr to avoid fracture. This alloy although harder than lead, is still sufficiently soft to adapt itself to irregularities in the objects held and the clamps being thick, last longer, and more readily admit of being restored to form by the hammer or rasp, than those made of sheet lead

Spring or jointed clamps of the several forms figs 849 to 857, are also made. Fig 849 represents two stout rectangular pieces of metal, united by two springs which pass on the sides of the vice screw, these open to a considerable distance, and from the flexibility of the springs, readily adapt themselves either to thick or thin pieces

The clamp fig 850 is made in two pieces of cast or wrought iron, jointed like a wide door hinge, and with a spring to separate the two parts to a small extent, this clamp has a piece of soft steel or iron attached to each half to make a fine close mouth, suitable to delicate works and thin plates

Fig 851 is a nairow spring clamp made of one piece of steel to which the attached pieces of wood or brass that may be renewed when worn out of shape—the clamp fig 852, is made of one piece of steel, and formed with a crease to hold small writes horizontally—853 and 854 are detached clamps—one plain the other with an angular notch, that serve for holding round and other pieces vertically—852 and 853 are each useful in holding round bars whilst they are being tapped—and not unfrequently their inner edges are cut with file teeth, after which they are hardened and tempered—As shown in fig 855 some of the vice clamps are made with jaws inclined at about 30 degrees to the perpendicular to serve for holding chamfer bars for slides, and various bevilled works, these clamps have the effect of placing the chamfered edge nearly horizontal which latter is the most convenient position for the act of filing

Fig 856 are the long sloping clumps, consisting of two pieces of wood bevilled at their extremities and united by an external strap of sheet iron or steel which is riveted to them, should they fail to spring open sufficiently a stick is thrust between the two pairs as shown by the dotted lines, fig 857 are upright wooden clumps which are forked so that the tails proceed vertically one on each side of the screw of the vice. The sloping wood clamps commonly used by gun malers are made long enough to rest upon the floor, and when the one end of the gun barrel is pinched between them, the other end is supported either by a vertical propicalled a horse, or by a horizontal wooden horse, fixed to the bench at about the same height as the laws of the vice.

Wooden clamps, although of great convenience, are open to a

861

diamback that is sometimes acutely felt, as when small pieces are briskly filed whilst held in wooden clamps, owing to the slow conducting power of the wood the works become so hot as to be inconvenient to be held in the fingers, but which is continually required as it is necessary at short intervals to remove the work from the vice for the purpose of testing, by the straight edge, square or other measuring instruments, the progress made Sometimes the work is grasped between slips of leather or card, that are simply held to the vice by the penetration of its teeth Leather and card are, however partly open to the same objection as wood clamps, from which the metal clamps owing to their superior power of conducting heat are nearly free


A great number of small works are more conveniently filed, whilst they are held with the left hand, the file being then managed exclusively with the right, this enables the artizan more easily to judge of the position of the file. In such cases a piece of wood f fig. 858 called a filing block is fixed in the table or tail vice and square round, and similar pieces, are rested in one of several notches made in the block with a triangular file. If the works are rectangular, or have flat surfaces they are held quite at rest. If they are circular they are continually rotated as will be explained and if they are wide and flat, they are laid on the flat surface of the filing block f, against a ledge or projection represented on the lower side of the block, which is then placed upwards

Pieces that are sufficiently long and bulky are held upon the filing block by the hand unassistedly, but small and short works are more usually fixed in some description of hand vice, and applied in the position shown in fig 858, and the vice being larger than the work, serves as a handle, and affords a better grasp

For works of larger size the hand vices are progressively larger as in 859 and 860, some of them have wooden handles. Almost all the hand vices have fly nuts to be twisted with the fingers but the most powerful, which sometimes weigh as much as about three pounds have square nuts that are fastened by a key or spanner s. Occasionally to ensure a strong grip one ear of the ordinary fly nut is pinched in the tail vice whilst the hand vice is twisted bodily round, but unless due caution is

used, either the vice may be strained, or the screw broken from the great purchase thus obtained

Hand vices he not however, in all cases employed, but small whies and other pieces are also held in a species of phers, fig 861, called pin tongs or shding tongs, which are closed by a ferule that is drawn down the stem. Fig 862 shows another valiety of this kind that has no joint, but springs open by elasticity alone when the ring r is drawn back.

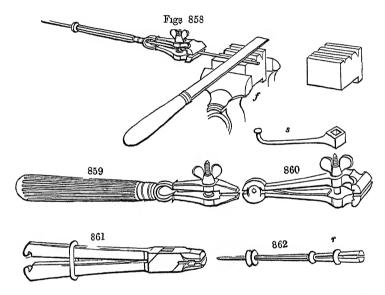

The small pin vice, fig 858, is used by watchmakers in filing up small pins and other cylindrical objects, the jaws are not united by a joint, but are formed in one piece with the stem of the vice the end that constitutes the jaws being divided or forked, the sciew and stem are each perforated throughout, that the ends of long wires may be filed, and the stem is octangular that the pin vice may be readily twisted to and fro between the fingers and thumb of the left hand, whilst the file is reciprocated by the right hand, and in this manner a considerable approach to the cylindrical form is obtained

Independently of the lapid movement of the hand vice to and fro on ts axis, simultaneously with the strokes of the file the two hands being moved together, the hand vice is thrown progressively forward with the fore finger about a quarter of a turn at nearly every alternation, so as to bring all parts of the work alike under the operation of the file. But as it is in this case important that the work should be pinched exactly central in the vice or so that the axis of the work may pass through the axis or central line of the vice, a central angular groove is frequently made in each jaw of the land vice, to give the work, without trial a nearly axial position. This is more usual in the narrow vices, fig. 859, known as dog nose or pig nose hand vices than in those with wide or cross chaps. 858 and 860

Many cucular works that were formerly thus filed are now, from motives of expedition and accuracy, more commonly executed in the turning lather since the great extension in the use of this machine, which has become nearly as general as the vice or the file itself, but frequent occasions still remain in which the hand vice and file are thus employed, and it is curious to see how those accustomed to the rotation of the different kinds of hand vice with the wrist will in this manner reduce a square or inegular piece to the circular section


In the pin tongs, fig 862 besides the facility of tuining the instrument found with the fingers, from the reverse end having a center and pulley the same spring tongs serve conveniently as forceps for holding small drills to be worked with the drill bow and also for other purposes in watch work

Numerous flut works are too large thin and integular in their superficies to admit of being fixed in the various kinds of bench and table vices that have been described and if so fixed, there would be risk of bending such thin pieces by the pressure of the vice applied against the edges of the work consequently, different methods are employed in fixing them

The largest flat works are simply laid on the naked surface of the work bench and temporarily held by half a dozen or more pins or nails driven into the bench. The pins should be as close to the margin is possible, and yet below the surface of the work so as not to interfere with the free application of the file, it is frequently necessary to lift the work out of its temporary bed for its examination with measuring instruments and advantage is taken of these opportunities for sweeping away with a small brush (like a nail brush for the dressing table,) any loose

filings that may have got beneath the work, and prevent it from lying flat

For thin flat works of smaller size, the filing board, fig 863, is a convenient appendage it measures six or eight inches square, and has a stout rib on the under side, by which it is fixed in the vice. Such thin works are required to be frequently corrected with the hammer and also to be turned over in order that their opposite sides may be alternately filed, so as to follow and compensate for, the continual changes they undergo in the act of being filed. In some instances the work is held down with one or more screw clamps or hand vices as represented this is need full when pins would bruise the margins of nearly finished works and a card or a few thicknesses of paper are then interposed to protect the object from the teeth of the vice

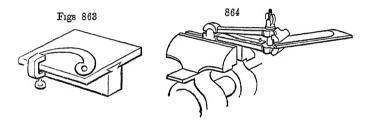

In filing thin flat works, such as the thin handles or scales of penknives and lazors, and the thin steel plates used in pocket knives, the Sheffield cutlers generally resort to the contrivance represented in fig 864 and known as a flatting vice. A hand vice is fixed in the ordinary tail vice or table vice by the one jiw with the screw uppermost, so that the jaws of the hand vice are horizontal. The thin scale to be filed is then placed on a flat piece of metal not less than a quarter of an inch thick, and the two are pinched together by the one corner so that all the remaining surface may be free to the action of the files, and the work is readily shifted about to allow all parts to be successively operated upon. The facility of changing the position is particularly useful in working on pieces of tortoiseshell buckhorn and other materials of irregular form and thickness, to which the filing boards with pins or clamps would less conveniently apply

As before observed, the one face of the small filing block f, fig 858, is also used for very small thin works, and which are

prevented slipping from the file by the wooden ledge, or by pins driven in In many instances, also thin works are held upon a piece of cork, such as the bung for a large cask, beneath which is glued a square piece of wood, that the cork may be held in the vice without being compressed. The elasticity of the cork allows the work to become somewhat embedded by the piessure of the file between which and the surface friction, it is sufficiently secured for the purpose without pins.

STOT IV —INSTRUCTIONS FOR FILING A FLAT SURFACE UNDER THE GUIDANCE OF THE STRAIGHT EDGE, AND OF THE TRIAL PLATE, OR PLANOMETER

In following out the subject of the instructions for the use of the file, it is proposed, first to explain that which may be called the manual process of producing a true or plane surface on a piece of cast iron of moderate dimensions say four or five inches wide and eight or ten inches long and although the entire routine is only required for surfaces of the most exact and finished kind, the same general treatment when discontinued at certain stages, is equally suited to various other works in me chanism that only demand by comparison an inferior degree of precision—the routine is also nearly the same for surfaces larger or smaller than that referred to

Before any effective progress can be in ide in filing flat works, the operator must be provided with the means of testing the progressive advance of the work, he should therefore possess a true straight edge, and a true surface plate. The straight edges used by smiths are generally of steel and although they have sometimes a nearly reute edge at its much more usual to give them moderate width thus in steel straight edges from one to four feet in length, the width of the edge is from one sixteenth to one fourth of an inch and in east non-straight edges from six to mine feet in length, the width is usually two to three inches

The straight edge is used for trying the surface that is under correction, along its four margins, across its two diagonals, and at vurious intermediate parts which respective lines, if all exact, denote the surface to be correct, but the straight edge alone is a tedrous and scarcely sufficient test, and when great accuracy is desired, it is ilmost importance to have at least one very exact

plane metallic surface, or surface plate (the plano metre of the French,) by which the general condition of the surface under formation may be more quickly and accurately tested at one operation and to avoid confusion of terms, it is proposed in all cases when speaking of the instrument to employ the French appellation plano metre or rather prenometer, which is exact and distinctive

The flat piece of cast non, intended to be operated upon, having been chipped all over, as described in page 850 a coarse hand file of as large dimensions as the operator can safely mange is selected, and in the commencement the rough edges or indges left by the chipping chisel are levelled those parts how ever being principally filed that appear from the straight edge to be too high

The strokes of the file are directed sometimes squire across as on a fixed line, or obliquely in both directions alternately other times the file is traversed a little to the right or left during the stroke, so as to make it apply to a portion of the work exceeding the width of the file These changes in the applica tions of the file are almost constantly given, in order that the various positions may cross each other in all possible directions and prevent the formation of partial hollows. The work is tried at short intervals with the strught edge and the eye directed on a level with the work to be tested readily perceives the points that are most prominent After the rough errors have been putially removed, the work is taken from the vice, and struck edgeways upon the bench to shake off any loose filings, and it is then inveited on the plinometer which should be fully as large or larger than the work As however, it cannot be told by the eye which points of the work touch the planometer, this instru ment is coated all over with some colouring matter such as pul verised red chalk mixed with a little oil, and then the touching places become coloured

In all probability the work will at first assimilate so imper feetly with the planometer, that it will only rest thereon at its two highest points, most likely at the two corners of the one diagonal and when pressure is applied at the two other corners alternately, the work will probably ride or rock on the two points of temporary support. The work is slightly rubbed on the surface plate and then picks up at its highest points some of the

red matter it is refixed in the vice and the file is principally used in the vicinity of the coloured parts with the occasional test of the straight edge, and after a short period the work is again tried on the planometer

Should the same two points still become reddened, they are further reduced with the file but it is probable the work may be found to rest upon larger portions of its surface, or upon three or four points instead of two only and if so all the marked places are reduced in a small degree before the suc ceeding trial. This process is continually repeated and if watchfully performed, it will be found that the points of contact will become gradually increased say from two to four, to six or eight, then to a dozen or more and so on

In this, or rather an earlier stage of the work, the smith's plane for metal is often advantageously used in connection with the file. The general structure of the plane is shown by the figure and description on page 183, and it is employed much after the manner of the joiner's plane, but it may be used at pleasure lengthways, crossways, or diagonally, without any interference from grain or fibre as in wood work. The grooved or roughing out cutter is employed in the commencement because it more readily penetrates the work and a few strokes are given to crop off the highest points of the surface, the furrows made by the seriated cutter are then nearly removed with the file, which acts more expeditiously although less exactly than the plane, and in this manner the grooved plane iron and the coarse file are alternately used. In the absence of the planometer, the metal plane assumes a greatly increased degree of importance.

As the work becomes gradually nearer to truth the grooved cutter is exchanged for that with a continuous or smooth edge, a second cut or bastard hand file, is also selected, and the same alternation of planing and filing is persevered in, the plane serving as it were to direct the file, until it is found that the plane non acts too vigorously, as it is scarcely satisfied with merely ser uping over the surface of the east iron but when it acts it removes a shaving having a nearly measurable thickness, and therefore, although the hand plane may not injure the general truth of the surface at will prevent the work from being so delicately acted upon, as the continuance of the process now demands,

a smoother hand file is consequently alone employed in furthering the work

If the piece of cast non should have been turned in the lathe, or planed in the planing machine, instead of having been wrought entirely with the chipping chisel, plane and file, the former instructions would be uncalled for, as the remaining steps alone would remain to be followed. Unless, indeed, the work had been so imperfectly fixed as to have been strained, and thence become distorted, on being released from the machine on the latter supposition the grosser errors would probably require correction with the bastard file, before the smooth file could be judiciously used

The necessity of the convex form of the file will now be ren dered most striking as were the file absolutely flat on its face, it would be scarcely possible to reduce with it any small and isolated spot that might become coated with the red chalk from off the planometer, but as the file is a little rounded any precise spot on the work may be acted upon, as the end of the file may be pressed with the fingers of the left hand on the exact spot to be reduced, whilst the remainder of the file is held just out of contact with the rest of the surface

When, however, the points of bearing become numerous, the file cannot even thus be managed with sufficient discrimination, and notwithstanding the best efforts it will act on too large a part and thereby lengthen or it might be said altogether to prevent the complete correction of the work, because the file is not sufficiently under control. Before the file has assumed this questionable tendency, it is politic and usual as a measure of economy to discontinue the use of the file and to prosecute the work with a scriper which having a sharp edge instead of a broad and abrading surface, may be made to act with far more decision on any, even the most minute spot or point. A worn out triangular file, ground at the end on all the faces, so as to make thin keen edges, is generally used as the scraper this should be keenly sharpened on an oil stone, so as to act without requiring much pressure, which would only fill the work with strike or utters

The continual reduction of all the points which we sufficiently prominent to pick up the colouring matter from the planometer, is now persevered in with the scraper instead of the file, and pre

cisely in the same manner except as regards the change of the tool, and if the process have been carefully performed through out it will be found at the conclusion that if the work and plano meter are both wiped clean and rubbed hard together, that the high points of the work will be somewhat burnished, giving to the work a finely mottled character

In producing metallic surfaces the constant effort should be to reduce all the high places with as much expedition as circum stances will admit but avoiding, on the other hand, that energetic use of the tool which may too hastily after the condition of the surface and in expunging the known errors, induce others equal in degree but differently situated. Throughout the work attempt should be made to keep the points of bearing whether few or many, as nearly equidistant as may be, instead of allowing them to become grouped together in large patches.

In respect to the tools there should be a gradual diminution in their cutting powers and also of the vigour with which they are used as although energy is wise at the commencement of the work, it should gradually subside into watchfulness and caution towards the conclusion. The periods of alternation between the hand plane and the file and also the times when these are successively rejected in favour of the scraper as the finishing tool must be in great measure left to the judgment of the operator

There should be a frequent examination of the work by means of the straight edge and planometer, which latter should at all times be evenly tinted with the colour. At the commencement it is necessary the coating of red stuff on the planometer should be moderately abundant so as to mark even those places which are minutely distant, but with the continued application of the work, the colouring matter will be gradually removed from the planometer, and which is desirable as towards the conclusion the quantity of red should be small, so as but funtly to mark the summits of each little eminence, the number and equality of which are dependent on the perfection of the planometer, and the steady persevering watchfulness of the operator

It is not to be supposed that it is in every case needful to proceed in the careful and progressive mode just described, as the parts of different works require widely different degrees of

perfection as to flatness For instance, in many it is only neces sary they should be clean and bright and have the semblance of flatness, with such even the straight edge is little if at all used as a test. Those surfaces by which the stationary parts of framings are attached, require a moderate degree of accuracy, such as may be comparable with the perfection in the hewn stones of a bridge or other massive edifice, which require to be flat in order that they may bear fairly against each other as without a certain degree of truth the stone might break from the unequal strain to which it would be exposed

The flat parts of metallic works, if similarly imperfect, would bend and perhaps distort the remainder but although it is of great importance that bearing surfaces should be out of winding or not twisted, it is by no means important that such bearing surfaces should be continuous, as a few equally scattered bearing points frequently suffice Thus it was the common practice before the general introduction of the engineers planing machine, to make fillets or chipping places wound the margins of the bearing surfaces of castings which fillets alone were conjected with the chisel and coarse file for the juxtaposition of the larger pieces or frame work of michines, the intermediate spaces being left depressed and out of contact This mode sufficed, provided the pressure of the screw bolts could not, by collapsing the hollow places distort the castings, with which view chipping places were also generally left around the bolt holes of the work, this method greatly reduced the labour of getting up such works by hand but fillets and chipping places are now in a great measure abandoned Smaller and more delicate works, requiring somewhat greater accuracy than those just described are left from smoother files but in most cases without the necessity of scraping but the rectilinear slides and moving parts of accu inte muchinery, and the trial or surface plates of the mechi meran require beyond all other works the most dexterous use of the file and other means from which it is again repeated grinding should be entirely excluded

Until very recently when the points of bearing had been so multiplied by the file and scraper as not to exceed about half an inch in average distance, and that a still higher degree of accuracy was desired, it was the ordinary practice to attempt the

obliteration of these minute errors by the method of grinding Supposing only one piece or surface to have been required it then became necessary to grind the work upon the planometer itself but to avoid the necessity of so injurious a practice, it was usual when practicable, to make three similar pieces at one time, in order that, when all three had been separately filed and scraped to agree pretty nearly with the straight edge and plano meter the three pieces might then be mutually employed in the correction of one another, by grinding the faces successively together with emercy powder and water

The one piece was laid down horizontilly, wetted all over with water and then stiewed with emery powder, after which, one of the other surfaces was inverted upon it, and rubbed about in various with longitudinal, lateral, and curling or circular strokes on the supposition that as the two pieces came into contact respectively at their highest points, these highest points became mutually abraded with a tendency to reduce them to the general level. After a short period, the top surface was removed fresh emery and water were applied, and the third surface was rubbed upon the first, after which, all three were variously interchanged, by placing every one in succession as the lower surface, and rubbing the two others upon the lower until it was considered from the uniform but deceptive grey tint, thus produced, that the circus in all were expunged, and that the three surfaces were all true

It is, however, considered quite unnecessary to enter more into detail on a process that may be considered to be nearly obsolete, as regards the production of plane metallic surfaces, especially as at a future part of this Volume, the practice of grinding will be noticed in reference to surfaces requiring inferior exactness and consisting of materials that do not admit of the employment of the file and seruper

That two surfaces which are very nearly accurate if ground together for a very short time, do in some degree correct each other is true, but it has been long and well known that a continuance of the grinding is very dangerous, and apt to lead the one surface to become convex, and the other concave in a nearly equal degree, and on this account three pieces were usually operated upon that the third might act as in umpire, as although two pieces possessing exactly opposite circus may appear quite

to agree, the third cannot agree with each of these two, until they have all been made alike and quite plane surfaces

But the entire process of grinding although apparently good is so fraught with uncertainty, that accurate mechanicians have long agreed that the less grinding that is employed on rectilinear works the better, and Mr Whitworth has recently shown in the most satisfactory manner,* that in such works grinding is entirely unnecessary and may with the greatest advantage be dispensed with as the further prosecution of the scraping process is quite sufficient to lead to the limit of attainable accuracy, the only condition being that the mode of continually referring the work to the planometer and scraping down the points sufficiently high to be coloured, should be steadily persevered in, until the completion of the process and worls thus treated assume a much higher degree of excellence than is attainable by grinding

Mi Whitworth stated a further and equally important advantage to result from the discontinuance of grinding as regards the slides and moving parts of machinery. Some of the grinding powder is always absorbed in the poies of the metal, by which the metallic surfaces are converted into species of laps, so that the slides and works carry with them the sources of their depreciation and even destruction. The author's previous experience had so fully prepared him for admission of the soundness of these views, that in his own workshop he immediately adopted the suggestion of accomplishing all accurate rectilines it works by the continuance of scraping, to the entire exclusion of grinding

SECT V —INSTRUCTIONS FOR ORIGINATING STRAIGHT EDGES AND TRIAL PLATES OR PLANOMETERS

The remarks hitherto offered on producing a flut surface were based upon the supposition that the operator is in possession of a good straight edge and a good surface or planometer, and which is usual under ordinary circumstances, but it may be considered necessary that the more difficult case should be placed before the reader, of originating the planometer itself, by which alone can be render himself independent of external assistance the previous observations will greatly abridge the description

^{*} In a Paper read before the British Association for the Adv incoment of Science Glasgow 1840

First, to originate a straight edge—In origin iting a straight edge it is judicious to piepare the ground, so far as possible. with the means possessed by every joiner, and accordingly three pieces of hard straight grained mahogany should be first planed as straight as possible with the joiner's plane Calling the three pieces for distinction A B and C when they are com pared, A and B may appear to agree everywhere even when one of them is changed end for end this shows A and B to be either both strught or else the one concave, the other convex but C may be unlike either of them C is then adjusted also to A and will therefore become a duplicate of B but when the duplicates B and C are compared it may be found that they touch in the middle, and admit light between them at the ends, showing each The central parts both of B and C, which are to be convex erroneous in the same direction, are then each reduced in a nearly equal degree, until in fact the transmission of light is prevented throughout their length, even when they are reversed and by which the condition of each will be somewhat improved

Next to ascertain whether B and C, when thus improved, are each pretty near to the truth. The third or A, is fitted to B, making A and B as nearly as may be, counterparts of one another, and if A, when thus altered, should also agree with the third or C all are true, but this can scarcely yet be strictly the case. And the routine is therefore continually repeated of reducing in an equal degree the two which may show evidence of being nearly alike, (either both convex or both concave,) and then by fitting the third to one of the corrected two, as a test by which to try if they not alone agree with each other but like wise agree with the third, or the test, as the work can only be perfect when all three admit of being compared without any want of contact being observable in any of the three comparisons

If the trying plane is carefully manipulated, the three pieces will, in three or four repetitions of the series of operations become as nearly accurate as the nature of the tools and of the method will admit, and then, either the best of the three wooden straight edges or all three of them, may be used as the preliminary test in making the steel straight edges *

^{*} The more common practice of the joiner is to operate upon only two pieces each of which is first planed until they agree together when placed edge to edge in the ordinary manner, or in one plane. The two pieces are now placed side by side

Sometimes the metal straight edges are wide strips cut off from a sheet of steel of hard quality, if forged from a bar of steel, the hammering should be continued until the metal is quite cold to render it haid and elastic, and in some instances the straight edge, when partly finished, is hardened and tempered before its edges are completed In all cases if the one edge is to be chamfered, this should be done in an early stage, as it is very apt to throw the work crooked and the sides are always filed, or otherwise finished, before any great progress is made in correcting the edges When three straight edges are made at one time, the three are generally united by temporary pins through their ends to make one thick bar, and are then corrected in the mass as the first stage

The work having been thus far prepared, the wooden straight edge is rubbed with a dry lump of red chalk, that it may leave evidence of the points of contact A coarse file is first used, and it may for a time be assisted by the hand plane, the size and length of the file are gradually decreased, and after a time it will be found that the wooden straight edge is no longer suffi ciently delicate to afford the required test When all three of the steel straight edges have been brought collectively to a state of approximate truth, they are separated and wrought the one from the other, precisely in the same order that was described in reference to the wooden straight edges but as on the steel a very small and smooth file may be used the process of correction may be carried with the file much higher upon steel straight edges, than upon metallic surfaces In addition to the mode of examining straight edges by the transmission of light they are also compared by laying them two at a time upon a true bench or surface and rubbing them together without colouring in itter the high places will then mutually rub each other sufficiently to

and their edges are placed in agreement at the extremities so that the fingers passed transversely across their ends cannot feel any want of continuity of surface in other words cannot feel the joint. If whilst thus placed the joint is also in appreciable to the sense of touch at various intermediate parts of the length of both pieces the work is correct and the two are straight


From the very precise action of the trying plane the wooden straight edge may perhaps be equally well produced by the methods requiring either two or three to be made but the method of making three at once is given in the text because it is always followed in metal works in consequence of the different nature of the working tools and of the abstract superiority of the method

leave a small degree of brightness, that may be easily observed on a careful scrutiny, and as both edges of every straight edge are commonly wrought, the investigation becomes amplified and improved from there being six comparisons instead of three

A little grinding is sometimes resorted to in completing steel straight edges—it is less objectionable with steel than with cast iron and other metals which are softer and also more porous than steel but the process of grinding being very difficult of control is not desirable, and as very small files may be used and with nice discrimination in correcting straight edges, the scraper although useful here likewise, does not present the same importance as in correcting wide surfaces or planometers

Secondly, to originate a surface plate or planometer —This process requires that the operator should be in possession of at least one very good straight edge, one of a series of three that have been accurately tested in the manner just described. The present case also demands like the last, that three pieces should be operated upon, in order that the same correctional method may be brought into effect

The planometer should be a plate of hard cast iron having ribs at the back to prevent its bending either from its own weight, or from taking an unequal bearing on the bench or other support Generally a deep rib extends around the four magins of the planometer and one two or more intermediate and shallower ribs are added, which divide the back into rectangular compart ments, as in fig. 865, this planometer would rest upon the bench around its edges, or on four prominent points at the corners represented black. It has been recently proposed by Mi Whit



worth, that the 11bs should be placed obliquely and made to converge to three points of bearing, as in fig 866, which is a much better plan as the planometer is then at all times supported on precisely the same points notwithstanding the inequality of the bench which can scarcely be the case when four feet are used

The handles are added at the ends, that the planometer may be readily inverted, in order that it may be applied upon such heavy works as it would be inconvenient to lift, and then immediately replaced on its feet when returned to the work bench

In the absence of the planing machine, the three castings for the planometers would be chipped all over and roughly filed, and in this case the smith's plane for metal would render most important service for a considerable period. A good wooden straight edge is now convenient as when rubbed with red chilk it denotes the high places very effectively, and should be applied at various parts of the length and width, and also obliquely and indeed a small thick block of beech wood or mahogany, planed very flat as a surface and rubbed with chalk, will serve to hasten the process of obliterating the coarser errors

In due time, the plane, the coarse file, and the wooden straight edge would all be laid aside, and the work would be prosecuted with a smoother file, under the direction of a met il straight edge, and which if coloured must be also greased to make the red matter adhere. This part of the work may be carried to no mean degree of perfection, as a very correct judg ment of a plane surface can be obtained from a good straight edge applied in all directions as the eye readily measures the comparative width of the line of light transmitted, and the fingers also appreciate, when the straight edge is slightly rotated or rubbed sideways which points of the work are the highest, and give rise to most friction

One surface which may be called A having been corrected very carefully with the file and straight edge, may be now smeared with red stuff and oil and employed to hasten the correction of the second piece or B and the third of C until these two are about as near to truth as the first, or A the three are afterwards mutually operated upon under the guidance of colouring matter. At this stage of the work it will soon become necessary to discard the file in favour of the scraping tool, in using which it will be found very convenient to remove by a paper screen the glare of the bright metallic surface, so as to enable the little patches of colour to be more readily observed. The screen, fig. 867, consists of a small frame of wood eight to ten inches square, covered with writing paper, and attached to a small board, the paper is inclined some tende grees towards the

operator, and at night a short piece of candle is placed in the center of the board or pedestal as shown

The three plates having been, as before observed brought into nearly the same preparatory state it is to be now judged of by the straight edge whether all three are nearly alike or lean to the same kind of error Thus supposing the pieces A and B to have a tolerably equal disposition to convexity or that when placed in contact they rest in the center but fail to touch around the maigin, then A and B are each a little reduced in the middle until the tendency to rotate in the center is gone. A and B will be then each a shade nearer to truth than before The third piece or C, is fitted to A, after which, supposing for a moment A and B to be each a true, or a plane surface, C would become also a plane surface, and the task would be then completed Perfection is not, however nearly so easy of attainment, and it is almost certain that although A and B may be counterparts, they will not be planes presuming therefore that C has been fitted to A, it is almost certain that C will not fit B (This may be called routine One)

Considering therefore that now A and C are the two most nearly alike, or that both we proved to be convex these we the two upon which an equal amount of correction is this time attempted until they become counterparts or fit well together and the third piece, or B, becomes the arbiter in this stage of the work. (This may be called routine Iwo)

We will lastly assume that B, when altered until it fits C, does not quite fit to A, but that B and C present an equal departure from truth and are still both convex, then B and C are altered in an equal degree until they appear to be perfect counterparts and this time A, when fitted to one of them, shows whether the whole three are planes or that two of the pieces are convex and one concave (This may be called routine Three)

The method of comparison will probably be rendered somewhat more evident by the following tabular view of the processes

	Routine One	Routine Two	Routine Three
A	P Counterparts	A C Counterparts	B C Counterparts
	C Arbiter	B Arbiter	A Arbiter

The inspection of the letters in three routines will further show, that every one of the three surfaces admits of comparison with the two others, and that the abstract method is to fit together

those two which appear to have the same error, by altering those two in an equal degree, after which, the third piece when fitted to one of the other two pieces, incontestably proves whether all three are planes—as this cannot be the case until all three agree together in every comparison—The attainment of true planes will be found to require several repetitions of the three routines, but towards the conclusion increasing care will be continually required in order that no degeneration may insidiously occur, to disappoint the hope of the progress towards perfection being steadily on the increase

This correctional process, which is precisely analogous to the mutual correction of three straight edges is somewhat familiar to mechanicians but the process is obviously very much more tedious than the origination of straight edges on account of the gleat increase of the surface to be operated upon, and the circumstance that the quantity taken in excess from any part, must be amended by reducing every other part of that surface in an equal degree

For the sake of simplicity it has been supposed throughout the description that the two convex pieces were in each case selected for correction but this is immaterial, as the result would be the same if the two concave pieces were wrought or the one and other pair alternately, as circumstances may accidentally suggest


The three planometers having been made as perfect as the skill and patience of the operator will admit, one of them should be carefully laid aside and only used in the most guarded manner in the reproduction of other planometers, or the correction of those in general use which latter process will be found occasionally requisite but the less frequently so if the instrument is equally worn by rubbing the work to be examined at all parts of the planometer, instead of upon the central part alone. And a true surface or standard having been once obtained it should be most scrupulously preserved, as it will be found very considerably less troublesome to copy a good standard, than to originate the three standards themselves from which the one is to be reserved.

SLCT VI —INSTRUCTIONS FOR FILING RECTILINLAR WORKS IN WHICH SEVERAL OR ALL OF THL SUPLRFICILS HAVE TO BE WROUGHT

The former instructions have been restricted to the supposition that only one of the superficies of the work was required to be

made plane or flat, but it frequently happens in rectangular works, such as the piece A B C, fig 868, that all six surfaces, namely, the top and bottom A, a the two sides B b and the two ends C, c all require to be corrected and made in rectangular arrangement (the surfaces a, b c being necessarily concealed from view), and therefore some particulars of the ordinary method of producing these six surfaces will be added and the former remarks on pages 500 to 503 on squaring thick and thin works in wood may be also consulted

The general rule is first to file up the two largest and principal faces A and a, and afterwards the smaller faces or edges B b, and

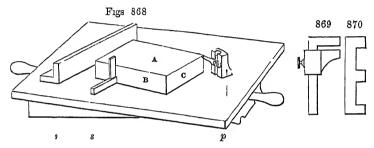

C c The principal faces A a especially when the pieces are thin must be proceeded with for a period simultineously, because of the highlity of all materials to spring and alter in their form with the progressive removal of their substance, and on this account the work, whether thick or thin, is frequently prepared to a certain stage it every part, before the final correction is attempted of any one part

The straight edge and surface plate are required, to prove that each of the faces A and a is a plane surface, and the callipers or a similar gage is also needful to prove them to be in parallelism Callipers unless provided with set screws, are very hable to be accidentally shifted and it is needful to use them with caution, otherwise their elasticity arising from the length of their logs, is apt to deceive. There are gages such as fig. 869 with short puallel paws that open as on a slide, and are fixed by a side screw, and a still more simple and very safe plan, is to file two rectingular notches in a piece of sheet iron or steel as in fig. 870, the one notch exactly of the finished thickness the work is required to possess the other white larger to serve as the coarse or picliminary gage.

Sometimes the one face of the work, or A, having been filed moderately flat a line is scored around the four sides of the work with a metal marking gage, the same in principle as the marking gage of the joiner, fig 342 page 487. At other times the conjected face A is laid on a planometer larger than the work, is represented, (neglecting the inversion,) and the marginal line is scribed on the four edges by a scribing point p fig 868 projecting from the sides of a little metal pedestal that bears truly on the surface plate

Chamfers or bevelled edges are then filed around the four edges of the face a exactly to terminate on the scribed lines the central part of a can be reduced with but little watchfulness, until the marginal chamfers are nearly obliterated. This saves much of the time that would be otherwise required for investigating the progress made buttowards the last, the callipers and planometer must be carefully and continually used, to assist in rendering A and a, at the same time parallel and plane surfaces

The two puncipal edges, B b are then filed under the guidance of a square, the one aim of the square is applied on A or a at pleasure as in joinery work, or if the square have a thick back, it may be placed on the planometer, as at s, fig. 868 if preferred, the work may be supported on its edge B upon the planometer, and the back square also applied, as at s in which case the entire length of the blade of the square comes into operation, and the irregularities of the plane B, are at the same time rendered obvious by the planometer

Another very convenient test has been recommended for this part of the work—namely a stout bar such as r, fig 868, the two neighbouring sides of which have been made quite flut and also square with each other. When the work and trial bar (or rectangulometer) are both laid down, the one side of the bar presents a truly perpendicular face, which may by the intervention of colouring matter, be made to record on the work itself the points in which B differs from a rectangular and vertical plane *


When the edge B has been rendered plane and square, the opposite edge b, may in its turn be marked either with the gage or scribing point at pleasure, the four edges of b may be then chamfered and the entire surface of b is afterwards corrected (as in producing the second face a) under the guidance

^{*} See Smith's Panorama of Science vol 1 page 30

of the square, callipers nectangular bar, and surface plate, or some of these tests

The ends C c now claim attention and the marginal line is scribed around these by the aid of the back square alone but the general method so closely resembles that just described as not to call for additional particulars

Should one edge of the worl be inclined, or bevelled, as in the three following figures, in which the works are shaded to distinguish them from the tools the rectangular parts are always first wrought, and then the bevelled edges, the angles being denoted by a bevel instead of a square either with a bevel having a moveable blade, as in fig. 871 or by a bevelled templet made of sheet metal as in figs. 872 or 873, which latter cannot get

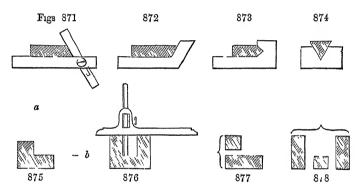

misadjusted The bevelled edge of the work, is also applied if possible on the planometer in fact the planometer and bevel are conjointly used as the tests Bevelled works are either held in the vice by aid of the chainfer clamps fig 855 page 859 or they are lud in wooden troughs, with grooves so inclined, that the edge to be filed is placed horizontally. Triangular bars of equilateral section are thus filed in troughs, the sides of which meet at an angle of 60 degrees, as in fig 874


The succeeding examples of works with many plane surfaces are objects with rebates and grooves as represented in figs 875 to 878. Precess of the sections 875, and 876, supposing them to be short would in general be formed in the solid, either from forgings or castings, as the case might be, the four exterior and more accessible faces would be filed up square and true, and afterwards the interior faces, with a due regard to their

parallelism with the neighbouring parts, just after the mode already set forth. The safe edge of the file is now indispensible as in filing the face b the safe edge of the file is allowed to tub against the face a of the work and which therefore serves for its guidance and in filing the face a the side b becomes the guide for the file. The groove in fig. 876 requires a safe edge square file.

When however pieces of these sections but of greater lengths, have to be produced by means of the file alone it is more usual to make them in two or three pieces respectively as shown detached in figs 877 and 878, and which pieces are first rendered parallel on their several edges and are then united by screws and steady pins, or rather, they are united before being actually finished, in order that any little distortion or displace ment occurring in fixing them together may admit of correction

In works of these kinds which have rebates, grooves, internal angles, or cavities, the square, with a sliding blade, shown in fig 876, is very useful, as the blade serves as a gage for depth bosides acting as a square the one aim of which may be made of the precise measure of the edge to be tried. This instrument is often called a turning square as it is particularly useful for measuring the depth of boxes, and other hollowed works turned in the lathe

In making straight mortises, as at s s, fig 879, unless the groove is roughly formed, at the forge or in the foundry, it is usual to drill holes nearly as large as the width of the mortise, and

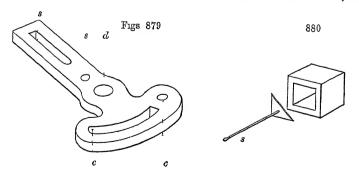

in a straight line, the holes are then thrown into one another by a round file, or a cross cutting chisel, and the sides of the mortise are afterwards filed square and true

For a circular mortise c c, the mode is just the same, with the exception that the holes are made on a circular line and that, instead of a flat file being used throughout, a half round or a crossing file is used for the concave side of the mortise


Short rectangular mortises or those which may be rather considered to be square holes as in fig. 880 would if large be prepared by forging or casting the material into the form, and then the six exterior faces having been corrected, the aperture would be filed on all sides under guidance of some of the various tests before referred to. And in such a case it is convenient to employ a small square s in the form of a right angled triangle to which is attached a wire that may serve as a handle, whereby the square may be applied at any part within the mortise without the sight of the workman being intercepted by his own fingers. Some times also a cubical block filed truly on four of its faces to the exact dimensions of the aperture, is used as a measure of the parallelism and flatness of the four interior faces.

These miscellineous examples of filed works with plane surfaces will be concluded by others of somewhat frequent occurrence and in which different tools are judiciously employed in conjunction with files. The method first to be described as one that is considerably used in thick pieces of metal, for making holes differing from the circular form such as square hexagonal triangular elliptical and other holes by first drilling a round hole and then enlarging and changing the section of the circular hole by a taper punch, better known as a drift, which tool is made of steel, and exactly of the same section as that required in the hole, the drift is hardened and tempered before use

The drift for a taper square hole is made as in fig. 881, or simply as a square pyramid, considerably longer than the hole required a round hole is first drilled in the work, just large enough to admit the small end of the drift which is then driven in its angles indent and force out the metal, making it first like the mignified line m and ultimately exactly square, unless by mistake the hole were drilled too large, when the circular parts would not be quite obliterated. If admissible the endlong blows on the drift are immigled with a few blows on the sides of the work, as it b or parallel with the sides of the drift, which cause the metal to idupt itself more readily to the tool. The drift must not however be used too violently, for as it acts as a

wedge it may burst open the work and which latter is therefore mostly left strong and rough before being drifted and generally, when the angles have been somewhat indented, they are partly iled out and completed by the alternate employment of the file and drift, the marks made by the latter serving continually to indicate the parts to be removed with the file

Taper square holes such as those in the chucks for drills, are nade with some facility The chuck is first drilled on its own nandiel and the drift is put in the four different ways in suc ession, that the errors incidental to its form may be scattered and lost, the chuck is also placed on the mandiel at intervals, with the drift in its place, that the drift may show as it i evolves, whether or not the hole is concentific. When it is required hat the drifted hole should be parallel instead of taper the drift s made as in fig 882 that is, parallel for a short portion in the niddle of its length, and the extremities alone are tapered so as o make the tool smaller at each end the work is theirefore first ridually enlarged to admit the largest part of the drift and the arallel part is then driven through the work and renders the nner surface of the same a true counterpart of the drift of proper are have been taken In some few cases, the sides of the drifts

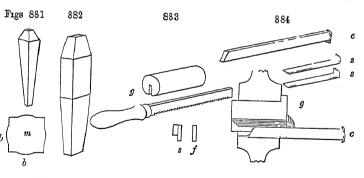

e notched with a file, so as to act as teeth but this is not eneral

When drifts are used the process of working is often ieversed, the interior surfaces are completed before the exterior. The ples are first drifted whilst the work is larger than its intended ze, and afterwards the exterior part is filed or turned, as the se may be, from the hole, that is the hole (sometimes filled with e drift,) is made the basis of the measurement of the exterior

portions of the work Frequently as in a squire washer the drift itself, or else a square arbor of similar form, with a center hole at each end, is made to serve as the chuck by which the work is placed in the turning lathe for completion

In the concluding example of this section, that of making by hand the lev ways in the round holes of wheels it is to be observed that it is common to turn a cylindrical plug exactly to fill the hole and to make a notch in the plug as wide as the intended key way and parallel with the axis the plug is shown at q fig 883 A piece of steel f is then filed parallel and exactly to fit the notch and its edge is cut as a file and used as such within the guide block, the latter being at the time inserted in the hole of the wheel In this case the block becomes the director of the file and the notches in any number of wheels are made both parallel and axial and the only precaution that ie mains to be observed is in the depth of the notches, and this is not always important the depth may however be readily deter mined by making the grooves at first a little shallower than their intended depth and then, the plug having been removed from the hole a stop is attached to the side of the file parillel with its edge as at s, to prevent its penetrating beyond the assigned depth

The method of cutting key ways in large wheels that was frequently employed prior to the introduction of machinery for the purpose was as follows Supposing the wheel to have been board with a three inch hole and to have required a key way half inch wide and half inch deep. The guide block g fig 884, of three inches diameter, would have had a groove say half inch wide and one inch deep, and a cross cut chisel c exactly to fill the groove would have been made The chisel having the same section as the groove, when driven through would produce no effect, but if a piece of sheet steel s, 1 thick, were laid at the bottom of the groove the chisel would then cut a groove hulf anch wide and 1 deep, and if two, three, four, and ultimately eight such strips were successively employed together, as in the section and detached views, fig 884, the hole would be accurately chiselled out by the repetitions of the process The hole would require to be finished with a puallel thick file, called a key way or cotter file, which has already been described on page 822-3 of the present volume


SECT VII —INSTRUCTIONS FOR FILING CURVII INFAR WORKS ACCORDING TO THE THREE ORDINARY MODES

The curvilinear surfaces of works are commonly of less im portance than the plane surfaces neither do they in general require the same skilful use of the file especially as the more important curved lines and surfaces in machinery are circular and are therefore produced in the turning lathe, and of the remaining curves the majority are introduced either to give a more pleasing outline to the works than would be obtained by straight lines, or to obliterate the numerous angles that would be inconvenient to the hands

In filing works that are convex flat files are always used and the file is necessarily applied as a tangent to the curve, and in filing concare works round and half round files are used and in some cases they are selected, nearly or exactly as counterparts of the hollows to be wrought

The manipulation of the file upon curvilinear works is entirely different from that required to produce a plane surface in which latter case the work is held at rest and the hands are moved as steadily as possible in right lines but in filing curved works an incessant change of direction is important and so far as practicable, either the file or the work, is made to rotate about the axis of the curve to be produced

A semicircular groove of half an inch radius as in fig 885 would be most easily filed with a round file of nearly the same




curvature, and the correspondence between the file and work, and consequently of their axes likewise would render the mitter very easy but the file from the irregularity of its teeth, would leave ridges in the work, unless in every stroke it were also twisted to and fro axially by the motion of the wrist, and occa sionally in the reverse direction, so that the furiows made by the teeth might cross each other. If the groove to be filed had a diameter of three or four inches although the file might be selected to correspond in curvature with the groove, as it would not embrace the entire hollow, the twisting and traversing of the

file would be imperative in order to arrive at all parts of the work

Under ordinary circumstances it is certainly best that the cuivature of the file and work should agree as nearly as possible, but it is obvious that the file if more convex than the work can only touch the latter at one part, as at a fig 886 whereas if the file is less convex, or fitter, than the work it will act at two places as at b b fig 887. The Sheffield cutlers in filing out the bows of scissors, and which they do with great rapidity always avail themselves of this circumstance and until nearly the conclusion, use files flatter or less convex than the work

In filing concave works, there is but little choice of position, as the file is always parallel with the axis of the curve, as in the dotted line in fig 888 but in convex works such as fig 889 the file may be applied either parallel with the axis as at p p or transversely thereto as at t t In general however the work would be fixed obliquely as in fig 890, and the file would be first



used transversely for some one or two strokes at an inclination of about 30 degrees with the horizontal line as at a, so as nearly to agree with the straight side of the object the file would be successively raised to the horizontal and depressed in the same degree on the other side, in fact proceeding through the positions a b c, fig 890 at some eight or ten intervals and which would tend to make as many insignificant ridges upon the work. The ridges would be then melted together by swinging the hands from the position a to c in every stroke to be repeated a few times, but as the entire semicircle could not be embraced at one stroke, the work would be re fixed in two or more positions, so as to divide the operation into about three stages

A more exact although less energetic method would be to place the file parallel with the axis as on p p fig 889, and to sweep round the curve principally by the twisting motion of the wrist which joint can be more readily moved, and also with less

fatigue, than the two hands conjointly. A third mode frequently adopted in such small pieces as can be held upon the filing block with the hand vice, is to swing the work upon its axis and to use the file with the right hand, as if on a flat surface, a mode explained in fig. 858 page 862

Some works are curvilinear in both directions such as curved aims and levers with rounded edges—many of these kinds are completed by draw filing them or rubbing the file sideways or later ally around the curve—instead of longitudinally as usual—but the changes consequent thereupon do not require any especial notice


The success of all the modes of filing curved works, will be found very much to depend on the freedom with which the several twisting and excursive motions of the hands are performed and the work should be frequently examined, in order that the eye may judge of the parts in excess and that require to be reduced, in order to produce a pleasing outline

Having considered the general manipulation of the file in respect to curved works it remains to be noticed that curvilinear objects are filed up in different modes dependent on their respective forms and characters. Thus the great majority of curved works are moulded and formed prior to the application of the file, which is then principally used to smooth and brighten them—other works are shaped almost entirely with the file, assisted by outlines drawn on the pieces themselves—and again other works are shaped with the file under the guidance of tem plets or pattern plates of hardened steel. Some observations will be offered on all three of these modes

Firstly curved works that are moulded or formed prior to the application of the file —The methods employed in the prepulation and figuration of materials into curvilinear and other forms by founding and forging have been largely considered in the first volume and from which remarks it will have been seen, that the perfection of cast works greatly depends on the perfection of the foundry models or patterns, and these latter greatly depend on the facilities offered in pattern making by the turning lathe, and the joiner's planes, and although such castings in many cases do not admit of being finished in the lathe, the perfection of the pattern is a great source of embellishment and economy, in the configuration of the works made by moulding and custing

In respect to filing up metal works that have been accurately shaped by founding or forging little or nothing remains to be added to the remarks on the last page as the only object is to act on every part of curvilinear surfaces in the most expeditious and commodious manner with the general aim of reducing any trifling errors of form that may already exist in them, and avoiding the introduction of new ones—which circumstances call for the frequent scrutiny of the eye and an incessant yet judicious variation in the position of the hands

Secondly curved works that are moulded or formed almost entirely with the file—These are blocked out square, and the outlines of the curves are drawn on the ends and sides of the pieces, to guide the file in a manner analogous to the routine pursued by carpenters, misons and other artizans. For instance, to form a bead, as in fig. 891, the work is prepared of a nearly rectangular form and the half circle having been drawn at each end, the angles of the works are coarsely removed at about 45.

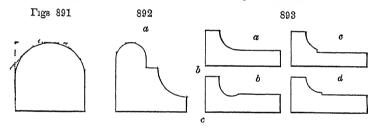

degrees, maling the end a semi octagon—sometimes the four angles are faither reduced giving to the work eight facets prior to their being thrown together in making the general curve—If these sides are made with only a very moderate degree of exact ness, they will greatly tend to preserve the uniformity of section throughout

Many workmen when they have removed the two principal angles at 45 degrees will make a chamfer entirely around the semicircle at each end, to guide the file in hastily reducing the principal bulk of the material, until the chamfers are nearly obliterated, after which the curve is finished in exact agreement with the lines with a smooth file. It is also desirable that the straight edge should be frequently applied along the axis of the curve, at various puts, during the progress of the work

Should the entire piece fig 892, have to be made from a solid

block, two cuts a and b made with the saw would remove the corner, and a little filing would then suffice to complete the internal angle. The round part of the bead would be made as before and previous to filing the hollow it would be chamfered on the line c a half round file, of less curvature than the hollow itself would be first sunk in the middle of the chamfer and the hollow would be deepened and extended sideways, always main taining an easy curve, until it reached the marginal lines where the hollow meets the plane surfaces. This mode is better calculated to avoid the accidental obliteration of the angles of the work, than if the file were sunk at each margin

Where hollows run on to right lines as at a fig 893, there is some risk of making a break in the junction either from the curve sinking below the right line as at b or from the straight line as at c advancing too far and breaking in upon the curve. On this account a break or fillet is usually made at the part as at d or else it is usual primarily to give that form, by filing the first and then sinking down the hollow just to meet it, and at the conclusion letting the half round file run a little way on to the right line. Some however prefer the opposite course, or that of sinking the hollow to its full depth, and then filing down the remainder with the flat file, but which mode is certainly attended with more risk.

Thirdly curved works that are shaped with the file under the guidance of templets or pattern plates of hardened steel—This mode is much followed in works of two principal kinds namely, thin works required in great numbers and precisely of one form, and in a variety of works that require to be exactly cricular although they may not admit of being so fashioned in the lathe

Many thin works of the first kind are stamped or punched out of the sheet metals, as for instance the wishers for machinery the links of jointed chains steel pens parts of locks for joinery, and numerous other thin works but many objects of larger kinds, and that are not wanted in such large numbers are not stamped, but are either cast or cut out with the shears and after wards filed between templets. Instances of such works are occasionally met with in the numerous class of machines for spinning and wearing, cotton, silk and wool and also in lace and stocking machinery. The mathematical instrument makers likewise

employ the mode to a considerable extent in works that require much repetition $% \left(1\right) =\left(1\right) +\left(1\right) +\left($


The snail wheel of a striking clock, fig 894, is frequently thus formed, by means of a templet it has an edge formed in twelve steps, manged spirally the positions of which determine the number of strokes of the hummer on the bell In this case, which will serve as a general example a piece of sheet steel is cut out flattened and smoothed on one side, to receive the drawing of the snail wheel and a second piece is also prepared The two are first drilled together with a cential hole, and another hole as distant from the center as admissible The two plates are then united by two pins and the outline of the work having been drawn on one of them they are next filed in steps carefully to the lines and square across the edges and they are afterwards hardened and slightly tempered to lessen their liability to fracture on being pinched in the vice The dozen or more snail wheels having been cast or cut out of sheet biass, and flattened with the hammer two or three at a time are pinched alongside one of the templets whilst the two pin holes are made with the breast drill or in the lathe with a drill that exactly fits the holes in the It only remains to place the dozen plates between the templets keeping them in position by two pins extending through the whole number and then all the notches are filed in the brass plates until the file very nearly touches the steel patterns as absolute abrasion on the steel itself would greatly injure the files In this mode the several biass plates become very exact copies of the pattern *

A different application of templets is sometimes met with in filing up numerous similar parts in the same object, as the arms or crosses for the wheels of clocks and other machines. The exact

^{*} Templets are as much used for setting out and producing series of holes in any special ariangement as in filing works to any particular form the most complex example of the kind that occurs at the moment to the author of templets being used in this manner is in drilling the side plates of harps intended for the arbors and link works used in temporarily shortening the strings. The respective positions of the holes in these side plates require a most exact arrangement any depirture from which would prevent that precise shortening of the string required to produce the semitones with critical accuracy and would also cause an unbearable jar unless the crinks of the harp were severally in true position or on the lines of centers, so as firmly to support the tension of the strings under all cricumstances.

pattern of one spoke is filed up as a templet which is shaded in fig 895, and serves for the similar configuration of every spoke, the position of the templet being given by a central pin, aided by any little contrivance which catches into the 3, 4, 5 or 6 equil distant teeth corresponding with the number of aims. Many other equally available cases of the use of templets might be cited, but we must now proceed to works of the second kind, or those of an outline partially circular.

It frequently happens that certain forged, cast and other works have parts, known as bosses, swells, collars and knuckles that are pierced with holes which require their flat surfaces and also their margins to be made partially or entirely concentric with the holes When such parts occur as bosses, they often

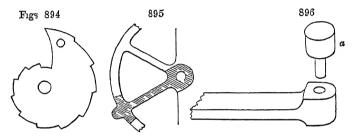


project from a flat surface, and after the central hole is drilled some of the pin drills drawn on page 550 or analogous tools used in drilling machines are employed in finishing the margins thus figs 482 and 184 serve for facing the extremities of the holes, 483 and 485 for the external faces of cylindrical bosses or collars, used in the guidance of arms jointed concentrically with the holes and figured cutters 485 serve for bosses with mouldings intended for ornament

When the circular margins are discontinuous files and tem plets are more or less required thus the extremity of a forged arm, such as fig 896, is drilled, and in the configuration of the remaining parts if but one or two such pieces are to be made, a boss or plug of wood is turned like a, that shall fit the hole the shoulder of the wood is then rubbed with red chalk to mark that part of the surface which is not at right angles to the hole and the circular edge of the boss serves for the guidance of the file in finishing the exterior margin, visually rather than obstructively, as the wooden boss would be reduced instead of the file being

checked If therefore many such objects had to be filed two bosses or templets would be made of hardened steel and used one at each extremity of the hole and they would be held in position by grasping the three pieces collectively in the tail vice. The same general method is very largely and more rigorously followed in making joints or hinges, of which three examples will be quoted in conclusion of this section.

The bruss and steel plates fig 897 used for the joints of car penters rules are filed up to templets in all respects after the manner described in reference to the snail wheel fig 894 and the joint plates are inlaid by means of the file saw, chisel, and plane by modes that do not require to be noticed

The joints of drawing compasses are made somewhat differ ently, and mostly as follows The solid knuckle a, fig 898, is first

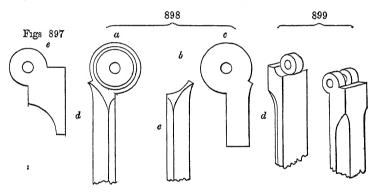


dulled and made cucular by aid of a templet c, and the hollow side b is filed to correspond exactly with a, the two are then punched together in the vice on the line d d, and the parallel notches for the steel joint plates are made in each with the saw fig 712 page 729 as deep as the line e e The parts a and b are then separated the notches in b are completed with the frame saw and the bottom of the notches in a are rendered circular with the joint saw, fig 713, as there explained The middle plates, when filed a little larger than the templets c are inserted in b and soldered in their places, the two parts are smoothed on their various internal surfaces and united by a temporary joint-pin and any little inegularities in the external or cir cular curves, (which are left purposely a trifle too large) are mutually detected by their want of agreement when the joint is opened to different distances any parts in excess are very care fully reduced with a small smooth file principally by draw filing after which the screw pin with its brass cheeks or bosses is added

The pin drill fig 475, p 547 is commonly used for cutting out the concave parts that extend to the side of small compass joints such as are represented in fig 899, and also for inlaying the heads of small countersunk screws

Larger joints with wider knuckles such as fig 900 are in many instances cast from patterns closely resembling the finished works. In such cases the first process is generally to remove any little external errors with the file and to clear the angles with a small chipping chisel—the faces of the knuckles are then smoothed and inserted within one another very tightly. The joint hole is afterwards drilled throughout all the knuckles and which are filed up externally sometimes under the guidance of templets put at the ends but principally by the reduction of those high parts which get scratched or rubbed by the opposite parts and thereby show their excess of height

But if such joints are required to be made more accurately, the holes are first drilled in each piece separately, and rather too

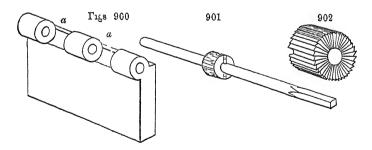

close in the corners the holes are broached with a parallel broach, so as exactly to admit a steel cylinder, fig 901 which has a square end for the brace, this rod is intended to receive the cutters, shown on a luger scale in fig 902, which are cylin direal pieces of steel bored to fit the rod, and cut with teeth on the outer cylindrical part and on one flat surface, a pin is inserted through both the cutter and bar, so that the two may be united after they have been placed within the joint to be worked, sometimes the back free of the cutter has only a diametrical notch to receive

the driving pin, which pushes the cutter before it as it revolves A recess must first be cleared for the cutter with a chisel and hammer or by a wide joint saw or cutter, such as fig 713, and the hollowed parts at a a fig 900 are then cut throughout their length with the cutter, that afterwards serves to flatten the faces of the knuckles in exact parallelism throughout, and at right angles to the central hole

The two halves of the joint having been separately hollowed and faced until the knucl les will penetiate some distance into one another, the external parts of the joint are next separately filed under the guidance of hard steel rings or templets of the same diameter as the cutter, and placed on the cylindrical rod after which the two parts of the joint are put together when yet slightly too large, and the central pin is inserted in order that the rubbing of the knuckles against the corresponding hollows may denote the parts that are still too high or full and by cautiously removing all the parts that are abraded the joints may be made to fit very closely and accurately, and yet to move with great smoothness

Many joints that are at the same time wide and small as in hinged snuff boxes could not be drilled as above described with safety and are therefore made quite differently by means of small tube, called joint wire the mode of drawing which was explained in vol 1 page 129

For instance in miking a shuff box the rims for the top and bottom are fitted and jointed together before the top and bottom plates are soldered in, and the joint is thus constructed. Supposing that five knuckles are required for the bottom, and four for the top, the nine pieces of joint wire are cut off, and filed square at the ends—the rims for the top and bottom having been fitted so as to form the rebate, are placed together, and carefully filed out with a semicircular recess or groove, by means of a parallel round file or a joint file, exactly of the diameter of the joint wire which therefore leaves a hollow equal to the fourth part of the circle in each rim

Five of the joint pieces are then strung on a wire, inserted in the hollow of the rim for the bottom of the box and tied therein with fine binding wire, the intervals between these five knuckles are regulated by inserting the other four between them for the moment, while the binding wire is being fastened, after which

this first series of knuckles is soldered in with moderately hard silver solder which is usually fused with the blow pipe. The lid is then treated in the same manner and the bottom part of the box now serves as the gage for regulating the distance between the knuckles in the top rim. The same plin is also used by mathematical instrument makers and others who however more generally turn the joint pieces in the lather as the draw bench forms no part of their ordinary supply of tools, and the wide joint pieces or knuckles in mathematical works are usually larger than could be produced in that manner

SECT VIII —COMPARATIVE SAETCH OF THE APPLICATIONS OF THE FILE AND OF THE ENGINEER'S PLANING MACHINE ETC

The general aim of this present section, is to show by way of continst how several of the pieces advanced as illustrations of works executed with files in sections iv to vii are produced by the planing machine and analogous continuances

The comparison of the modes of producing flat and rectilinear works with the file and with the planing machine is greatly in favour of the latter method in respect to facility, expedition, and accuracy and the modes are besides entirely different

For instance, the laborious and tedious mode of filing a flat surface has been spoken of at some length, and it will be remembered the work is fixed and the tool is moved in a variety of directions upon the surface to be filed

So far as the action of the smith's hand plane for metal (page 483) and carpenters planes may be brought into comparison, they are used in many respects as the files, but are applied generally parallel with the one side of the superficies that is being wrought

But the engineer s mode of planing works in metal is entirely different from either of the above and is strictly analogous to the mode of turning works in the lathe with a slide rest if we consider the arial motion of the lathe to be replaced by the rectilinear motion of the planing machine, as was briefly explained in general terms in the introductory chapter to the present volume more particularly in reference to the "guide principle," see pages 168 and 469

The work to be planed, is there briefly described as fixed on a

chirage or sledge that is made to move to and figure a time right line, as upon a very accurate railway—whilst the cutting tool which is just like those used in the turning lathe was supposed to be affixed to a bridge standing across and at right angles to the railway—Such a fixed tool would plough a furrow in the work—which furrow would be accurately straight as the callway or guide from which the work itself received its direction of motion

If the reader will only conceive the work to be continually moved to and tro upon the slide or railway a distance equal to its own length and that by a subsidiary contrivance or another slide placed horizontally, the tool between each reciprocation of the work were moved a small distance to the right continually, a series of grooves would be ploughed all individually right lines and these grooves would shave off all the asperities and irregularities of the work leaving it finely grooved in parallel furrows. Or provided the end of the tool were flat and ever so little proader than the small interval between the successive strokes, the tool would leave a plane or smooth surface, and the perfection of this surface would mainly depend on the railway or the cutting slide, and the horizontal or position slide, being each truly rectalines.

Supposing now, by means of a third slide placed exactly perpendicular the tool were depressed the tenth of an inch and the process were entirely repeated the surface would be reduced with perfect uniformity one tenth of an inch all over and the new surface would be mathematically parallel with that existing immediately previous. Pursuing this idea let it be further supposed that the surface just planed is the upper surface of the turinge or sledge of the planing machine, technically known as the bed or table, upon which the work that is to be planed is fixed by screw bolts and clamps

It will now be shown how the piece represented by A B, C, in fig 868 pige 879 would be treated in the plining machine, in order to make its sides strictly parillel in purs and also at eight ingles to each other, in short, to convert it into a true purillelopipedon

The side A, of the piece would be first placed uppermost and correctly planed if iterwards the side Λ would be inverted and placed on the bed of the machine, care being taken that no

shavings intervened to prevent their coming into absolute contact, and the second face, or a, would be planed strictly parallel with A and that without any especial care on the part of the operator

Next, to plane the edge B, it would be necessary the third slide of the planing machine should be placed truly vertical, and that between each recipiocation of the bed of the planing machine on its railway the tool should be depressed a small quantity by the vertical slide so as in the end to make it slowly descend, by intermittent steps down a vertical and right line, exactly equal to the perpendicular height of the side B

All things now remaining fixed as before, if the tool were traversed horizontally until it touched the second edge of b, this edge of the work would, on pursuing the same gridual depression of the tool be planed also vertical and in strict parallelism with its opposite, or B

Continuing the same order of work as in the hand process, the ends C, c, would require the work to be released from the bed of the machine shifted just 90 degrees and then refixed when the ends C c would be treated exactly as B b had previously been and would thence be made parallel and square

In some instances, indeed the analogy to the railway is strictly maintained for a faither stage of the work, as such a piece as A B C fig 868 would sometimes be mounted as it were upon one of the turn plates by which the railway carriage is twisted one quarter round preparatory to moving it from off the principal to an adjoining line. In the planing machine the turn plate on which the work is fixed is a supplementary circular bed having a horizontal or azimuth motion so that by leaving the tool unaltered except in its vertical path, the several edges of any regular polygon whether a square plate or a triangle pentagon hexagon &c may be planed with strict accuracy. The sides of any integular polygon, may be also planed, by moving the tool so much on the transverse or horizontal slide, is the differences in the radial distances of the sides of the unequal polygon from the center of the turn plate.

Supposing the piece ABC, fig 868 to be bevelled or chamfered on one or all of its edges, the slide which had been previously fixed in the vertical line, or perpendicularly, would be inclined the piecise number of degrees required, so as to produce the

chamfered edge with as much facility as the square or vertical edge

The more convenient course in small and long works of sections resembling figs 871 to 874, is to place upon the bed of the planing machine two headstocks or lathe heads, the one furnished with a dividing plate and so arranged that the axis of the headstock is strictly parallel with the path of the railway or main slide of the planing machine In this case the planing tool is ilmost always made to traverse horizontally, and which indeed is the most generally convenient. The triangular prism fig 874 would be planed with great ficility and truth by placing it in three successive positions, one third of the circle or 120 degrees asunder by means of the dividing plate, and if the axis of the head stocks were inclined vertically, a triangular pyramid or wedge, instead of a triangular prism, would be produced The headstocks if horizontal and shifted four times, or ninety degrees each time would plane square or rectangular pusms, and of course also the rectangular faces of the pieces 871, 872 and 873, and again if instead of constantly shifting the headstocks ninety degrees, as for the rectangular parts the changes were thirty forty five or sixty degrees according to the angles respec tively required in the objects represented the bevilled or chim fered edges would be obtained with great facility and accuracy

The planing machine almost entirely prevents the necessity for building up work in a dissected state as in the figures 877 and 878 as such grooves may be sunk, and any fillets may be planed, upon the upper surfaces of works, the vertical or lateral surfaces and even the lower or inferior surfaces by bending the tools into appropriate forms, so as to reach into the parts, after the manner of fig 439 page 534 as such contortions of the instruments do not in any respect interfere with the paths of the slides in which the tools are fixed and guided

And consequently, many parts of machinery that if worked by hand would be very difficult of access, and also very difficult of proof intespect to their accuracy, are accomplished in the planing machine with a degree of facility most satisfactory to the mind astegrads their abstract truth and the puallelism of their various parts however strangely situated, and also most satisfactory, as regards the relative economy of the method, indeed the planing machine may be truly considered to have effected a most enor

mous and beneficial revolution in the art of metallic construction generally

The key glooves in wheels for the keys or wedges by which they are attached to their shafts, when made by machinery, are cut out by a modification of the planing machine invented by Mr Richard Roberts, of Manchester it is designated the key groove engine and may be presumed to have been derived from the mortising engines in Brunel's block machinery (ante 505 6)

The cutter used in the key groove engine resembles a strong mortise chisel, and is reciprocated in a vertical line by means of a crank or excentic, whilst the wheel to be grooved is placed horizontally on a slide and traversed towards the cutter until it has entered to the required depth. To make the groove taper to the same angle as the key or wedge, the slide is tilted some one or two degrees and if two or three key ways are wanted instead of one only then the wheel is mounted on a species of turn plate with notches cut on its edge, by means of which the grooves are placed at exactly equal distances, as in planing squares hexagons, &c

An offspring of the key gloove engine called the paring or slotting machine, is also commonly used to fulfil many of the works hitherto performed with the file. The tool of the slotting machine resembles in all respects that used in cutting key ways, but the slotting machine has two horizontal slides at right angles to each other and a circular adjustment or turn plate all three used in shifting the position of the work beneath the cutter and all three fitted with apparatus for mechanically feeding the cut as it is technically called or for moving the respective slides a minute quantity between every stroke of the recipiocating cutter, thus making the machine self acting

In such a slotting and paring machine, the piece fig 879 on page 882 could be produced without the intervention of filing. The central hole d and the holes at the one extremity of each mortise s s and c c would be first drilled—the work would be guided by a pin in the center of the turn plate, fitted into the center hole d—The hole s would be elongated into the straight mortise by a chisel of the same width—the work being traversed beneath it by one of the straight slides—The other hole c, would be clongated into the circular mortise by the gradual adjustment

of the turn plate which would swing the work round on its axis d. The turn plate moving on d would also serve for paring the outer edges parallel with the circular mortise and the straight slides would enable the exterior straight lines of the work to be pared


Even the small semicicles around the ends of the circular moitise in fig 879 might be shaped if before the formation of this moitise the piece were chucked with c c successively in the center of the turn plate or a clever workman, by moving the two slides by hand, or independently of the self acting feed, would follow any such outline with tolerable regularity removing the bulk of the metal, and leaving the parts square on the edge, and pretty nearly perfect in form so that a little filing would complete them satisfactorily and thus, by the manual adjustment of the slides, many irregular curves are pared out, to any particular outline previously drawn on the work by that method which the mathematician would perhaps call the method of double or dinates

Another modification of the planing machine, called the shaping machine, and which may be considered to have grown out of the paring machine last alluded to is much used in correcting the forms of the circular and other parts of large works of the character of figures 897 to 900 pages 893 894. In such works, the central hole is first bored out, the object is then chucked on a spindle, or arbor, which may be almost considered as the mandrel of a turning lathe, the tool is next traversed above the work, and in a line parallel with the axis of the mandrel, whilst, at every stroke the mandrel is slightly moved on its axis so that in the end, the whole of the circular arc is accurately shaped

These shaping machines have also generally two rectilinear slides at right angles both to each other and to the axis of the mandrel either of which or the revolving arbor, can be set to feed itself so that by a little dexterity of manipulation all the edges of a piece, such as fig. 897, could be shaped, even including the hollow as the cutting tool is placed at the end of an arm, or radius, of some three to six inches so as to be applicable to the cutting of inverted arcs.

In this manner, with the preparatory aid of the turning-

In the, every part of the cross head figs 903 and 904 may be wrought mechanically. The work is first chucked in the lather between centers on the line a a whilst the whole of the contour in the side view fig 903 is turned and also the bearings e e, it is then fixed to insversely on the face chuck of the lather to bore out the center hole b b for the piston rod and to turn the central flat surface. After this the lines seen in the plan fig 904 may be completed in the shaping or paring engine, the central convex part by the twisting of the work on the general

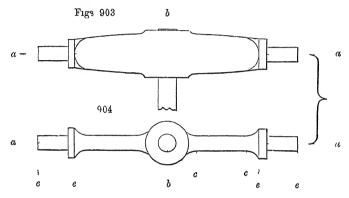

center the concave parts by the twisting of the tool on the centers c c and the straight parts by the movement of the horizontal slides and these several changes may be so nicely managed as to render the joinings of the several lines scarcely distinguishable

The method followed in maling such works is not always as above described, as in inany such pieces especially in those of large size, the planing machine is brought into requisition and sometimes also being machinery by which likewise the hollows c c may be shaped out. The artist has altogether omitted the transverse mortise for the key which fixes the piston rod and which mortise is made in the key way or paring engine leaving, in fact nothing to be accomplished by hand labour

Many of the varieties of machines for planing and shaping metal works with a single pointed tool, and various other machines of similar effect, in which circular cutters are used, might be here noticed, and in which numerous machines objects that were formerly always shaped by filing, are now worked by machinery, but it is hoped enough has been shown to satisfy the reader that almost any solid with plane or circular surfaces, how ever numerous or combined, and also many irregular or arbitrary surfaces are in the present day most effectively produced by means strictly mechanical. But it will be borne in mind, that the detailed investigation of these matters appearans more strictly to the proposed fifth volume to be devoted to the 'Principles and Practices of Mechanical Engineering and in which it is proposed this trifling sketch should be filled up and elaborated

The author cannot, however conclude this chapter on files their applications and certain relative topics without adverting to the revolution as regards filing, consequent on the introduction of the planing machine and its descendants—a revolution more especially felt in regard to the larger classes of machinery

The obvious effect of the luge and economic accession of engineers tools which act by cutting, has been to lessen in a proportionate degree, the employment of files and of minual processes generally amongst engineers and those occupied in the construction of luge machinery. It necess unly follows as a result that amongst such artizans the practice of filing from being less required as far less generally learned by the present race of workmen, and consequently many of the latter, when deprived of the refined machinery of the workshop, and thrown upon their own handicraft or manual efforts with the simpler and earlier tools, are certainly less skilful than their predecessors

The ait of filing is however, still largely employed and will probably continue to be fostered as much as ever amongst artizans who work on smaller objects, and those to which machinery of the kind referred to, is less applicable than the file and its more simple congenitors by means of which alone, when employed with skilful manipulation, highly elaborate and accurate works have been and may still be produced, although in many instances at a greater cost

In justice to the file it is also right to state, that in many cases it is indispensable that works produced in the planing and other machines, should be finished and adjusted by means of smooth files, and further that the machines referred to are unavailable in many small works, which can only be produced by individuals who have been long and delicately skilled in the use of the file


CHAPTER XXIX

SHEARS

SFCT I -INTRODUCTION CUTTING NIPPERS FOR WIRES

SHEARS are instruments of a character quite different from any of those hitherto described, as the cutting edges of shearing tools are always used in pairs and on opposite sides of the material to be sheared or severed. In many cases the shears are constructed after the manner of pincers and pliers or as two double ended levers united at the fulcrum by a pin, but other modes of uniting the two cutting parts of the instruments are also employed, as will be shown

The general form and position of the cutting blades of shears, was adverted to in the elementary diagram fig 316, at the begin



ning of this volume and the sections of some varieties of this instrument are represented by a, b, c of the annexed fig 905, from which it will be seen that the edges of shears and scissors meet in lateral contact and pass close against one another severing the material

by two cuts, or indentations, or thrusts, which take place in the same plane as that in which the blades are situated and are moved

Some of the largest shearing tools of the kinds used by engineers, such as c serve to divide bars of non, 4 o or 6 inches wide and 1 to 2 inches thick then requiring the greatest possible solidity and freedom from elasticity

On the other hand some of the finest scissors of the section a such as are used by ladies in cutting lace will cut with the greatest cleanness and perfection, the most flexible thread or tissue of threads, or the finest membranes met with in animal or vegetable structures. But this latter kind of shears unlike the engineer's shears, is altogether useless unless possessed of a considerable share of elasticity to keep their edges in accurate contact at that point in which the blades at the moment cross each other,

as will be explained otherwise such thin materials are folded down between the blades instead of being furly cut. The transition from the elastic to the inelastic kinds of shears is not as may be supposed by one defined step but by gradual stages, mil ing it as difficult in this as in other classifications, to adopt any precise line of demarcation

In addition to the above of to shears properly so considered, there are a few tools known as cutting pliers or nippers, in which the blades meet in direct opposition but do not pass each other as in the legitimate kinds of shears this kind is represented by the section d fig 905, and it is proposed to consider these several tools as nearly as may be under four heads, namely,—


Sect I Cutting nippers for wires

- " II Scissors and shears for soft flexible materials
- , III Shears for metal worked by manual power
- " IV Engineer's sherring tools, generally worked by steam power

Cutting pliers if they idmit of being classed with shears, are certainly the most simple of the group, and are used for cutting asunder, small wires mails and a few other substances. Their edges are simply opposed wedges exactly as shown in the above diagram at d and as respects the remainder of the instruments by which their wedges are compressed the most simple kind exactly resembles carpenters ordinary princers for drawing out mails, except that the cutting princers are made with thinner edges and figs 906 to 909 overleaf represent different kinds of cutting pliers and hippers

When cutting impreis are compressed upon a nail or a piece of wise, they first indent it on opposite sides, and when from their penetration, the surfaces of the wedges exert a lateral pressure igainst the material, the latter eventually yields, and is torn asunder at the moment the pressure exerted by the wedges exceeds the cohesive strength of the central metal yet uncut. Consequently the divided wire shows two bevilled surfaces, termin iting in rindge slightly torn and ragged. The quantity of the material thus torn instead of being cut, will be the less the softer the metal and the keener the phers, but experience shows an angle of about 30 to 10 degrees to be the most economical for the edges of such tools.

Little remains to be said on the varieties of cutting pliers most of these used by general artizans and clockmakers, are smaller than carpenters pincers and the extremities of the Jaws are bevilled as in *uatch nuppers*, fig 906 that they may cut pins

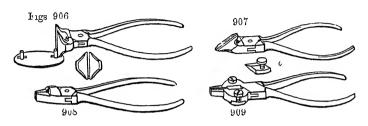

lying upon a flat surface. Other cutting pliers called side nippers are oblique as in fig. 907, those used for the dressing case and known as nail nippers are concave on the edge to pare the nails convex, and another kind known as nipper pliers, bell hanger s or bottlers pliers, have flat points at the end for grasping and twisting wires, and cutters on the sides for removing the waste ends, as shown in fig. 908

Surgeons also employ cutting nippers, for dividing small bones such as those of the fingers and toes, and for removing splintered and dead portions of bone. They assume the forms already explained, and also some others as will be seen on consulting the work before quoted in the foot note, pages 801, 2, namely Secrity's Armamentarium

The edges of cutting mippers are apt to be notched, if used upon hard wires or if wriggled whilst the cutting edges are buried in the wire and they scarcely admit of being reground or reparred. This inconvenience led to a modification of the instrument fig. 909 by the enlargement of the extremities to admit of loose cutters fitted in shallow grooves being affixed by one screw in each as shown detached at ϵ , so that the cutters may admit of removal and restoration by grinding which end is effectually obtained although somewhat to the prejudice of the instrument by increasing its bulk *

^{*} H Bursill a youth only 19 years old was rewarded for this contrivance by the Society of Arts in 1845

SECT II —SCISSORS AND SHEARS IOR SOFT FIEXIBLE MATERIALS

The scissors and shears to be described in this and the succeeding section, act on a very different principle from the nippers recently spoken of. The nippers have edges of about 30 to 40 degrees meeting in direct opposition, but yet leave ragged edges on the work, whereas the shears have edges commonly of 90 degrees, seldom less than 60 degrees, these edges pass each other and leave the work remarkably keen and exact.


Let the edges of scissors be ever so well sharpened, they act very imperfectly if at all, unless the blades are in close contact it the time of passing, and this imperfection is the more sensible the thinner and more flexible the miterial to be cut, as it will then fold down between the blades if they do not come in contact. Whereas when the blades exactly meet, the one serves to support the material whilst the other severs it or rather this action is recipiocal and each blade supports the material for the other fulfilling the office of a counter support or of the bench, stool or cutting board used by the carpenter with the paring chisel

On a cursory inspection of a pair of ordinary scissors at may be supposed that their blades are made quite flat on their faces or with truly plane surfaces like the diagram fig. 910 overleaf representing the imaginary longitudinal section of the instrument, the two blades of which are united by a sciew consisting of three parts differing in diameter, namely the head, the necl, and the thread—the bottom of the countersink that receives the head of the sciew is called the shelf or the twitter bit—If how ever the insides of scissors were made flat and as carefully as possible, they could screely be made to cut slender fibrous materials or if at all, then for only a short period and additional friction would accrue from the rubbing of their surfaces

The form which is really adopted more resembles the exag gerated diagram fig 911—the blides are each sloped some 2 or 3 degrees from the plane in which they move, so that their edges alone come into contact, instead of the blades being straight in their length they are a little curved so is to overlap, and close behind the screw pin by which they are united, there is a little transgular elevation, insignificant in size but most important in effect, which may be considered as a minimuture hillock or ridge,

sloping away to the general surface near the hole for the sciew. This end agement or bulge is technically called the "riding part and as there is one on each blade when the scissors are opened or that the blades are at right angles, the points or extremities only of the riding parts come into contact and the joints may then have lateral shake without any prejudice. But as the blades are closed, first the bases or points of the riding parts and lastly the summits or tops rub against each other and tilt the blades beyond the central line of the instrument—the effect of which is, to keep the successive portions of the two edges in contact throughout the length of the cut as by the time the scissors are closed the points of the blades are each sprung back to the central line of the scissors which is dotted in the diagram

Although scissors when in perfect condition for work, may be loose or shake on the joint when fully opened (and thereby placed beyond their range of action) they will be always found



to be tight and free from shale as soon as the blades can begin to cut the material near the joint and so to continue tight until they meet at the points. That all scissors do exhibit this construction may be easily seen, as when they are closed and held edgeways, between the eye and the light they will be found only to touch at the points and at the riding parts, or those just behind the joint sciew, the remainder being more or less open and gently curved, and their elastic action will also be expendenced by the touch, as whilst good scissors are being closed, there is a smoothness of contact which seems to give evidence of some measure of clasticity

Fig 912, represents the section of the one blide of a pair of scissors registered in July 1811, by Mr G Wilkinson, of Shef field and in which the clastic principle is differently introduced. These scissors are made without the riding part, but instead thereof, immediately behind the sciew which unites the blade as usual, the one blade is perforated, for the purpose of admit

ting freely a small pin or stud fixed to the end of a short and powerful spring so that the stud s, from acting on the opposite blade throws the points of both towards each other so as to give them a tendency to cross but which being resisted by the edges of the blades touching one another, keeps them very agreeably in contact throughout their motion, and causes them to cut very well

If further evidence is wanted of the elastic principle in seis sors, it is distinctly shown in slicep she us which besides their ostensible purpose of shearing off the fleece are used by leather diessers and others It is well known that sheep shears, fig 919 page 915, are made as one piece of steel, which is tapered at each end to constitute the cutting edges is then for a distance fluted and strught to form the semi cylindrical parts for the grasp, and that in the center or opposite extremity, the steel is flattened and formed into a bow by which the blades are united and kept distended, sheep shears consequently require no joint pin and the hands have only to compress them as they spring open for themselves If sheep shears are examined when fully opened, or when partially closed by tying found the blades a loop of string it will be found that the blades have a tendency to spring into contact as after having been pressed sidewijs and asunder, the cutting edges immediately return into canci contact the moment the distending pressure is removed

The construction of scissors with the riding place as adverted to in fig 911 is that which ordinarily obtains in most scissors, from the finest of those used by ladies, to the heavy ponderous shears for tailors which sometimes weigh above six pounds, and are rested on the cutting board by one of their bows, that are large enough to admit the whole of the fingers


The peculiar form of the insides of the blades is in all cases of paramount importance, and in the manufacture of fine scissors is attended to by a person called a putter together whose province it is to examine the screw joint, and see to the form of the riding places, and lastly to set the edges of the scissors, which for general purposes are sharpened on an ordstone at an angle of about 40 degrees, but for the fine scissors more nearly upright or at 30 degrees from the perpendicular

So important indeed is the configuration of the inner face of scissors, that they should never be ground or meddled with at

that part, but by a person fully experienced in their action and scissors may with careful usage be kept in order for years with out being ground if the edges are occasionally set on the oil stone at the inclination above referred to. It will frequently happen that well made scissors which appear to grate a little when closed merely do so from dut or dust which if removed by passing the finger along the edges will restore the scissors to their smooth and pleasant action

It seems quite uncalled for to enter into the separate description of various instruments known as button hole serssors cutting out, drapers flower garden and grape serssors horse trimming serssors hur, lace lamp nail paper pocket stationers and tailors serssors and many others nor of the large shears for the garden such as pruning trimming and border shears the distinctions between which varieties are sufficiently known to those who use the several kinds but the author will merely notice such of them as present any peculiarity of structure

Button hole scissors are notched out towards the joint screw as in fig 914, so as to enable the instrument to make an incision

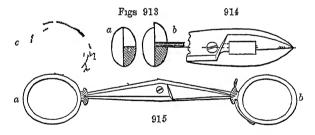

a little distant from the edge of the material, the joint must be made stiff so as to prevent the points catching against each other

Flower and grape scissors assume the section of fig. 913 so that they first cut the stem, and then hold it like a pair of pliers the one blade requires to be made in two parts riveted together, when entirely closed they present an elliptical section a, and b shows how the stem of the flower is grasped the blades are rounded at all parts that they may not injure the plants

Lamp scissors have the one blade very broad and with a little rim to prevent the snuff of the lamp falling on the carpet

Nail scissors for the diessing case are made very strong and

with short blades In using scissors formed in the ordinary mode the fingers and thumb of the right hand have naturally a tendency to press the blades together, in that position in which they are intended to cut, but the left hand on the contrary has a tendency to separate the blades and defeat the principle on which scissors act. Therefore nail scissors are made in pairs and formed in opposite ways, or as "rights and lefts, so that they may suit the respective hands

Pocket scissors have blades which admit of being locked together in the form represented in fig 915 as the point of the one blade catches into a small spring near the bow of the other and the instrument cannot be opened until the spring or catch is released with the nail. When closed for the pocket, the bows stand on one line is at $a\ b$ when opened for use as at $a\ c$

Surgical scissors are of many forms but have generally short blades and long straight slender handles that the hand may not impede the vision. In some of the surgical scissors the blades are curved as scimitars and others are curved sideways, these kinds are difficult to make as the elasticity of contact in the blade is required nevertheless to be maintained


Many of the shears and scissors used in gardening only differ from scissors and shears in general in their size, and the adaptation of their handles some of which are of wood, and placed at an angle of 40 or 50 degrees as in the letter Y inverted. Other garden shears used in trimming borders, have handles a yard long and inclined about 80 degrees to the blades, which may therefore he on the ground whilst the individual stands nearly erect. Some of the border shears have rollers to facilitate their movement along the ground.

In pruning shears and scissors, two peculiarities of form are judiciously introduced. In the more simple of the two kinds which is shown in fig. 916 the one part of the instrument termi nates in a hook, with a broad and sometimes a roughened edge, to retain the branch from slipping away, the other part of the instrument is formed as a thin cutting blade, the edge of which is con vex. Theoretically it should be part of a logarithmic spiral in which case the edge of the cutter would present a constant angle to the work throughout its action, and slide laterally through the incision made by itself, or make a sliding cut, whereas if the edge of the blade were radial, it would make a direct cut

without any sliding as in a paring chisel. The spiril blide cuts more easily, and will therefore remove a larger branch with an action precisely analogous to that of the oblique cutters in some of the planes, although differently produced

Some of these instruments when a little modified in form are mounted on poles from 6 to 10 feet long, and are actuated by a catgut, this tool which is known as the *Averuncator*, is very efficient for pruning at a considerable distance above the head

The other pruning shears represented in fig 917 are denomi



n ited sliding shears, the pin that unites the two pairs fits in a round hole in the one blade and a long mortise in the other and a link or builde iod c e, is attached by a sciew to each lever, in consequence when the instrument is fully opened the pin or fulcium is at the end a of the mortise whereas on the shears being gradually closed, the cutting blade slides downwards upon the pin until the fulcium is near the opposite end b. In this modification of shears the sliding action is produced to a much greater extent than with the spiral blade but the construction is a little more expensive—and as the instrument is not provided with bows for the fingers—the spring d e is added to throw it open

Before dismissing this section two modifications of shears will be briefly adverted to those used by card makers and the accolving shears employed in manufacturing woollen cloth

Card paper is prepared in large sheets when died and pressed it is cut into square pieces of the required sizes by means of long shears, the one blade of which is fixed at the end of a table, and has the joint at the futher extremity, whilst the cutting blade has a handle in front, and moves through a loop to keep the blade in its position as in some chaff cutting machines, there is also a stop fixed parallel with the blades and as distant as the width of the slips into which the card is first divided, and these slips are then cut again the lengthway of the curds. The shears are moved so rapidly, that the action

sounds like that of knocking at a door, and still the cards agree most rigidly in size

Revolving shears or "perpetual shears" are used for shearing off the loose fibres from the face of woollen cloths. For narrow cloths the cylinders are 30 inches long and 2 in diameter, eight thin knives are twisted around the cylinders, making $2\frac{1}{4}$ turns of a coarse sciew, and are secured by sciews and nuts which pass through flanges at the ends of the axis formerly the cylinders were grooved and fitted with several thin narrow plates of steel 6 or 8 inches long. The edges of the eight blades are ground so as to constitute parts of a cylinder by a grinder or strickle fed with emery passed to and fro on a slide parallel with the axis of the cylinder which is driven at about 1200 turns in the minute

In use the cylinder revolves about as quickly and in contact with the edge of a long thin plate of steel, called the ledger blade, which has a very keen rectilinear edge measuring 40 to 50 degrees the blade is fixed as a tangent to the cylinder, and the two are mounted on a swing carriage with two handles so as to be brought down by the hands to a fixed stop. The edge of the ledger blade is sharpened, by grinding it against the cylinder itself with flour emery and oil by which the two are sure to agree throughout their length

The cloth, before it goes through the process of cutting is brushed so as to raise the fibres it then passes from a roller over a round but and comes in contact with the spring bed which is a long elastic plate of steel, fixed to the framing of the machine, and nearly as a tangent to the cylinder, this brings the fibres of the cloth within the range of the cutting edges, which reduce them very exactly to one level. The machine has several adjustments for determining with great nicety the relative positions of the cylinder ledger blade and spring but, but which could not be conveyed without elaborate drawings. Formerly the cloth was passed over a fixed bed having a nearly shap angular ridge, but which mode was far more hable to cut holes in the cloth than the spring bed

Broad cloths require cylinders 65 inches long, and machinery of proportionally greater strength. In Lewis s patent cross cutting machine the cloth is cut from list to list or transversely, in which case the cloth is stretched by hooks at the two edges,

and there are two spring beds—the cylinder in this machine is 40 inches long and the cloth is shifted that quantity between every trip until the whole piece is sheared—The perpetual shears are also successfully applied to coarse fabrics including carpets *

A modification of the above revolving shears, made in a much less exact manner for mowing grass lawns is fitted up somewhat as a wheel barrow, or hand truck so that the rotation of the wheels upon which the machine is rolled along gives motion to the shears, which crop the grass to a level surface

SECT III -SHEARS FOR METAL WORKED BY MANUAL POWER

When metals are very thin such as the latten brass used for plating and other purposes they may be readily cut with stout scissors, and accordingly we find the weakest of the shears for metal are merely some few removes in strength, beyond the strong scissors for softer substances

It is however to be observed, that as common scissors are sharpened to an angle varying from about 50 to 60 degrees, they may fairly be considered to cut the materials submitted to their action, but shears for metal have in general rectangular edges as they are seldom more acute than 80 degrees, and therefore instead of cutting into the material they rather force the two parts asunder by the pressure of the two blades being exerted on opposite sides of the line of division

It was recently stated to be of the utmost importance that the blades of the weaker or elastic kind of shears should be absolutely in contact, or else thin flexible materials would be folded down between their blades without being cut


And it may now be uiged as of equal importance, that the blades of the shears for metal should be also exactly in contact not that rigid plates or bars of metal could be bent or folded down between their blades, even if these were a little distant but the resistance to the operation of cutting would be then enormously increased because the force exerted to compress the shears would not be then exerted in the line of their greatest resistance which is strictly the case when the edges truly meet in one plane

Messrs Sugden and Son of Leeds malors of machinery for the manufacture of cloth kindly furnished the author with the information from which the above remarks were gathered

If the blades were distant as in fig 924, from the want of direct support, the bar or plate would be tilted up, and become jammed this would tend further to separate the blades, and the shears would be strained or perhaps broken without dividing the bar whereas all these evils are avoided if the shears close accurately in one and the same plane as if the lower blade were shifted to the dotted line and in which case they require the least expenditure of power and act with the best effect

Having now in accordance with the general method of this work, noticed the principles on which the shears for metal act, the author will proceed to describe some of the ordinary forms of the instrument

Hand shears, which are the smallest of these tools are made of the form represented in fig 920, and vary from about four to nine inches in total length, they are much used by tinmen copper

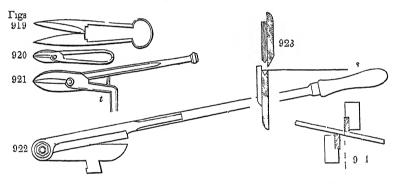


smiths, silversmiths and others who work in sheet metals, and are often called *snips*, to distinguish them from bench shears—some times however they are fixed by the one limb in the table or tail vice and then become essentially bench shears and this enables them to be used with somewhat increased power

Bench shears of the ordinary form are represented in fig 921, the square tang t, is inserted in a hole in the bench or in a large block of wood, or else in the chaps of the bench vice itself a less usual modification is seen in fig 922, with the joint at the far end and the cutting part between the joint and the hindle

Bench shears vary in total length from about one foot and a half to four feet, and the blades occupy about one fifth of the length sometimes to increase the power of these shears, the handle is forged thicker at the end to add weight, so that when

the instrument is closed with r jerk it may by its momentum cut thicker metal than could be acted upon by r simple thrust but when considerable power is required it is better to resort to the shears next described

Purchase shears which are represented in fig 925 are in every respect more powerful than those previously noticed the framing is much more massive and the cutters are rectangular bars of steel inserted in grooves to admit of their being readily sharp

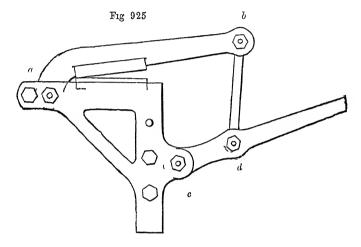

ened or renewed Instead of the hand being applied on the first lever or a b, a second level c d e, is added and united to the first by the link b, d and but for the limit of the paper the hand level c d e, would have been represented of twice its present length

As the length of the part a b is three to four times the length of c d the hand has to move through three to four times the space it would if applied directly to the shear lever, and consequently the purchase shears have three to four times the force of common shears, supposing the manual lever to be of equal length in each kind. There is usually at the back of the moving blade, a very powerful spring or back stay, to keep the two edges in contact and still further behind a stop to determine the lengths or widths of the pieces sheared off

Before using shears, in those cases where the stop is not employed to determine the width, it is usual to mak on the work the lines upon which it is intended to be sheared, the

shears he then opened to the full and the extremity of the line is placed in the angle formed by the jaws, if the work is short it is also observed whether the opposite end of the line hes exactly on the edge of the lower blade, but if the work is long the guidance is less easy. When the blades he closed the work will probably slip endlong notwithstanding the resistance of the hand until the angle at which the blades meet is so far reduced that they begin to grasp the work when the extreme edge will be first cut through and then the incision will be extended to the full length of the blades

As however each successive portion is severed, the two puts are bent asunder to the angle formed by the blades, and both pieces become somewhat curved or curled up, provided the cut is through the middle of the sheet so that both are equally strong, the two puts become curved in the same degree but when a narrow and consequently weaker piece is removed from the edge of a wide sheet, the curling up occurs almost exclusively in the narrow strip on account of its feebleness. In long pieces it is sometimes necessary to increase the curvature in order that as the work is sheared off the one part may pass above and the other below the rivet or screw by which the halves of the she us are united

When from use or accident the joint becomes loose, so as not to retain the two parts in contact in order to make the shears cut, the moving half must be pressed against that which is fixed to the pedestal or tail vice. Sometimes the sway of the blades of jointed shears is prevented, by allowing the moving aim to pass through a loop or guide which may retain it in position.

Such a guide is mostly used in the light shears with which printers cut their space line leads or those thin slips of metal inserted between the lines of type, to separate them and make the printing more open. The leads are cast in strips about a foot long, and are cut into pieces of the exact width of a page by laying them in a trough having at the end a pair of shears, and beyond these a stop to determine the precise length, so that any number of the leads may be cut exactly to the length required. Before adverting to the powerful shears used by engineers, two modifications of those already described will be noticed.

Fig 923 page 915, represents the section through the blades

of a pair of shears invented by Mr Collett, by which the tags of tin ferrules at the end of silk lices are cut and bent atone process the general aspect of the tool being that of fig 921 page 915. The shearing blades are shaded obliquely in fig 923, and to the lower, which is fluted on the edge, is attached a stop that determines the width of the piece removed from the strip s, to make the tag. The upper shear blade which is ground more acutely than usual carries a ridge piece, (shaded vertically) which compresses the strip as it is cut off, into the fluted edge of the lower blade, and thereby throws it into a channelled form, and by the employment of a pair of hollow phers, or else a light hammer and a hollow crease, the bending is readily completed and the tag attached to the coid.*

A nearly similar machine, but constructed more in accordance with the printers space line shears, is used for cutting slips of thin latter brass into the channelled pens used in stationers machines for ruling the blue and red lines on paper for account books &c. The one side of a slip of brass $1\frac{1}{2}$ inch wide, is thus cut and channelled at intervals suited to every line the sides of every channel are closed to form a narrow groove, and the intervening pieces are removed with hand shears. The compound pen is fixed on a hinged board, and a strip of thick flannel laid at the top of the pen is saturated with ink which flows steadily down all the channels whilst the paper is moved horizontally under the pens by two or three rollers and tapes somewhat as in the feeding apparatus of printing machines, and thus the whole page is ruled one way and very quickly

Shears of the above kinds with rectiline in blades are not suited to cutting out curvilinear objects such for example as the sides of collipers a fig 950, page 933. The outline of such collipers is first of all marked on the sheet of steel from a templet, and with a brass wire which leaves a sufficient trace, the outline is followed with a hammer and chiscl upon an anvil, the chiscl having a rounded or convex edge. Detached cuts running into one mother are made around the curve, and the work is finally separated by pinching it in the tail vice successively at all parts of the curve and wriggling the other edge of the sheet with the hand until it breaks


The vice is often ilso used for cutting off straight pieces which

^{*} Sec Trunsactions of the Society of Arts I ondon 1876 vol xliv proc 76

are then fixed with the line of division exactly flush with the chaps, and an ordinary straight chisel is so applied, that the chamter of the tool rests on the chaps of the vice, and the edge lies at a small angle to the work and after every successive blow the chisel is moved a little to the left without losing its general position

SECT IV —FNGINEFFS SHEAPING TOOLS, GENERALLY WOPKED BY STEAM POWER

The enliest machines of this class were scarcely more than a magnified copy of the bench shears shown on page 915 but made very much stronger, thus fig 926, represents a shearing and squeezing tool used in some non works and smithies. It has one massive piece that is fixed to the ground, and jointed to it is the lever which carries at α a pair of shearing cutters situated exactly on two ridii struck from the center of motion this

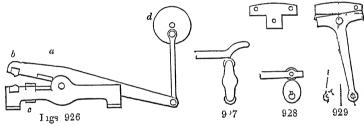

muchine has also two squeezers b, for moulding pieces of non when red hot to the particular forms of the dies. The longer end of the lever is united by a connecting rod to an excentric stud in the disk d, which is made to revolve by the steam engine


The late Mr Penn of Greenwich moved his shears by means of an axis carrying two rollers placed at the extremities of a diametrical arm, as in fig 927. The one roller acts on the radial part of the shear lever in the act of cutting and the curved part then allows the lever to descend by its own weight rapidly yet without a jerk, by the time the other roller comes into action for the succeeding stroke of the machine, which by this double excentic makes two reciprocations for every revolution of the shaft

It is however more usual to employ cams, as in fig 928, and in this case the part of the cam which lifts the she is lever is usually spiral, so as to raise it with equal velocity, the curve of

the back is immaterial provided it forms a continuous line so as to prevent the level descending with a jerk

Fig 929 represents the double shears contrived by the late Sn John Barton for the Royal Mint the one part, shown also detached presents two horizontal but discontinuous edges with the rais in the center, this piece is fixed to a firm support the other or the moving part somewhat resembles the letter T or a pendulum, to the lower end of which and beneath the floor is joined a connecting rod, that unites the pendulum with an excentive or crank driven by the engine. The machine is double or cuts on either side and has two pairs of rectangular cutters of hardened steel, which may be shifted to bring the four edges of all of them successively into action

Boiler makers have great use for powerful shears for cutting plate non from $\frac{1}{4}$ to $\frac{1}{4}$ and sometimes $\frac{3}{4}$ inch thick, and the next stage of their work is to punch the rivet holes by which the plates are attached. The two processes of shearing and punching are so far analogous in their requirements that it is usual to unite

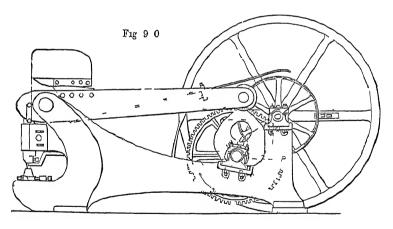

the two processes in one machine and as it sometimes happens the boiler makers yard is at a distance from the general factory, it then becomes necessary to work the shears by hand with a which handle and which is effected in the manner shown in fig 930 by the introduction of only one wheel and pinion. The wheel is fixed on the cam shaft the pinion on the same axis that carries the heavy fly wheel employed to give the required momentum, this mode of working the shearing and punching

congine is perfectly successful but of course less economical than steam or water power, the agency of which the machine is also adopted to receive

When she us that move on a joint and have radial cutters as in fig. 906 are employed for thick bus, owing to the distance to which their jaws are opened they meet at a considerable nigle and therefore from their obliquity they do not grasp the thick but but allow it to slide gradually from between them to prevent which a rigid stop is added at the part c fig. 926 when as the bar can no longer slide away it becomes severed. The she are with a idial cutters are also hable from their very oblique action to curve the plates, neither do they serve for making long cuts, as the joint their prevents the free passage of long world.


All these inconveniences however are obviated in the shearing machines with slides, in which the edges approach in a right line instead of radially and are also nearly obviated in the very massive and powerful shearing and punching tool with jointed level designed by Mr Roberts of Manchester, and represented in fig. 930 which occupies an entire length of eleven feet, and serves for cutting plates not exceeding \(\frac{3}{4} \) inch thick cutting 12 methes in length at a time, and punching holes of 1\(\frac{1}{4} \) inch drumeter in \(\frac{3}{4} \) inch iron. The shearing cutters are in this machine 1) inches long and raised above the center of motion as they lie on a chord instead of a radius, the longest pieces may therefore be cut without interference from the joint, and the cutters have the further advantage of meeting at a much smaller angle than if fitted radially

The portable punching and shearing machine shown in front and side elevation in figs 931, and 932, was also designed by M1 Richard Roberts, it will serve for a general example of such machines as the differences in the several constructions are only those of form and arrangement and not of principle

This in white stands upon a base of a triangular form and has in front a strong chamfer slide, which is reciprocated in a vertical line, by an excentile that is concealed from view it being immediately behind the slide, and upon the same axis as the excentile is the toothed wheel. The pinion that tall es into this which is on the shaft that curries the fly wheel, and one of the units of the latter, receives the handle by which the machine is

usually worled, or if it is driven by power, fast and loose pulleys are then fixed on the same axis as the fly wheel

The upper put of the slide carries a hearing cutter which is about 7 inches wide, and meets a similar cutter that is fixed to the upper and overhanging part of the casting. The cutters although ground with nearly rectangular edges, are bevilled to

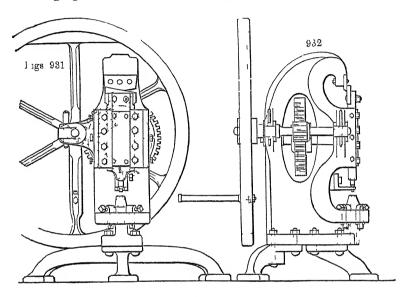

the extent of about three fourths of an inch in the direction of their length, that they may commence their work on the one edge, and therefore more gradually than if the entire width of the cutter penetrated at the same instant—this degree of obliquity does not cause the worl—to slide from the shears—neither does it materially curl up the work—and as the blades are quite clear of the framing a cut may be extended throughout the longest works provided the cut is not more than five anches from the edge of the plate—the distance of the cutters from the framing of the machine.

The above machine which measures in total height about five feet, makes 12 or 15 strokes per minute, shears $\frac{1}{2}$ inch from plates and punches $\frac{1}{4}$ holes in from $\frac{1}{4}$ inch thick. A larger machine makes 10 or 12 strokes per minute, shears $\frac{3}{4}$ inch plate and punches $1\frac{1}{4}$ inch holes in from $\frac{3}{4}$ inch thick. and a still heavier machine working it 8 or 10 strokes in the minute, shears

I much plates, and punches 2 much holes in mon 1 much thick some of these are provided with railways by which the worl is carried to the shours or punches as will be described and Mi Roberts but cutting machine having only shearing cutters at the bottom and the excentile at the top of the slide is used for cutting bars not exceeding $6\frac{3}{8}$ inches wide by $1\frac{5}{8}$ thick or bars 2 or $2\frac{1}{8}$ square, but he thinds these dimensions of the works performed might if required be greatly exceeded in he wire machines

A pitent has been recently granted to Mr G B Thorney croft for a she using machine for cutting wide plates of sheet from this machine which is used in the manufacture of wrought from has two wide cutters of steel fixed to the edges of thick plates of cast from the lower cutter is at rest and quite horizontal the upper cutter but is fitted in grooves at the end of the frame so is to be carried up and down vertically by a shaft or spindle im mediately above the cutter and parallel with it this shaft has an executive it each end and one in the center, and three connecting links which attach the cutter frame to the excentices, and give it a small reciprocating motion. The upper cutter is a little oblique so as to begin to act at the one end, and in removing the strips cutls them but very little.*

Nismyth Giskell and Co's vice for cutting wide pieces of boiler plate is bised on the mode of cutting thin slips of sheet metal over the chaps of the ordinary tall vice as described on page 918.9. The jaws of the machine are about six feet long faced with steel, and powerfully closed by two perpendicular screws and nuts, one at each end, which also secure the machine to the ground

The plate of non is therefore fixed horizontally and with the line of division level with the jaws. A strong rod chisel struck with sledge hummers is applied successively along the angle formed between the work and the vice, and after the non has been indented the whole length, the blows of the sledges directed on the overhanging piece of non complete the separation †

ling 933 represents the plan, and fig 934, the partial vertical section of a 'hydraulic machine for cutting off copper bolts,'


I homogenoit slatent scaled 31st January 1843 is de cubed in the Repertory of 1 itent inventions vol ii Lulurged Series page 129

[|] Nasmyth Gislell and Co scutting vice is figured in plate 49 of Buchanan's Mill Work, edited by Sir G Rennie TRS 1841

devised by Mi A M Renton, and constructed for the Government Dock Yards by Messrs Charles Robinson & Son This machine is actuated by the hydro-mechanical principle discovered by the celebrated predecessor of the firm, Mr Timothy Branch

The circle in fig 933 represents the cylinder of a hydrostatic press which is flattened to the width of the rectangular bar that is fixed alongside the cylinder, the two being enveloped in the external casting which is shaded in the section fig 931 and resembles a stunted pillar three or four feet high. The whole of the parts are traversed by nine sets of holes suitable to bars from $\frac{3}{5}$ to $2\frac{1}{2}$ inches drameter, the holes where they meet on the lines b b, are furnished with annular steel cutters and are enlarged outwards each way to admit the work more easily

The rod r r, to be sheared is introduced whilst the holes are directly opposite or continuous and the men then pump in the injection water through the pipe w, it acts upon the annulus or shoulder intermediate between the two drameters of the cylinder,

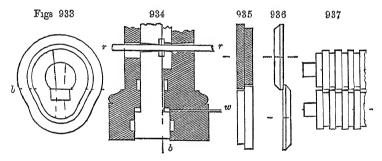

causes the descent of the latter with a pressure of about 100 tons and forces the bar asunder very quietly, and from the annular form of the cutters without bruising it. When the bar has been cut off, the injection water is allowed to flow out from beneath the cylinder, and the latter is raised by a loaded lever beneath the floor ready for the next stroke. The machine is far more economical in its action, than the old mode of cutting off the copper bolts with a frame saw used by hand and the storekeeper in charge of the bolts, can if needful perform the entire operation unassistedly, although usually four men work the pair of one inchangection pumps by a double ended lever as in a fire engine

In concluding this chapter it is proposed to speak of the rotary she us for metal which have continuous action like rollers and are pretty generally used. In the best form of the instrument,

two spindles connected together by toothed wheels of equal size have each two thin disks of different diameters which are opposed to each other, that is a large and a small in the same plane, as in the diagram fig 935, the larger disks overlap each other and travel in lateral contact, and therefore act just like shears, and the two disks in each plane meet, or rather nearly meet, so as just to grasp between them, after the minner of flat ting rollers, the two parts of the strip of metal which have been severed, and by currying these forward they continually lead the yet undivided part of the metal to the edges of the larger disks, which in this manner quickly separate the entire strip of metal into two parts

The machine requires that the spindle carrying the disks should have an adjustment for lateral distance as in flatting rollers, to adapt their degree of separation to the thickness of the metal to be sheared. One of the spindles should also have an endlong adjustment to bring the disks into exact lateral contact and the machine requires in addition a fence of guide, fixed alongside the revolving shears to determine the width of the strips cut off. Sometimes the two smaller disks are omitted and the larger alone used, as in fig. 936, the circular shears are then somewhat less exact in their action, but perform acverthe less sufficiently well for most purposes.

Cheulu or rotary shears, are very useful for shearing plates not exceeding one eighth of an inch thick, and one of the advantages which the rotary possess over the common shears, is the ficility with which curved lines may be followed, on account of the small portion of the disks that are in contact whereas the length of rectilinear shear blades prevent their ready application to curves. Of course the speed at which the machines may be driven depends on the nature of the work, and if the cuts are straight and the plates light, the velocity of the shears may be considerable

As remarked on page 188 of the first volume, the circulus shears of splitting folls used in the works where wrought from is manufactured, are composed of steel disks of equal thickness, but of two diameters, arranged alternately upon two spindles is in fig 937, so as at one action to split thin plates of non of about 6 inches in width into very narrow pieces known as mall rods and into strips from half to one inch wide designated as bundle of split from Of course different pairs of rolls are required for every different width of the strips thus manufactured

CHAPTER XXX

PUNCHES

SECT I -INTRODUCTION PUNCHES USLD WITHOUT GUIDES

The title of the present chapter, may at the first glance, only appear to possess a very scanty relation to the tools used in mechanical manipulation, as the ostensible purpose of a punch may be considered to be only that of making a round or square hole in any thin substance. But it frequently happens that the small piece or dish so removed by the punch, is the particular object sought, and some of the very numerous objects thus made with punches assume a very great importance in the manufacturing and commercial world as will perhaps be admitted when a few of these are referred to in the course of the present chapter

The general character of a punch is that of a steel instrument the end of which is of precisely the form of the substance to be removed by the punch, and which instrument is forcibly driven through the material by the blow of a hammer. When the subject is entertained in a moderately extended sense it will be seen that much variety exists in the forms of the punches them selves and also in the modes by which the power whereby they are actuated is applied

So far as relates to the actual edges of the punches by which the materials are severed they may be classed under two principal divisions, namely duplex punches and single punches. The duplex punches have rectingular edges and are used in pairs often just the same as in shears for metal. The single punches have sometimes rectangular but generally more acute edges the one side being mostly perpendicurar

The single punches require a firm support of wood lead time copper, or some yielding material into which the edge of the punch may penetrate without injury, when it has passed through the material to be punched. Consequently many of the tools the author has ventured to consider as single punches might be classed with chisels and many of the duplex punches might be classed with shears analogies which it is not worth while cither to pursue or refute

The following classification has been attempted, as that best calculated to throw into something like order, the miscellaneous instruments that will be more or less fully described in this chapter namely,

Section I Punches used without guides

- II Punches used with simple guides
- " III Punches used in fly presses and miscellaneous examples of their products
 - , IV Punching machinery used by engineers

It is proposed in all the sections to commence with those punches hiving the thinnest edges, and which are used for the softest materials.


It would be hardly admitted that a carpenter's chisel driven by a mallet through a piece of card could be considered as a punch, still the circular punch used with a mallet on a block of lead for cutting out circular disks of card for gun wadding is indisputably a punch and yet so neely more than a chisel bent round into a hoop. The gun punch is formed as in fig. 938 over leaf and is turned control without and cylindrical within or rather a little larger at the top that the waddings may freely ascend, and make their way out at the top through the aperture, when however annular punches exceed about 2 inches in diameter it is found a stronger and better method, to make them as steel rings attached to iron stems or centers spread out at the ends to fill the rings, as in fig. 939 but holes are then required to push out the disks that stick into the punch, as shown by the section beneath the figure 939

The punch used in cutting out wafers for letters is nouly similar, it being formed as a thin cylindrical tube of steel fitted to the end of a perforated biass cone having at the top two branches for the cross handle, by which it is pressed through several of the farm iceous sheets and as the wafers accumulate in the punch they escape at the top. Confectioners use similar cut ters in making lozenges and frequently the thin steel cutter is fixed to a straight perforated handle of wood. The lozenges are cut out singly and with a twist of the hand

When the disk is the object required the punch is always chamicied exteriorly is then the edge of the disk is left square and the external or wasted part is bruised or bent but the

punch is made cylindrical without and conical within when the annulus or external substance is required to have a keen edge. And when pieces such as washers or those having central holes are required in card or leather, the punches are sometimes constructed in two parts as shown separated in fig. 940 the inner being made to fit the outer punch, and their edges to fall on one plane so that one blow effects the two incisions and the punches may then be separated for the removal of the work should it stick fast between the two parts of the instrument

Punches of irregular and arbitrary forms, used for cutting out paper, the leaves for artificial flowers, the figured pieces of cloth for uniforms and similar things are made piecesely after the man ner of fig 938, and also of fig 939, except that they are forged

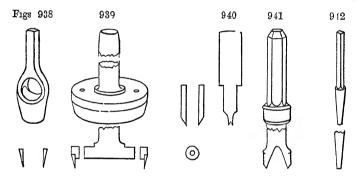

in the solid or without the loose ring. These rinegular punches use however much more tedrous to make, than the circular, which admit of being fashioned in the lathe


Figured punches of much larger dimensions have been of late used for cutting out the variously formed papers used in making envelopes for letters. The punch or cutter is sometimes made in one piece as a ring an inch to in inch and a half deep, or else in several pieces screwed around a central plate of non and when the punch is sharp it is readily forced through three to five hundred thicknesses of paper by the slow descent of the screw press in which it is worked. Army clothiers use similar instruments for cutting out the leather for shoes and various other parts of military clothing and several of these punching or cutting tools are often grouped together.

Proceeding to the punches used for metal, those having the thinnest edges are known as hollow punches—they are turned

of various diameters from about $\frac{1}{1}$ to 2 inches, and of the section fig 911 they are always used on a block of lead, and sometimes for two or three thicknesses at a time of tinned from copper of zinc. Punches 942, smaller than $\frac{1}{4}$ inch, are generally solid, quite flat at the end, and are also used on a block of lead which although it gives a momentary support, yields and receives into its surface the little piece of metal punched out by the tool

Fig 944, represents the punch used by smiths for red hot iron the tool is solid and quite flat at the end, and whether it is round, square, or oblong in its section, as for producing the holes represented, it is parallel for a short distance then gradually enlarged, and afterwards hollowed for the hazel rod by which it is surrounded to constitute the handle (see foot note, page 202 vol 1). Various practical remails on the application of the smith's punches are given on pages 215—217 of vol 1 it will be thence seen that the smith's punch is frequently used along with a bottom or bed tool known in this case as a bolster and which has a hole exactly of the same area as the section of the punch itself.

Punches when used in combination with bolsters are clearly similar in their action to the shears with rectangular edges, as will be seen on comparing fig. 943 and 914, the only difference

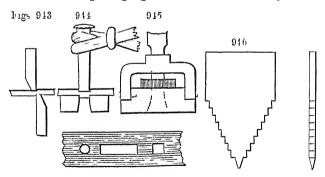

being that the straight blade of the shears, is to be considered as bent round into a solid encle for a circular punch or converted into a square, rectangle, or other figure as the case may be, but every part of the punch should meet its counterpart or the bolster in lateral contact the same as formerly explained in reference to shears. This supposes the tools to be accountely made and correctly held by the smith, but which is somewhat difficult,

because, the bolster, the work and the punch, are all three simply built up loosely upon the anvil and the eye can render but little judgment of their relative positions the punch is consequently apt to be misdirected so as to catch against the bolster and damage both tools. The mode sometimes used to avoid this inconvenience is represented in fig. 945 in which a guide is introduced to direct the punch but agreeably to the proposed arrangement this figure will be more fully explained in the next section when some other tools of a lighter description have been spoken of


Previously however to concluding this present section atten tion is requested to fig 946 which shows a punch used by haip makers and others in cutting long mortises in sheet metal. The punch is parallel in thickness, and has in the center a square point from which proceed several steps, this punch is used with a bolster having a narrow slit, as long as the width of the punch A small hole is first drilled in the center of the intended mortise. the first blow on the punch converts this into a square the next cuts out two little pieces extending the hole into a short mortise and each successive blow cuts out a little piece from each end thereby extending the mortise if needful to the full width of the punch From the graduated action the method entails but little risk of breaking the punch or bulging the metal, even if it should have but little width Sometimes to make the punch act less energetically at the commencement of its work the steps it the point uen idesmiller both in height and width the seriated e lge then becomes curved instead of angular as shown

SECT II -- PUNCHES USED WITH SI IPLE GUIDES

Beginning this section with the tools having the most route edges, we have to refer to the punch phers, fig. 947, fitted with roundhollow punches for making holes in leather straps and thin materials some phers of this land have a small oval punch terminating in a chisel edge, for cutting those holes that have to be passed over buttons, and phers have been made with circular, square and triangular punches for the circular practice of marking sheep in the ear. In all these tools the punch is made to close upon a small block of ivory or copper so as to on une the material being cut through without injuring the punch.

Another example of slender chisel like punches is to be seen in Mi Rogers machine for cutting the teeth of horn and tor torseshell combs (see page 130 vol 1). The punch or chisel is in two parts slightly inclined and curved at the ends to agree in form with the outline of one tooth of the comb the cutter is attached to the end of a jointed arm moved up and down by a crank, so as to penetrate almost through the material, and the uncut portion is so very thin that it splits through at each stroke and leaves the two combs detached

The little instrument called a pen making machine is another ingenious example of punches moving on a joint, it is represented of half its true size, and ready to receive the pen, in fig 918, and in fig 949 the two cutters are shown of full size and

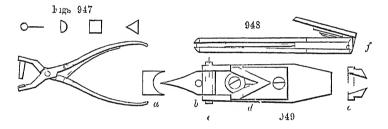

laid back in a right line—although in reality it only opens to a right angle—The lower half has a small steel cutter b pointed to the angle of the ribs of the pen and fluted to the curve of the quill as at a, the upper cutter d is made as an inverted angle with nearly vertical edges as seen at e, which exactly correspond with the lower cutter, so as between them to cut the shoulders of the pen—The upper tool also curres a thin blade or chisel, which penetrates nearly through the quill and forms the slit

The quill having been pared down to its central line, is inserted through the hollow joint, on the line f and the cutters being very near the joint the lever on being closed gives abund ant power for the penetration of the punches. The pen requires to be afterwards nibbed, and for which purpose another cutter is attached to the instrument which has likewise an ordinary pen blade, so as to be entirely complete in itself

This method of producing a pen was introduced in a some what different form, in the late Mr Timothy Li unth's patent machinery for making portable quall pens, the barrel of the quall

was in that case cut into two lengths and each length being split longitudinally into three parts, and shaped it each end in a smill fly press with cutters of the above character converted every quill into six double ended pens, many thousand boxes of which were made they may be considered to have opened the path to the present truly enormous manufacture of steel pens, which consumes many tons of steel annually

Passing from the punches with guides obtained by means of joints and actuated by the pressure of the fingers, we will return to fig 945 on page 929 which with its simple guide becomes a very effective tool sometimes known as the hammer press in contradistinction to the screw or fly press to be hereafter spoken of

The guide in the contrivance fig 945 is a strong piece of non attached to the bottom tool and sufficiently above it to admit the work between the two Each part is pieced with a hole of exactly the same size, and accurately formed as if they were interrupted portions of the same hole. The punch is made exactly to fit either hole, so that from the upper it receives a correct guidance, and it therefore cuts through the material and penetrates the lower piece, with a degree of precision and truth scarcely attainable when the tools are unattached, and are used simply upon the anvil as before described

As however the punch mostly sticks tight in the work it is needful to turn the instrument over, and drive out the punch with a drift a little smuller than the punch and on which account punching tools of this kind are often made of two parallel plates of steel firmly united by sciews or steady pins yet separated enough for the reception of the work, and frequently contrivances are added to guide the works to one fixed position, in order that any number of pieces may be punched exactly alike


Thus in punching circular mortises as in the half of a pair of inside and outside callipers a, fig 950, the punch c is first used to produce the central hole, and this punch is then left in the bed b, to retain the work during the action of the second punch m by which the mortise is cut. The punch m is very short to avoid the chance of its being broken, and it is also narrow so is to embrace only a short portion of the mortise, which is then completed with little risk to the tool, at three or four strokes whilst the punch c serves is a central guide

Occusionally also punches of this simple kind, but on a lugar

so de have been placed under drop hammers, falling from a con siderable height through guide rods, somewhat as in a pile driving machine. This mode of obtaining power is not suited to the action of punches used in cutting out metals amongst other reasons, because the punch sticks very haid in the perforation it has made, and requires some continuance for pulling it out which is not so easily obtained in this apparatus as in fly presses, that are suited alile to large and small works

The drop hummer or as it is more commonly called a force is however, very much used it Brimingham in the manufacture of stamped work, or such as are figured between dies, of which an example is described at length in pages 109 & 410 of vol 1 Compared with a fly press of equal power the force is less expensive in its first construction, but it is also less accurate in its performance

Fig 951 is a very simple jet effective tool which may be viewed as a simplification of the fly piess it consists of one very strong piece of wrought non, about one inch thick and

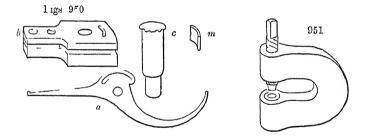

four or five inches wide, thickened at the ends and bent into the form represented, the one extremity is tapped to receive a coarse screw, the end of which is formed as a cylindrical pin, or punch that is sometimes made in the solid with the screw, but more usually as a hardened steel plug inserted in a hole in the screw. Immediately opposite to the punch is another hole in the press, the extremity of which is fitted with a hardened steel ring or bed punch. When the screw is turned round by a lever about three fect long it will make holes as large as \frac{3}{4} inch drameter in plates \frac{3}{6} inch thick, and is therefore occasionally useful to boiler in deers for repairs, and also for fitting works in confined situations about the holds of ships, and other purposes. When this screw is turned backwards the punch is drawn out

and relieved from the work but the screwing motion is apt to wear out the end and side of the punch and therefore to alter its dimensions

A very convenient instrument of exactly the same 1 and is used in punching the holes in leather straps by which they are laced together with leather thougs or united by screws and nuts to constitute the endless bands or belts used indiving machinery. In this case the frame of the tools made of gun metal, and weighs only a few ounces the end of the screw is formed as a cutting punch and it is perforated throughout that the little cylinders of leather may work out through the screw, which only requires a cross handle to adapt it to the thumb and fingers

In this case the sciewing motion is desirable, as the punch in revolving acts partly as a knife, and therefore cuts with great facility as the leather is supported by the gun metal which constitutes the clamp or body of the tool

SECT III —PUNCHES USFD IN FLY PPESSFS AND MISCELLANEOUS EXAMPLES OF THEIR PRODUCTS


The punches used in fly presses do not differ materially from those already described, but it appears needful to com mence this section, with some explanation of the principal modi fications of the press itself. The fly press is a most useful machine which, independently of the punch or dies wherewith it is used may be considered as a means of giving a hard, uneiling perpendicular blow as if with a powerful well directed The precision of the blow is attrined by the slide whereby the punch it guided the force of the blow by the heavy revolving fly attrched to the sciew of the press When the machine is used the fly is put in lapid motion, and then sud denly unested by the dies or cutters coming in contact with the substance submitted to their action The entire momentum of the fly directed by the agency of the screw is therefore inst in taneously expended on the work to be punched or stamped and the reaction is frequently such as to make the screw recoil to nearly its first position

The bare enumeration of the multitude of articles that are partially or wholly produced in fly presses, would extend to considerable length, as this powerful and rapid auxiliary is not only

employed in punching holes and cutting out numerous articles from sheets of metal and other materials but also in moulding stamping bending or raising thin metals into a variety of shapes and hill ewise in impressing others with devices as in medals and coins

Fig 952 represents a fly press of the ordinary construction, that is used for cutting out works and is thence called a cutting press in contradistinction to the stamping or coining presses. It will be seen the body of the press which is very strong is fixed upon a bed or base that is at right angles to the series the

latter is very coarse in its pitch and has a double or tuple square thread the use of which is from about one to s x inches in every revolution The nut of the sciew is mostly of gun metal and fixed in the upper part or head of the piess The top of the sciew is squire or hexi gonal, and carries a lever of wrought non terminit ing in two solid cast non bills that constitute the fly, and from the lever the

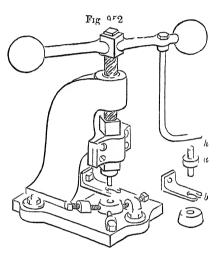

additional piece h, descends to the level of the dies to serve as the handle, so that the left hand may be used in applying the material to be punched whilst the right hand of the operator is employed in working the piess

The screw is generally attached to a square but called the follower, which fits accurately in a corresponding aperture and is strictly in a line with the screw and to the follower is attached the punch shown detached at a. The punch is sometimes fitted into a nearly cylindrical hole and returned by a transverse pin or a side screw, but more generally the die is screwed into the follower, like the chucks of some turning lathes—the bed or bot tom die c which is made strictly parallel rests on the base of the press, and is retained in position by the four screws that pass through the four blocks called dogs—these screws, which point

a little downwards allow the die to be accurately adjusted so that the punch may descend into it without catching at any part, and thereby inflicting an injury to the tools

The piece b which rests nearly in contact with the die is called the puller off, it is perforated, to allow free passage to the punch when the latter rises, it carries up with it for a short distance the perforated sheet of metal that has been punched through, but which is held back by the puller off whilst the punch continuing its ascentiases above the puller off and leaves behind the sheet of metal so released, the sheet is again placed in position whilst another piece is punched out and so on continually

Before proceeding to speak of some of the works produced in stamping presses at as proposed to describe some of the points of difference met with in fly presses

The body of a cutting press is in general made with one aim, as represented in fig 952, because the sheet of metal can be more freely applied to the die, but stamping and coining presses which are used for precess that have been previously cut out require greater strength, and have two aims, or are made some what as a strong lofty bridge with the screw in the center

The fly of the press is frequently made as a heavy wheel which may be more massive and is less dangerous to bystanders than the lever and balls and in large presses there are two, three or four handles fixed to the 11m as many men then run round with the fly and ledgo when the blow is struck

Fly presses are variously worked by steam power—thus in the Royal Mint the twelve presses for cutting out the blanks or disks for coin, are uranged in a circle around a heavy fly wheel which revolves horizontally by means of the steam engine—The wheel has one projecting tooth or cam—which catches successively the twelveradral levers fixed in the screws of the presses, to cut the blanks and twelve springs immediately return the several levers to their first positions, ready for the next passage of the cam on the wheel


The fly and sciew are also worked by power in some cases by an excentice or crunk movement fixed at a distance, a long connecting rod then unites the crunk to an arm of the wheel or to a straight lever, and gives it a reciprocating movement

At other times, in place of the crank motion are ingeniously

substituted a piston and cylinder worked after the manner of an oscillating steam engine, if we imagine the boiler to be superseded by a large chamber, exhausted by the steam engine nearly to a vacuum thus constituting an an engine, the one side of the piston being opened for a period to the exhausted chamber whilst the other receives the full pressure of the atmosphere. This mode is adopted in several Mints constructed by Mi Hague of London for foreign countries, and the author believes it is also employed for the stamping or coming presses of our national Mint.

In the manufacture of steel pens, (see page 9423) it is important to have an exact control over the punches which cut the slits and those which mark the inscriptions as by descending too far they might disfigure the steel or even cut it through Accordingly Mi Mordan introduced between the head of the press and the lever, an adjustable ring which acts as a stop and only allows the punches to descend to one definite distance until in fact the ring is pinched between the press and lever

The sciew of the fly piess is sometimes superseded by a continuance known both as the toggle joint and as the knee joint. The two parts a, b and b, c, fig. 953, are jointed to each other at b,

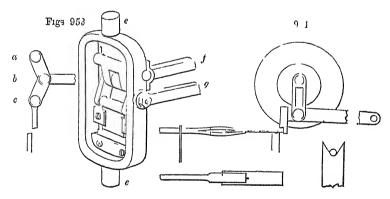

the extremity a is jointed to the upper part of the press, and c, to the top of the follower. When the parts a b, and b c is inclined at a small angle, the extremities a, and c is brought closer together, and ruse the follower but when the two levers are strughtened, a and c separate with a minute decree of motion, but almost missistible power, especially towards the

r See Encyclep edia Metropelitma put Munificture – wir le Cenni

completion of the stroke The bending and straightening of the toggle joint, is effected by the revolution of a small crank, united to the point b fig 953, by a connecting rod b f

Presses with the toggle joint are perfectly suited to cutting out works with punches and bolsters provided the relative thick ness of the work and tools are such, as to bring to bear the strongest point of the mechanical action at the moment the greatest resistance occurs in the work but as the fly press with a sciew is in all cases powerful alike, irrespective of such propor tions, provided alone that there is sufficient movement to create the required momentum, the fly press is more generally useful

The cut 954 refers to a level piess worked by an excentric, and used in cutting brads and nails, which will be again alluded to when this manufacture is briefly noticed

It is now intended to describe a few examples of works executed in fly presses giving the preference to those appertaining to mechanism

The round disks of metal for coin are always cut out with the fly press and are then called blanks, the punch being a solid cylinder, the bed or bolster a hollow cylinder that exactly fits it In the gold currency, more especially great care is taken to make these punches as nearly as it is possible mathematically alike in diameter, and the sheets of gold also mathematically alike in thickness, by aid of the drawing rollers or rather drawing cylinders referred to in vol r page 428, but notwithstanding every pre caution the pieces or blanks when thus prepared, do not always weigh strictly alike This minute difference is most ingeniously remedied, by using the one error as a compensation for the Trial is made at each end of every strip of gold and by cutting the thicker gold with the smaller punches, the adjust ment is effected with the needful degree of accuracy so that every piece is made crititically time in weight without the tedious necessity for weighing and scraping otherwise needful

Buttons are mide in enormous quantities by means of the fly press. That metal buttons should be thus cut out with tools and stamped with dies, will be immediately obvious to all, but the fly press has been also more or less employed in making buttons of horn shell, wood, papier mache and some other materials. Amongst others may be noticed the silk buttons called, Florentine

buttons, each of which consists of several pieces that are cut out in piesses then enveloped by the silk covering and clasped together at the back, (in the press) by a perforated from disk the margin of which is formed into 6 or 8 points that clutch and hold the silk, whilst the cloth by which the button is sewed on is at the same time protruded through the center hole in the back plate of the silk button details that may be easily inspected by pulling one of them to pieces. Indeed great ingenuity has been displayed, and many patents have been granted, for making this necessary article of dress, a button

Round washers that are placed under bolts and nuts in machinery, are punched out just like the blanks for coin, although in punching the larger washers that measure 5 and 6 inches in diameter and $\frac{1}{4}$ inch thick, with the ordinary fly presses the iron requires to be made red hot


The round or square holes in the washers are made at a second process with other tools and to ensure the centrality of the holes, some kind of stop is temporarily affixed to the lower tool. The more complete stop is a thin plate of non hollowed out at an angle of from 90 to 120 degrees and screwed on the top of the bed as this may be set forward to suit various drameters. But the more usual plan is to drill two holes in the bed to drive in two wires and to bend their ends flat down towards the central hole as also shown in fig. 955 overleaf the ends of the wires are filed away until after a few trials it is found the blank when held in contact with the stops by the left hand is truly preced, the whole quantity may be then proceeded with as rapidly as the hands can be used, with confidence in the centrality of all the holes thus produced

Chains with flat links that are used in machinery are made in the fly press. The links are cut out of the form shown at a, fig 956 the holes are afterwards punched just as in washers and one at a time every blank being so held that its circular extremity touches the stops on the bed or die, and thereby the two holes become equidistant in all the links which are afterwards strung together by inserting wire rivets through the holes

The pins or rivets for the links are cut off from the length of which in the fly piess by a pan of cutters like wide chisels with square edges, assisted by a stop to keep the pins of one length or by one strught cutter and an angular cutter hollowed to about

60 degrees or by two cutters each hollowed to 90 degrees. In the three cases the wire is respectively cut from two three, or four equidistant parts of its circumference semicircular cutters are also used. The straight cutters first named, are moreover very usefully employed in the fly press for many of the smaller words that would otherwise be done with shears.

Sometimes the succession of the links for the chain is one and two links alternately as at b fig 956 at other times 3 and 9 or 4 and 3 links, as at c, and so forth up to about 9 and 8 links

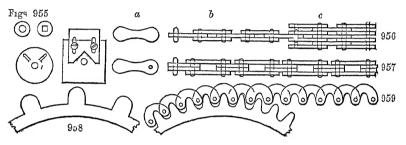

alternately which are sometimes used and the wires when inserted are slightly riveted at the ends

The pin is generally the weakest part of the chain and gives way first but in the chains with 8 and 9 links the pin must be cut through at 16 places simultaneously, before the chain will yield

Chains are sometimes intended to catch on pins or projections around a wheel of the kind shown in fig 958 to fulfil the office of leather bands without the possibility of the slipping which is apt to occur wit¹ bands when subjected to unusual strains

Such chains are made after the manner shown in fig 957 to constitute the square openings that fit over the pins of the wheel the central links are made shorter by which means the apertures are brought closer together than if the longer links were used throughout. Fig 959 shows a different lind of chain, that has been used for catching in the teeth of an ordinary spur wheel with epicycloidal teeth, the author believes this chain to have been invented by the late Mr. John Oldham, Engineer to the Bank of England

Chains for witches time pieces, and small machinery, are too minute to be made as above described therefore the slip of steel is first punched through with the rivet holes required for a number of links, by me ins of a punch in which two steel

whies are inserted—the distance between the intended links is obtained (somewhat as in file cutting,) by resting the burns of the two previous holes against the sharp edge of the bed or bolster—The links are afterwards cut out by a punch and bolster of the kind already noticed, but very minute, and the punch has two pins inserted at the distance of the rivet holes, the slip of steel being every time fitted by two of the holes to these pins, all the links are thereby out centrally around the rivet holes

The tools are carried in a thick block having a perpendicular square hold fitted with a stout square but, the latter is driven with a hummer, which is supported on pivots a used by a spring and worked by a pedal but when the links measure from ! to ! an inch in length, such tools are worked by a screw

The punches are fitted to the side of the square bar, in a projecting loop or mortise, and secured by a wedge. They are drilled with holes for the pins, and across each punch there is a deep notch to expose the reverse ends of the pins, in order that when broken they may be driven out and replaced. The pins are typer pointed that they may raise buris, instead of cutting the metal clean out, and being typer, no puller off is required, and the bed tools are fitted in chamfer grooves in the base of this old yet very efficient instrument.

A luge chun for a poel et chronometer now before the author, measures nearly 14 inches in length, and contains in every inch of its length 22 fivets and also 35 links (in three rows) the total number of pieces in the chain is therefore 770, and its weight is 91 grains. A chain for a small pocket witch measures 6 inches in length, and has 12 rivets and 63 links in every inch in all 630 pieces, and yet the entire chain only weighs one grain and three quarters.

The square links of chains for jewellery are often cut out with punches, the exterior and interior being each rectingular after which each alternate link is slit with a fine saw for the introduction of the two contiguous links and then soldered together so that the gaps become filled up. Other chains are drawn as square tubes and cut off in short lengths with a saw these after having been strong together are often drawn through a draw plate with round holes to constitute chains which present in almost continuous cylindrical surface like round wire, a very next manufacture invented in France.

The teeth of saws are for the most part cut in the fly press. Teeth of the forms figs 643 to 647 page 684 whether large or small require but one punch the sides of which meet at 60 degrees. I wo study are used to direct the edge of the blade for the saw to the punch, at the required angle depending on the putch or inclination of the teeth and an adjustable stop determines the space or interval from tooth to tooth, by catching against the side of the last tooth previously made. Gullet teeth figs 6.0 to 653 and the various other kinds shown, require punches of their several compounded figures, and of different dimensions of each size of tooth

The teeth of circular saws are similarly punched out by mounting the perforated circular disk on a pin or axis, but in cutting the last six or eight teeth it is needful to be watchful so as to divide the remaining space into moderately equal parts

In cutting the teeth of circular saws not exceeding 12 inches diameter, Holtzapffel and Co have been in the habit of mounting the steel plates on a spindle in a lathe with a dividing plate, and using a punch and bed fitted to a square socket fixed horizontally in the ordinary test of support for the turning tool the punch being driven through the plate by one revolution of a small of cam, by means of a winch handle and thrown back by a spring. In this arrangement the dividing plate ensures the exact dimensions and equality of the teeth which are rapidly and accurately cut

The copper caps for percussion guns are punched out in the form of a cross with short equal arms or sometimes in a similar shape with only three arms, and the blanks after having been annealed, are thrown into form by means of dies, which fold up the arms and unite them to constitute the tubular part whilst the central part of the metal forms the top of the cap that receives the composition and sustains the blow of the hammer

Steel pens are mother most prolific example of the result of the fly press they pass through the handsmany times, and require to be submitted to the action of numerous dies, to five of which alone we shall advert. The blanks are cut by dies of the usual kind so is in general to produce a flat prece of the exterior form of fig 960 page 914, the square mortise at the bottom of the slit is then punched through the next process is usually to strike on the blanks the maker's name

The sht is now cut by a thin chisel like cutter, which makes an angular gap nearly through the steel, from that side of the metal intended to form the inner or concave part of the pen and the act of curling up the pen into the channelled form, brings the ingular sides of the groove into contact, rendering the slit almost invisible. The slit which is as yet only part way through the pen is in general completed in the process of hardening, (see vol 1 page 249) as the sudden transition into the cooling liquid generally causes the little portion yet solid to crack through, or else the slit remains unfinished until the moment the pen is pressed on the nail to open and examine its mbs


Lauviere's perforated plates for strainers lanterns, mert safes, colunders and numerous other articles exhibit great delicacy and accuracy in the mode in which they are punched out, the tools are illustrated by the enlarged sections, fig 961 overleaf punch consists of a plate of steel called the punch plate, which is in some cases pierced with only one single line of equi distant holes, that are countersunk on their upper extremities Every hole is filled with a small cylindrical punch made of steel wne, the end of which is bumped up or upset to form a head that fills the chamfer in the punch plate so that the punch cunnot be drawn out by the work in the ascent of the press The bed punch or matrix has a number of equidistant holes corresponding most exactly with the punches In this case the holes in the work are punched out one line at a time, and between each descent of the punches, the sheet of metal is shifted laterally by a screw slide, until it is in proper position to acceive the adjoining line of holes

At other times the tool instead of having only one line of punches is wide and entirely covered with several lines, so as to punch some hundreds or even thousands of holes at one time. For circular plates the punches are sometimes arranged in one radial line but more usually, the whole of the punches required for the fourth, sixth, or eighth part of the circular disk are placed in the form of a sector and the central hole having been first punched, is made to serve as the guide for the four, six, or eight positions, at which these be utiful tools are applied

Many of the thin plates thus punched require to be strained like the head of a drum to keep the metal flat, in which case the metal is grasped between little clamps or vices around its four

cages and then stretched by appropriate screws and slides with which the apparatus is furnished and the same mechanism prevents the metal from rising and therefore fulfils the office of the puller off commonly used with punches

The construction of the tools above described, calls for the greatest degree of precision the drill employed to preice the punch and matrix is of the land fig 474 page 547 and of exceedingly small size in the finest perforated works, as it is

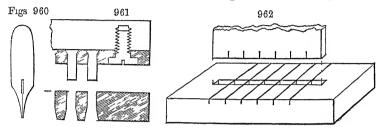

said so many as six of seven hundred holes have been inserted in the length of six inches which, considering the intervening spaces to be half as wide as the diameter of the holes would make the latter of the minute size of only six thous indths of an inch diameter. Such finely perforated metal appears to office nearly the transparency of muslin and is a manifest proof of the great skill displayed in the construction of the instruments and in conducting the entire process *

Mi Julius Jefferys Patent Respirator or breath warming apparatus for persons having delicate lungs presents another very near example of punched works. Most persons will have had an opportunity of seeing that the apparatus consists of about a dozen very thin plates of metal punched out with several rows of large rectangular holes leaving the metal like a delicate lattice. These lattices are severally wound round with fine wire and then assembled together between perforated covers. The exhalation of the breath amidst the interstices of the wires warms the instrument and the instrument in return, warms the un that is inhaled by the wearer

To raturn to the operation of punching the lattices, it is to

^{*} M Marc Luivides patent was granted 28th Nov 1825 and is described in the Repertory of Patent Inventions vol in 31d Series, page 182 Some other puticulus are to be found in Gill's Technical Repository, vol ix 1826, page 75 translated from the Bibl Univ, for Dec 1824

be observed these measure from center to center half an inch in length and one fifth of an inch in breadth, the bed punch which is represented in fig. 962 is a piece of steel about $\frac{7}{4}$ inch thick, having a central aperture, $3\frac{1}{4}$ inches long, and 18 hundredths of an inch wide as the long bars of the lattices are two hundredths wide. Six transverse notches, one eighth of an inch deep and half an inch issunder are then made across the bed with a circular saw three hundredths of an inch thick the grooves are fitted with slips of hardened steel, after which the whole is ground to a level surface. The punch is a plate of steel $3\frac{1}{4}$ inches wide and 18 thick, across which six notches about $\frac{1}{4}$ inch deep are also made with the circular saw at intervals of $\frac{1}{4}$ inch

The press has a puller off or stop much as usual, and at the buck it has a long screw of five threads in the inch the nut of which has two square pins exactly like the two exterior portions of the punch The copper, which measures about one hun diedth of in inch thick is cut in long wide strips and one row of holes having been punched the piece is hooked on the two pins of the nut, and when the screw has moved once round under the governance of a spring catch a second low of holes is punched exactly one fifth of an inch from the former and so on When five rows have been punched the screw is moved two turns to leave a wide 11b, and another series of five 10ws is punched and so on alternately and afterwards the lattices are separated through the wide ribs with a pair of shears Some of the lattices of small respirators have only six rows in the long and four in the narrow direction, and others five rows by three, thus making three distinct sizes with the same tools, and all present a most beautiful regularity and slenderness *

All the foregoing examples of punched works, suppose the punch to have been fixed to the follower of the press, and the matrix to the base of the same, in which case the bed punch requires to be very exactly adjusted by the set screws or dogs of the press. But it remains in concluding this section, to advert to a different arrangement in which the cutting tools are quite detached, and are far less hable to accident or fracture, even

Patent granted to Mr Julius Jefferys for his improvements in enum, or relieving disorders in the lumes Scaled, 23rd January 18 6 I ablished in I operatory of 1 stent Inventions vol vi 4th Scries page 211 The patent respirator is very fully described, but not so the machinery

when the punches are of very large area and complicated figure, than when constructed in the ordinary manner with a shank by which they are united to the follower of the press. In this present case the press has merely two flut surfaces six or eight inches in diameter or square and of similar size, thereby more nearly resembling a hammer and anyll of a very powerful and exact kind, to which the fly press was first compared


Punches to be used in this manner, for works with various detached apertures requiring any especial arrangement, and for various straggling and complicated objects, are constructed as shown in figs 963 to 965 There are two steel plates some what larger than the work and from 3 to 3 thick the plates are hinged together like the leaves of a book, but are placed sufficiently distant, to admit between them the work to be stamped out and which is pinched between them by a thumb The two plates whilst folded together, are perforated with all the apertures required in the work, which perforations may be either detached, continuous, or arranged in any orna mental design that may be required I o all the apertures are fitted punches which in length or vertical height, are about one eighth of an inch longer than the thickness of the upper plate, so as to stand up one eighth when resting on the material to be punched, as seen in the partial section 965 in which the work is shaded obliquely and the punch vertically

As it would be difficult to fit the punches in one single piece to the cinamental or straggling parts of some devices and as moreover such large and complicated punches, would be almost sure to become distorted in the hardening or broken when in use the difficulty is boldly met, by making the punch of as many small pieces as circumstances may render desirable but which pieces must collectively fill up all the interstices of the plate

In using these punching tools, it is only necessary first to fix between the plates the metal to be pierced then to insert all the punches into their respective apertures, and lastly to give the whole one blow between the flat disks of a powerful fly press, this drives all the punches through the work, and leaves them flush with the upper surface. The whole is then removed from the press, and placed over an aperture in the work bench, and with a small drift and hammer the punches are driven out of the

plates into a drawer beneath and on the plates being separated, the work will be found to be exactly perforated to the same design as that of the tool itself—or with any part of the design instead of the whole of part only of the punches were inserted in their respective places—The punches are selected from amidst the corresponding pieces of brass which latter are laid on one side, and the routine is recommenced

It is by this ingenious application of punches that buhl works are stimped as referred to in the foot note page 737 of this volume. If a honey suckle should be the device, the piece of brass is first placed between the plate and punched out and provided the punches are of the same length, the honey suckle

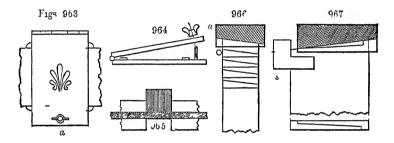

is removed in one piece although the punch may be in several the wood is afterwards inserted and is punched to exactly the same form so that the brass honey suckle will be found to fit in the most perfect manner as it is an exact counterpart of the removed wood

The process is very economical and exact but is only suited to large designs, because of the injury it would otherwise inflict on the wood and on account of the expense of the tools, the mode is only proper for those patterns of which very large num bers are wanted, whereas the buhl saw is not hable to these limitations but is of universal, although less rapid application

Cut brads and nails or those which instead of being forged, are cut out of sheetmon by machinery constitute the last example it is proposed to advance in this section

Brads of the most simple kind as in fig 966 have no heads but are simply wedge form, and are cut out of strips of sheet non equal in width to the length of the brads, these strips are slit with circular shears, transversely from the ends of the sheets of iron so that the fibie of the iron may run lengthways through the nails

When such brads are cut in the fly press the bed has a rectangular mortise shown by the strong black line in fig 966 the punch is made rather long and rectangular so as exactly to fill the bed, but the last portion of the punch say for half an inch of its length is nicked in, or filed back exactly to the size and angle of the brad as shown in the inverted plan in which the shaded portion shows the reduced part or tail of the punch. The punch is never raised entirely out of the bed in order that the strip of metal may be put so far over the hole in the bed, as the tail of the punch will allow it, and also in contact with a stop or pin fixed to the bed and in the descent of the punch its outer or rectangular edge removes the brad

The strip of metal is turned over between every descent of the press so as to cut the head of the one brad from the point of that previously made and the double guides afforded by the tail and stop enable this to be very quickly and truly done. The upper surface of the bed is not quite horizontal but a little inclined, so that the cutting may commence at the point of the brad, and thereby curl it less than if the tools met in absolute parallelism

In cutting brads that have heads the general arrangements are somewhat different as explained in the diagram fig 967, in which as before, the rectangular aperture in the bottom tool is bounded by the strong black line, the tail of the punch is shaded, the stop s, is situated as far beyond the aperture in the bed as the vertical height of the head, and it is so made that the small part which extends to the right overhangs the slip of from that is being cut after the manner of a puller off but the overhanging part only comes into action when the slip is tilted up either by accident or from being so short as to give an insufficient purchase for the hand. It is also to be observed that the width of the point of the brad is just equal to the projection of its head

On the end of the strip of non being first applied a wedge form piece is cut off exactly equal to the difference between the tail of the punch and the bed, and a little projection is left near s and which projection, after the iron is turned over, rests against the tail of the punch, as shown in the figure so that the succeeding cut removes the one biad and forms the head of the following the tail of the punch being inclined to the precise angle

drawn from the point to the head of the brad, as denoted in the diagram

When as it is more usual, brads are cut out by steam power, the cutters are not worked in a fly press, but the moving cutter is commonly fixed at the end of a long aim which is moved rapidly up and down by a crank, the strip of metal is held in a spring clamp, terminating in an iron rod, which tests in a Y or folk, so that the boy who attends the machine can turn the metal over very rapidly between every alternation of the machine, these particulars are shown in fig 954, page 937

The machine fig 951, may be used for binds either with or without heads, it is however always necessary to turn the iron over between every cut, but in the toggle press fig 953 on the same page and which acts much more quickly, it is not requisite to reverse the metal as the entire press is moved on its proots e e by the rod e, so as to incline the press alternately to the right and left, to the angle of such nails as are simply wedge form or have no heads, as in fig 966 page 947

In some machines resembling fig 954, the nail as soon as cut off is grasped in a pair of forceps or dies, whilst a hummer, also moved by the machine strikes a blow that upsets the metal and constitutes the first head in the kinds known as cut mails, and tacks 4

to John (hifford 1, th July 17)0 (see I epertory of I stent Inventions 1st Sein vol vii p 217). The mode preferred by the putented was to employ two rollers of non-freed with steel in which were suil impressions of the nulls half in each roller. The indent stions were an inject encumferentially with the heads and tail in contact, so as to extend the grooves wound the roller and roll the whole rod of non-into-a string of nulls which required to be separated from each other with shears impress or other usual means. Sometimes many grooves were cut around the rollers and a sheet of non-was then converted into several strings of nulls that required to be separated nearly as before

The same inventor took out a second patent about six months later for a method of maling nails by punching. The plates of metal were forged or rolled typer to the ungle of the nuls, and were then cut up by a punch and bed each made taper and also to the angle of the nul. Nuls that required heads were afterwards put into a heading tool or bed having a taper hole of corresponding form that left a small proce of the thick and projecting, and the head was upset with a punch or die just after the manner now practised in maling solid headed pains. This second a dent was scaled on the 4th of Dec. 1790 and is described in the 77th page of the volume before referred to

Sub-cruently to this period not less than thirty to forty patents have been granted for maling brids and nails and some three or four of them have been very successfully would

SECT IV ---PUNCHING MACHINERY USED BY ENGINEE'RS

After the remarks offered on pages 919 to 923 on shearing tools, little remains to be said in this place on the punching machinery used by engineers as it was there stated that the cutters for shearing and the punches were most usually combined in the same machine the punch being placed either at the outer extremity of the jointed lever or at the bottom of the slide in those machines having rectilinear action. The punch is fixed to the slide or moving piece, the die is secured to the framing by means of four holding and adjusting screws just as in fly presses and the puller off or stop is likewise added all which details are represented in the woodcuts on pages 920 and 922

The principal application of the engineers punching engine is for making the rivet holes around the edges of the plates of which steam boilers tanks and non-ships are composed. Another important use and in which the punches trench upon the office of the shears is in cutting out curvilinear parts and apertures or panels in boiler work, to which straight bladed shears cannot be applied. In this case the round punch is used in making a series of holes running into one another along the particular line to be sheared through, or in other words the punch is used as a gouge by which the hole that has been first formed, is extended by cutting away cresent form pieces, thus leading the incision in any required direction.

This employment of the punch to shearing curved lines is also much used in cutting out the side plates of the framings of loco motive engines, which consists of two pieces of stout boiler plate (the technical name for iron in sheets from \(\frac{1}{4}\) to \(\frac{2}{4}\) inch thicl) inveted alongside a central piece of wood that is sometimes also covered above and below with iron all the parts being united by rivets. The punching engine serves admirably for cutting out all the curved lines in these side plates, also the spaces where the bearings for the wheels are situated and various apertures

Messrs Maudslay Sons & Field introduced many years back a very great improvement in the punching engine as applied to making boilers and tanks in which the rivet holes are usually required to be made in straight lines and at exactly equal distances, so that holes in two pieces punched separately may exactly correspond

The plate was fixed down upon a long rectilinear slide or carriage and during every ascent of the punch, was advanced by the machine itself, the interval from hole to hole, the moment after the punch was disengaged from the work. Subsequently 2 3 or 4 punches were fixed at equal distances in the vertical slide but the punches were made of unequal lengths so that they came successively into action thereby dividing the strain and the horizontal slide was consequently shifted every time a distance equal to 2, 3, or 4 intervals. This machine, which dis played much ingenuity of invention, served as the found ition of the more simple punching engines that are now met with *

This volume will be concluded by the account of two sets of experiments in punching. The first. An account of some experiments to determine the force necessary to punch holes through plates of wrought iron and copper by Joseph Colthurst.

"These experiments were performed with a cast non lever, 11 feet long multiplying the strain ten times with a screw adjust ment at the head and a counterpoise —"The sheets of iron and copper which were experimented upon were placed between two perforated steel plates, and the punch, the nipple of which was perfectly flat on the face, being inserted into a hole in the upper plate was driven through by the pressure of the lever'

' The average results of the several experiments (which are given in a detailed tabular form) show that the power required to force a punch half an inch diameter through copper and iron plates is as follows

^{*} Messis Mudslay contiled their machine in order to manufacture in a short space of time a very considerable number of water tanks for the Royal Nivy the machine is circfully engraved in plates 51 and 52 of Buchanin's freatise on Mill Work edited by G Rennie Esq. F.R.S.

Other punching engines some of them with shears are also engraved on pages 48 50 and 52 or the same valuable work

The plate 52 contrins the section and clevation of a sterm punching machine by Mi Cave of lais it is in effect a combination of the punching rightness with the high pressure steam engine. This muchine may carry either punches or shearing cutters at pleasure but although apparently more costly than those actuated as usual by a simple crank movement it does not appear to be so convenient neither would it be politic to construct every machine in a factory so as to include a steam engine for its own especial use

⁺ latracted from the Minutes of Proceedings of the Institution of Civil Ingineers for 1811 pages 601

Iron plate	0	08 thick, required a pressure of	6	025	pounds
	-0	17	11,	,950	
	-0	24	17	,100	
Copper plate	0	08	3	983	
			7	883	

'Hence it is evident that the force necessary to punch holes of different diameters through metal of various thicknesses, is directly as the diameter of the holes and the thickness of the metal. A simple rule for determining the force required for punching may be thus deduced. Taking one inch diameter and one inch in thickness as the units of calculation, it is shown that 150 000 is the constant number for wrought non plates and 96 000 for copper plates. Multiply the constant number by the diameter in inches and by the thickness in inches the product is the pressure in pounds, that will be required to punch a hole of a given diameter through a plate of a given thickness.'

'It was observed that the duration of pressure lessened considerably the ultimate force necessary to punch through metal and that the use of oil on the punch reduced the pressure about 8 per cent. A drawing of the experimental lever and apparatus accompanied the communication.

The second experiments were by Mr Hick, of Bolton who by means of a hydrostatic press having four cylinders in combination, punched through various precess of iron the thickest of them measured $3\frac{1}{2}$ inches thick and from which was punched out a disk of 8 inches diameter, with a pressure of 2000 tons

The removed piece was rather thinner than the remainder and a little taper which arose from the circumstance of the bolster having been purposely made with a flat bottom and a little larger in directer than the punch so that the disk when removed was a little spread or flattened out

It is curious that experiments so distant from one another in their scale of proportion, should yet agree so nearly by Mi Colthurst's formula

The computed force is 150 $000 \times 8 \times 3^{1} = 4200\ 000\ \text{lbs}$ The actual force was $2000 \times 20 \times 112 = 4480,000\ \text{lbs}$

APPENDIX

During the period in which the Second Volume of this Worl has been pussing through the gress rarious new and additional matters having relation both to the first and second rolumes have come under the authors notice the more important of these additions are here given. Py inserting in the body of the first addition of the work references as follows—see Appendix note II—note I & at the pages respectively designated the notes will come under observation at their appropriate places in the text

Note H Page 22-To follow the Foot Note

(Payne's Putent for preserving timber by the double decomposition of sulphate of iron and minute of lime within the porcs of the wood)

In this process which is now more resorted to than others for this purpose several process of timber are arranged side by side on a sledge bound together by hoops and chains and thus introduced upon a railway into a long cylindrical iron vessel the cover or end of which is then screwed on air tight. Steam is now admitted first to drive out the air through a valve opened for the purpose and then to form a vicuum which purially occurs when a little of the cold solution of sulphate of non is pumped into the vessel by means of the steam engine to condense the steam, the vicuum is then completed by an air pump, the liquid flows in as the air is exhausted and is ultimately subject to pressure by force pumps also woulled by the steam engine, this fills all the poics of the wood with sulphate of non. After a few minutes the sulphate is allowed to flow out of the tank by the readmission of air the vessel is again heated with steam, and is similarly filled with numerate of lime.

Adouble decomposition instantly occurs within the price of the wood as the munitic acid gives over to the non-forming munite of iron and the sulphune acid proceeds to the lime forming solid sulphate of lime or gypsum the little remains principally in the porce whilst the munite of iron pervades the wood generally. The entire process of preparing the timber including the filling and emptying of the tank requires from one to three hours according to the sile of the cylinder. The wood becomes much heavier indisposed to decay less combus tible darker in colour and also proof against rot and the ravages of masets.

By certain variations of the process and the employment of some other salts the light coloured. English woods may be stained in a variegated manner throughout their substance so as to be available for making ornamental furniture but the principal application hitherto made of the process (for which the patent was specified in January 1842) is for preparing timber for railway purposes and for building especially the wood used in piles and wet foundations

Mr I type has a new patent which will be shortly specified designed for a different preparation of timber for the sheathing of ships and sea walls

Note I Page ? .—In follow the Foot Note
(Ihe Bassoolah or Indian Ade)

By fir the handlest instrument (said the late Sn. John Robison) for blocking either hard or soft wood for the lather is the bassoolah or Indianadze with a head

of from 13 to 2 pounds weight. The eye is conicil and made widest at the upper end so that the handle may be knocled out to allow of the adde being ground

The Bassoulah is represented at d fig 318 page 470, of this present volume

Notes J K L Page 46- to conclude the Page
(Note J-M: Inving & Carving Machine)

Since the period at which Messrs Bruthwaite's patent for carving wood by burning was lanted in Nov 1840 (see Note A Appendix vol 1) two other important patents have been taken out for carving wood by revolving cutters and on each of which patents a few words will be now offered

Mr Irving's Patent sealed November 1843 although it may be used for figures in low or high relief is principally applicable to works in one plane such as the mouldings of Gothic tracery whether straight curved or undercut and of all sections—the work is generally executed from templets or pattern plates

The revolving drill or cutter which is mideglobular elliptical or of the particular section of the moulding is mounted on a vertical axis at the end of a swinging irm or lever which is jointed to the solid framing of the michine. The wood or other material to be carved is fixed towards the edge of a circular table that is free to move on a vertical and central post. The aim with the drill is capable of being adjusted vertically by means of a treadle to make the tool penetrate more or less deeply into the work.

As therefore the drill may be moved in one arc say nearly from east to west by swinging the arm upon its axis and as the work may also be moved in another arc nearly as from noith to south by swinging the table round upon its axis and as these two motions may be accomplished simultaneously and in any relative degrees by the two hands any outline that has been drawn on the work may be readily followed with the drill or cutter. But more usually a perforated templet is affixed upon the work and the end of the cylindrical spindle or drill socket is allowed to rub against the templet in order that the drill may cut away all the material between the interstices of the templet and which latter mode is much the more rapid and exact especially when many copies of the same work are required

Many of the mouldings both in wood and soft stone that are used in the new Houses of Parliament are in the course of manufacture by this machine which is now the property of Mr Pratt of London

Note K to follow Note J on Page 46

(Mr Jordan's Patent Carving Machine)

Mr Thomas Brown Joidan's Carving Machine patented Feb 17 1845 is more employed for figures and ornaments than for mouldings and two copies are generally carved at once the pattern being placed midway between them

The model and the wood for the copies are fixed say exactly 8 or 10 inches as under upon a acctilinear slide free to move from north to south and which slide moves upon a second rectilinear slide free to move from east to west these two slides run upon anti-friction rollers and trigither support what is called the floating table upon which the work is fixed. The two movements of the table are under the guid ince of the two hands of the worl man while he controls a third slide with his foot. The third slide which is vertical to the other two carries in the center a tracer of globular form, and also at 8 or 10 inches on the right and left of

the tracer cutters of the same globular form which latter are both set to make about 6000 or 7000 revolutions in the minute. The third slide which together with tracer and two cutters forms one entire mass when left to itself descends with a moderate pressure that sends the two cutters into the two blocks of wood until the central tracer rests in contact with the model the cutting then ceases and the slide is raised from the worl by the treadle

In this manner by a multitude of vertical incisions at different parts the whole of the material might be cut away until the copies were reduced to the exact form of the model. I ut it is a more expeditious mode together with the vertical motion of the distandative is to move the work about horizontally by means of the two slides as in every such sampling motion, the cutting will cease when the tracer comes in contact with the model. The only conditions are that the cutter and tracer be exactly alike in form and size and that the distance between them and also the distance between the model and copies whether 8 or 10 inches or other measure be fixedly preserved throughout the one process.

The above case in which the worl lies always horizontally is that most usually required but when the work has to be carved on all three sides as for example in bruckets or corsoles projecting from a wall although the arrangement of the cen trial tracer and the cutters parallel therewith partiking of a vertical motion in common remains unaltered the model and copies are all three adjusted so as at one time all to lie on their backs at other times all on their right or left sides with the progress of the work. Sometimes this change is effected simultaneously by mounting them on platforms that are situated on fixed parallel and equidistant axes and shifting all three at one movement by a simple arrangement derived from the ordinary parallel rule with radius bus

In the case of figures carved in the round or on every side the central model and two copies are built above one wide bar upon three circulating pedestals or turn plates with graduations and detents by which the three objects may be alike twisted round to face any point of the compass, and as the wide bar upon which the three circulating pedestals are built has a tilting motion by which the three pedestals may be all alice placed either horizontally or inclined to the right or left in any required degree until nearly vertical at its clear that these two directions of motion constitute universal joints and enable any and every similar part, of all three objects to be presented to the tracer and cutters respectively

Messrs Inylor Williams and Jordan of London employ these curving machines for all the woods and occasionally for soft stones marble and alabaster and these machines as well as Mr Pratt's are also contributing largely to the embellishment of the New Houses of Parliament and other buildings now in course of being elected

Note L -To follow Notes J and K on Page 46

(Mr Tomes's Patent Dentification for maling Artificial Gums Teeth and Palates)

Another variety of criving machine bearing some analogy to that last described was invented at about the same time as Mi Jordan's we allude to Mi Iomes's Dentifictor a machine for criving the artificial teeth gums and palates used in dental surgery patented March 3rd 1845

This inchine lile the list is intended to mile in exict copy from a solid model but which in Mi Tomess case is a true counterpart of the mouth of the individual produced by moulding. Thus in impression of the mouth is taken as usual in oftend bees wax from this a plaster east is obtained and from the plaster a model or

impression is made in a fusible though haid composition principally gum lie combined with a softer gum which produces an exact reverse or counterpart of the gums one that when carefully made fits o exactly to the surface of the mouth as even to exclude the air from between the model and gums and is therefore capable of being actuated in position without springs simply by atmospheric pressure. The object of the machine is to curve an exact freshable of the composition model in happoportanus or waltus ivory to constitute the artifical palate to which the teeth are fastened.

As some analogy necessarily exists between Mi Tomes's machine and that last described this account will be facilitated by briefly noticing some of the principal points of difference resulting from the circumstance that Mr Tomes moves the work about in a vertical plane and moves the drill in a hori ontal plane and usually cuts the material away by parallel cuts extended laterally over the surface whereas in the wood carving machine at will be remembered the work is hori ontal the drill vertical and the motion rambling in all directions

Mi Fomess tracer and drill are fixed four inches asunder on one slide that is moved horizontally towards the work by a weight and pulled back by a lever and the cement model and the avery to constitute the copy are clamped on circular plates or disl's also four inches asunder and which disl's are fitted upon the slide plate of a long houzontal slide moved by a coarse screw with a winch handle by the triversing of which the series of lines is usually cut. This horizontal slide is mounted upon a vertical slide having a screw and ratchet movement so arranged that when one nregular undulating line of the work has been cut and the drilling slide withdrawn to its full extent the work is shifted by the ritchet movement more or less either upwards or downwards according to the particular nature of the work and thus by a succession of parallel cuts the entire surface is eventually produced the weight all along supplying one constant pressure to the slide curying the drill and tracer to keep them up to their work with the right de ree of force and from the graduated path of this machine and its perfection of action the tool marks are not discoverable in the finished work as they become completely merged onc into the other

To enable the few undercut parts that occur in artificial palates to be carved by the doubtfactor Mr. Tomes now makes the slide that carries the disks not with one flat surface but to have two inclined and parallel planes that serve as the foundations for the circular disks and which latter are connected by one long tangent sciew that moves the two upon their axes similarly and equably so as by the angular change of the disks which carry the work and model to place the few undercut parts successively at the lowest sides of the inclines or at the bottoms of the hills when such undercut parts (unless they exceed in inclination 20 degrees and which never occurs in this branch of ait) slope the reverse way so as to be conveniently accessible to the revolving cutter.

The dentifactor was constructed in the author's manufactory and he therefore feels increased pleasure in announcing the complete efficacy of Mr. Tomes's project which was favourably noticed in the Minutes of Conversation of the Institute of Civil Inquieers page 250 in the Medical Ga etter p. 161 and numerous other publications and for which invention Mr. Iomes received the Gold Isis Medal of the Society of Arts—all in 1845

Note M Page 121 —To precede the last two lines (Straightening stag horn and buck horn)

Stag and buck horn admit of being partially straightened when in thin pieces or scales to adapt them to the forms of the handles of pen and pocket knives. To effect this a dozen pieces of the stag or buck horn when reduced nearly as thin as required are thrown into a vessel of water almost boiling and on removal one at a time are flattened or untwisted by grasping their ends between pliers and straining them into form after which they are allowed to cool in the air or are some times dipped in cold water. The under sides of the scales are then filed or rasped upon a strip of non-held in the flatting vice represented in fig. 864, page 864.

Sta, hour and buck hour me considered to become more brittle from the immersion which is therefore made as short as possible. Stag horn buck horn ivory and pearl shell especially the first are somewhat hable to cause rust on the steel works of knives not so however tortoiseshell or buffalo and similar horn.

Note N Page 155 — To follow the first paragraph (Isinglass glue)

If it be wished to dissolve good isingless in spirits of wine it should first be allowed to soak for some time in cold writer when swelled it is to be put into the spirit and the bottle containing it being set in a pan of cold water may be brought to the boiling point when the isingless will inclusive a uniform jelly without lumps or strings which it is apt to have if not swelled in cold water previously to being put in spirits a small addition of any essential oil diminishes its tendency to become mouldy

If gelatine which has been swelled in cold witer be immersed in linseed oil and heated it dissolves and forms a glue of remailable tenacity which when once dry perfectly resists dump and two pieces of wood joined by it will separate mywhere else rather than at the joint. Ordinary glue may be thus dissolved and sometimes a small quantity of red lead in powder is added. Set J. Lookson

Note O Page 160-161

(Prosser s patent process for worls made of dry clay)

The first line of the article on elsy which ran as follows. This material is only worked in the soft and plastic state—is unintentionally erroneous as the author since learns that Mr. Mencke obtained in 1828 a patent for manufacturing birds and tiles from dry pulverized elsy containing a quantity of moisture not exceeding one per cent—the clay was pressed forcibly into moulds and immediately baked without the necessity for its being direct and from the dense condition of the compressed mass without the risk of cracking in the fire

Mi kowland liosed sinited 1840 is for a similar but superior employment of dry clay sometimes inited with colouring matters for maling buttons rings knobs the tesseric for payement and other things. The dry powder is put into a deep mould that holds just the right quantity and terminates at foot in the bottom die the top die is attrohed to the fly piecs descends within the tube and moulds the object maling the four holes in the button at the same moment. The pieces are released from the mould by a piston or a uniner pressed upwards is usual by a treadle in otherwise. This patent is successfully worled by Messa's Minter of Stole upon front.

Note P Page 191 to precede Section IV

(Clay's patent process fo manufacturing wrought iron)

The author transcribes from the Minutes of Conversation of the Institution of Civil Engineers for 1843 page 82 a part of the account of this process

By the ordinary system of iron making the ores are reduced into the state of curburet of iron and then by refining and puddling the metal is de carbuietted thus making it into malleable non by a number of processes which are recapitulated —

1st Calcining the one

2nd Smelting in a furnace by the aid of blast either cold or heated with raw coal or coke for fuel and limestone as a flux

3rd Refining the pig into plate iron

4th Puddling shingling and rolling to produce merchant or 5th No 2 bars

6th A repetition of the same process to make best or No 3 bars

Seeking to diminish the number of manipulations by the new process a mixture of dry Ulverstone or other rich ore (Hæmatite) is ground with about four tenths of its weight of small coal so as to pass through a screen of one eighth of an inch much. This mixture is placed in a hopper fixed over a preparatory bed or oven attached to a puddling furnace of the ordinary form. While one charge is being worked and balled another gradually falls from the hopper through the crown upon the preparatory bed and becomes thoroughly and uniformly heated the carbinetted hydrogen and carbon of the coal combining with the oxygen of the ore advances the decomposition of the mineral while by the combustion of these gises the puddling furnace is prevented from being injuriously cooled. One charge being withdrawn another is brought forward and in about an hour and a half the iron is balled and ready for shingling and rolling.

The cinder produced is superior in quality to that which results from the common system—it contains from 50 to 55 per cent of iron and is free from phos phonic acid which frequently exists—and is so injurious in all the ordinary slags when re-smelted the cinder produces as much as No 1 and No 2 cast iron—and is of as good quality—as the ordinary—black band—ore of Scotland

The process was highly commended by the meeting as being simple and scientific and evidence was advanced to show the iron produced in this mode to be equal to the best cable non

Note Q Page 196 of Vol 1 — To follow the Foot Note

(Nasmyth's Patent Direct action Steam Hammer)


Since the foregoing pages were printed a valued friend of the author Mi Jumes Nasmyth of Patricioft near Manchester has brought into successful operation two very important machines the one the Direct action Steam Hammer employed in the place of the old helves or lift hammers the other a le-itimate descendant of the above hammer a machine invented for driving the piles required for the foundations of buildings and coffer dams. The author is enabled to present to his readers some particulars of these machines, which their inventor has been kind enough to write for these pages.

hig 968 represents a general view of the stam hammer B is the cylinder in which the piston works and to the piston rod which comes out at the bottom of

the cylinder is attached the hammer A. high pressure steam is let in under the piston which raises it together with the hammer A. to any required height within its vertical range of motion and in which it is guided by two planed guides E.E. On the escape of the steam when the valve of the cylinder is opened the hammer falls on the work that lies on the anvil with the full force due to gravity and without any loss worth naming from friction—the instant the hammer has given its blow the steam is again let in under the piston—and the same action is repeated with ease and rapidity

When it is desired to lessen the force of the blow the steam is let in under the piston ere the fall is complete so that a cushion of steam is then presented to receive the force and modify it to any required extent—such is the precision with which this can be done that the hammer may be arrested in the most soft and silent manner even when wi hin one tenth of an inch of the anvil—The hammer can be thus set to give any definite blows by the due adjustment of the lever which closes the valve for which purpose its position is regulated by two long screws seen in the figure—there opening of the valve is effected by a small cylinder and piston (at B) on the top of which piston steam is made to act as a most perfect spring

When on the other hand it is desired to increase the energy of the hammer by making it give blows even more powerful than those due to the highest fall of the hammer by gravity alone the following simple but effective arrangement is

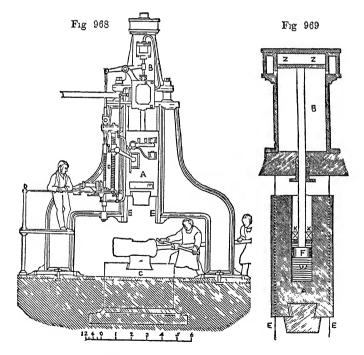

brought into action This contrivance consists in making the top of the cylind r quite steam and an right so that when the piston passes beyond the holes $o \circ o \circ o$ fig 969 the old steam or air which is then pent up in the chamber $\angle Z$ above the

piston may obtain a reviving energy by the compression it receives from the upward motion of the piston and this compression is wholly returned in the condition of elastic recoil of the most perfect kind which recoil added to the simple gravity of the hammer vastly augments the rapidity and intensity of the blows. As soon as the piston re-passes the holes $o \circ o \circ o$ the old steam or air re-enters with perfect freedom, so as to offer no resistance to the fall of the hammer

It may be well to notice in conclusion the peculiar elastic yet firm manner in which the connection between the piston rod and hammer block is made—this being one of the most important details in the whole arrangement and without which this invention would have possessed but little practical utility—It will be seen in the enlarged section fig—969—that the piston rod has a large end Γ forged to it this goes down into a well inside the hammer block and rests on several pieces of hard wood placed at W one or two rings of the same material being placed above the part Γ the whole being keyed hard down by two taper leys XX which are driven in over the wood rings through the body of the hammer—these cross leys retain all the parts firmly together

This ittrehment while it effectually unites the piston rod and hammer at the same time presents such an elastic or yielding medium as to remove all risl of destructive action which would be otherwise certain to occur if any hard unyielding substance were placed between the anvil and hammer or that these two parts were allowed accidentally to come in violent contact in such concussion can now injuriously affect the piston and hammer. A close resemblance will be observed in this arrangement to that of the cultilage in the joints of animals between bone and bone

The author of this volume has to add that several of these steam hammers have been erected in our Government Dock Yards and at the works of various engineers sometimes they have flat faced hammers and anvils for general purposes—at other times semicircular tools for swaging round shafts—and in this case peculiar advantages arise from the steam cushion which prevents the approach of the tools beyond one precise distance—so that the shaft is made of uniform diameter throughout

The sterm hummer has also been employed in minufacturing large copper pans into the central parts of which the convex hammer then dips with unerling precision and any particular measure of force

The largest of the steam hammers as yet made has been erected in the works of Sir John Guest But Dowlas South Wales for the manufacture of wrought from and in this machine the hammer weighs 6 tons it can be inited 7 feet and its face measures 4 feet by 2 feet so as to consolidate at one action the entire mass of the blooms or uses for making rulway buts as the hammer face includes the whole surface of the bloom at every blow—the bed or anvil—perhaps the largest from casting in the world—weighs 36 tons—and was cast in one mass from the united contents of four great furnaces

In a former account of the steam hammer written by Mr Nasmyth for the Civil Lingmeer's and Architect's Journal Vol VI page 40 he first describes the circuitous mode in which the power was conveyed from the steam engine through intermediate gear and shifting to the old helves or lift hammers illuded to in the first volume some of which lift hammers although weighin, upwards of 6 or 7 tons give by comparison ineffective blows on large masses because from moving on a joint the rise and fall of the hammer is limited and in forging thick works when the strongest blows are required the hammer has the less space to fall. Mr Nasmyth then contrasts the above circuitous mode with his own simple and direct

means applied to the same end under an arrangement in which the largest works may with more consistency be made to receive the strongest blows


Another comparison there also instituted is greatly favourable to the patentee as he adds that although from various practical leasons the dimensions of the old helves cannot be materially exceeded the cylinders and appendages required in the new hammer admit of an almost unlimited increase in their magnitude, in order to meet the continual aggrandisements of engineering requirements

Note R —To follow Note Q on Page 196 (V1 Nasmyth's Steam Pile Driving Enjine)

On this machine Mi Nismyth writes— There are two grand or important features of novelty in this pile driving engine compared with all former contrivances for the like purpose. In the first place by the employment of the steam

hummer action the st am is made to act direct in raising up and letting fall the hammer or morley without the intervention of any iotative motion while in the second place another grand feature of novelty consists in the employment of the pile which we are about to drive is the foundation or sole support of the apparatus A B C fig 971 so that by its resting on the shoulders of the pile we have not only the effect produced by the blows of the hummer (0 cwt at 80 to 100 three feet falls per minute) but we have also the entire weight of the apparitus A B C equal to 3 tons assisting in a most im portant degree to force the pile down into the ground

The pile to be driven is raised up and planted in its situation by the machine by means of a windlass worked by a small detached steam engine at H the apparatus A L C is it the ame time raised up and

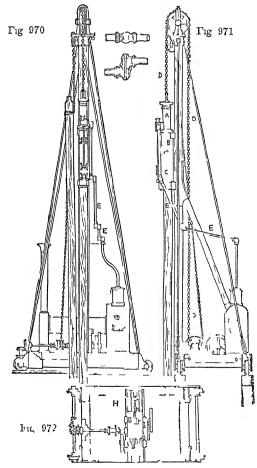

placed on the shoulders of the pile like an extinguisher on a candle the chun D D is then let free so that the entire weight of A B C shall rest on the pile the steam is now let in from the boiler to the cylinder by the jointed wrought non pipe E E the hammer then sets to work with great energy showering down its ponderous blows on the head of the pile at the rate of 80 to 100 per minute at each blow the pile sinls and the machinery A B C follows down with it guided in its descent by clamps which loosely grasp a guide rail fixed on the side of the great upright and which upright also returns the pile in true position all the way down

Some idea of the rapidity with which piles are driven by this machine may be formed when we state that a pile of 60 feet in length and 14 inches square can be driven 45 feet into stiff soil down to the rock below in 4 minutes and such is the good effect resulting from the blows being given by a *neat mass* of 30 cwt striking quict but with small velocity of actual impact that the pile head requires no hoop and presents after being driven a neater appearance than it had when it was first placed under the hammer

This is a very important result and the initural consequence arising from the employment of mechanical force in the right conditions for the purpose required namely in this case striking a quick succession of blows with a large mass or hammer but with small velocity of impact by reason of the small height from which the hammer falls—the action of the ordinary pile driver being quite the reverse of all these conditions. By inspecting the figure it will be seen that the entire inachine is possessed of locomotive powers inasmuch as it is mounted on wheels and moves along rails so as to pass onwards as the piles are driven in succession—it may be as well to observe that the apparatus A. B. C. is only raised up by the small fixed steam engine once per pile instead of once per blow as in the case of the ordinary machine.

The author has not had the advantage of seeing Mr Nasymth's pile driving muchine but he understands from eye witnesses—that its rapidity is such as to excite a smile from the almost marvellous manner in which this jack in the box (the hammer being concealed from view by the frame or casing) performs its work as it fulfils in 4 minutes that which frequently required by the old maching a period of 36 hours presenting a ratio in the time saved as 540 to 1 a ratio most egregious but true withal

A pile said to have been driven home or as far as possible by the old pile driving engine (as the old ram then rebounded as from a solid rock) was driven a further quantity of 10 feet by the steam pile driver until it had indeed met the solid rock beneath


The action of the muchine is adduced as a most perfect evidence of the high importance of I nowing under what modification we should use force in the accomplishment of certain duties thus—if you want to split and shatter a pile into lucific matches then let fall cannon balls upon it from a great height but if you want to drive the pile then let the cannon itself fall on it and that from a small height and is rapidly as it can be effected say 100 times in a minute so that it may have give the pile a moments time to set fast in the soil

Note S Page 202 — To follow the third paragraph (The Oliver or small lift hammer)

I is 9:3 represents a species of lift hammer worked by the foot. The hammer head is about 2 inches square and 10 long with a swage tool having a conical crease attached to it and a corresponding swage is fixed in a square cast non-anni block.

about 12 inches squire and 6 deep with one or two round holes for punching &c I he hummer handle is about 2 to 2 teet long and mounted in a cross spindle nearly as long supported in a wooden frame between end screws to adjust the groove in the hammer face to that in the anvil block. A short arm 5 or 6 inches long is attached to the right end of the hummer axis and from this arm proceeds a cord to a spring pole over head and also a chain to a treadle a little above the floor of the smithy

When left to itself the hammer handle is raised to nearly a vertical position by

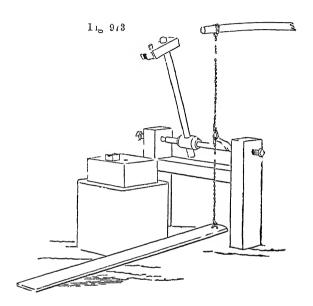

the spring and it is brought down very readily with the foot so as to give good hard blows at the commencement of moulding the objects and then light blows for finishing them. The machine was used when the author first saw it in making long stout nails intended for fixing the tries of wheels secured within the felloes by washers and riveting—the nails were made very nicely round and taper and were forged expeditiously.

Note T Page 226 —To follow the fifth line (The Manufacture of IV rought Iron 1 ube)

The authors attention has been drawn to the contents of pages 925 and 9.36 of his first volume aftering to the manufacture of wrought from tubes associated with a refret that he had not set forth more fully and historically the progressive steps through which this interesting and important manufacture has arrived at its present state of perfection.

Upon this hint the author requested Mr liosser with whom the suggestion originated to point out the errors of mode and date that he had committed and which correction Mr lioser has most kindly rendered in the accompanying synoptical table here inserted we hout alteration

SYNOPTICAL TABLE

01 1111

MANUFACIURE OF IRON TUBES

Drawn up for this Work by Rowland Prosser Esq CE of Limingham

		т	Т	 -			T			,	-,		
Drawbench introduced into England 1 65							1Se						0
I olls inverted for rolling iron by Cort 1 83			ne				ehor		омп				t h
Drawberch und Poll used for rading lead pipes by Will son 1 30		1 .	ارا 13	100	onn	sell	Con lus Whitehouse	Z,	nd b	=			nd Wh
Combin to 1 of 9 3 or more purs of rolls by Hayledine 1 18		Coop	and J	Hem y Osbon n	Henry Osborn	Jumes Ru sell	sm	George Royl	y n	S S	d P	Ŧ	1
		Benj	а	emy	emy	mes	l ä	orge	Þ	H	ч	b Cutl	=
			٦		-				П	H	R	٦	H
Dates of Prt nts		1808	181	181	181	18 1	18	15 1	1836	18 (1540	1841	184
N=====	WLTDING PA												
10	H and hamm is	1808											
241													
70	Power hammers		181	181		1871							
	M my holes in two rolls		181		1817			1831					
I white					ļ								
<	Muylels in two ill }		1812										
305	S gment moving on a bed			151									
	or a source of the source of t			1 31									
	Three or f u rolls mak }										1810		
الله الله	•												
	Driwn though holes			1			ر 18					1511	181
0	Drawing through rolls				1					1836		1841	
					1								
600	FINISHING BY Drawberch and hales												
ر ق	Driwoel en than Ies	1508						1831		15 (1811	
0,,,,,,	Di iwbench u di lls	1808											
70	are a mis	1000				18 1				15 (
	Drawin over a mind I											1811	
	1 ORM OF MANDI IF												
	N mind il	,		151		18 1	18	18 1		18 6			
		1 08		181		18 1							181
	Fiper and in inotion		181										
	Enluged end and it iest				181,				18 6		1510	1541	
	TORM OF JOINT												
	Butt (or jum)					18 1	18	18 I	15 (1530	1 10	1511	
	Scuf(on ly)	1605	151	151	ISI .				1 (1510	, , ,	161
	* * * * * * * * * * * * * * * * * * * *				. "				- '		1540	1011	101

In the first column on the left of the Synoptical Table are represented little sletches of the principal means employed in the manufacture of woulded tubes next follow the verbal explanations of the sketches and the group of columns on the right are headed with the names of patentee and the dates of their patents. The dates inserted in these columns in the same horizontal lines as the sketches are intended to show that such means were employed under the several patents designated by the dates.

For example running the eye down the first date column it is to be understood that Benjamin Cook's the first patent for the manufacture of non-tubes was dated 1808—that by him the tube was welded by the hand hammer—finished by the draw bench and drawing rolls—that the mandal employed was parallel and lastly that the tube had a scul or lap joint—and so with all the others

This tabular view although most freemiting for a cursory inspection could not be made to convey various matters of detail and points of important yet minute difference which have existed in the several modes of practice and which have given use to many and expensive lawsuits. And therefore as a brief sum many of the entire manufacture the author subjoins from the pen of a friend who is professionally and intimately acquainted with the subject a condensed account showing the dates titles and the main features and processes of the entire series of patents for making wrought iron tubes

LENJAMIN COOK of Birmingham Patent dated 28th Maich 1808 for a method of maling bariels for fowling pieces muskets pistols and other similar fire arms and ramiods for the same

The Patentee proposed three plans of muling burrels in one only of which was there any welding

The first plan consisted of forging or otherwise producing a round bar of non or other proper metal of a short length is compared with the intended buriel and then a hole was dialled in the same and it was proposed to clongate the buriel by draw plates similar to wire drawing, but having a manuful in the buriel or the clongation was to be effected by proved rollers using a mandril marke the buriel

The second plan was to turn a short plate of non-or-steel over a mindral or leaf from and to weld it by I and then to clong to the buriel so produced by drawing through holes in dies or by grooved follows as before using a mandral inside the barrel when clong using it

The third plan consisted of taking a circular plate of metal and then by successively forcing it through a series of holes in a die it was proposed to rare it not the shape of a cup and then having done so the cup was to be cloubated by drawing it through holes in a die or by means of a pair of grooved rollers using a mandril on the inside of the barrel when elongating it none of these plans succeeded and they never came into public use

HENRY JAMPS AND JOHN JONES of Binningham Patent granted 26th July 1911 for an improvement in the manufacture of burels of all descriptions of fire aims and artillery

There are two methods of welding briefs described in this invention. I rist the plate of iron was to be turned over into the shape of a build so that the edges should be liought into a position for welding a part of the brief being heated to a welding heat was to be placed on a hollow until having several grooves to cere spond with the burel, and then lya series of humiers, worlled by in tehincip, the

heated put of the banel was to be welded a stump or mandril being inserted in the burnel when welding. And secondly the Patentee proposed to use grooved rollers the grooves being of the figures of the banel and a mindril was to be used. This appears to be the first invention of the use of grooved rollers to weld barrels of fire arms.

HENRY OSBORN of Boldesly near Birmingham Sword and Gun Lurrel Mal er Patent granted 1st of March 1817 for a new method or principle of producing cylinders of various descriptions

The Patentee had a previous patent for turning the plates of iron ready to be welded into barrels or cylinders and this was done by grooved rollers the present patent was for using grooved rollers as a means of welding cylinders or gun barrels and it consisted in using similar grooved rollers to those described by Jumes and Jones but in this patent a mode of using a mandril was described very different to that suggested by Jumes and Jone and it is by means of these inventions that by far the largest proportion of gun barrels have ever since been welded in Limmingham

The novelty in using the mandril consisted in this there was to be a shield fixed on the mindril so as to prevent the mandril being drawn through between the grooved rollers when welding a cylinder or barrel thereon. In using the mandril it was inserted into an unwelded barrel (the barrel being at a welding heat) and conveyed thereon to the rollers the mandril being retained by stops which prevent the shield passing thus the barrel as it was welded by the rollers was drawn off the mandril the mandril leeping the bore open and preventing the nion from being rolled into a solid mass. In this manner was the weld made and then by repeatedly heating the barrel or cylinder and passing it between grooved rollers with a succession of mindrils the barrel or cylinder was drawn out to the desired length

JAMES RUSSELL of Wednesbury Gas Tube Manufacturer Patent granted 19th Junuary 1824 for an Improvement in the manufacture of Tubes for Gas and other purposes

This Patentee proposed to weld iron tubes or bariels by means of a hollow hummer and tool and it was intended that the tube to be welded should be held in the hollow tool and receive blows by the hollow hammer and this welding was to be done either with or without the aid of a mindril. And then having welded the tube or barrel it was to be shaped interiorly and exteriorly by means of a pair of grooved rollers and a mandril with a large head over which the grooved rollers were to move the welded tube or barrel. This Patent fulled of success. It was found that the hollow hummer and corresponding hollow tool would if they embraced the barrel have no effect on it and if the barrel was too large in diameter for the hollow it would only be crushed by the sides of the hummer and the hollow tool

CORNELIUS WHITEHOUSE of Wednesbury Stafford Whitesmith Putent dated 26th February 1825 for certain Improvements in Manufacturing Tubes for Gas and other purposes

This Invention was the first to suggest that a tube might be formed and welded by simply applying external pressure without internal support and the inventor described the means of accompli hing the welding and shaping of iron tubes for gis and other purposes to consist of first turning up the plates of non-so that the edges would come together or nearly so and then about half the length was to be heated to a welding heat and by means of a draw bench such heated part of the

prepared tube was to be drawn through a bell mouthed die which might be formed in the shape of a puriof tongs with hindles to open or close the two 1 dives of the die or the two halves might be opened or closed by a screw. The inventor did not confine himself to the particular construction of the dies and it was held by a Court of Law that grooved rollers capable of giving complete circumferential pressure when no internal support of a mandril was resorted to was within the claim of the Patentee.

Such was the great simplicity and utility of this Invention that notwith stunding the assignee of the Intent Mr Russell had made a very considerable rum of money by the Patent the Privy Council advised the Crown to extend the period for which the Patent was granted from 14 to 20 years

GFORGE ROYL Walsall Stafford Whitesmith Patent granted 21st March 1831 for an Improved method of maling Iron Pipes Tubes or Cylinders

This Patentee proposed to use two grooved rollers placed in front of the furnice so that the prepried tube when it was helted to a proper welding helt should be drawn out and welded by the rollers and to facilitate the working the upper roller was capable of being separated from the under one by which the tube could be moved between the rollers and when the upper roller was brought to the lower roller and motion communicated to them the tube was run out of the furnice and welded. The tubes being thus welded were to be passed through dies to give them a better shape this invention was put into use by Messrs Dison & Co of Wolverhampton. This mode of manufacture was declared to be an infringement of Whitehouse's Patent because the welding was by circumferential pressure without any mandril or internal support being employed.

TREDERICK EDWARD HARVFY of Tipton Stiffordshire and JERE MIAH BROWN of the same place—Latent granted 3rd Lebiuary 1836 for ceitum Improvements in the process and michinery for manufacturing Metallic Lubes and also in the process or machinery for forging or rolling metal for other purposes

In this invention growed collers were employed and the principal novelty consisted in the mode of supporting the mandril which was a short instrument placed and fixed in front of the collers and in such manner that the enlarged head came just in the pinch of the rollers and in working the heated tube was to be forced over the short cranked stem of the mandril the unclosed seam of the tube being sufficiently open to allow it to pass the fin by which the stem of the mandril was carried

THOMAS HINRY RUSSILL of Hundsworth Warwick, Tube maler Patent granted 3rd May 1836, for improvements in making or manufacturing welded Iron Tubes

'Fins Patentee proposed to make welded from tubes without first turning up the Iron plate from end to end and the invention consisted of only turning up a few inches of the length and then by apparatus placed in front of the furnice to cause the plate of iron when in a wilding state to be first turned into the shape of a tube and the welding was simultaneously to go on by means of dies or by rollers in the manner of Whitehouse's Invention before mentioned

RICHA D PROSSER of Birmingham Civil Engineer Patent dated 27th Much 1840 for improvements in inachinery or apparatus for inanufacturing Lipes

This Patentee proposed to use a combination of three or four rollers. When four rollers are employed they are formed with grooves all exactly equal to the quadrant of a circle and with edges bevelled at 45 do_orees so as collectively to make up the entire circle. The four rollers are connected with equal wheels in order that they may travel with the same velocity. The end of the thin strip of non is bent to the circle and when at the proper heat the rollers carry it forward and depose the welded tube upon a long mandral smaller than the bore of the tube and placed immediately opposite the rollers—the mandral serves to support the tube whilst in its heated and soft state. Large numbers of tubes have been made in this manner by the four rollers and when three only are employed they embrace one third of the circle instead of the fourth

THOMAS HFNRY RUSSELL of Wednesbury Stuffoldshire and COI NF I IUS WHITHHOUSE of the same place Putent granted March 7th 1842 for improvements in the manufacture of welded Iron Pubes

This Invention has for its object a mode of welding very thin iron tubes when mal in the joints and the tubes were purioularly intended for steam boilers. The invention consisted in using a maidful of small drameter when compared with the intended drameter of the tube and the tube was welded by passing the tube with



the mundril in it between grooved rollers or through bell mouthed dies the hole being of in ovil shipe so that when making the weld the mandril was set fast in the tube throughout its length but on passing the welded tube through dies with a

circular opening the tube was made cylindrical thus allowing the mandril to be readily withdrawn in consequence of the smallness of its drameter when compared with that of the tube. The messure of the roller or dies was made to a to first on the outer edge of the lap joint them on the inner and lastly on the central part, the three processess being accomplished at one heat and the drametrical line upon which the pressure was applied became for the time the shorter drameter of the oval

'JAMIS ROOST of Wednesbury Stufford Patent granted 9th May 1918 for an Improvement or Improvements in the mode or method of manufacturing welded from Indee

I has invention consisted of a mode of using dies and also rollers with grooves and mandrils in a peculia manner which does not appear to have come into use

JOHN JAMIS RUSSFII and THOMAS HENPY PUSSIIL of Wednesbury Staffordshire Tube Manufacturers Patent granted July 24 1844

This Invention was for the welding of the larger class of tubes for boiler and such lile purposes and consisted of a moving hollow bed on which the prepared tube in an unwelded state was placed, and the bed with the tube passed under a grooved coller. A fixed mandril being used on the inside of the pipe over which the pipe moved so as to give support and resistance where the weld was talling place. The end of the tube being fixed to the hollow bed, the movement of the bed neconstally carried with it the tube and caused it to pass over the mandril and under the pressing or welding roller.

INOMAS III NRY RUSSI LL of Wednesbury Stafford Tube Manufacturer I start granted 14th August 1845 for improvements in the manufacture of welded Iron Tubes

This Patent describes an invention for welding iron tubes for steam boilers and other purposes and it consists of using a long fixed bar or beak iron supported at one end on to which a prepared iron tube at the welding heat is placed the edges of the metal overlapping in order to produce a lap joint and then the weld is produced by external mechanical pressure which is shown to be produced by a grooved roller situated above the end of the beak iron by drawing it off the beak iron and beneath the roller the beak iron must not be less than half as long as the tube and the latter is welded at two process s. This invention has come into extensive use in malling tubes of large diameter of thin plate iron with lap joints.

In concluing this notice of the manufacture of wrought iron tubes the author has to observe that the great feature of modern times in the manufacture of tubes is the being able to dispense with all internal support and to complete the tube by external pressure alone such pressure acting on all points of the circumference

The mindril was quite indispensible when gun bairels were forged by means of the lateral blows of hand hammers upon anvils or swages and the idea of the necessity for the mandril has been long retained under various modifications greatly to the projudice of the entire manufacture of wrought non tubes as when the mandril fits tightly it hinders the progress of the tube over it and spoils the work. The mandril when now used is only employed as a supporting instrument one that does not fit the tube but only serves as a holder or bracket to carry the tube in its heated and flexible state and not in any respect as a means of forming or perfecting the bore of the tube

On this point the strongest yet clearest judgment was pronounced by Baron Parke in the trial on Whitehouse's patent namely that the great norelty is the complete circumferential pressure with motion leaving out the mandril or any internal support

Another point of great meety in the manufacture is the reverberatory furnace which notwithstanding its length requires to be heated most intensely yet uniformly throughout sometimes a blast is used but the description of Mr Prossers furnace will serve as a general explanation

The furned requires of course to be of the full length of the longest tube and it has a door at cache end for the entry and removal of the skelp on the one side are several stole holes for the introduction of the fuel which is mostly coal sometimes cole and in the opposite wall beyond the bridge of the furnee are corresponding apertures leading into a longitudinal chamber puallel with the fire and thence into the lofty flue the dimensions of the apertures must be determined in some measure experimentally until the furnee burns with equal intensity throughout its length

The tune the non is exposed to the intense heat of the furnice lil ewise requires carrial attention as if accidentally exceeded the iron is entirely spoiled

The munificture of thin tubes his recently obtained a great impulse from the very general idoption of the tubular system in makine boilers. These tubes are usually about one tenth of an inch thick and as large as three inches diameter to adopt them to the combustion of coal the fuel of makine engines, whereas the tubes of locomotives in which cole is always burned are of only about half the bore of those for makine boilers, the tubes for locomotives although more generally of brass are also made of wrought non

The tubular constructions of boilers present a very great fire surface and effect a proportionate saving in the dimensions of the boiler in 1 consequently in the weight both of the boiler ind the water contained therein. Third tubes from their weight, would be altogether in applie the earlier to maine or locemotive belief

Note U page 256 —To follow the Foot Note

(Additional remarks on the late Sir John Robison's Worlshop Blowpipe)

Articles herted in the firme of the worl shop or gas furnice blowpipe (said it-inventor) preserve their polish in the same way is by Mr T Oldham's process if they have been lept in the flame. As the whole of the oxygen is taken up by the hydrogen of the gis none is left free to act on the surface of the steel and is those appears to be a tendency to a deposition of carbon on glass rods when sul mitted to this flame it may be that this may not only have an influence in saving the steel from oxidation but may produce some chemical effect on its composition as workmen suppose that gravers or turning tools hardened from this heat are more enduring than those heated in the muffle or on a bar of hot iron

As already noticed on page 440 the worl shop blowpipe is figured and described in the Weck May for 1842 page 258

Note V page 283 —In continuation of the article on Silver (Amalgams used by Dentists for stopping teeth)

Dentists employ in amilging containing silver for stopping curious teeth it is prepared by rubbing together in a mortar or even in the hollow of the hand finely divided silver and mercury and then squeezing out all the uncombined mercury leaving a plastic mass which feels to grate and crepitate under the fingers. When all the unsound parts of the tooth have been carefully cut away the amil am is thrust into the diy cavity that the tooth may be heimetically scaled from the air and in the course of a few hours the amilgam appears to crystallize and become considerably hander than lead

The usual mode of preparation is to dissolve the silver in muintic acid and precipitate it as a fine metallic powder by stirring the solution with a rod of zinc or iron. Some dentists file part of a shilling into dust, under the impression that the copper then also employed makes the amalgam harder others rub in with the silver a little gold leaf or platinum leaf with the ame intention. Precipitated pulladium forms with mercury a similar amalgam to that with silver but with the evolution of heat at the time of combination. These alloys which have received various high sounding names are seldom remelted but then resume for some hours their plastic condition.

Note W page 393 —to follow the seventh line (Pablet's Patent 1nti fi iction Metal)

Bubbet's untifriction metal to be used somewhat after the manner of tin for the bearings of machinery is thus described —

An excellent compound or alloy for this purpose may be prepared by the inabout fifty puts of ting five of antimony and one of copper but other compounds analogous in character may be used

The or compounds like the above used alone owing to their softness spread and escape under the superincumbent weight of locomotive engines and other heavy machinery and therefore brasses or bearings are employed under this patent to support the softer metal but the brasses are made larger in diameter and with internal fillets that almost touch the vales so as to prevent the thin lining of the anti-friction metal from spreading and being pressed out

The brasses are first cleaned and tinned and an exaction model of the ayle having been turned the parts are heated put together in their relative positions luted with plastic clay and the fluid antifriction metal is poured in which then becomes of the required form and effectually soldered to the biass. The unit first in metal scalesly appears to suffer from wear and owing to its unctuous greasy nature requires much less oil than other metals and alloys used for bearings.

See Letters Pitent granted to Wm Newton 15th May 1843 for Centum improvements in the construction of boxes or releties of locomotive engines and currages and for the bearings or journals of machinery in general and also improvements in oiling or lubricating the same Leing a communication of

Note X page 285 at foot and 30?—Before The Pulludiumi ing process (Craifurd's Patent for Galrani ed Iron)

At the time the author inserted in his former volume the account of Millett process for conting from with zinc and palladium, he accidentially overlooded a previous patent granted to Mr Henry William Crauturd April 1837 (and described in the Repertory of Patent Inventions. Volum New Series page >>9) he will now proceed to supply the deficiency and also to give some particulus of mother method by which from that has been previously timed is also coated with zinc.

In Mr Craufurd's patent sheet iron non castings and a mious other objects in iron are cleaned and secured by immer ion in a both of water acidulated with sulphuric acid heated in a leader ves el or used cold in one of wood just to remove the oxide. They are then thrown into cold vater and taken out one at a time to be secured with sand and water with a pace of cold or more usually a piece of the husk of the cocoa nut the ends of the fibres of which serve as a brush and the plates are afterwards thrown into cold water.

Pure zine covered with a thick layer of sil ammonice is then inclted in a both and the non-if in sheets is dipped several sheets at a time in a civile or griding. The sheet are slowly raised to allow the superfluous zine to drain off and me thrown whilst hot into cold witer on removal from which they only require to be wiped dry

The pieces we heated before immersion in a reverberatory furnice to avoid cooling the zinc. Chains are similarly frested and on removal from the zinc require to be shaken until cold to avoid the links being soldered together. Nails and small articles are dipped in muritic read and dired in a reverberatory furnice and then thrown also ether in the zinc covered with the sal minimize left for one minute and tallen out slowly with an iron skimmer, they come out in a mass soldered together, and for their separation are afterwards placed in a caucible and surrounded with chargout powder then heated to redness and shallon about until cold for their separation. When is recled through the uncounter which it is compelled to dip by a foil or other contrivence.

It is to be observed that the zine is inclted in a bith or crucible just a little beyond the point of fusion and is always covered with a thick cost of sal unmorm to both to prevent the waste of the zine and further to prepare the medial that is to be zineed. Cast non both or vessels such as included in melting to the vessel but zine acts very appelly upon the cast non-unites with it and falls in a granula state to the both in of the vessel therefore in earther liming of fire barel lutted with clay was with some difficulty and 1 sold at main tuned in the cast non-vessel to defend the same from the action of the zine

(Craufurd's prient 1837) Now however wrought from baths welded at the angles are used without the clay lining (Morewood & Robers's patent 1841) as the deterioration both of the zinc and of the vessel is then less rapid and the process succeeds better than when cust from boths are employed. The spoiled granulated metal which is only considered to contain about five per cent of iron is ladled out and actualized to the zinc manufacturers for purification or is manufacture.

Note Y page 285 at foot, and 302 —Before The Palladrumizing process (Mon awood and Rogers's Galianised Tinned iron)

Mr Ldmund Morewood's process is different and is declared in his patent dited 1841— to consist in timing the metals to be preserved from oxidation as aforested in the ordinary manner of what is called timing and then in what I call zincing the sud tim so that the external surface may be zinc placed in such a clation with the tim and the metal to be preserved from oxidation as that both the said tim and zinc should have a united or combined influence in preserving the sud include Sec I epictory of Patent Inventions. New Series Vol xviii page 170

The present practice is however different from the above as the iron is covered with tin by a galvanic deposition as in the electrotype process, and is afterwards zinced in a both of the fluid metal. The following is the practice which is secured by subsequent patents, enumerated further on

The sheets of non-ne-pickled scouned and cleaned just the same as for ordinary timms. A large wooden both is then half filled with a dilute solution of murrate of the prepared by dissolving metallic tim in concentrated muniate and which requires a period of about two or three days and two quarts of the saturated solution are added to 500 or 400 gallons of the water contained in the bath. Over the bottom of the bath is first spread a thin layer of finely granulated zinc then a cleaned non-plate and so on a layer of finely granulated zinc and a cleaned from plate alternately until the bath is full—the zinc and non-to-ether with the fluid constitute a weal galvance battery and the tim is deposited from the solution so as to coat the from with a dull—uniform layer of metallic tim in about two hours

Whilst the above process is in operation a wrought from both containing fluid zing is prepared the melted metal is covered with salammoniae which becomes about is fluid is treate. It wo non rollers immersed below the surface of the zing we fixed to the both and we driven by machinery to carry the plate through the fluid metal it my velocity previously determined. The plates are now received one by one from the timing both drained for a short time and passed at once whilst still well through the melted zing by means of rollers, the plates thus till up a very regular and smooth layer of zing which owing to the presence of the time and it issumes its natural drystalling character giving the plates an approximate recembling that I nown as the marrier metallique.

When the short of metal is dipped vertically into the zine the lower edge is much longer in conflict with the zine than the upper and from the violent action of melted zine or non-this males the bottom edges of the sheets sensibly more brittle than the upper awhere is the rollers cause every part of the sheet to be reted upon in the same degree and which degree may be exactly determined by the velicity given to the rollers. Consequently by the roller process thinner non-may be zinced than by dipping edgeways and vertically as no part of the non-need to be immersed.

longer in the metallic bath than is absolutely necessary for its properly taking the coating of zinc

In addition to Mr Morewood's patent dated 1841 for the general process by ordinary tinning and zincing Messrs Morewood and Rogers have patents dated re pectively 1843 for the rollers and the electro mode of tinning in fact for the mode of covering metals by the conjoined processes first of voltaic deposition and subsequently of immersion in another fluid metal——1844 for new fluxes and details of management—— and 1845 for the manufacture of the galvanized tinned non plate into tiles and ridge pieces for roofing and other works by various processes of stamping

Craufurd's Patent (worked by the Calvanized Iron Company) and Morewood and Rogers's combined patents have obtained very extensive employment for a great variety of purposes and both methods are well supported by testimonials. But so far as the author can learn the galvanized non covered with pure zinc is much more suitable to the sheathing of ships for which it is highly economical as it is proved to be much cheaper and is expected to prove more durable than copper—the galvanized tinned iron plate is more malleable and may be used for thinner iron and is therefore more suitable to being wrought as by the tin smith with the hammer and it is also found to answer thoroughly for roofing—as it can be bent and soldered with facility—Galvanized iron is now largely used by Govern ment and by public companies for this purpose

The author is informed that both kinds are open to two curious facts the first that the chains of tillers and cranes and objects exposed to much friction do not lose their coating of zinc this is accounted for by the smooth un oxidized zinc suifaces of the chain moving freely on one another whereas unprotected iron, when covered with rust (the peroxide used in polishing) is subject to continued wear and it has also been imagined the zinc becomes as it were burnished into the suiface of the iron. But it may happen that when moisture is occasionally present that the worn parts are then continually rezinced from the neighbouring parts as explained by the curious fact now to be noticed and which on its discovery excited great surprise

The edges of some galvanized iron plates cut with shears so as to expose the central non when attached to the piles of the Bell Rock Light House for the purpose of experiment became zinced around the cut edges and at the holes where the nails were driven and it was also observed that even the nails and fastenings made of un galvanized from became zinced from their proximity to the galvanized sheets. By the same action the holes perforated through the sheathing for nailing it to the ships sides become coated and the zinced wires of the Electric Telegraph where cut through become coated by the action of the rain water on the galvanized portion of the surface

Note Z page 308 —To precede Section II (Portable brass furnace)

Since the foregoing pages were printed Holtzapffel & Co have constructed portable brass furnaces made of the hexagonal form in sheet iron lined with Stourbridge clay and fitted with cast non pedestals tiles and stout sheet non pipes complete so as to be elected on any level spot of ground and if near a dead will so much the better

The smaller sized of these an furnaces serve for about 10 pounds weight of brass or copper, and a large furnace on the same model will melt 20 pounds when

fivouribly managed they have been made hot enough to melt cast non. These firmides have entirely superseded the little blast furnaces formerly made for the postable forge shown on page 203 of Vol. I

Note AA page 3.4 —To follow the last Foot Note

(Berlin method of moulding delicate complianted objects)

One method said to be followed by the Beilin founders for producing complicated subjects such as a bouquet of flowers is to dissect the object to be moulded into small pairs which may be straightened out or moulded separately and cast in fusible metal

Having cast all the parts separately in soft fusible composition these parts are then bent into the natural forms and a synthetic operation is commenced or that of putting the parts together again by means of soldering and tying together by which whole object has been in this way built up it is embedded in the mould (with proper productions for the escape of air) the mould is heated to allow the fusible metal to melt and escape and the nonisrum in by a descending gart which enters the mould at its lowest part, and the fluid metal carries up any impurities on its surface expelling the air as it rises through the vents. Su John I obsort

Note AB page 421—To follow the paragraph ending wax is generally used

(Fluid for lubricating draw plates imployed in India)

The lubricating matter for facilitating the slipping of which though draw plates is perhaps not a matter of indifferent choice—the Hindoo Son ars who are noted for their deatenty in drawing gold wire uniformly use Castor oil which they alloo prevents wiste of gold by friction—Sir John Robi on

Note AC page 410 —To follow the paragraph that precedes Section III (I oxall s patent Method of running Versels in sheet metal)

Notice of the pitent granted to Mr. I homes Foxall Griffith of Birmingham for improvements in stimping and shiping sheet metal. I ch. 1846


In the pure plus which this note follows as an appendix it was stitled that words having lofty and perpendicular side, such as jully moulds could not be produced by stumping but this difficulty has been very eleverly overcome under the recent patent above cited in which the processes of stumping and that of lurinshing to form or spinning are successfully alternated. Quoting the words of the specification, the patentes observes—

Herefor no sheet metal has been rused by the simple act of stamping in dies by rusing and letting fall r succession of forces and the process of burnishing to form has been combined with the ordinary process of stamping whereby sheet metal having been rused as far as possible in dies by the processes of stamping the shaping has been completed by the process of burnishing the stamped atteles on chief sin r lather and to secure such last mentioned combined processes letters patent were granted on 15th 1 character 1831

'In shaping sheet metal by stamping as heretofore practised the sides of the uticles depend materially for the height of the rusing on the stretching or extending of the metal and to this end the metal at the outer encumference is supported the nighout the process of stamping by a projecting fluich which rests horizontally

on the upper surface of the dies such flanch being progressively reduced and the metal thereof stretched or extended so that from the bottom to the upper edge the thiclness of the metal is brought thinner and thinner which is objectionable At the same time owing to the severe treatment to which the sheet metal is thus subjected it requires to be more often annealed in order to prevent its suffering injury by the successive processes of stamping and such is the extent to which the metal is stretched or extended by raising according to the old practice that the disl or blank of metal employed for raising a vessel of a few inches diameter to a considerable extent is only about three quarters of an inch larger in diameter than the finished vessel raised therefrom by stamping. Whereas according to my invention the blank or disk of sheet metal used for making any particular article when the sides thereof are upright is of a diameter of about the diameter of the vessel or article added to the depth of the vessel thus supposing the vessel or article produced by stamping in a die be six inches in drameter and three inches deep then the die or blank of sheet metal would be about nine nuches diameter and the article when stamped therefrom if it be cut through the ides and bottom all parts would be found as nearly as may be of the same thick ness and that thicl ness the thicl ness of the original sheet metal

The figures A to G reduced from the specification show the several forms which would be given to the work originally of the drimeter aa by the employment

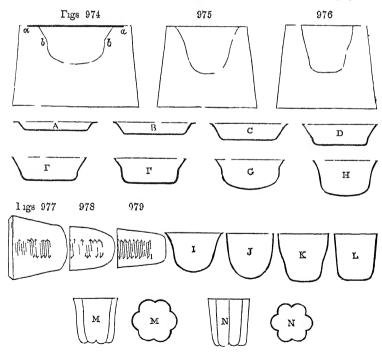

of a die such as fig 974 with a second point of bearing at bb. The successive forces or top dies that are employed being so shaped as to be a only on the bottom of the vessel so that the dg bb and not on the loping ad a lywhich cheme the

edge bb fulfils in great measure the purpose of a draw plate such as would be used for drawing cylindrical tubes

After having been progressively stamped to the contour of G the work is burnished to form on a chuck such as fig 977. The work is then again stamped in the second due fig 975, then burnished on the second chuck fig 978, and is afterwards struck in a third due fig 976, and then burnished on a third chuck fig 979 to make the metal proceed through the stages H to L of course the work is occasionally annealed as will be explained.

Fluted works such as N are first raised nearly as cylinders with bottoms to the shape of L by the intermittent stages already explained and the burnishing to form is then di continued. The flutes require the use of two or more pairs of dies and forces in which the flutes are gradually developed but which tools have not been represented. In the first pair of tools for the object N the flutes are shallow and the die a little bell mouthed in the second pair the flutes are of the full depth, and as from the sides being almost perpendicular or exactly counterpairs of the burnished object N the piece when struck holds fast in the die the latter is perforated and has a central raimer which is ruised by a side lever to force the finished work out of the die, these particulars are all minutely explained in the specification.

The vessels when cut throu h present a nearly uniform section and which may be thus explained as regards the cylindrical vessel. If the disk of 9 inches diameter could have its maight folded up without pucketing it would have a nim of 1' inches high the upper edge being of twice the primary thickness as in fig. 271 page 400 but the stretching from the dies causes the height of the sides to become 3 inches and therefore this tapering thickness is gradually drawn out as in tube drawing to constitute the increased height

In proof of the complete efficacy of the mode it may be stated that vessels may be thus made in sheet iron (known as charcoal iron) a material far less tractible than copper and brass. Great difficulty was experienced in carrying out this alter nation of the two processes of stamping and burnishing to form when working with iron owing to the scaling or oxidation of surface which resulted from the annealing and which roughness tended to prevent the employment of burnishers. This difficulty was after various trials obviated by annealing after the method practised in annealing articles made of malleable cast iron (see pages 259 260) in which case the ductility and tenacity of the sheet iron are preserved and that with a surface quite unimparied by the firing. The patentee prefers for the annealing mixture one put of pulverised iron one added to eight of coke or time and he gives the preference to that non one which has been once used for annealing cost non

be completely successful ne the combined processes that extinguishers have been thus rescal from round draws of sheet non-and of course without a seam—the method of stamping with dies having the bevilled mouth and shoulder b b fig. 974 on bles vessels to be raised much higher than by any other method of stamping—even when burnishing to form is not employed in connection with the stamping

Note AD page 431 —To follow the first pringraph

(Drawing taper brass tubes for locomotic engines)

Some of the briss tubes for locomotives nemade cylindreal without and a little tiper within the metal for them is cost hollow, and driven on a typer triblet through

an ordinary plate The thick end is placed near the file box that the tube may be the longer in wasting away from the action of the file and also that cinders capable of entering its smaller end may readily escape at the larger

Note AF page 431 —To follow the second paragraph (Rand s Patent Collapsible Tubes)

These thin tubes are closed at the one end by a convex disk with a projecting sciew the sciew being perforated for the expulsion of artists colours or other matters inclosed in the vessels. They were first drawn as tubes as described in the text and the ends were cast and soldered in but the entire vessel is now made by means of only two blows in dies of appropriate kinds.

By one blow of a screw press a thick circular disk of tin of the external diameter of the intended vessel is punched out made concave and perforated with a central hole somewhat like a washer for machinery

By a second blow the blank or button is converted into the finished tube. The bottom tool is a mould with a shallow cylindrical cavity of the same diameter as the button of tin and terminating in a hollow screw—the upper tool is a cylinder exceeding the length of the tube—ind with a small taper spindle of the diameter of the hole—The cylinder is just so much smaller than the mould as to leave an annular space equal to the intended thickness of the tube—The very soft ductile tin when submitted to great pre sure in the contracted space within the mould follows the laws of liquids and may be said literally to flow through the annular crevice and up the cylindrical mandrel as indeed the formation of the tube appears to be instantaneous and is a beautiful example both of true principle and accurate workmanship in the means employed

The tube is released from the mould first by the ascent of the cylinder which leaves the tube behind and the screwed extremity of the mould is then driven up by a ram and lever from below and the screwed dies being divided on their diameter instantly fall away from the vessel thus elegantly produced by a mode which was only attained after repeated variations in the process respectively secured by patents. Small tubes are thus made in screw presses and large tubes in hydrostatic presses of proportionate strength.

Note AF page 433 —To follow the third paragraph

(Clay props used by the Asiatics instead of binding wine in soldering)

The Asiatic goldsmiths seldom use binding wire for light work they have always beside them a little dish of a tempered inixture of clay and sand or powdered blick with little portions of which they form connections and supports for the picces they mean to solder together. Thus if two tubes have to be joined in the form of the letter T (inverted whilst being soldered) they first warm the lower picce, and then dab on a little at a time of the mortar (leaving the joint clean) until the inclined props of the clay run high enough nearly to touch the upright piece, which being warmed and set in its place, the connection is completed by a further addition of the mortar which when heated over charcoal becomes quite firm and supports the pieces, whilst the solder is running, even in works of pretty considerable size.

So John Robinor

Note AG page 444 - Fo precede Section IV

(Pumice stone used by Dentists instead of Charcoal as a support in soldering)

Dentists are much in the habit of using a lump of pumice stone as the support in soldering the gold work to which artificial teeth are attached. The pumice stone is usually filed or rubbed to a flat surface and the work when laid on this incombus table support and subjected to the action of the blowpipe receives a more moderate heat than when laid on charcoal—which latter support is less convenient as it loses its form from burning continually away and because at the same time owing to its combustion at reverberates more heat than is required by the dentists for their particular purpose

The following Notes in the Appendix refer to the Second Volume

Note AH page 482 —To precede the last paragraph (Silcoil and Love's Patent Planes for Joine's &c)

Subsequently to the foregoing matter on planes having been printed Messis Silcock and Lowe of Birmingham took out a patent in January 1844 for various linds of bench planes contructed in great part of malleable cast non—Several of these planes are figured and described in the Mechanics Magazine for 1844 papers 81 to 86 to which the reader is referred. A few lines are however extracted nearly verbatim for the convenience of those readers to whom this journal is not accessible

The first of these planes is certainly a very remarkable instrument. It is a double fillister plane which is so constituted that it is capable of filleting boards of all sizes from about 3ths of an inch to about 3 inches and may be adapted to the several purposes of a filliting plane a side fillister a sash or back fillister and a slewed rabbet plane.

When this tool is to be used as a filleting plane both the right and left side planes are combined together and fixed at a distance from each other corresponding to the breadth of the fillet. To use it as a side fillister the left side plane only is required with a stop inserted into an appropriate recess. When it is to be used as a sash or back fillister the right side plane only is employed but with a slight modification in the figure of the fence.

To use the tool as a skewed rabbet plane the right hand plane with its chase und fence are luid aside and the left hand plane only is employed

All the parts are of cast iron protected by tinning or zincing from corrosion with the exception of the stocl and the handle and body of the fence which are of wood and with the exception also of the screws the cushion of the travelling screw and the sliding nut which are all of brass

The forc and buck parts are east in one piece. The wood of the handle is not cut icross the grum as usual but with the fibres running in a direction at rightingles to the body of the planes, whereby a considerable increase of strength is gained.

The second instrument described is a fluting or growing plough. In this tool the body is wholly of metal, but in all other respects as regards the materials and mode of putting them together it possesses the same peculiarities as the double fillister plane first described.

The third instrument is a dado grooting plane, with which no less than sixteen

i

and more different sizes of work may be executed—the fourth instrument is a trying plane suitable both for rough and smooth work—the fifth and last is a moulding or bead plane—The explanation of these peculiar tools cannot however be conveyed without exceeding our limit of space and the introduction of numerous figures

In addition to the foregoing patent planes constructed principally in metal the patentees manufacture ill the ordinary wooden bench planes with screws tor fixing the non—instead of the wedges driven by the hammer

Note AI page 487 —To follow the third paragraph

(M: Lund's Screw I outer Plane)

Mi Win Lund his constructed the router fig 341 phot 487 with a screw adjustment to the cutter is it is mostly necessary this should be set gradually deeper as the work progresses. When is similar but smaller tool is fitted with a perpendicular cutter he finds it very useful in reducing the level bid grounds of small ivory carvings in basiclef in which case a maight is left wound the subject if only as a temporary guide for the router to run upon

Note AJ page 488 —To follow the last pur graph
(Wr Fulconers Improved Circular Plough)

Mi Talconers plough rewarded by the Society of Aits in the Se sion 1846 presents many points of improvement on the building plane by Mi Onwin described in the text. The prin iples of the plough fig. 3.5 page 486 are nearly followed but instead of a variety of tences being used some concave others convex the new instrument has a flexible steel fence attached to the plough by two stays which are justed to the ends of the clistic fence whilst to the central part of the same is fitted a screw adjustment so that the one fence may be made to assume any required curvature either convex or concave and of course the right line also


The willths of the grooves are determined as usual by those of the cutters which me provided with double pointed somers or nucleus for cutting through such of the filtes of the worl as he transversely and would otherwise be torn up. The entire construction of this circular plough is very judicious and complete and the tool may be considered as greatly improved on those previously used for this purpose

Notes AK AL and AM — To follow the last line of page 495 (Note AK M1 Fraul line Screw Bench Hool for Curpenters)

A serew bench hook for expenses intended to supersede that shown at a fig. 3. 3 page 494 was invented by Mr. 1. E. Franklin of Purton Wilts and published in the Lians ections of the Society of Arts for 1840 vol. 53 p. 99. There is a metal sheath or societ fitted to the bench within which an non-bur with a side spring shides up and down under the guid ince of an adjusting serew below the square bare curies two or more steel teeth formed as a separate piece and serewed on. The continuance although quite effective is a their expensive for ordinary use

Note AL —To follow the above on page 495
(Mr. De Beaufort's Vice or Stop for a Joiner's Beach)

1158 978 and 979 represent the vice of stop for a joiner's bench for which Mr H De Jay De I enufort of Icinatur received the reward of the Society of Art in 1841 There are two double ended levers moving freely on the centers by which they are attached to the bed or foundation piece so that when a board or piece of

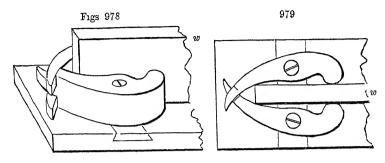


wood w placed on edge is inserted between them it catches between the tails of the levels and separates them until the piece is grasped also by the other ends of the same levers and therefore at two places at once as seen in the plan fig 9,9. The levers are about one inch thick and the tail of the one is thinned to enter a eleft on the other as distinctly shown in fig 978 to adapt the vice to very thin pieces and the levers being mounted on chamfered slides may be fixed wider as under for very thick pieces. See Transactions of the Society of Arts. vol. 53 page 86.

Note AM —To follow note AL on page 495

(M1 S Nicholls Stop or Clamp for a Joine s Bench)

Fig 980 is a perspective view and fig 981 a plan of Mr S Nicholls subsequent contrivance for the same purpose and rewarded by the same society in 1843. Two inclined and undercut slips of wood α α are firmly screwed to the bottom board and between them are loosely fitted two pieces b b nearly counterparts of

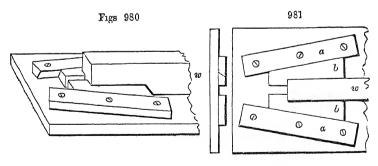

 $\alpha\alpha$ but with projecting fillets at the end. When the board w is in eited between these loose jiws or chaps they are thrust forward until they reach that contracted part of the angular gap which compresses them firmly upon the board to be fixed. This mode serves for a much greater range of size in the pieces fixed than the last and the straight faces of the jaws do not indent the worls is may happen when soft woods are clamped in the vice shown in figs. 978 and 979. See frans actions of the Society of Arts, vol. 55 page 42

Note AN page 504 — To follow the paragraph commencing The Scale board Plane (Messis Esdaile and Wargi are s Scale board Machine)

The scale board machines used by Messrs Esdaile and Margiave at the City Saw Mills London has a wide cast iron slide plate that works freely in chamfer bars elevated on framework about six feet above the ground the power of the steam engine is applied to the slide by means of a stout leather strap or rather by two straps for the to and fro movement but one is always out of action and loose. The slide is perforated for a cutter upwards of one foot wide placed beneath the slide and inclined horizontally about 40 degrees as a skew relate plane but the pitch of the iron or its vertical face up which the shavings slide has only half the inclination of the horizontal or about 20 degrees.

The log of wood which is preferred wet on account of its superior elisticity in that condition is held down by heavy weights whilst the metallic plane slides beneath it and shaves off in an admirable manner one single shaving the thickness of the same is determined by the adjustment of the cutter which is principally held by wedges

Messrs Esdaile and Margrave recently patented the employment of three cutters situated as above but one behind the other to remove three scale boards in immediate succession—the scheme was effectual in its action but in the end less economical than the single—cutter—and which must be moved by a strap or rope as although ricks and iron chains have been tried—they fail apparently from the want of sufficient elasticity

Note AO page 505 —To follow the second paragraph
(On Machines for Planing Wood)

Of the michines for producing works in wood similar to those usually accomplished by hand planes several have been constructed to act by means of cutters having circular motion. Thus in Paxton's michine various circular saws or cutters of different diameters and forms are placed on one spindle beneath which the sash but is traversed. In michines for planing mouldings from 2 to 8 inches wide for house joinery picture frames &c two figured cutters of the entire width of the moulding are screwed to a rectangular block fixed on the revolving spindle by which means the cutters are presented at the proper pitch or inclination of 60 or 70 degrees to the face of the moulding. Circular cutters were also used in the curlier experiments with Burnett and Poyer's michine some of them with only 4.5 or 6 edges or teeth constructed very nearly on the principle of ordinary plane irons

But encular cutters were abandoned by Messis Burnett and I over from two motives the first the difficulty of constructing and sharpening them and secondly that notwithstanding the rapidity at which the cutters might be driven they still left marks upon the work because there is a distinct though small interval of time between the passage of the one cutting edge and that next following and during which small interval the uninterrupted advance of the work allowed certain portions to be less reduced or left as little hills and ridges slightly above the general surface. The wood only becomes absolutely smooth when its traverse is so far diminished that one point of the cutter (or probably the highest point of the entire series) is enabled to touch every individual portion of the work and which requires a much greater reduction in the feed or traverse than might be expected thus mostly leaving something to be smoothed off or removed by hand tools

Messis Burnett and Poyer from these circumstances ultimately rejected revolving

in favour of fixed cutters and thus in planing mouldings they employed a stool which contained from twelve to twenty cutters every one figured and secured by a separate wedge so that the first cutter penetrated but little into the moulding and that every succeeding tool removed a sharing of its own—all the cutters gradually assimilated more and more to the latt of the series—which was sharpened exactly to the form of the mouldin—Under this arrangement the machine was enabled to work mouldings in pine wood at the enormous velocity of 70 lineal feet per minute and still the work had all the smoothness of that produced by the joiner's hand planes as usual

Note AP page 50, -To follow the former note having the same reference
(Mr Antonio Mayer's Patent Splint Cutting Machine)

The production of an article of apparently minor importance has led to the invention of a very effective and important machine alhed to the planes namely the splint cutting machine for cutting the wood for chemical matches

It is necessary to premise that when these useful matches were first introduced they were mere shaving cut from blocks of deal by the plane previously used in preparing the chips of willow and other woods from which ladies bonnets are woven. This plane had at the front a series of lancet like I nives which scored the wood in shallow parallel furrows, and immediately behind the I nives was fixed an inclined plane iron of very low pitch which cast off a shaving thus producing several splints at once from the edge of a board about one inch thicl

When the same splint plane was used for the stronger and less flexible matches nearly one tenth of an inch square now used the splints were found to be broken or disrupted in their fibres by the computatively abrupt angle at which they were removed from the block of wood notwithstanding that the plane had a very thin iron sole and a cutter of very low pitch. This defective a tion of the hand plane led to the invention of Mr. Mayer's Putont Splint Cutting Machine, used exclusively at the celebrated worls of the Messis. Esdailes and Mugrave of London

The splint cutting michine has a metal slide which travels purallel with the ground but in a vertical plane by means of a crank and connecting rod that give it 60 strolles in a minute. The slide carries first a series of 30 lancet like knives half sloped on the upper surface, the other half on the lower these penetrate the wood about one tenth of an inchound are immediately followed by the cutter or plane non the broad flat side of which rests directly against the wood to be cut (no sole being used) the edge of this line is very much inclined namely to 70 degrees and is ground with a very long bevil 2 inches wide giving to the edge the write angle of 12 degrees and which combined with the great obliquity of the line causes the splints to be only bent from the wood at the insignificant angle of about 1 degrees so as to be entirely removed by cutting and not by splitting or rending


The wood used for maling the silints consists of whole deals 10 inches wide 3 inches thick cross cut into blocks of inches long. Three of these blocks are placed together constituting a len thou f 15 inches sufficient for six silints or matches and as there are thirty lincet linives every traverse of the machine products 180 splints this at 60 strokes a minute males 648 000 an hour or 6,480 000 in a day of ten hours. There are two such machines constantly at work and these not withstanding the areage production of each is upwards of three millions of splints a day furnish another proof that in some processes machinery cannot overpower hand labour as the larger proportion of the splints used in this country are never theless obtained from the hand cutters and foreign importations. The hand cut splints although cheaper are inferior to those cut by the machine in question

Note AQ page 533 —To follow the last line but one (On grinding some of the tools for tunning non)

When the tools 431 or 43? p 53? are u ed in both directions that is if some times moved towards the right hand at other times to the left it is then necessary the chamfer or upper face of the point should be ground square across to serve for either direction of motion. But when the tool is used exclusively from the right hand towards the left the chamfer hould be so ground that the left side is the higher as this from being then the entering angle of the tool worls much more freely from being sloped some 50 degrees from the horizontal is already explained

On the very same principle an efficient side cutting tool for iren to be used in the slide rest is derived from the triangular tool page 591 and represented in three views in the annexed figure 982. A bar of steel is drawn down at the end to about

half its thickness the width or rather the veitical heightiemaining unaltered this nail ow partischam fered on its outer fice so as to be a little inclined from the per pendicular and is then ground on



its upper surface to make a hidge puilled with the side of the tool. The ridge which is sloped about 50 from the horizontal is sometimes on the right some times on the left is the tools are made in pairs, and as they will readily remove a shaving an inch or into e wide a cylinder of six inche diameter may be reduced to four inches or less at one cut in a lattle having proportionate power

Note AR page 5°8 —To follow the purgraph ending for sense if purposes (Orlulus sting n tal training tools with a ater)

When water is used for lubricating the tools in turning non with hand tools the most simple plan is to dip the tool occasionally into a small vessel containing the fluid. A more effectual way employed in turning by hand or with the slide rest is to make a small mop of a bit of rag surrounded by a loop of which the ends of which are twisted together to form a handle as in a bottle brush with which the work is occasionally moistened.

In tuning with the slide iest or self-acting lather practical men often fix a drip can to the slide iest that the water may fall on the work close by the tool or in the best mode a flexible hose is used that leads from a cistern above the discharge of water being regulated by a small tap. These two modes require that metal pairs should be placed beneath the work to each the water that runs away and also that some vigilance should be excited to keep the lather from becoming rusty

Notes AS AT AU and AV —To follow the last line of page 5.8 (On the Principles of Iools for Funning and I luring Metals)

The formation of the tool in ed for turning and pluring the metals is a subject of very great importance to the practical engineer as it is indeed only when the mathematical principles up in which such tools act are closely followed by the worl man, that they produce their best effects. With a full conviction of the advantages which result when theory and practice are thus associated the author has to causi adult the himself on being able to present to his readers two original

papers respectively written on the subject of the principles of tools for turning and planing metals by Charles Babbage Esq FRS &c and Professor Willis AM Γ RS &c both distinguished by their high mathematical attainments and their intimate practical experience in the use of tools

Note AS—(Paper on the Principles of Tools for Turning and Planing Metals by

Charles Bubbage Lsq FRS lc &c)

Steel of various degrees of temper and under various forms is almost universally employed for cutting metals. Before deciding on the forms of the different tools it is desirable to inquire into the principles on which their cutting edges act and to assign special names to certain angles on the relations of which to each other and to the metals upon which they are used their perfection mainly depends

In fig 983 c is a cylinder of steel or other metal and T is a planing or turning tool acting upon it at the point α . A c is a horizontal line passing through the center c and the cutting point α . B α is a line passing through the cutting point α and along the upper plane b α of the cutting tool T. C α is a line passing through the cutting point α and along the front plane c α of the cutting tool D α is a line from the cutting point α at right angles to the radius c α


The angle D α C may be called the angle of relief because by increasing it the friction of that face of the tool upon the work is diminished

The angle C a b may be called the angle of the tool

The angle B α A may be called the anyle of escape because the matter cut away by the tool escapes along it

The forces to be overcome in cutting a thin shaving of metal from a cylinder or from a flat surface are of two kinds

1st It is necessary to tear along the whole line of section each atom from the opposite one to which it was attached. The force required for this purpose will obviously be proportioned to the length of the cutting edge of the tool and depend ent on the nature of the metal acted upon. But it will be quite independent of the thickness of the part removed

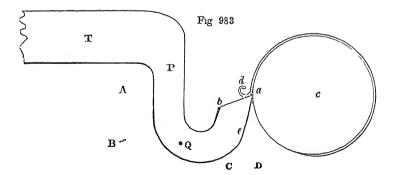

2nd The shaving cut off by the tool must in order to get out of its way be bent or even curled round into a spiral. This second force is often considerable and when thick cuts are taken is usually far larger than the former force. If the bending were of small extent, then the force to be exerted would vary as the square of the thickness of the shaving multiplied by some constant, dependent on the nature

of the metal operated upon—But the bending very frequently proceeds to such an extent that the shaving itself is broken at very short intervals and some shavings of iron and steel present a continued series of fractures not quite running through but yet so complete that it is impossible even with the most careful annealing to unwind the spiral—This partial severance of the atoms in the shaving itself will require for its accomplishment a considerable exertion of force—The law by which this force increases with the thickness most probably embraces higher powers than the first and second—and may be assumed thus

$$force = a + b t + c t + d t^3 +$$

For the present illustration it is unnecessary to consider more terms than those already more particularly explained namely the constant force and that which varies as the square of the thickness of the shaving

If therefore t be the thickness of the shaving and A and B two constants we shall find amongst the forces required for the separation of the shaving the two terms

$$A + Bt$$

where A and B depend upon the nature of the metal acted upon

We may learn from this expression even without being acquainted with the values of the constricts A and B that the force required to remove the same thick ness of metal may vary considerably according to the manner in which it is effected

For example If a layer of metal of the thicl ness of 2 t is to be removed. It may be done at two successive cuts and the force required will be equal to

$$2A + 2Bt$$

But the same might have been accomplished at one cut when the force expended would have been

$$A + 4 B_4$$

Now the force required for the two cuts will always be less than the force required for making one cut if $t>\frac{A}{2\,B}$

For let
$$t = \frac{A}{2B} + i$$
 then

Force for two cuts

=2 A + 2 B
$$\left(\frac{\Lambda}{2B} + v\right)$$
 = 3 A + 2 B ϵ

I once for one cut of twice = A +4 B $\begin{pmatrix} A \\ 2B + v \end{pmatrix}$ =3 A +4 B v

which former is always smaller than the latter force by the quantity 2 B v. In the same manner it may be proved that if

$$t > \frac{A}{nB}$$
 or $t = \frac{A}{nI} + v$

it will always require less force to make n separate slices than to cut one slice of n times the thick ness for

I once for n slices
$$= n \Lambda + n \operatorname{I} \left(\frac{\Lambda}{nB} + v \right) = (n+1) \Lambda + n \operatorname{I} v$$

Force for one slice of
$$n$$
 $= \Lambda + n$ $B \left(\frac{\Lambda}{nB} + v \right) = (n+1) A + n B v$

which former force is always less than the latter by the quantity of (n-n) B v. The in le of relief should always be very small because the point a will in that case have its support nearly in a line directly opposed to that force acting upon it

If a tool either for planing or for turning is defectively formed or if it is presented to its work in such a minner that it has a tendency to dig into it then a very small angle of relief in addition to a long back ae will in some measure counteract this defect

I he smaller the angle of the tool the less will be the force necessary for its use. But this advantage of a small angle is counterbalanced by the weakness which it produces in the upport of the cutting point. There is also another disadvantage in making the angle of the tool smaller than the escape of the shaving requires for the point of the tool being in immediate connection with a smaller mass of metal will not so quickly get rid of the heat it acquires from the operation of cutting as it would if it formed part of a larger mass.

The angle of escape A a B is of great importance and it varies with the nature of the material to be acted upon—If this angle is very small the action of the tool is that of scraping rather than of cutting—and the matter removed approaches the form of a powder—If however the material is very flexible and cohesive in that case shavings may be removed—The angle I have found best for cutting steel is about 27—but a series of experiments upon this subject is much required

After the form of the cutting tool is decided upon the next important point to be considered is the manner of its application. The principle which is usually stated for turning tools is that the point of the tool should be nearly on a level with the axis of the natter to be turned or rather that it should be very slightly below it. This rule when applied to the greater number of tools and tool holders is calculated to mislead. Before applying the correct rule it is necessary to consider in each tool or tool holder what is the situation of that point around which the cutting point of the tool will turn when any force is put upon the tool. Let this point be called the center of flexure. Then the correct rule is that the center of flexure should always be above the line joining the center of the work and the cutting point

On looking at fig 983 A c is the line joining the cutting point a and the center of the work c. By making the tool weak about Q that point becomes the center on which the point a will bend when any unusual force occurs. On the occurrence of any such unusual force arising from any pin or point of unequal density in the matter cut the point of the tool a by bending around the center Q will dig deeper into the work and cause some part of the apparatus to give way or break

If on the other hand the point P is that around which the point of the tool when resisted tends to tuin then since this point is above the line joining the cutting point and the center of the work the tendency of the additional strain on the point is to make it sink less deeply into the work and consequently to relieve itself from the force opposed to it

Fortunately the position of this point can always be commanded for it is always possible by cutting away matter to make one particular part weak. This is indeed a circumstance too frequently neglected in the construction of machinery. Every piece of mechanism exposed to considerable force is liable to fracture, and it is always desirable to direct it to break at some one purticular point if any unexpected strain occurs. In many cases where danger may arise from the interference of the broken part with the rest of the machinery this arrangement is essential. In all cases it is economical because by maling the breaking if it occur at a selected spot provision may be made of duplicate parts, and the delay arising from stopping the machine be avoided.

The results of the preceding inquiry would lead to considerable changes in the forms of tools generally used in cutting metals and is the time employed in taking

a cut is usually equal whether the shaving be thick or thin the saving in power by taling thin cuts separately would be accompanied by a considerable expense of time. This however need not be the case if proper tool holders are employed in conformity with the following several conditions thus


The tool holders should be so contrived as to have several cutter successively removing equil cuts—The cutting ed es should be easily adjusted to the worl—The steel of which the cutters are form dishould be of the best kind and after it is once has lened should never a sin be submitted to that process—The form and position of the cutter should be such that it may when broken or blunted be easily ground having but one or at the utmost but two faces requiring similar—It is desirable that when being ground it should be fixed into some temporary handle in order that it may always be ground to the same cutting angles—The cutters should be very securely but also very simply tightened in their places—The center of flexure of the cutter should in turning be above the line joining the center of the work and the cutting point—whilst in planing the center of flexure should be in advance of a line perpendicular at the cutting point to the surface of the work planed. I xamples of some tool holders of this kind will be given subsequently

The effects of such improved tools would be to diminish greatly the strain put upon lithics and planing machines and consequently to enable them to turn out better worl in the same time and it a less expense of power—whilst the machines themselves so used would return their adjustments much longer without reparation

Note A7 - Lo follow Note A5 at foot of page 538

(The author's desiry tron of Looks and Took holders for turning and planning metal constructed by C Babbane Log FRS)

In the course of the investigation which led Mi Tabbige to write the foregoin, paper he constructed various experimental tool holders a part of the more successful of which I shall now attempt to describe beginning with these in which a

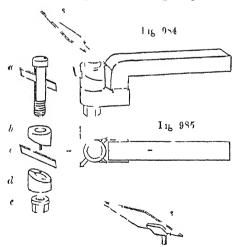

sin le cutter is used. The figures not one fourth of the size of the actual to be to the proportions i which may excounse be callaged or reduced according to norm times.


Fig 984 represents the perspective view fig 985 the plan and abcde the detuls of Mr Babbage's tool holder for the general purposes both of turning and planing metal the tool itself c being simply a short rectangular piece of steel cut off from the end of a long bar and ground at the end with one chamfer at about 60 degrees with the length of the blade. The stock is cast of gun metal and of a cranked form as seen in fig 984 the end being pierced with a vertical hole in which is fitted the bolt a having a long diametrical mortise to admit the tool freely as shown and a nut and washer e below to bind all the parts together. The bolt a passes through two circular wedges b and d inclined at the angle 27 on their internal faces and loosely united by steadying pins, the lower circular wedge has a diametrical inclined mortise to serve as the seat for the tool and which is grasped by the margins or walls of the wedges when the bolt and nut are tightened

Sometimes the cutter lies centrally to the shaft of the holder as shown in fig 984 and also by the central dotted line in the plan the vertical branch of the holder is pierced with a mortise then to receive the superabundant length of the steel cutter but at other times the cutter is inclined about 45 in either direction as represented in the plan fig 985 and the lutter then just escapes the stock through a little notch filed for the purpose

The one inclined position has been represented in the plan fig 985 and in this case the point of the cutter lies in a very fivourable position for turning either cylindrical or plane surfaces as the cutter stinds in advince of the stock and may proceed into an internal angle such as the joining of a mass composed as it were of two cylindrical blocks of different diameters. The took when simply bevelled or ground with one chamfer will not perfect the inner angle of the work on both faces but which may be done if the took is ground with two faces or as a pointed took meeting at an angle a little less than 90

The figure also represents a very useful addition applicable to all the tool holders and slide lests for metal turning namely a little eye shade which is no more than a small piece of window glass attached either to the tool holder or any part of the rest in a spring clamp which retains it at about an inclination of 40 or 50 degrees so as to be nearly at right angles to the line proceeding from the point of the tool to the eye of the workman which it effectually shields from injury. This simple contrivance which may be readily added to any slide rest embles the worl man inrowly to inspect the course and progress of the tool and yet defends his eye completely from the shavings.

Fig 986 represents the perspective view and fig 987 the end view (full size) of

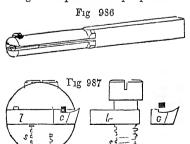

Mr Bubbares tool holder for internal worls and the small parts are shown detached also full size


The cutters c me short pieces cut off from a bar of steel fluted in the planing muchine to give that which Mi Bab bage has described as the angle of relief and they me sharpened almost exclusively at the end nearly square across or slightly chamfared or rounded at the coinci. This tool holder is made of steel the end is turned cylindrical and a cleft is sawn with a thick circular

cutter or saw down one side nearly to the axis and entirely across the end to the depth of about one diameter and a half

In the end view fig 987 c represents the cutter b the block against which the cutter rests and s the sciew that passes through b and holds the several parts in contact. The tool may be made to cut on the right or left hand side at pleasure as c and b each reverse. To enable the cutter to resist being drawn out by the force of the cutting action the small square wire represented black is added this square wire fits a groove planed out in the tool holder and lies in the flute of the cutter so as to secure it

In this internal cutting tool as in all others of similar kind a hole must be drilled or otherwise made in the work to admit the shift of the tool before it can be used and from the contricted measure of the tools used for turning the inner surfaces of small pertures the most suitable angles cannot be generally given to the internal tools

I igs 9.8 and 989 represent in the entire and dissected states one of several tools contrived by Mr. Babbage for turning wood by means of the slide rest. A small part of the end of the gun metal tool holder is inclined to the stem and the extreme end is filed convex to fit the concave side of the going c which is ground on the outside exactly as usual with a going end by hand. The cutter is retained by means of the strap d which embraces the cutter and also two little blocks a and b fitted together with a chamfered joint so that the middle piece which is carried down by the central binding screw, acts as a powerful wedge and fills out the space within

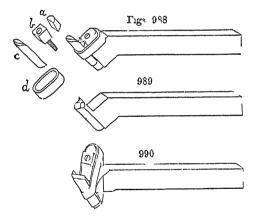

the loop consequently the tool is grasped with considerable firmness against the rounded end of the holder even when the pressure of the screw is very moderate. The screw requires a groove below its head and the wedge b, a corresponding pin or key that it may be raised to release the tool when the screw is unwound

In some of these tools the cutter is circular as a gouge in others straight as a chisel or angular as a pointed tool and of these three varieties some have bent shafts the ends of which not only dip downwards as shown in the side views figs 988 and 989 but are also inclined horizontally at an angle of 45 as in fig 990 in order to produce the same effect as the inclined position of fig 985 and enable the same tool to serve alike for turning cylindrical or plane surfaces at the one fixing The whole of these cutters for wood act in a vigorous and efficient manner


I shall now say a few words on Mr Bubbage's notions of the employment of cutting tools with many points, so that the work may be equally divided among all the points

The most simple case quoted by Mr Babbage is that of the screw tap in which to carry out his principle he cuts 6 or 7 longitudinal grooves instead of three only the faces of which grooves are undercut or inclined to the radius although not fully to the approved angle of 27 they more resemble those taps called by work men original taps shown in figures 250 and 251 page 591 but they nevertheless answer for tapping and screwing the finer class of worl as they produce true threads and work freely. The circular tops of the threads are is usual a little cleared with the file unto near the cutting points and in the larger sizes of these tap the flutes are undercut to admit of their being sharpened on a revolving lap

Another example quoted by Mr Babbage is that of Messrs Whitworth's key way cutter for making the internal grooves in the holes of wheels for the keys by which they are fixed upon their cylindrical shafts. The cutter is a cylindrical rod of steel through which are made about ten or a dozen rectingular mortises placed at equal distances and in a right line. Every mortise is fitted with a small steel cutter, the sides of which are made exactly true in the engineer's planing machine. The first cutter is sharpened so as scale by to project beyond the surface of the cylindrical bar the second projects a little more than the first and so on to the last the projection of which equals the full depth of the key way. When used the bar is first put into the hole of the wheel and which it should exactly fit and the bar is steadily pushed quite through the hole of the wheel or pulley by and of the steady move ment of an appropriate screw press.

This mode of action always cuts the key way parallel and not tiper as frequently wanted. From the abdivision of the work among the many cutters the work is well done and almost without injury to the cutters which should be sufficiently close tog their that the succeeding cutter may enter the groove before the provious one has passed through the same in other word, the interval between the cutters should be always less than the thickness through the boss of the wheel. The cutters after having been sharpened are set forward by aid of little screws fitted in a thin bar inlaid in a chamfered groove extending the whole length of the cutters.

Figs 911 and 992 represent Mr Bibbage's tool holder with many blades for the planing machine. This tool holder consists of two parillel bases of gun metal united

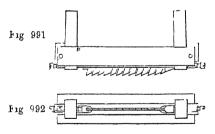

to closs pieces at the ends so as to form a narrow central cleft—the side bases are pieced with several holes which receive as many pins—that constitute the centers upon which a series of short purilled blades are jointed to the holder. When in use the blades are separated by parallel slips of brases and at the left of tremity is a block to which is given the inclination of 97—and—the end


screw being fastened the whole of the blades are fixed at thit ingle. Mr. Bubbigs says in making another tool holder of this kind he would cost the holder in one piece and tighten the cutters by the method of the screw and wedge a b fig. 988

In order to sharpen the cutters the briss separating precising the ingle block at the end are removed and all the flat preces then fall down so that their chamfered ends he in a straight line—when thus fixed by the end screw their chamfers are all ground at once upon a lap—on the reinsertion of the brass plates the tools bristle up like so many saw teeth after the manner shown—I he tool is fixed in the planing prachine at such an inclination—that the first cutter penetrates but a little way

and every succeeding cutter penetiates more and more unto the required degree owing to the inclined position of the tool holder—the difference in elevation of projection of its two ends being exactly equal to the intended thickness of the shiving to be removed and the two tails of the tool holder enable each end of the same to be securely grasped in the planing machine—(See first paragraph page 982)

Fig. 993 a free cutter for the lather is the last of these tools which Mr. Babbage's occupations have given him leasure to devise. The circular block is screwed to the lather as an ordinary chuck and on its cylindrical surface are cut 10 wedge form grooves or notches the one side of every notch is exactly on a diameter, the other side of the notch is inclined a few degrees and fitted with a parallel steel blade and a gun metal wedge, the several wedges are sent forward by tail screws tapped through a ring screwed on the back part of the chuck or otherwise attached

To sharpen the blades they are removed from the chucl and placed in the rhom bondal cavity of a tool holder shown in perspective in fig. 995, and in plan in fig. 996 the sides of the cavity are parallel and in pairs, but inclined in both directions to the angles at which the cutters are ground upon a revolving lap the horizontal

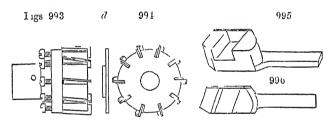

angle seen in 996 is 24 degrees the vertical is 16. By means of this holder the chamfered ends of the cutters are all thrown into one plane and the sides of the cutters into another plane and secured by two equal or folding wedges the ends and sides of all the cutters are then ground in musse


When replaced in the chief a distance plate d with a central projection or boss is first fixed to the end of the chief the cutters are allowed to rest in contact with this plate and on the sciews being tightened every cutter becomes fixed by its wedge and the distance plate ensures the ends of the cutters lying on one plane and as much in advance of the end of the chief as the space between the chief and the reduced margin of the distance plate

This circular cutter with removable blades may be viewed as a miniature and refinement of some of the large boring tools and cutters with loose blades figs 515 and 517 pages 509 and 571 and the tool here hown has been extensively used by Mi Babbage in facing all kinds of rectilinear pieces which are at the time fixed in the slide rest or in a universal chuck with series jaws attached to the slide rest by means of which the works are carried past the end or face of the slowly revolving cutter which serves for several of the metals including steel but the most effectively for brass and gun metal

Note AU - To follow note AT at the foot of pige 538

(Paper on the principles of Looks for Lurring and Planing Metals by the Rev Prof Willis of Cambridge A M I L 5 & Cc)

Let FGHK fig 997 represent rough cylinder of metal running in a lithic between the centers M and L and suppose that this is subjected to the action of the tool DBE which in the figure is supposed to have travelled from A to B for the purpose of turning the surface of the cylinder. The tool is fixed in a slide test by which it is carried in a direction parallel to the axis of the cylinder. It moves at such a rate that during each revolution of the cylinder the point B of the tool is carried onwards through the space B b. The proportions of the figure are greatly exaggerated for the purpose of showing the effect proposed to be illustrated for in practice as is well known although it is true that the effect produced by the tool in turning a cylinder is to trace a screw upon the surface yet the thread of that screw is either so fine from the slow motion of the tool that it appears as a mere roughness of surface or else it is so flattened as to disappear from sense * In this figure the screw must be considered as an exaggeration for the sake of explanation

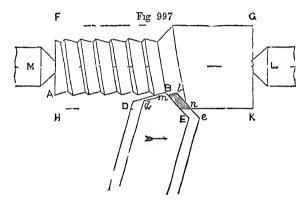

Since DBE and dbe represent the two successive positions of the tool at the beginning and end of one rotation of the cylinder a little consideration will show that the shaded space between them namely mbn is the section of the spiral shaving which runs off the work during the process of turning. In this diagram bn is the breadth of the shaving and bm its thicknes—but by varying the position or angles of the tool and its relative motion to the work it may happen that the reverse may be the case—that is to say that bm may be the breadth and bn the thickness. In all cases however the two cutting edges of the tool are employed in detiching the shaving the one (as BL in this figure) separating its breadth from the solid and the other (as DB) separating its thicl ness or abceverse

In adjusting the position and angles of a tool for turning or planing a given piece of work it appears to me essential that its action as shown by such a diagram as this, should be well foreseen and investigated and I can only regret that the narrow limits within which I am at present circumscribed prevent me from explaining the consequences of this principle by a variety of figures

For example In practice if a tool were used in the position of fig 997 the motion would be slow and the space Bb or mb which is the thickness of the shaving would be much less than in the diagram. It would be usually argued that BE was the real cutting edge and that the shaving would come off without the assistance of the other edge BD. Nevertheless the action of this edge BD is the only one

^{*} In fig 997 the thread of the sciew is inadvertently drawn so as to incline in the wion, direction. In fact the figure now shows the lower surface of the work seen transparently instead of the upper as it ought to have done

which is left upon the surface of the work and if the shaving be torn off edgewise by neglecting the action of this edge the surface will necessarily be left lough

By plucing the edge BD still more nearly or even exactly parallel to the axis of rotation and rounding off the corner D* to prevent it from catching the surface the screw form may be wholly obliterated and if the edge BD be carefully sharpened a finished surface will result—for it is clear that thus the edge BE is wholly occupied with the hard work of separating the breadth of the shaving and that the surface which it leaves at each turn is wholly removed in the next whereas the edge BD has the lighter worl of separating the shaving edgewise and the surface which it leaves is in fact the visible surface of the work when completed

Let us now examine the angles that may be given to the tool edges. The 998 shows the pointed tool in its simplest form. AB and AC are its cutting edges. The stem of the tool may be of various shapes for convenience but the cutting portion of the instrument is bounded by three planes namely two side planes one of which only S is shown in the figure, and a third or upper plane U. The intersection of this upper plane with the two side planes respectively produces the cutting edges AB AC and the intersection of the two side planes produces the line of the front angle AD.

By a proper management of the inclination of these planes to each other we obtain the desired form of the point of the tool and the proper acuteness of the cutting edges. This is the subject to which I wish in the next place to direct attention

The front angle upon AD determines the form of the point of the tool in plan and also the section of the shaving as already explained. As to the cutting edges, a greater or less inclination of the upper plane U of the tool to the horizon (always supposing the tool to rest on a horizontal bed), will produce a greater or less degree of acuteness in these cutting edges

If the upper plane be horizontal the cutting edges will plainly be square whatever be the front angle of the tool. But if not then the rugle of the edges will vuy conjointly with the front angle of the tool and the inclination of the upper plane

Different metals and qualities of metal require different degrees of acuteness in the cutting edges which have not been as ful I how exactly determined. In the present case I will assume that wrought non requires an edge of 60 cast aron of 70, that brass may be roughed out with an edge of 80, and finished with one of 90. These angles I believe to be very near to the best probably a variation of a degree or two is of little consequence. But as the finishing of some kinds of work requires that the edge of the tool should endure through a long process without giving way and requiring fresh grinding it is of some importance that the edges should be carefully investigated.


In grinding a tool of this form it is convenient to consider only the angle which the upper plane U makes with the line of the front angle AD. In other words the angles of the cutting edges AB AC being equal if we suppose a vertical plane to pass through AD and make equal angles with the side planes S it will clearly intersect the upper plane in a line AI, biscoting the angle BAC and the upper plane will be perpendicular to this vertical plane. A rough gonometer | will enable us to grind this upper

^{*} In fact there is no occasion to round off the corner D because the edge 1 D is in most cases inclined downward; and the corner D carried thereby clear of the surface of the worl except in face turnin

By this term is meant a frame attached to a rinding machine capable of being set at different angles so as to ensure that the tool which rests upon at during the process, shall receive it projet form. A joing tat would be a better name

plane at any desired angle IAD and thus to ensure that the cutting edges shall be alike

But this angle kAD is not the same as that of the cutting edges and the question to be answered in every case is the following — Given the front angle of a tool (i.e. the plan of its point) and the cutting edge required by the metal which it is to cut to find the angle of inclination IAD of the upper plane. This is an affair of trigonometrical calculation, and for practical purposes is best resolved into the form of a

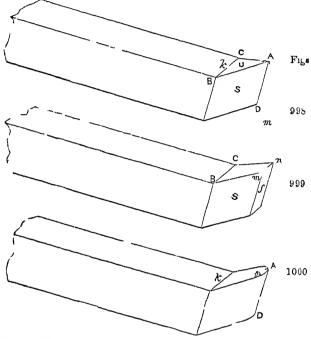

short table which I will give simply iemarling that I have not thought it neces sary to state the results nearer than to the next hilf degree which is indicated in decimals when it occurs as 69 5

Table of the Angles k A D												
TRONG ANGLL	R(Nf ANGLL CUITING FDGE											
UPON A D	85	80	75	70	65	60	55	50	45			
150 140 130 120 110 100 90 80 70 60 50	84 5 84 83 5 83 82 81 80 78 75	80 795 785 785 77 76 715 725 70 66 595	74 5 74 73 5 72 5 71 5 70 68 5 66 63 5 52 40	69 5 69 68 67 65 5 63 5 61 8 53 5 47 36	64 63 62 60 5 59 56 5 53 49 42 33 0	59 58 56 5 55 52 5 49 5 45 39 29 0	54 5,5 51 49 46 42 36 27 0	48 5 47 45 42 38 5 33 25 0	43 41 5 39 35 5 30 23 0			

To use this table take the column which corresponds to the required cutting edge. The degree placed opposite to the front angle of the tool will show the inclination of the upper plane U to the front angle namely the angle $k{\rm AD}$. Thus to obtain cutting edges of 10 for a tool whose front angle is 90 the plane U must be ground to an angle of 61 with the line of the front angle AD.

By means of this table severa curious results may be obtained. For example I have often seen tools for tuining iron in which the front angle AD has been made 60. Now referring to the table in the column for 60 (the proper cutting edge for non) we find zero opposite to the front angle 60 indicating that the desired form is impossible that is to say that it is impossible to place the upper plane of the tool at an angle that will cause it to make the desired cutting edges of 60. The same front angle of 60 under a cutting edge of 65 gives the angle \$\text{kAD equal to 33}\$ which is still too route for the required strength and even a cutting edge of 70 requires the weak angle \$\text{lAD of 47}\$ In short no proper edge can be given to an iron turning tool whose front angle AD is not greater than 60.

To produce a stronger point the front angle of the tool is sometime—ground flat as at f in fig. 999 so as to make a short intermediate cutting edge m n. It is clear that the angle of this new cutting edge m n is the same as 7 AD in fig. 998 in the table which table will therefore serve for this newform. This shows the impossibility of making the front cutting edge m n with the same angle as the other two for the former will be much more acute than the latter except they be all square edges. If it were not for this circumstance this form would give a strong and effective tool so that it is worth while to examine the amount of the objection

Supposing the front angle of the tool (which in this case is the angle it which the two side planes would meet) to be 90—the table shows that if the lateral cutting ed es are 60—the front edge m n will be 15—As this is too acute to stand let the front edge be made 60—this will give about 70—for the side edges. For iron and steel tools then this form is bad because the difference between the angles of the cutting edges is too great—The best form for these metals appears to be one in which the front angle of the point is made as obtuse as possible and both the cutting edges alike

I or example the front angle may be made equal to 135. This corresponds by the table for a cutting edge of 60, to a vertical angle IAD of 57, and produces a very strong tool similar in form to the part of fig. 999 which is included between the planes S and f but having both its outting edges of the same degree of acuteness

The same remarks upply but not perhaps so for cibly to the case of tools for east iron in which the cutting edge should be about 70. Thus if we give to the form fig. 999 lateral cutting edges I m (n of 70 (supposing as before that its side planes are inclined at 90) the front edge m n will be only 61. and if we make this front edge 70 the lateral edges will be about 76. Thus the difference is much less than in the former example but still the form of fig. 998 is preferable and the more obtuse the front angle is made the stronger will the point of the tool be An angle of 150 may be given to the front angle AD

Sometimes tools up made nearly like fig 999 but in which the front is rounded off as in fig 1000 instead of being bluuted by a plane as tf. These are liable to the same objection as the form fig 999 namely the impossibility of giving an equal angle to all the cutting edges. For comparing fig 999 and fig 1000 it is clear that the vertical angle 7 \D is the same in both and that in the round point this angle passes through all degrees of acuteness between that at A and that it a instead of abruptly changing from one to the other at th as in fig 999

Besides this a shaving which is separated by a round tool and which conse quently has a cuived section cannot roll itself off the work with the same ease that a ribbon shaped shaving does. It thus opposes greater resistance to the edge of the tool and blunts it sooner. Also a round pointed tool is more difficult to keep in order than a tool whose edges are formed by planes alone.

On the whole then I am inclined to recommend the obtuse pointed tool for cylinder turning and the planing of flat surfaces but the tool should terminate in an angular and not a rounded point and the edge BD (see fig 497) should be set nearly or quite parallel with the path of the tool as from A to B in turning a cylinder or planing a flat surface. For more complicated figures of course different forms must be adopted as for planing into corners or turning projections but the same principle of keeping the front angle AD fig 998 as obtuse as possible may always be recollected with advantage

There is yet another point to be remarked. In the above pages the tool being assumed to rest upon a horizontal plane, the side planes S may be supposed to be vertical and consequently the line of the front angle AD vertical also

But M1 Nasmyth has well explained the necessity of inclining these planes to an angle of about 3 from the vertical. This produces in AD an inclination from the vertical which varies according to the amount of the front angle of the tool, but which must be taken into the account in the construction of the gonostat. For the angles given in the table above, are the angles kAD and not the angles which the upper plane makes with the horizontal plitform of the slide rest upon which the tool is seated. The following table therefore is given to show the angle which AD makes with the vertical line An under different angles of the front always supposing the plane S to make an angle of 3 from the vertical according to Mr. Nasmyth's statement.*

FRONT ANGLE	150	140	130	120	110	100	90	80	70	60	50	40
VERTICAL ANGLE m AD	3 5	3 10	3 17	3 27	3 38	3 53	4 12	4 44	5 11	6	7	8 39'

The above remarks are offered in the hope that some one with the proper opportunities will be induced to make experiments upon the best form and edge of tools for different materials

The relative angular positions of the planes of the tool point and the different kinds of edges produced may be made clear to persons not familiar with geo metrical notions by large wooden models in which the three principal planes being cut the resulting edges may be measured with a gonometer

Note AV —To follow Note AU at the foot of page 538

(A Paper on a new form of tool holder with detached blades for turning or planing metal and on a new mode of fixing down tools upon the slide rest, by Professor Willis A M &c)

Instead of making the cutting portion and the stem of a tool in one piece of steel the cutting part is sometimes formed out of a small piece of steel and the stem is furnished with some convenient contrivance for grasping it

This principle has several advantages especially for amateur workmen who can

^{*} Mr Nusmyth's tool grube for showing this angle is described and figured on page 34 of the text

shape and temper a small piece of steel but who may not be provided with a forge and apparatus necessary for the construction of a complete tool Besides the process of tempering can be more effectually carried out with a small piece than when we have to deal with the end of a large lump. I do not I now the hi tory of this contrivance. Mr Holtzapffel has had for many years on sale a tool on this principle and I have also seen it in other factories.*

I will proceed to describe the form into which I have put it for the purpose of experimenting upon the ingular forms of the tool edges deduced in the preceding pages. As the cutting extremity of the tool is bounded by three planes, the piece of steel may be arranged with respect to those planes, in different ways, according to the purpose required.

Thus a triangular prism of steel may be adopted of which the front sides S fig $1001\,$ make the same angle with each other as that of the side planes of the proposed

The stem of the tool must guasp the pusm so that these planes may make an angle of 3 from the vertical and the upper plane U only must be ground Figs 1001 from time to time at the proper angle the prism being of course raised in its clamp so that the point shall al vays coincide with the level of the axis of the lathe This is the mangement of Mi Holtzupffels 1002 tool It does not allow of different angles being tiled for the side planes because the grasping part of the stem is so fitted to the angles of the prism as not to admit of prisms of different front angles being in And indeed this would not be practicable for according to the second table which I have given 1003 it appears that the angle of inclination of the paism would be different for different front in les I ut when the best front angles are determined this arrangement will probably be found very effectual

Another method is to clump the steel prism it such in ingle that its upper surface U fig 100° may coincide with the upper plane of the tool and in this case the side planes S can be ground at any desired angle but the angle of the upper plane remains fixed

I have found it convenient to choose in angular position for the prism that shall as in fig 1003 he between the mean place of the upper planes of the tools and the places of the side planes. Thus if C fig 100 be the prism inclined at an angle of 55 to the horizon side planes S may be ground at its upper end and also an upper plane αb


The section of the prism being thus independent of the relative angular positions of the three planes that form the cutting extremity may be determined solely from considerations of convenience for facility of shaping and fixing. I have employed round steel wire of the largest diameter usually kept in the shops (namely I area shire bright steel wire) and filed slightly flat on the upper surface as shown in the succeeding figures. When the side planes have been formed the granding may tale

^{*} The ruthor believes that tool holders with small detached cutters were first used in the block michinery at Lortsmouth, and since 18,0 he has the cly employ divitions kinds of these tool holders in his manufactory. See text, pages 535,6 where some of the tool holders are described in Ligitud.

place on the upper plane alone for some time thus beginning at ab we may grind down to cd then we may grind the side planes aftesh and so on

I will now describe the stem and clamping apparatus figs 1004 1005 and 1006 A but of non ABCDE shown in elevation in fig 1004 serves as the foundation of the instrument. It is strught and square from A to B which portion is the stem of the tool by means of which it is fixed in the tool holder of the slide rest. The form of the part BCDE which receives the steel wire PQ is given in the elevation. It is bounded however by the same vertical planes as the stem AB.

An angular notch is filed at DE for the reception of the wire. The axis of the wire when clamped into the notch should lie in a vertical plane parallel to the sides of the stem and should make an angle of 55 with the horizon. The section of the notch is shown in fig. 1005 which is a plan of the tool or rather projection upon a plane perpendicular to the axis of the wire. The inner side of the notch

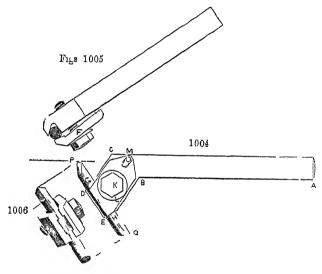

is sunk perpendicularly to the side of the tool so that the flat side of the wire may be upwards. The wire is clamped into the notch by means of a piece I. The form of this piece is shown in fig. 1004 and is very nearly the same as that if the extremity of the stem piece. The screw K tipped into the stem piece presses Γ into contact with the wire along one extremity GH and with a short pin M (fixed into the stem of the tool) at the other extremity. To ensure the firm grasp of the wire the following an angements are made.—

The first requisite is that the clamping piece F should be left at liberty to talle a secure bearing upon the wire—If the latter were perfectly straight and cylindrical and the under surface of I perfectly flat this bearing would take effect along the line GH which is the line of continuence of the said plane and cylinder

But in practice a rounded or twisted surface would defeat this object and there fore the middle of the bearing surface of the clamp is filed away is shown in the front view fig 1006 so as to insure a pinch at or near each extremity of the line CH (For the same reasons the notch in the stem piece should be filed away in the middle as also shown)

The bearing at the other extremity M of the clamp is upon a round headed short hard steel pin driven tight into a hole in the stem piece. The head of this pin is received friely into a notch filed lengthwise in the tail of the clamp as shown by the dotted lines. This allows the clamp to settle itself freely upon this bearing point and at the same time prevents it from turning round and shift ing its proper position upon the stem.

Thus the pressure of the screw K is distributed upon the three points G H and M and by the well known principles of statics if N be the bisection of GH and if the center of K he in the straight line joining N and M then will the pressure of the screw be equally divided upon C and H whatever be the angle GNM Further if MK be equal to twice NK the pressure of the screw upon all three points will be equal. However it is better to throw M as far from the screw as possible for thus less pressure is exerted upon M and therefore more upon G and H

Finally to ensure the fiee transmission of the pressure of the screw to the clamp without jamming or wedging a spherical washer L is interposed between the head of the screw and the clamp and is received into a corresponding cavity turned in the clamp. If this be thought too expensive an arangement, the lower part of the head of the screw may be made spherical and received into a coincal or countersunk civity. Care must be taken to make the hole in the center of the clamp F through which the screw passes considerably larger than the diameter of the screw else all these arrangements to enable the clamp to settle itself freely upon its bearing points may be defeated by its being driven laterally against the screw. A short wire spring coiled loosely round the screw between the clamp and the stem piece and touchin, the clamping piece between k and N serves to press this piece out wards against the spherical washer and also keeps it in contact with M and thus prevents it from hanging loosely when the wire is withdrawn

(1 new Tool holder for the Slide rest)

In the ordinary tool holder or contrivance by which the tool is secured to the tible of the slide rest no provision is made for placing the tool in various angular positions. The stem must lie provided or very nearly so with one side or the other of the tible or in other words we have but the choice of two directions far its stem. If it be desired to present the point of a tool in an oblique direction it can only be effected by bending the tool itself. I am aware that contrivances have been proposed to enable the tool to be fixed angularly as for example. Mr. Parsion's Improved Box for a slide rest. (described in the Society of Arts Transaction's Vol. xlviii. page 240) which is I believe but little used and in principle of construction is entirely different from mine.

The continuous I am about to describe I constructed in the spring of 1842 and have had in use ever since and it was also immediately adopted by Mr. Holtzapfiel by whom it has I believe been found perfectly effective. It enables the tool to be fixed at any equired angular position upon the table of the slide rest and is besides capable of being entirely removed from the table so as to leave it free for the reception of other contrivuous as for drilling cutting wheels. &c. The tool holder is shown in plan in fig. 1008, and in elevation (partly sectional) in fig. 1007.


In this tool holder the tool is secured in its position by the action of a single nut A which is tripped to a strong sciew pillar BC. This screw has a found shoul ler

^{*} Nearly all the sliding rests in the authors manufactory have been fitted with Mr. Williss apparatus for prepring the tools and which inswers so completely as to be always adopted in sliding rests for metal turning now made therein

below which bears upon the surface of the table—beneath this shoulder is a short portion of screw C which is tapped into a hole in the table—The screw pillar can therefore be removed or replaced by means of a key applied to flat faces filed upon the shoulder—The pressure of the nut A is transmitted to the upper surface of a triangular clamping piece DEF fig—1008—through the interposed spherical washer G which works freely in a corresponding cavity in the triangular clamp as shown in the section fig—1007

Two short rounded studs of hard steel D E are driven into the lower side of the triangle and rest upon the upper surface of the stem of the tool. At F a sciew is tapped stiffly into the triangle and its lower end being rounded like those of the studs D and E it follows that when the nut A is brought into action its pressure upon the triangle is resolved upon the three bearing points below, namely upon the two D E which press upon the tool and clamp it to the surface of the table and upon the third at F which pies es upon the table through the intermediate piece H which is principally interposed to save the table from bruises

If the nut be loosened the tool and triangle are set at liberty and the latter may be placed in any required angular position when a turn of the nut at once fixes it

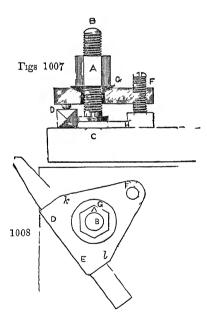

completely But as it is necessary that the tool should be under the stude D F and therefore always at the same distance from the center of the seriew the intermediate piece H is contrived also to answer the purpose of guiding the stein of the tool readily to this distance

The outline of this piece is exactly the same as that of the triangle under which it lies with the exception of the side which is parallel to the tool. The side is made at such a distance from the center of the screw that when the tool rests against it it is set in the proper position to receive the pressure of the study D E

11

106

of the thrugular clamp. The dotted line k l fig. 1008 is the boundary of the lower piece and at the opposite extremity of this piece a thick lump is formed in which a notch or groove is filed in a direction pointing to the center of the screw pillar. This groove receives the end of the screw F as already explained. The form and thickness of the lump and the position of the groove are shown by the dotted lines in the figures.

The tringle ind wisher are drawn in section in the upper figure to explain the adjustment of the wisher G. As the upper surface of this washer is always hore zontal the hole need be no larger than is sufficient to pass fixely up and down the screw pillar. But the case is different with the triangle D I is for as that is required to accommodate itself to nice which the screw pillar passes should be large and slightly coincid as shown in the section. In fixing the position of the screw pillar upon the table of the slide rest it should be placed at such a distance from the two edges that the bearing points D L F of the triangle may not hang over the edges in any position but that the tool may be always clamped within the limits of the table—the dotted circle in the plan explains this sufficiently

A circular hole in the middle of the piece H fits loosely the shoulder of the sciew pillar and is the end of the sciew F is received freely in the groove of the interine diate piece which latter is thereby kept in its proper place below the triangle it to lows that the whole combination of tool triangle and intermediate piece may be swing round the central pillar without escaping from their proper relative positions

The sciew I is introduced to allow of adjustment for tools of greatly differing thickness. But if it be necessary to put thin wedges under either end of the ster i of the tool in order to raise or depress its point, the spherical washer allows of this by transmitting freely and centically the pressure of the nut notwithst unding that the upper surface of the triangle becomes inclined from the horizontal position. It must be also observed that the tool may be placed either to the right or left if the series pillar at pleasure, and a spiral spiring may be introduced below the triangle to prevent it from falling down when the tool is withdrawn.

The trivingle should be made of such a size that the distance between its bearing pans D I may be the same as that which would be given to the binding serews of an ordinary tool holder


Note AW to follow the first purgraph 542

(Mr Frantlin's Lupanding Center Bits)

This modification of the center bit fig 457 page 541 enables a series of three tools to bone all holes intermediate between half an inch and two inches in diameter and that with very little interference in the general principle of the tool

In figure 1009 the two parts of the instrument are separated beyond the distince at which they are used in order to show the construction and from which view it will be seen that the part a of the expanding bit which is squared at the end to fit the expenter's brace is extended at the other end to form the central pand by which the tool is guided. The moveable part curies the scoring outter or nuclei c and this piece admits of adju timent of diameter it being attached to the main stem by the rivet b and fistened thereto by the binding screw c that passes through the mortise in the investble piece—this latter part is formed to constitute the latter if cutter f by which the shavings are as it were swept out of the hole that is being in ide

When the center bit is contracted to serve for its smallest diameter as in fig 1010 the radii of the nicl er and cutter are just all e but it is found that the radius of the nicker may be increased above one fourth as in the dotted position, and that still

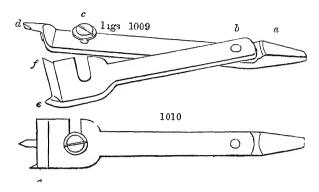

the cutter acts furly as the shavings become readily disen nged. These expanding bits menotintinded to supersede the ordinary center bits of fixed sizes but to serve for occasional works. and they are extremely well suited to the wants of amateurs.

Note AX to follow the paragraph page 544 commencing another Screw Auger (The American Screw Auger)

The American screw auger fig. 466 page 548 was patented by Mr Wm Ash of Sheffield and is described in the Practical Mechanic and 1 n meers Magazine Glusgow 1842 Vol 1 page 108

This description speals of a different modification of the screw auger from that described in the text and in which a piece called a guide is employed instead of the worm usually soldered to the shaft. The guide consists of two thin rings united concentrically by two fin situated on a diametrical line leaving two large semi-annular spaces between them. The outer ring is made as a short conical screw the inner embraces the central stem of the auger upon which it fits loosely behind the cutter.

The ruger first bores a shallow hole into which the loose guide ring is sciewed to serve for the guidance of the instrument by the central ring or thumble which fits the auger shaft and the shavings have to escape through the annulu spaces between the two rings. This part of the continuance appears however to be fulless practical than that described in the text

M1 I hineas Coole was rewarded by the Society of Arts in 1771 for the invention of the screw auger fig 403 page .43 but the difficulty and expense attending its first construction appear long to have withheld it from general use — See also Smith's Panorama of Science Vol 1 p 113

Note AY page 554 to follow the purish uph ending without figures

(I'reeman's Pegistered Drill Iool)

This is a very useful substitute for the drill bow it consists simply of a flat strip of wood from about a to 16 inches long by , to 11 wide with an appropriate handle and on one side of the wood is cemented a strip of sheet india rubber or

crouted one. The pulley of the dull or drillstock is made of wood and cylindrical the drameter and length being about equal and the extreme angles slightly rounded. The contact between the wooden pulley and the contact one will be found quite sufficient for the worling of small drills and as the tool is samply used as a violin bow the tedrous process of coring on the string of the ordinary bow is entirely avoided.


Not A' pine 5.7 to i llow the econd paragraph (W. MacDiu Us 12 him I an Scien Diull tool)

Mr MrcDow alls improved drillstool fig 1011 is a very us ful instrument to be using by icer reciting metion and which was new used in 1845 by the Society. Afts It consists of a rod of the so called pinion who (the formation of which is noticed on page 476 and fig 294 of vol 1). The one end of the wife is been dup to serve as a societ for receiving the drills the other end is formed into a center point and contained within a handle or societ by which the instrument is suided towards and pre-sed into the worl—the remainder of the instrument consists of a slid r or nut fitted to the ribs of the pinion—wire and possessing a handle having an universal joint.

If the grooves of the pinion were were straight like the flutes of a column the nut might be slid up and down without giving any motion to the drill but is the

wir is twisted to the extent of two or three turn in its length lile a very oblique s new every seemt in decent of the hamilic cruses a circular reciprocating motion of the drillstock to the extent of two or three revolutions to and fround fulfils the office that would otherwise require the drill bow of the breast drill or the cross staff of the upright or pump drill

The instrument is above described mawers beautifully for very small holes but the injent as inventor was again rewarded in the following year for addition by which the power of this drill tool is much increased. He first added a transverse or diametrical arm at the foot carrying two balls to cave is a fly and give momentum, but mean venicine their occurred from the weight having to be said dealy stated and stopped. This defect was judiciously remedied by introducing a little eath which or a which is in the nut by which is in the brequet watch ley and also in the ratchet drill page 561, the catch slips over the



tecth of the ratchet wheel in the iscent and only moves the drill in the descent thus allowing the fly to let uninterruptedly and impel the drill with continuous motion in the one direction only and with increased force. With the improved instrumentie-istered under the nume of the *Continued I crotion / Archimedean Drill* heles can be pierced of fully twice the diameter of those which could be inade with the former and in its simple Archimedean drill having a recipioe sting action.

Note I A - 10 follow the Note AZ on pr e 557

(Mr Man Dewall's Pectangular Archimedian Drillstel for Dental Surgery)

This tool which is represented in fig. 1012 is in off hoot of the reciprociting Archimede in drillstock. The parts a b c to d of the succeeding figure are preciply


unalogous to the corresponding parts in fig. 1011 except that from b to d extends a string ht bar that firmly unites these two parts. From d to e is a socket or tube carrying at e a small drill socket or hollow mandrel at right angles to the length of the instrument and within the tube are concerted two very small beard pinions the one fixed on the drill soclet the other on the end of the recipiocating drill shaft b d which is continued within the tube so far as e the beard pinions therefore transfer the motion of the recipiocating shaft to the drill

The tube which extends from d to e may be moved round in the collar at d and fixed in any required position by the thumb screw so that the drill may be directed upwards downwards to the right or to the left according to the position of the hole the dentist has to drill in the tooth of his patient

Note BB -To follow the Note BA on page 557

(Capt G D Davison's Rectangular Divilstoci for Dental Surgery)

Fig 1013 represents an instrument for the same purpose as the foregoing and which was invented at about the same time as fig 1012 by an officer of the Phitish Army engaged in the Ahmednuggur Survey in India It consists of two slender

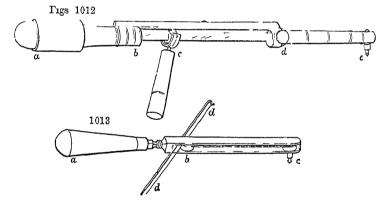

burs of steel united at both extremities and inserted by the one end into a wooden or ivory handle α at c is a small spindle for the drills with an appropriate pullcy situated between the two side bars and at b is a similar pullcy. The catgut line by which the drill is moved passes entirely round the pulley of the drill societ at c the two ends then run parallel with the stem of the tool in a each a quarter turn in opposite directions over the guide pulley b and then proceed to the extremities of the drill bow d d which passes through the space between the side bars of the instrument. If the pulley c is situated close to the end of the instrument and the drill bow nearly fills out the space between b and the steel frame the cord will then be returned in the grooves of the pullies with little or no risk of its being accidentally detached. This instrument like the last may be used in all the required positions


Note BC page 563 —To precede Section IV

(M) George Scotts Apparatus for Boung and Tapping Cast is on Main Pipes for Water and Gas)

Fig 1014 represents Mr. George Scotts apparatus for drilling gas and writer pipes and which was rewarded in June 1846 by the Society of Arts. The parts are all

grouped together as if in use but the pipe itself is represented in dotted lines in order that the point of the drill and the apparatus generally may be better seen a is a semicircular iron strap that embraces the pipe b b c c is a cross piece with a screwed central hole attached to the curved strap by the nuts d d and e is a tube screwed into c c and which tube carries the revolving socket f terminating in the drill g. When the parts are all united and fixed to the pipe as in the figure the drill socket f g is handed round by means of a spanner about two feet long applied to the square at f and whilst the hole is being pierced the drill is set gradually deeper by a screwed nut which is extended so as to constitute the handles h h by the movement of which at intervals the drill is gradually forced deeper into the hole it is in the act of boring

When the hole is completed the soci et and dull fg are removed from the cross piece cc and the screw tap shewn separately at i is inserted into the same hole and the threads of cc and i being alike in diameter and pitch cc serves to guide the tap

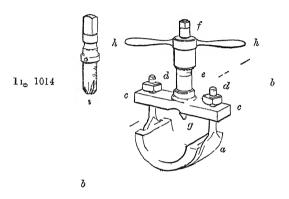

very truly into the hole previously made. By introducing different saddle pieces of wood that he between the strap α and the pipe and by using smiller drills and sciew taps of the same thread the same apparatus may be made available for smaller pipes. It is very efficient for its intended purpose and a decided improvement on former methods. The principal part of the tap i is left with the thread entire to serve for the guidance and the end alone is tapered and cut with several notches almost as a conical countersink, and which fully suffice for tapping the thin metal of the pipe.—See also text page 558

On Drills and Boring Bits used in Tathes and Boring Machines

Six tools of this class have come to the author's knowledge since the foregoing pass were printed they will be now figured and described by why of appendix to the text. Three of these tools are intended to maintain their several diameters unaltered the other three admit of adjustment for size within certain limits. To the best of the author's belief they are all quite separate and independent inventions up lied to one nearly common purpose.

Note BD —To follow the text pages 564 to 567 (M: Collass lathe didl)

A lathe drill described as the invention of Mr. Collas of Paris Engineer is figured in page 171 of the Engineers and Machinists Assistant Glusgow 1846. The instrument for greater perspicuity is here represented in per pective in fig. 1015. This drill is turned as a cylinder and perforated to the extent of three or four diameters with a hole of about one tenth of the exterior size. Exactly one third the



cylindical end is removed so as to form a longitudinal incision extending to the center and having radial sides—the extremity of the drill is ground somewhat a in the half-round bit fig. 507 page 365 to make the one edge cut—behind the angular part a further portion is reduced to the diametrical line and the remainder is either cylindical or square—and terminates in a center for the populated

The work having been chucked in the lather and a shallow recess turned out to admit the end of the bit the latter bores the hole in the solid metal to any depth that may be required as the core or the small portion opposite the central hole extends up the drill shaft (which it is considered to guide) and the core breaks off in small process as the drill progresses into the solid metal

The ordinary half round bits fig 507 may also be employed for boring holes in the solid metal but which is not their common as plication and when exactly semi-circular they remove the whole of the m-tal not leaving a core but as usually ground they leave the bottom of the hole as a very obtuse cone—to make the bottom of the hole quite flat the half round bits may be ground square across on the cutting side—and bevelled on the opposite to clear the bottom—But the nearly rectan ular edges of the half round and similar lats require more power and work less freely an drilling holes in fibrous metals than the ordinary fluted drills fig. 470 page 548 and are more troublesome to enter

The author considers the central lolo in In Colless drill not to be required for the purpose of guiding it which office is performed by its exterior surface and he sees no reason why the cutting edge should not as in the half round bit proceed beyond the center and remove the whole insteard as in making a flat bottomical hole in this case the central pin left by Mr. Colless drill requires after removal

Note BL -To follow the text pages 764 to 567

(C Holt at fils borrng bit with chen, cable cutters derived from the half round bit)


This was continued for boning h les in models of guns howitzers and mortals to word the expense of the inany long boning bits required in maling a series of these models

The stock is constituted as shown entire in fig. 1016 and detrehed in fig. 1017. The end of the stock is turned cylindrical and has a notch across the extremity extending below the diametrical line and also a longitudinal groove on the under side. The notch access the cutter can hack embraces the flattened edges of the stock and is held by two small scients the groove accesses the bearing piece by which is fixed by two other sources that are countersunk.

The outer parts of c and b are turned to the cylindrical form and hardened the cutting angle c being allowed to be always more prominent than the two other parts

One stock was thus made to serve for vulous diameters from $\frac{1}{5}$ of an inch to $\frac{1}{1}$ (or 882 to 1169) another for sizes between $\frac{1}{4}$ inch to $\frac{1}{5}$ (or 1297 to 166) so as between them to answer for boring models of the entire series of Ordnance employed by the British Government when constructed on the scale of one sixth their true sizes


I or drilling the preparatory holes below $\frac{\pi}{3}$ drameter the system of three tools described in the first paragraph page 567 was employed so as to ensure the exact

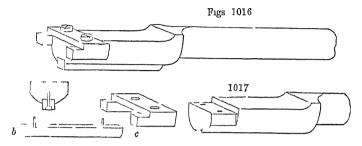

centrality and traightness of the bore and in forming the curved chambers in the various models different cutters with tail sciews were inscreed in a hole typed in the axis of a long boring bar also used in the lathe. The entire scheme was quite successful and is perhaps the smallest example of (viitually) half round bits with loose cutters.

Note BF —To follow the text pages 564 to 567 (The Corns h bit with loose cutters)

The Counsh bit is a useful lathe duil apparently derived from the boning bar fig 514 page 569 and lile it is adapted to holes of certain fixed diameters. As seen in fig 1018 the stock which is cylindrical throughout (except where it is square for the hook wrench) is calluged at the one end and has a diametrical mortise fitted with a cutter c notched out at the one end to embrace the flattened sides of the bar and secured with the wedge was in fig 514. But as the Counsh bit is used in the lather and is therefore only supported by the work at the one end and the popit head at the other a bearing piece b is fitted in a longitudinal chamfer groove on the




under side of the stool as seen in the end view in order to leep it central. The three edges of the cutter and beging piece respectively are all turned in their place. The utter is been lied and rounded so as to cut at the front only after which the justs are hadened.

The Connish bits are not made for holes smaller than about 11 inch in drameter and by means of additional cutters and bearing pieces every stool may admit of an increase of size of fully one half its minimum diameter or say from about 1½ to 2½ inches and larger sizes in proportion. This is a very effective tool, and is in gone all use amongst engineers.

Note BG -To follow the text pages 564 to 567

(Messes Mandslays boring bits with loose cutters for boring the bosses of wheels pumps and s nall steam cylinders in the lathe)

Boing bits of the kind represented in fig. 1019 ringing from about 3 to 12 inches in diameter and with a power of variation in size were many years back introduced by Messrs. Maudslays and employed for boring the bosses of wheels small cylinders pumps to. The stocks of the smaller sizes of these tools are made in wrought from those of the larger in cist non-the cutters rest in contact with a fillet made on the stock exactly at right angles to the axis, and are held down by screws which pass through mortises in the cutters to enable these to be set out to various




diameters. The beaung pieces beneath although generally fitted in a chamfer groove are also made to admit of packing pieces by which they may be set out to mile the three points of bearing to fall in a circle of the exact diameter of that to be bored. The larger of these tools the cutters of which are a now very much less used since the boring bus with sliding heads or blocks are fixed to in pages 569 to 372 of the text, have obtained such general employment for boring cylinders and pumps.

Note BH — To follow the text pages 564 to 567 (Mn Strens Pegastered Lathe Drill)

This instrument is represented in perspective in fig. 1020 and in plan with the top plate removed in fig. 10°1 it has two cutters which are adjustable for various diameters—the tool is intended to be used after the manner of figs. 509–510 and 511— $1 \le 565$ that is with the loop fig. 511—The two cutters c.c. lie in oblique grooves the ends of which are it in angle of 45 degrees and between the cutters is placed a wedge u.u. the long shaft whereof extends through the entire length of the duil shaft and has the hollow center for receiving the pressure of the popit head. When this long wedge is set forward by a tail screw and nut (not represented) it throws out the two cutters in any required degree so that the bit for holes of one such in diameter may be thus enlarged for any size not exceeding about $1\frac{1}{4}$ inch and so with the larger tools

The cap piece or plate p p which is represented removed and is attached by three sciews has a shillow circular recess within which the two pins fixed in the cutters we loosely contained to pievent them from being accidentally lost. The


cutters are rounded at the ends and sharpened precisely like the bit fig 509 and the two edges of the shaft from a to b are made symmetrical and with rectangular edges in order to stick into the sides of the loop such as fig. 511 from which this

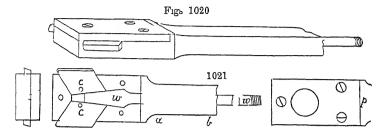

drill receives its axil guidance in the manner already explained on page 566 but it appears objectionable that the guiding loop should from necessity be so far removed from the cutting edges of this expanding drill which is proposed to be made as large as eight inches in dirmeter

In this instrument three parts instead of two only are made to adjust radially and equally—from the one point only being sharpened—and from there being a bottom bearing upon the surface of the hole that is boiled the instrument is used in all respects as the common half round bit—and without the necessity of the loop or guide (fig 511 page 565) required with Mr Stivens expanding drill and of which latter Mr Kittoe had not the least knowledge when he constructed the present tool

Fig 1022 is the perspective view of the boing bit when in condition for work fig 10°3 is a section of the same through a horizontal plane and α to 7 fig 1024

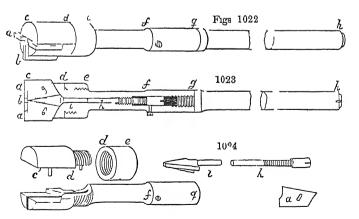

we the parts shown separately the same letters being attached to the same puts throughout. The part from ϵ to g is of brass, and contains all the neech union g to

h is an iron iod screwed into the biass to serve as the shift of the tool and which is made of any required length. The portion from c to e is constructed in two pieces which separate nearly on their diameter and are united jointly by steady ins and the screwed nut d e the division being made for the purpose of introducing the two bits a a one of which only is made to cut b the bottom bit is inserted in a similar but vertical cleft.

The three bits are simultineously and equally advanced by the central wedge \imath shown also detuched which resembles a cone reduced so as to form three fins at right angles to one another that enter the grooves for the bits the wedge \imath is set forward by the tull screw // there is a side screw which prevents the unintended movement of the set screw // to arrive at which latter it is necessary to remove the socket eg from the stem of the instrument gh

If the wedge with its three fins were considerably advanced beyond its present position it would stand before the cutter and prevent the tool fr in proceeding to the extremity of a flit bottomed hole in order to word this Mi like to his mide the back edges of the cutters at the same angle as the wedge so that the act of setting forward the wed e also sets forward the cutters to keep them in advance of the point of the wedge. The cutters have oblique mortises which pass over the retaining pass fixed in the semicicular piece, and prevent the cutters from being accidentally lost.

It is the intention that every instrument constructed on this mode should possess various sets of the bits α b so proportioned in size that the smalle trinstrument should be capable of being expanded to the smalle trize of the second instrument the second to the third and so on in order that a few of the boing burs or stocks may serve for a considerable range of sizes

Note PJ -To follow foot note on page 572

(M) George Wright inventor of the modern system of boring large Cylinders)

The author is informed by John Taylor Esq FRS &c that the mode of boing steam entire cylinders by means of a revolving bar with a traversing cutter block and cutters as slightly explained in fig 517 page 571 was invented by Mi George Wil ht while tin the employment of Mersis Builton & Witt of the clobiated Soho Volks near Limin him. This admirable continuace has proved of in meane advantage to practical engineers.

It may be added that Mr Nasmyth constructs his heaviest boring bars with three longitudinal grooves fitted with adjustable chamfer bars and that sustain the pressure of the cut against those faces of the chamfer bars which are radial to the bar. The vertical position seems now to be rather preferred to the horizontal for this class of boring machines, so that the cylinders may be bored in the position in which they are afterwards elected.

Note Bk - Fo follow the text on page 550

(Mr Mallet's method of des ribing regular and irregular spirals)

We transcribe from the Mechanics Migraine for 1841 pizes the communication of a very useful piper by Mr. Mullett of Dublin —

In many purposes of the uts a simile and implemented of training spirits upon a cylindric surface is important curvers wood turners &c often want such and in larger works such as some purioular branches of mill worl and inspecting it is also frequently winted. The unal method by dividing the

cylindric surface into equal portions in circumference and length and drawing lines diagonally is tedious

The following method believed to be new is simple and leady and sufficiently exact for most purposes. I wo straight edges of equal length and width and about "the of an inch in thickness each are to be secured on a table parallel to each other standing on their edges and distant from each other by nearly the length of the cylinder upon which the spiral is to be marked. Between these there is also to be secured in a diagonal direction stretching from one to the other a third straight cige formed of two slips of deal glued together, with a slip of straight thick Bristol board between them projecting to deal inch at one edge.

The entire height of the direction is to aght edge when standing on the table must be a shade more than that of the two other strucht edge. The three pieces being then thus arranged the edge of Bristel bond is charged with printer sink. Then on causing the cylinder to roll over the edges of the two parallel straight edges in the direction of their length, the diagonal slip of inked bristel board will trace a spiral upon the surface of the cylinder with very considerable accuracy.

Mr Mallett then goes on to describe that by substituting a conved edge for the inclined straight edges variable screws will be described following my particular condition set out in the developed surface of the screw is represented by the curve this he considers useful in setting out the variable screws or those of increasing patch for propellers and he further shows that spiral lines may be thus drawn on cones prisms to

Note BL page 696 to follow the paragraph ending a convenient bed for the file (On Sharpenin, the teeth of Sans ly means of Grand tones)

A peculiar m de of sharpening the teeth of lar e circular saws by means of grand tone—the author is informed as followed by Mr James Loag—f Johnston—than 1 manufacturer of Casl's and various worls in wood

A small gundstone mounted on a spindle and turned on the edge with anarrow ridge suited to the form of the teeth is made to revolve by the steam engine—the encular saw is placed upon the suiface of a slide having a center pin to fit the axis of the saw and a stop to determine how in ally it shall approach the grindstone the platform of slide is inclined agreeably to the angle at which the stone should meet the aw plate and there is a detent or hook which by catching against one if the teeth holds the aw plate in the positions successively required for every other tooth around its circumference.

The grindstone from its impldity of action is constantly employed when much has to be removed as in depthening the gullets when but little is required to be done to the saw the file is employed as usual

Sometimes all the saw remains at it the except as negards the change from tooth to tooth and the grand tone is mounted on a swing frame and brought down every time to a stop

Note BM referring both to the Fible on Rectilinen Sims page 699 and to the Fible on Cheulu Saws page 67 4

On the Cages at precent wed for measuring the thielness of sheet metals and wires and preposal for a new system of Cays found don the decimal subdivision of the Standard Inch

In setting out the Tables of the Dimensions of Saws, the rathor could only express their several third ne see in the measure always employed for that purpose in unely in the sizes or numbers of the Birmingham wife gage and to render these measures intelligible to the general reader the author then determined to introduce in this Appendix—first the exact values of the principal gages in use for sheet metals and wires a subject he believes to have been hitherto overlooked and secondly a proposal he has long desired to see carried out namely an easy and exact system of gages for sheet metals wires and general purposes founded on the decimal division of the inch and in which system the nomenclature should be so completely associated with the actual measures as to convey to the mind even in the absence of the gages themselves a very close idea of the several spaces of the gage or of the thicknesses or sizes of the works measured thereby

It is to be observed at the outset that the gages for measuring wires and sheet metals are usually thick plates of steel of several sizes and forms around and near the edges of which are first drilled various holes the next step is to save a notch from the edge into every hole saws of the widths of the several notches being used and listly little parallel plates of steel called do if is which are hardened and tem pered are driven into the notches in order to smooth the sides of the same and render them of uniform width after the manner of various other applications of drifts explained at pages 883 to 885

It should be further observed that the Birmingham and other gages seem to have been originated in great measure accidentally or almost by the eye alone and with out any attempt at system either as regards the values of the intervals between the successive measures or numbers or their correspondence with the subdivisions of the inch—And as moreover gages nominally the same have been made by various manufacturers with insufficient aim at unity of measures some irregularity thence exists amongst the gages in common use—notwithstanding that they may be nominally alike

In ascertaining the piecise measures of the principal gages the author has had the valuable cooperation of Messis Stubs of Wairington who manufacture a large number of these gages and who tested the drifts they employ by means of a sliding gage constructed by Holtzipffel & Co for reading off quantities to the thousandth part of an inch by means of a vernier the results of these admeasure ments are stated in the three sections of the accompanying table

The three series of measures or gages particularized in the annexed table have no relation whatever to one another—for example—the numbers 10 of the table are respectively different and undefined quantities—or are neither aliquot nor direct fractional parts of the inch—as the number 10 notches are severally 134—024—and 190 of an inch wide—and other similar numbers are also unrelated

The approximate measures of any one of these three series may perhaps be moderately familiar to those artizans who use that particular gage but those same artizans will probably be as little informed of the two other gages as the generality of individuals to whom the whole of these and other arbitrary ill defined mea sures are vague and confused because their nomenclatures have no relation whatever either to one another or to our general standard of such quantities namely ordinary linear measure or in other words the standard foot and inch

The following explanatory icmuls on the three gages specified in the tible and certain other gages derived from them will show the complicated and uncertain nature of the subject of measures for wires sheet metals, and various small works

VALUES OF GAGES

FOR

WIRE AND SHEET METALS IN GENERAL USE,

L\Phessld in Dlcim\L Parts of the inch

Section One	SECTION Two		Sr tion Three	
Bumingham Gage filim Whe and for Sheet Iron and Stoel	Bimingham Gage for Sheet Metils Briss Gold Silver &c	The smaller s	e for round Steel fr Pinion Wire izes distinguished Letters and call Grige	by Numbers
MARK SIZE	Mark sizi	MARK SIZE	MARI SIZC	MARK SIZI
0000 — 454 000 — 4°2 00 — 380 0 — 340 1 — 300 2 — 284 3 — 259 4 — 238 5 — 2'0 6 — 203 7 — 180 8 — 165 9 — 148 10 — 134 11 — 120 12 — 109 13 — 095 14 — 083 15 — 0'2 16 — 065 17 — 0'8 18 — 049 19 — 04' 20 — 032 22 — 0°8 23 — 025 24 — 022 25 — 020 26 — 018 27 — 016 28 — 014 29 — 013 30 — 012 31 — 010 31 — 010 32 — 009 33 — 008 34 — 007 35 — 005 36 — 004	1 — 004 2 — 005 3 — 008 4 — 010 5 — 012 6 — 013 7 — 015 8 — 016 9 — 019 10 — 024 11 — 029 12 — 034 13 — 0 6 14 — 011 15 — 047 16 — 051 17 — 0 7 18 — 061 19 — 064 20 — 067 21 — 072 22 — 074 23 — 077 24 — 082 25 — 095 26 — 103 27 — 113 28 — 120 29 — 121 30 — 126 31 — 133 32 — 143 33 — 145 34 — 148 35 — 158 36 — 167	80 — 013 79 — 014 78 — 015 77 — 016 76 — 018 75 — 019 74 — 022 73 — 024 71 — 026 70 — 027 69 — 029 68 — 030 67 — 031 66 — 032 65 — 033 64 — 034 63 — 035 67 — 0 16 61 — 0 38 60 — 0 39 59 — 0 40 58 — 0 41 57 — 0 42 56 — 0 44 55 — 0 50 54 — 0 55 53 — 0 36 51 — 0 64 50 — 0 67 49 — 070 48 — 073 47 — 076 46 — 078 45 — 050 54 — 050 54 — 050 54 — 050 55 — 050	40 — 096 39 — 098 38 — 100 37 — 102 36 — 105 35 — 107 34 — 109 33 — 111 32 — 115 31 — 118 30 — 1 '5 29 — 134 28 — 138 27 — 1 11 26 — 1 13 25 — 1 46 24 — 1 157 20 — 1 64 15 — 1 67 17 — 1 69 16 — 172 15 — 173 14 — 1 7 13 — 189 10 — 190 9 — 191 8 — 192 7 — 195 6 — 198 5 — 201 4 — 204 3 — 209 2 — 219 1 — 227	A — 234 B — 238 C — 242 D — 246 E — 250 F — 257 G — 261 H — 206 I — 217 L — 281 L — 295 M — 295 N — 307 O — 316 I — 358 V — 317 W — 356 V — 317 W — 356 V — 317 Y — 404 Z — 413 A 1 — 470 B 1 — 431 D 1 — 457 G 1 — 481 H 1 — 494

1 The first column of the talle refers to the gave used for most kinds of whe and is thence called for the sake of brevity the Wrigaje although it is also known as the Burmingham wire gage the Burmingham non whe gage and the Sheet won gage. The gage which is specified in the column of the table headed section one is the most common of the three principal linds and is employed not only fairon where is its name implies but also for bress and other whies for black at el where all of or sheet non-sheet steel and various other materials and lilewice for some manufactured worls including screws for joiners use

On reference to the table it appears the largest notch of the Birmingham iron were gage is marked 0000 and measures 454 thousandths of an inch or 11 tenth of an inch nearly and further that the smallest notch markel 36 measures 4 thousandths or the 1 250th part of an inch. Although this gage seems only to possess 40 terms in reality not less than 60 si es of wire are made as intermediate sizes are in many c is added and occasion lly although the sizes are retained their numbers are variously also details.

The sizes of which drawn for manufacturing needles correspond with a me of the ordinary wire sizes but the numbers we different thus No 1 of the needle who give a with 181 of the Limmingham wire giges as here shown —

Needle wires

Nos 1 2 2¹ 5 4 5 and thence to 21

And birmin ham wire gage Nos 18½ 19 19¹ 20 21 22 and thence to 38

Are respectively thile

Sometimes half sizes of both sense are interpolated and the manufactured needles when bought and sold are designated by another senses of numbers unrelated to either of these wire sizes

In the wire used for the string of plane fortes the sizes now commonly used and known as Nos 6 to 20 and these agree very nearly with the sizes and half at es of some of the notches of the Limingham wire gages as follows—

Music wires Nos 6 7 8 9 10 11 12 14 16 18 °0 And Birmin ham wire gage \(\cdot \) o 26 \(^15^1 \) 2\(\cdot 24\frac{1}{2} \) \(^24 - \frac{1}{2} \) 23 \(2 \) 21 20 19 Are respectively alide

The number 6 or the thinnest music were now commonly used measures about the fifty fifth pa t of un in h in diameter and the No 20 or the thiclest measures about the 25th of an inch

1 no fortes were formerly always strung with brass were but steel is now alone employed and they are strung much heaver or the leaver which cause the numbers 1 to 5 have probably fuller into disuse. The covert

fth (file	itle citl	Numlers Numlers of the file Screve Wickinge	ftl tl
25 — 0000 28 — 000 2 — 00 21 — 0 17 — 1 16 — 2	14 — 3 12 — 4 11 — 5 10 — 6 9 — 7 8 — 8	7 — 9 6 — 10 5 — 11 4 — 12 3 — 13 2 — 14	1 — 15 0 — 16 00 — 17 000 — 18

strings are of steel upon which a fine copper who is spirally wound and in vily short strings as those of Mr Pupe's Console Lino fortes and some others two

covering wries are used that the bulk of the doubly covered strings may comp in sate for their want of length

The manufacturers of the patent screws made from iron wire for joiners use also give the intervals of the wire gige a new system of numbers. Thus in the annexed table the left hand columns show the number of the screws the right hand the numbers of the wires from which they are respectively made.

Lymples of other and similar conversions of the numbers might be shown but which would only serve further to illustrate the niegularity and arbitrary nature of giges used in the mechanical and other arts

2 The second column of the table page 1015 refers to the gage employed for mo t of the sheet metals (excepting non and steel) namely copper bruss gilding metal gold silver platinum &c. This gage is called the Tunningham retail gage and for brevity simply the Metal gage or the Tlate gage in contradistinction to the Wie gage specified in the first column of the table

The intervals in the metal or plate gage are closer or smaller than those of the wire gage. Thus the No 1 which in this series is the *smellest* sized notch is 4 thousandths or the 9 0th part of an inch wide whilst the largest notch or 30 measures 167 th a midths or is evilently meant for the sixth part of an inch

When thiel er metils are winted their moral uses are sound that the Primmoham who gage thus the 30 on the plate gage nearly agrees with the 8 on the whoels and therefore the numbers 7 6 5 to 0000 of the latter are then employed too thicker metals than can be measured by the plate gag. Frequently the plate gage ends at 24 which number agrees with 14 of the wine gage and then the numbers 13 12 11 to 000 of the latter are similarly resorted to for thiel or metals. The ecombinations of different series of numbers running in reverse orders are evidently hable to lead to confusion.

The method in which sheet metal are commercially described also present much variation for instance one has a pacitive continued.—

```
Sheet me Nos 6 7 9 3 10 11 17 13 11 17 10 1 1 11 12 13 ue neally dil c
```

These thin sheets of zine which incisure only from one to about four him diedths of an inch thiel are principally used for gutters roofs and small worls manufactured with the haminer

Thicker zine plates or those from about 5 to 18 hundredths thiel and which me used for zineography do a plates and engraced works are commonly made to the notche 18 to 7 of the Birmingham Wire Gage without alteration of the numbers but which run the reverse way of those of the other series used for zine

Several of the metals are estimated by the weight of every superficial foot and that the more e pecually when the value of the material in the sheet exceeds the value of the labour attributed expended upon it in converting the metal to its intended purpose thus

Cast and milled lead are both described as of from 4 to 12 pounds to the super ficial foot the variation being one pound to the foot

Coppersimiths and brivious do not rel nowledge the plate gige at all but ited in their metal as from about 3 to 56 pounds to the sheet measures? feet by 4 feet and therefore contains 8 superfierd feet.

The precious metals are sometimes estimated as of so many ounces or primal weight troy to the superficial foot and it will be hereafter shown how by aid of

the proposed scheme derived from the decimal subdivision of the inch the coile spondence between the relative weights and thicl nesses of metals may be critically arrived at with great simplicity

The third fourth and fifth columns of the table page 1013 constitute one series of giges employed exclusively for the bright steel wire prepared in Lancashire and the steel pinion wire for watch and clockmakers

The smallest notch of this series is called No 80 and measures 13 thousandths of an inch or about the 80th of an inch and the first part of this series continues unto No 1 which measures 227 thousandths or nearly one quarter of an inch

The steel wire gige apparently ended at this size in the first instance but his since been extended by a second series to the diameter of 494 thousandths a measure doubtless intended for half an inch. In order to avoid the confusion attendant upon two series of numerals meeting at zero in the midst, the larger sizes are distinguished by the letters A to Z and these terms are then continued under the denominations A 1 B 1, C 1 D 1 to H 1 which latter size is the largest and measures 494 thousandths of an inches as shown by the table. This second part of the Lancashire wire gige is called by way of distinction the Latter gage.

Many other gages of arbitrary characters came to the author's knowledge in this inquiry several of which are applicable alone to particular trades amongst these may be mentioned the rod iron gage the nail rod gage the button in iller's gage others used in witchwork and the gage used by gun makers for the bores of guns and rifles three of which gages alore will be described

The 10d iron gage employed by Messrs Bradleys and some other non masters and also by Messrs Stubs for steel has measures derived from the division of the inch into Sths and 64ths as follows—

MESSRS	JOHN	BRADLEY	&	C0	s	ROD	IRON	GAGE	
		~ <u>-</u>							

No	Inch	No	Inch	No	Inch	٧o	Inch
00 0 1 2 3		5 — 6 — 7 — 8 — 9 —	8 8	11 - 12 - 13 - 14 - 15 -		17 — 18 — 19 — 20 —	— 1- — 1, — 1
4	a	10 —	- 4	16 -	— i		

MLSSRS JOHN BRADLEY & CO & NAII LOD GA(E

	No	Inch	No	Inch	No	Inch	No	Inch
	00 00½ 0 0½ 1		1 } - 2 - 2 <u>1 </u>	1 7 0H 4	4 4 ½ 5 5 ½ 6	· · ·	7 8 9 10	
4							1	_

It will be perceived that the intervals from $00\frac{1}{2}$ to $3\frac{1}{5}$ are the 64th of an inch from 4 to 11 the 32nd and above 13 the differences are $\frac{1}{5}$ of an inch. This mode although systematic is objectionable as there is no evident relation between the numbers and their corresponding measures and therefore both have to be impressed upon the mind

In guns of most kinds the weight of the balls determine the denominations of their respective sizes. Thus it is well known that heavy guns or ordinance are named 6.9 12 to 68 pounders from having bores respectively suited to iron shots of those respective weights the bore is always—th larger in diameter than the shot the difference being I nown as windage—The sizes of the bores of mortars and modern guns intended for hollow shot—are designated in inches as 8.10 13 inch mortars. &c

In rifles and fowling pieces the diameters of the bores designated as No 1 2 3 4 5 &c are the diameters respectively of leaden bullets or spheres of which 1 2 3 4 5 &c weigh exactly one pound avoirdupois and as the subject may have an interest for some of the readers of this volume the following particulars of the weights of the balls in grains and of the diameters both of the balls and of the barrels in hundredths of an inch are transcribed from Mr Wilkinson's gage which he has constructed with great care

MR WILKINSON'S GAGE FOR RIFLES AND FOWLING PIECES

N m bei	Diameter of Bole in Hundledths	Weight of Leiden bullet in Gruns	Num ber	Diameter of Bore in Bullet Hundredths Grains		Num bei	Diameter of Bore 11 Hundredths	Weight of Leaden Bullet in Grains
5	98	1400	15	70 ×	4663	25	60 ×	280
6	93—	16663	16	69—	437 4	26	59×	269,3
7	89	1000	c17 P	67 ×	411 ,	27	59	269 7
8	85	875	18	66	388	28	58 ×	250
9	81 —	7777	19	65 ×	368 B	29	58 —	241
10	79	700	20	63 x	355	30	57	23 }
M 11 E	77 —	636	21	63	333}	31	56 ×	225
12	75 ×	5831	22	62 ×	318	32	p6—	2183
13	74-	53813	23	61 x	3048,			_
м 14 s	72-	500	24	61	2913			

From the perusal of the foregoing particulars of numerous gages employed in different branches of mechanical art it will have been seen that little analogy on the one hand but great confusion on the other exist in such of the gages as have been referred to and the author will now briefly state the acmedy he would suggest to obviate the difficulty in the most simple and inexpensive manner

The remedy proposed to remore the arbitrary incomprious system of gages now used is simply and in every one of the cases above referred to and also in all others requiring minute measures to employ the decimal divisions of the ench and those under their true appellations

Thus for most runposes the division of the inch into one hundred parts would be sufficiently minute and the measures 1 2 5 10 15 or 100 hundredths would be also sufficiently impressive to the mind their quantities might be written down as 1 2

5 10 15 or 100 hundredths as the decimal mode of expression might if preferred be safely abandoned and the method would be abundantly distinct for common use if the word *Hundredths* were stamped upon the gage to show that its numerals denoted hundredths of the inch quantities which could be easily verified by all

It does not follow that the entire hundred notches should be at all times used as in many cases it might suffice that below 20 hundredths every size should be employed—from 20 to 50 hundredths every alternate size—from 50 to 100 hundredths every fifth size. As at present also the upper or lower part of the series of terms might be omitted to any desired extent in those cases where they were beyond the particular wants of the artizon or the particular branch of trade in order to lessen the bulk and expense of the gage

It may be objected to this scheme that for the more valuable metals and the more minute purposes the quantity of the one hundredth of an inch is too coarse a difference. Two facile modes of remedy may be here upplied. The first to make half sizes thus $8\frac{1}{2}$ or 8.5 would of course denote the medial interval between 8 and 9 hundredths. Or secondly and preferably below one tenth of an inch a finer scale might be substituted for the more minute and delicate purposes namely a gage based in precisely the same manner on the thousandth of the inch as the unit which would give a much finer decree of subdivision than is afforded by any of the arbitrary gages in general use in this case the intervals being derived from the thousandth of an inch the word. Thousandths should be stunged on every such a ge

In practice no difficulty could be seriously felt even without this precaution of mail in, the gages respectively with the word *Hundredths* or *Thousandths* as we should not more readily mistal e 5 thousandths for 5 hundredths than we should 5 tenths or half an inch for 5 whole inches or 5 entire inches for as many feet

Norther is it to be admitted that no such gages are attainable as may be read off in hundredths or thousandths. The demand would immediately create the supply and there could be no more difficulty in constructing the gages of the customary forms with notches made to systematic and defined measures that may be easily arrived at or tested than with their present unsystematical and arbitrary measures which do not admit of verification

Lesides for those who desire to possess them several very correct decimal gages already exist amongst which may be cited the decimal sector gages long since recommended and published by the Society of Aits Edinburgh and various shiling gages with vermers some to read off in hundredths and finer ones in thou sindiffs of the meh, all of which have been long and constantly used in the author's manufactory

To these may be udded—In Rivière's gage modified and enlarged from that used for the balance springs of watches amongst the Geneva watchmakers—Chater and II yward s gage for sheet metals and glass—Walker's gage for sheet non—Whitworth's nacrometer gage and others—which may be severally read off to the thousandth of the inch and even more minute quantities and amongst which kinds sufficient choice exists for almost every purpose

The advantages of cred by this proposed application of decimal measures appear to be numerous and considerable the more especially in those cases of small measures where the ordinary wine gages on the one hand and the course division of ordinary to times on the ether, we obviously insufficient for accurate purposes. Amongst the endy integer may be enumerated the following

The proposed decimal scheme would introduce one universality of system antel ligible alike to all instead of the numerous and inegular measures now used which are but partially and indifferently known and lead to frequent mistakes

It would give a superior idea of particular magnitude and enable the theoretical and practical man to proceed with so much more decision in their respective communications

In conveying verbal or written instructions the system would be in every way superior to the usual methods as being almost free from the chance of misunder standing more especially as some of the decimal sliding gages are so small as hardly to take up more room in the poel et than an ordinary penkinfe and might be therefore continually within reach for reference

When certain objects are required to be so proportioned as to constitute a series the intervals between the decimal measures would be far more easily an infect and appreciated than those of vulgar fractions and if calculation were reterred to the decimal figures especially when divested of the decimal point and the zeros to the right of the same would be immediately intelligible to the least informed from being then no more in fact than simple numerals

Quantities expressed decimally would be more easily written down and more exactly defined than the compound fractions such as $\frac{1}{3}$ and $\frac{1}{6}$ of an inch—or than the still more obscure method of $\frac{2}{3}$ of an inch full or bare as the case might be, which latter nearly sets all attempts at exactness in defiance

The smaller aliquot fractions of the inch such as the ' ½ 1 1 1 10 &c of an inch although in themselves very precise do not from their nature so readily admit of definition or comparison as the quantities 2 3 4 5 6 7 8 9 of 10 hun dredths of an inch because in the vulgar fractions every one has a specific relation to the inch whereas the decimal terms have one general relation decimals being sometimes considered as the numerators of fractions all having the constant denominator unity or 100 1000 &c and therefore the latter of the decimal terms constitute a simple arithmetical series or one in which the intervals are alike but this is not the case with vulgar fractions

It would bring all foreign measures within reach of our worl shops. I or example in the United States of America and Russia Linglish measure is employed and no difficulty would be felt in reference to these countries. And as most of the National Poot measures are more than 11 inches I nglish and less than 13 even if they are considered for the time as equal to our own foot and without any adjustment being attempted the average error would not exceed about five per cent. And further when two of Holtzapffell and Co is engine divided scales the one of the particular foreign measure and the other of Linglish inches are laid side by side they show visually as on a slide rule, the correspondence between any quantity of such foreign measure with our own as more fully explained in the author's pamphlet. On a New System of Scales of I qual Parts in which this and numerous other employments of scales of equal parts are treated at length.

The decimal scheme would allow the exact weight in every superficial foot of sheet metals and other substances to be readily arrived at — Thus as a cubic foot of water weighs 1000 ounces troy the specific gravities of lead copper silver &c denote at the same time how many troy ounces are severally contained in one cubic foot of the same. The specific gravity divided by 1200 gives the weight of applied or film the one hundredth of an inch thick and thence a table may be readily computed by addition alone to show the weight of plates of any thickness in troy ounces.

These calculations would be correct at once for gold and silver as these metals

are estimated by troy weight but for other substances requiring avoirdupois weight the numbers expressing the specific gravities of the substances must be previously altered by one of the usual methods namely either by multiplying them by 192 and dividing the product by 175 numbers which represent the ratio be tween troy and avoirdupois ounces or else instead thereof the specific gravities of substances may be multiplied by the decimal constant usually employed for effecting the same end

In this method also constant multipliers may be readily found for thus determining from the specific gravities of the several materials the exact thicl nesses of plates or sheets of the same which shall precisely weigh one ounce or one pound either troy or avoirdupois as may be required. This has already been done by Mi Hayward as regards crown glass for assuming its specific gravity to be 2.52 when the glass is of the thickness of 15°5 (or one tenth and a half nearly) it weighs 32 avoirdupois ounces to the superficial foot and thence by Mr. Hayward's calculation are obtained the following numbers—the first line denotes the weight of crown glass in ounces in every superficial foot the s could line the corresponding thicknesses in thousandths of the inch ranging from about 5 to 152 thousandths—

Crown glass of \} 1 2 4 8 12 16 20 24 28 32 ounces
Measures 00476 0095 019 038 0571 0762 0952 1333 1429 1524 inch

The above and the intermediate terms are sometimes engraved on Messrs Chater & Hayward's gages alongside of the line of graduations which denotes thousandths and at other times instead of the weight per foot are engraved divisions indicative of the 8th 9th 10th 11th 12th &c of the inch which quantities are of course obtained by simply dividing 1000 by those respective numbers

Tables might in the above minner be very readily computed that would show the weights in every superficial foot of the metals and other materials for all defined thicknesses—and also other tables for showing how thick the metals should be in order to weigh exactly so miny ounces to the superficial foot—These matters could be also arrived at by the employment of scales of equal parts—laid down in the proportions of the specific gravities of the substances—and in the opinion of the author they could be worked out with even greater simplicity and universality by a decimal proportional instrument he has some time since contrived which is applicable to the visual development of all ratios that have reference to decimal arith metic including those of interest discount profit and other calculations to which the term $Per\ Cent$ is applied

In conclusion the author begs to add that he does not suggest any alteration whatever as regards those measures for which the division of the foot rule into eighths and sixteenths may be found sufficiently piecise and minute. But he would ask whether for more minute measurements greater convenience and distinctiveness would not result from the general employment of measures expressed in hundredths of the inch than from the employment of the many gages for specific uses the sizes and numbers of which are entirely devoid of system and which gages may be considered as unknown beyond the particular trades in which they are employed

How confusing would it be if the measures by which broad cloths linens cottons silks velvets carpets and other textile fabrics are manufactured and sold were all different instead of being uniformly the yard measure—and yet this incongruity fully applies to the various articles whose measurements are described under the mystical names of Number—Si e Gage and other appellations which assume different values in different branches of manufacturing art, as for example in the various

kinds of sheet metals various kinds of wires in tubes joiners screws and vast numbers of small manufactured articles the various sizes of which are arbitrarily designated as Nos. 1, 2, 3, 4, &c.

Why not in all these branches of trade describe every thing measuring 1th of an inch as No 10 those of 10ths inch as No 30? and then in sets of objects required to be nearly alike the succeeding numbers could be 31 39 33 34 35 36 &c or if fewer and wider variations were wanted the series might be 32 34 36 38 40 or else 35 40 45 50 55 Every trade could select any portion of the series it might require both as regards general magnitude and the greater or less intervals between the idea and with the power of adding to or subtracting from the scale first elected as circumstances might suggest

But there should be one common understanding that the commercial numbers or sizes when different from the measures of the foot rule should be always under stood to be hundredths of the inch (in some rare instances thousandths) as then from the unity of system no confusion or difficulty could possibly arise

It may be true that some of the proposals having reference to the weights of materials in the superficial foot the correspondences with foreign measures and some of the projects principally intended for the purposes of science may not be required in every day practice but still much remains in the system that in the opinion of the author would admit of very easy introduction and most general and satisfactory employment

In respect to the practical application of the method of decimal divisions as regards mechanical construction the author can speak most satisfactorily from some years experience in his own manufactory as he has found it to be most radily followed by his workpeople and also that it has avoided frequent and vexitious misunderstandings to which before its adoption he was frequently subjected from the want of a more minute and specific system of measure than is afforded by the common footrule and wile giges

Therefore from conviction of the usefulness and practicability of the decimal system of measures for small quantities he would most strongly urge its general or indeed universal adoption as above proposed the more especially as it is a change that would be attended with very little temporary inconvenience or expense cultimaters which greatly retard all attempts at generalization

Note BN —To follow the paragraph ending the ribbon saw, page 751

(Mr Bodmer's Patent In es for Locomotive Wheels)

Mr Bodmers Patent mode of constructing the inner and outer these of locomotive wheels and other annular objects, might serve for making in one piece the ribind saw spoken of at page 751 and also the crown saws represented and described fig 497 pages 802—3

In making the tires of locomotive wheels the first course is to prepare a mass of wrought iron of the appropriate weight and with a central hole this rude annular piece of iron when raised to the welding heat is inserted between a pair of rollers that overhang the bearings in which they work. The one roller is placed within and the other without the piece of iron which however irregular is soon thereby reduced to an equal section throughout when the rollers are set in motion and a third roller placed in the path of the niscent hoop or tire gives it a folm almost as truly circular as if it had been turned in a lathe. The three rollers ensure circularity in the tire upon the same principle that is employed in the three bending rollers, see fig. 232 page 389. Vol. I


Note BO page 803 —To follow the third paragraph

(Mr Harvey's Patent Curvilinear Saws)

Mr Harvey took out a preent in June 1845 for an adaptation of the cylindrical or crown saws described in pages 800 to 803 by which they may be applied to works of indefinite length. The hoop constituting the saw is attached to a disk mounted on an axis but the disk only extends over 3 of the circumference leaving

exposed for the passage of the wood and the saw instead of receiving continuous circular motion as before is now recipiocited by a crank through a few degrees only of the circle so that the wood sawn off may proceed through the aperture between the saw and the disk which aperture somewhat resembles the space between the spokes of a wheel having three arms and a very thin flat rim

The square log fig 1025 is mounted on centers upon a drug or slide fitted with rack pinion ratchet and detent as usual for feeding the cut so that the log is presented with its four angles successively and the extreme edges having been first sawn off with an ordinary circular saw also attached to the machine the four

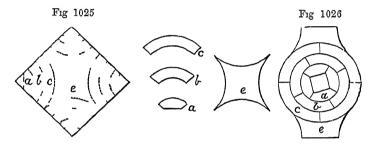

annular sections a a a a are first removed from the four angles then four larger b b b b with a saw of greater diameter and afterwards four others c c c c the nucleus e is then sawn in two and the several pieces when recombined produce the mast of the section fig 1026 which is said by the Patentee to be much stronger than any mast or spir consisting of a single piece of timber

The inventor also proposes to apply the saws to short works such as chair backs and brushes but which may be apparently better produced in the old drum saw which acts more rapidly from receiving continuous motion—he also proposes to cut pieces of double curvature or of the ogee form by the employment both of the inner and outer surfaces of the cylindrical saws according to circumstances. See Mechanics Mag 1846 Vol 44 p 18

The reader is referred to Note BN which suggests a new mode of constructing cylindrical or crown saws

Acte BP page 827 to follow the paragraph ending 'fast by each foot (Cutting the teeth near the ends of tiles)

To this paragraph it should have been added that in cutting the ends of the files which parts must necessarily be laid at the time wpon the anvil the opposite end of the blank is supported upon a wooden prop of the same height as the anvil and the straps are placed in the middle of the length of the file

Note BQ to follow the first paragraph page 839 (Mr Michael Kelly's Quannett)

Mr Michael Kelly's Quannett represented in figs 830 and 831 was rewarded by the Society of Aits in 1845—and the instrument has been successfully applied to scrapin, zinc plates for the process denominated Anastatic Printing invented in Germany and Pitchted in England by Mr Joseph Woods—By this ingenious art impressions may be made by the transfer process from any even the earliest printed works and engravings provided any portion of the oil still remains in the ink

Note BR page 841 to follow the paragraph ending 'are not at present used (Inventors of various file cutting machines)

Since the article on File Cutting Machines was written the author finds that Thiout was not as he had supposed the inventor of the first machine for cutting files as in the Memoir on the subject by M de Montigny read before the Committee of Commeice in 1778 the following were noticed as the more important of the machines invented for cutting files—namely that constructed by Duverger in 1699—by Fardouet 1725—by Thiout 1740—by Brachat et Gamain 1756—and by Vauchei 1778

To these muchines are to be added those subsequently made by Raoul in 1800—and by Trieson in 1836 See Article Limes (Vol 12 p 289 of the) Dictionnaire Technologique des Arts et Metiers Paris 22 vols 8vo and 2 vols Atlas 1822—1835

Note BS —Referring to page 299 of the First Volume

During the period in which the last sheet of this appendix was being printed Mr I laylor kindly pointed out to the author that in the table for converting decimal proportions into divisions of the pound avoirdupois inserted on page °69 of the flist volume a clerical error had been committed from the subdivisions of the avoirdupois ounce having been considered to consist of 8 drams as in apothecaries weight instead of 16 as in avoirdupois weight

The author much regrets this oversight which arose from the circumstance of the avoirdupois ounce being rarely subdivided in common use more minutely than into halves or quarters and he inserts overlent the corrected table, which Mr Taylor has been kind enough to calculate for this work

TABLE FOR CONVERTING DECIMAL PROPOPTIONS

Into Drissons of the Pound Arondupois

D cimil	oz dı	Dec mal	oz dı	Decimal	oz dı	Decimal	07 di
39	1	12 99	2 1	25 39	4 1	37 85	6 1
78	2	13 28	2 2	2578	4 2	38 78	6 2
1 17	3	13 67	2 3	26 17	4 3	38 67	6 3
1 56	4	14 06	2 4	26 56	4 4	39 06	6 4
1 95	5	14 45	2 5	26 95	4 5	39 15	6 5
2 34	6	14 84	2 6	27 34	4 6	39 84	6 6
2 73	7	15 23	2 7	27 73	4 7	40 23	6 7
3 13	8	15 62	2 8	28 13	4 8	40 62	6 8
3 52	9	16 01	2 9	28 52	4 9	41 02	6 9
3 91	10	16 41	2 10	28 91	4 10	41 41	6 10
4 30	11	16 80	2 11	29 30	4 11	41 79	6 11
4 69	12	17 19	2 12	9 69	4 12	42 19	6 12
5 08	13	17 58	2 13	30 08	4 13	49 54	6 13
5 47	14	17 97	2 14	30 47	4 14	42 97	6 14
5 86	15	18 ა6	2 15	30 86	4 15	43 36	6 15
6 25	1 0	18 75	3 0	31 25	5 0	4375	7 0
6 64	1 1	1914	3 1	31 64	5 1	4414	7 1
7 03	1 2	19 53	3 2	32 03	5 2	44 53	7 2
7 42	1 3	19 92	3 3	3742	5 3	44 92	7 3
7 81	1 4	20 31	3 4	32 81	5 4	45 31	7 4
8 20	1 5	20 70	3 5	33 20	5 5	45 70	7 5
8 5 9	1 6	21 09	3 6	33 59	5 6	46 09	7 6
8 98	1 7	21 48	3 7	33 98	5 7	46 48	7 7
9 38	1 8	21 88	3 8	34 37	5 8	46 87	7 8
977	1 9	22 27	3 9	34 69	5 9	47 27	7 9
10 16	1 10	22 66	3 10	35 16	5 10	47 66	7 10
10 55	1 11	23 05	3 11	35 55	5 11	48 05	7 11
1094	1 12	23 44	3 12	35 94	5 12	48 44	7 12
11 33	1 13	23 83	3 13	36 33	5 13	48 83	7 13
11 72	1 14	24 22	3 14	36 71	5 14	49 22	7 14
1210	1 15	24 61	3 15	37 11	5 15	49 61	7 15
1250	2 0	25 00	4 0	37 50	6 0	50 00	8 0

Application of the Table

The Chinese Packfong similar to our German silver according to Dr Tyfe's analysis p 2/9 is said to consist of —

40 4 25 4 31 6 2 6	parts of	Copper Zinc (Nickel (Iron	- equivalent to -	$\begin{cases} 6 \text{ oz } 7 \\ 4 - 1 \\ 5 - 1 \\ 7 \end{cases}$	drims — — —	full full newly newly
100 0	Parts			16 oz 0		Avoirdupois

Note BT —To follow the notes J K L on page 46 of Vol I (Mr Joseph Gibbs Patent Carving Machine)

Mr Joseph Cibbs patent for improved machinely for cutting maible wood and other substances—seiled 12 Nov 1829—was inadvertently overlooked by the author when he wrote the notes J K L of this Appendix on the carving machines subsequently patented by Irving Jordan and Tomes described on pages 954—7 he now proposes to supply the omission

A general idea of Mr Gibbs carving machine will be conveyed by imagining the model and the copy to be placed on two separate horizontal platforms situated one above the other—the drill and tracer are each exactly vertical—and in one and the same line—but of course in an interrupted line—as between them lies the platform with the model—The tracer is at the top of all—and rests on the model the drill is below the model and rests upon the copy that it is in the act of producing

It is next to be explained how the tracei and drill are simultaneously and equally moved in all directions over the model and copy which he at rest and this is accomplished by building them in one vertical line at the outer edge of a double swing frame consisting of two frames or panels which move on joints somewhat as a folding door that consists of two leaves jointed in the center is construction which also resembles that of the double swing frame used in Brunel's cross cutting saw machine see fig 789 page 796

The two leaves of the swing frame—to borrow the words of the former description—give respectively the powers of moving the tracer and drill simultaneously from North to South and from East to West. In addition to these two motions is a third for the entire mass of the swing frame is moveable vertically as it slides through fixed circular bearings and is supported on a treadle which allows the drill gradually to penetrate the work until the further descent of the machinery is arrested from the tracer coming into contact with the model to be copied. As in Brunel's saw machine and some others the motion of the prime mover is communicated by belts or strips reeved on pulleys situated at the two axes of motion so that the rambling of the tool does not affect the tension of the bands

One great application of this machine was to the cutting of the wooden letters used for shop fronts several in one pile and in which case a metal templet was used. The machine presented all the elements required for the purposes of carving and was used for that purpose but the duplication of the swing frame enfeebled the construction and gave rise to more vibration than exists in the subsequent machines of Irving Jordan and Tomes which all more or less resemble Gibbs original machine in principle although severally different in construction, and more efficient in use

END OF THE APPINDIX TO THE SICOND VOLUMI

WORKS PUBLISHED BY HOLTZAPFFEL & CO

64 Charing Cross and 127 Long Acre London

ECCENTRIC TURNING

By N B ENGLEHEART

A Concise Treatise on Eccentric Turning to which are added Practical Observations on the Uses of the Eccentric Cutting Frame the Drilling Frame and the Universal Cutting Frame Illustrated by Figures and I control latterns with full Instructions as to the Modes by which such Patterns may be effected Quarto cloth 50 Illustrations price 21s

NOTES ON THE EPICYCIOIDAL CUTTING FRAME

BY THOMAS SEBASTIAN BAZLEY MA

With special reference to its Compensation Adjustment, and with numerous Illustrations of its capabilities $\,$ 5vo cloth 111 Illustrations price 15s 6d

INDEX TO THE GEOMETRIC CHUCK

BY THOMAS SEBASTIAN BAZLEY MA

A Treatise upon the Description in the Lathe of Simple and Compound Epitrochoidal or Geometric Curves 8vo cloth 3500 Illustrations price 42s. The impression of this work consists of 150 copies only and as the lithographic stones were obliterated as the successive transfers were completed, the book cannot be reprinted. A few copies only now remain on hand

DESCRIPTIVE CATALOGUE OF THE WOODS

COMMONLY EMPLOYED IN THIS COUNTRY FOR THE MECHANICAL AND ORNAMENTAL ARIS

Interspensed with Extensive Botanical Noti's by Dr ROYLC FRS LS, and GS etc enc

8vo cloth price 2s 6d

A NEW SYSTEM OF DECIMAL GAGES OR MEASURES

FOR SHEET METALS WIRDS AND SMALL MANUFACTURED ARTICLES GENERALLY

Including the exact decimal values of the gages now principally used for these purposes in the Mechanical Arts Pamphlet 8vo in wrapper price 1s

PRINTING APPARATUS FOR THE USE OF AMATEURS

Containing full and practical instructions for the use of COWPER'S PARLOUR PRINTING PRESS also the description of larger presses on the same principle and various other apparatus for the Amateur Typographer

The pamphlet contains likewise numerous specimens of types brass rules checks, borders ornaments coiners arms &c 8vo cloth price 2s 6d

HOLTZAPFFEL AND CO'S GENERAL CATALOGUE

of lathes tools and instruments employed in the mechanical arts Stereotype Edition 8vo pp 72 price 6d or free by post 8d

A BRIEF ACCOUNT OF IBBETSON'S GEOMETRIC CHUCK

Entitled 'A brief Account of Ibbetson's Geometric Chuck manufactured by Holtzapffel & Co with a Selection of Specimens illustrative of some of its Powers Pamphlet 8vo, in coloured wrapper price 5s Very few copies remaining

HOLTZAPFFEL & CO.

Nº 64.

CHARING CROSS, LONDON,

ENGINE, LATHE, & TOOL MANUFACTURERS,

1 N TO

GENERAL MACHINISTS

TURNING PLANING SCREW AND WHEFL CUTTING TRAMING &c
IN MILLS AND WOOD TO DRAWINGS OR MODELS

Amateurs

ARI SUPPLIFD WITH THE APPAR TUS TOOLS AND MALPRIALS THAT ARE REQUIRED IN TURNING AND HILL MICHAELS AND ARIS CININ RALLY AND ARIS AT SO PRACTIC LLY NSII (110 IN HIFTE USE

Tools and Enstruments for

ARCHITICTS
BOOKBINDI RS
BRUSHMALIRS
BUILDI RS
CABINI IMAKI RS
CARLENTIRS
CARVITES
CLOCKMAKTES
COACHMALIRS

COLPIRSMITHS
INCINLIRS
LNCRAVIRS
CARDINIRS
CUNMALLES
HARNISMARFRS
HATTIRS
JEWILLIRS
MACHINISTS

MISONS
MILI WRICHIS
MODITIES
OFFICIANS
I VINTERS
I LASTERERS
I LUMBIES
I RINTERS
SADDIERS

SI AI PNC RAVLES
SII VI RSMITHS
SMITHS
SURVI YORS
FINSMITIS
TURNFRS
WATCHMAKERS
WHILE I WRIGHTS
WIRI DRAWIRS

Cutlery of every Mescription.

AN EXTENSIVE ASSORTMENT OF

TOO! CHESTS DRESSING CASES DRIWING AND MEASURING INSTRUMENTS
1 RINTING 1 RISSES (ARDIN 100ES &c.

MANUFACTORY, 127, LONG ACRE

FORLIGN ORDERS RECITLED FITHER DIRECT OR PHROUGH AGENCY HOUSTS INTOUTED WITH EXACENESS AND DISTARCH

LIST OF GENERAL CUTLERY,

OF THE BEST QUALITY PLAIN MEDIUM AND HIGHLY FINISHI D MADE BY

HOLTZAPFFEL & CO,

64, CHARING CROSS, and 127, LONG ACRE,

POCKET CUTLERY

Champagne Knives Chatelaine Knives Cigar Nail Desk and Erasing Knives Hunting Knives Instrument Knives—with few or many implements—in Ivery tag of Tortoiseshell handles Ladies Knives Pen Knives Pocket Pencil Rule Clasp Sailors Pen machine Lie nic and Masticating Knives

SCISSORS OF ALL KINDS

Button hole Cutting out Hair cutting House tumming Lump Paper Kitchen Whisker and Sungical Scissors

I adies Scissors Lace Work Small Work Fmbroidery and Nail Scissors Folding Scissors for the Pocket and Chatelaine Cases of Ladies Work Scissors containing 2 3 4 or 6 pairs Left handed Scissors

RAZORS AND TOILET CUTIERY

Razors in Ivory Tortoiseshell or Black Handles Guard Razors Flush backed Razors Hollow ground blade Razors Army Lazors Cases of 2 4 or 7 Razors Rell cases of Razors and Tollet necessaries Razor Hones Razor Strops Canton Strops Boot Hooks Button Hooks—solid or folding Hunting ditto for Tops Coin Files Die sing case Coikscrews Tweezers Dental Instruments Null Nippers Improved Perfect ditto Door Wedges Dumb Lells Steel Witch Guards Dog Chans Dog Collars Swivels and Pidlocks

LOCKS ESPECIALLY DESIGNED FOR SECURING LEATHER STRAPS Key Rings of all kinds plain or embossed with name and address

Hunting Knives in Sheaths plain or richly mounted Skean Dhu Knives Shikary Knives Gooika Knives Kookiie Knives Boar and Beir Spears Skinning Knives Alpenstocks Ice Axes (limbing Irons Riflemens Knives I leams I uniers Knives Cales of Larriers Tools Ditt for the Saildle Hoise chipping Machines Lancets Veterinary Hammer and Hoof Picks

SI ATES of all patterns Club Skates Ladies and Stiapless Skates

Corkscrives Champagne Tap Appers Hools and Knives Butlers Corkscrews Telescope Dressing case Pocket and Lever Corkscrews Ditto with lack and I mion (c. Locket Instrument Corkscrews containing from 2 to 12 useful implements. Needles Puking Needles Strap Punches Lyelet Lunches and Gentlemens Housewives.

HOLTZAPFFEL & CO'S

PRACTICAL SETS OF PORTABLE TOOLS

ARRANGED IN THE MOST COMPLETE FORM IN ROLL UP POUCHLS

Selected for Carpentry Canoeists Engineers Fishermen Officers Sportsmen Travellers Lachtsmen and others

The sets of Tools are of the Best Materials and Workmanship the stems made all to fit into One Handle to economise space. They consist of Chisels Gouges Files Hammers Saws Knives Screwdilvers Rasps Pincers Crow Irons Gimlets Lradawls &c. In their more simple form the Pouches contain sets of 12 18 24 30 or 36 of the above named tools only

In their more complete form the Roll Pouches contain sets as above but with additional loops for a selection of tools which are independent of the handle such as—

Callipers Cold Chisels Boltinons Diestocks—cutting several sizes of screws Drillstocks—carrying then bits in the handle Jointed Drillbows of steel Archi medean Drillstocks Cages to measure to the 100th or 1000th of an inch Grinlet Handles Hand Vices Oilstones in cases and oilstone slips Oil Bottle with Drift Planes of small sizes in gun metal Cutting Pliers Flat Nipper and Round I liers Cutting Compasses for Washers &c Punches of all kinds Rules Spirit Levels Steel Screw Wrenches Spokeshaves Squares Sliding Tongs Pin Vices Table Vice Watch Tools &c &c

Many of the above tools especially constructed to combine strength and convenience with extreme portability

HAMMER HATCHES combining Hammer Hatchet Crow Iton Screwdriver Fulcrum Lever and Wrench forged in one solid piece

GARDEN AND HORTICULTURAL CUTLERY

SURGICAL KNIVES Scalpels Scissors Forceps Lancets Needles &c
Pen Holder for enfeebled hand Table Knife and Fork for ditto Rheumatic
Hammers

Cases of Instruments for Botanists Orinithologists Taxidermists &c, and for general purposes Steelyards Machines for making Quill Pens

TABLE CUTLERY


Bread Knives in Ivory Stag or Wood plain or carved Handles

Tible Knives and Dessert Knives in plun Black Horn Hundles Bone Hundles Stag Hoin Hundles in Stig Hoin Hundles with Silver Ferrules and Butts in Ivory Handles in Ivory balanced Handles in Ivory balanced Handles with Silver Ferrules &c &c

Carving Knives and Forks and Poultry or Game Carvers of all sizes to match the above

Trowel shaped or Round of Beef Carvers in Stag or Ivory Cooks Knive Steels Knife Shirpeners &c

Table Knife and Fork combined for use with one hand
Complete sets of Table Cutlery with or without cases
Antlers, Tusks, Horns Teeth and other trophies mounted as any form of knife
Knives engraved with crests monograms &c

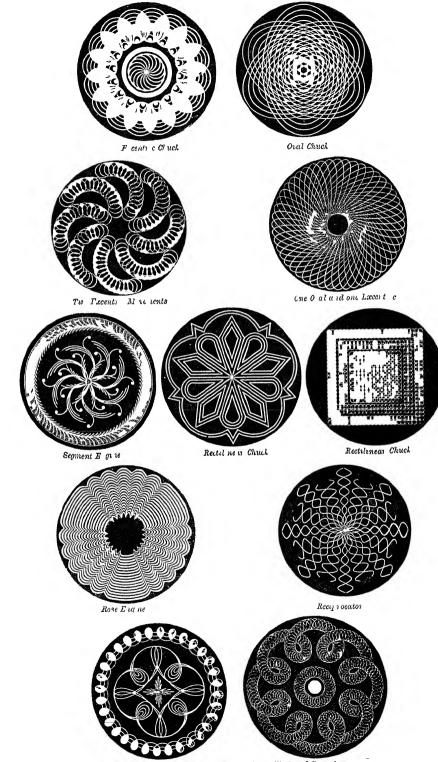

HOLTZAPFFEL & CO'S ENGINE DIVIDED SCALES,

for Engineers Architects Druughtsmen &c

Every scale is ruled in the Dividing Engine on a different slip of Specially Prepared Caidboard 18 inches long the figures and inscription having been previously printed dry. By this arrangement the confusion of crowded scales is entirely avoided and any of them may be upplied directly to the drawing or compared with one another without the employment of the compasses and as from their thinness they pass under the Γ square no offsets are required. The material of the scales and of the drawing paper being IDENTICAL both are equally affected by climate or temperature and expand or contract equally together.

ORDINARY DRAWING SCALES

A series of 24 scales consisting of the usual reductions of the foot viz $\frac{1}{16}$ $\frac{1}{12}$ $\frac{1}{8}$ $\frac{3}{6}$ $\frac{1}{16}$ $\frac{1}{12}$ $\frac{1}{12}$ $\frac{1}{12}$ $\frac{1}{12}$ $\frac{3}{12}$ $\frac{3}$

CHAIN SCALES

A scries of 24 scales in Chuns and Linl s viz 1 1_2 2 $2\frac{1}{4}$ 3 4 5 6 7 8 10 12 13 35 15 18 20 25 30 40 50 60 70 80 100 chains to the inch

The Set of 24 Scales in case price £1 2s Single Scales of any of the above and of many other varieties kept in stock

Single Scales of any of the above and of many other varieties kept in soleta piece 1s each

Single Scales graduated to order in English or French measures on separate slips of cardboard 18 inches long price 2s each

Single Scales of other measures graduated to order price 3s each

CIRCULAR CURVES

For Railway Plans and analogous purposes made as arcs of circles of any required radii between the two extremes of one inch and one mile

Holtzapfiel & Co cut these curves in stout cardboard made expressly for the purpose as this material combines in the most suitable manner economy with convenience and permanence of form. The convex and concave edges of these curves are both made to the same radius and they have received the approval and permanent purposage of the great majority of the Civil Linguisers Architects and Surveyors of the United Lingdom.

The usual set consists of 60 curves of radii increasing in due proportion from 1 to 170 inches. Those above 12 inches radius measure 3 inches in width and 18 inches

nn leng h

The Set of 60 Curves in Plain Deal Case, price £? 10s

Single Curves of any Radius I ept in stock price 1s, each

Single Curves of any required I ad us in English inches feet or chains. French

mine &c cut to order price 2s each

FNGINE DIVIDED CIRCULAR CARD PROTRACTORS

Every I rotiactor is ruled separately in the Dividing Linguise around either the outer or inner edge of a flut cardbourd ring


Holtzapfiel & Go's Card Protractors being ruled and not printed they possess the same accuracy as well as the other advantages of the Lugine divided Card Scales

External Drumeter—6 inch 2s 6d 9 inch 3s 6d 12 inch 5s Internal , —6 3s 0d 9 4s 6d 12 6s

THE ODONTAGRAPH,

Invented by Professor R Willis A M FRS &c This is an instrument of easy application used to describin, the teeth of wheels by circular arcs so that any two whicels of a set may work truly together. The theoretical explanation of this system of setting out the teeth of wheels which has been most extensively adopted by practical men will be found in the Trans Inst Civil Inginess vol in and in Williss Principles of Mechanism.

In Cardboard with tables and instructions for use rannished price 5s In Brass with tables and instructions for use mounted price £1 10s

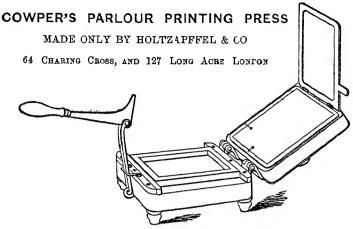

This little Printing Press is made of mahogany and stands in the small space of 11 by 8 inches. It is cipable of printing a page / by 0 incress and works so easily that a child may use it on the parlour table. A small type case accompanies it containing a fount of about 2000 types neatly arranged in three drawers with appropriate divitions a fourth drawer serves for the furniture inking tablet &c and to these are added the necessary tools so as to render the whole complete Should it be required the type case will contain a duplicate supply of type in addition to that usually furnished and which doubles the efficiency of the apparitus at a slight additional cost.

The above apparatus is well adapted for the amusement and education of youth and also to various applications of the inestimable typographic art to the common concerns of mankind

For example —Companies institutions and individuals have found it convenient for circular letters invoices and papers subservient to the dispatch and methodical arrangement of business naturalists and travellers for short memoirs of scientific researches or labels for specimens the friends of education for disseminating original and other papers wood engravers for examining the progress of their blocks practical printers for proofs of title pages stereotype plates or cards and nearly every different pursuit will suggest some new application of this little Press

LIST OF PRICES

SCCTION I -Cowper's Parlour Presses and Apparatus

COWPERS PARLOUR PRINTING PRESS with a galley chase a box of ink a vulcanized inking roller and a distributing tray

SMALL DEAL TYPE CASE painted with four drawers three of them partitioned to contain an assortment of about 2 500 types and a proportionate supply of laads and brass rule—the fourth drawer contains reglet furniture—side and foot sticks quoins &c

SLT OF EXTRAS—comprising transfer composing stick bodkin forceps mallet shooting stick planer brush and turpentine for cleaning the type two quires of demy printing paper cut into suitable sizes for the press and one pair of damping slates

GALLEY CHASE seven inches square inside

Total charge for the Plain Parlow Press and Apparatus complete &6

COWPERS PARLOUR PRINTING PRESS japanned and finished in the best man ner and fitted with a drawer in other respects as above

SMALL MAHOGANY TYPE CASE with brass lock and handles in other respects as above

SET OF EXTRAS comprising transfer composing stick &c as above

GALLEY CHASE seven inches square inside

Total charge for the Best Parlow Press and Apparatus complete, £8

DUPLICATE SET OF 2 500 TYPES and which may be contained in either of the above cases £1 12;

SECTION II -FOIIO FOOLSCAP PRESSES AND APPARATUS

- FOU IO FOOLSCAL LEINTING PRESS on the principle of Cowper's Larloui Press suitable to printing the half sheet of toolscap or the quito sheet of imperial. With an iron bed half an inch thiel planed quite level and true to increase the permanent accuracy of the Foolscap Liess and an iron counterpose to facilitate the working of the same. Measurement of the bed 15 by 10 inches. The press varnished and japanned complete with two iron chases register points &c.
- varnished and japanned complete with two iron chases register points &c

 LARGI DFAL TYIE CASE with six drawers and measuring externally 24 inches
 by eighteen and 11 inches high with iron hindles look ind key—I our of the
 drawers are putitioned after the I initer's method for holding 9000 types of the
 following varieties—Great Primer Roman Specimen No 9—vid—capitals
 figures points spaces ind quadrats—Pica Poman No 13—In c and small
 capitals lower case (small letters) with accented you also for printing the foreign
 languages figures points spaces quadrats and space his lead—complete
 Bourgious Antique No 93—capitals figures points spaces and quadrats
 Rourgious Antique No 93—capitals figures points spaces and quadrats
 I wo of the drawers contain space line leads furniture aide and footstal's quoins
 and relet also a mallet shooting stack planer bodd in printer secondary
 stack 9½ inches long brush for cleaning the type a pair of third damping slates
 &c all proportioned to the size of the Foolsc up 1 ress—Six inch vulcanized ink
 ing roller in frame and case and large box of superfine printing, ink

Total charge for the Folio Foolscap Press and Apparatus in the less complete form £22

FOLIO FOOI SCAP PRINTING PRESS exactly like the one last described

LARGE DLAL TYPE CASE with eight drawers similar to the case with six drawers above described but three inches higher and containing a considerably greater supply of each of the kinds of type specified in the foregoing description together with the addition of Giert Pilmer No 9 lower case letters. Pica Italic No 14 capitals lower case letter points and spaces and Bourgeois Antique No 23 lower case letters making the total number of types about 17 000 together with a proportionate increase of space line leads furniture &c and with the addition of 21 pieces of brass rule of three valueties six inch vulcanized inking roller in frame and case large box of superfine piliting ink composing frame of deal to receive the drawers of the type case when in use inclined galley of mahogany with moveable bottom, and four extra chases two of them with crosses

Total charge for the Tolio Foolscap Press and Apparatus in the more complete for m, £32

LARGER PRESSES ON THE SAME PRINCIPLE

- FOLIO DEMY PRINTING PRESS with non bed and counterpoise suitable to printing the hilf sheet of demy Measurement of the bed 20 by 13 inches The press variashed and 1 ipanned complete with two chases register points &c £1)
- BROADSIDE FOOLSCAI I RINTING PRESS made entirely of non and provided with screw adjustments to 10 ultit the pressure as required suitable to printing the whole sheet of foolscap Measurement of the bed 20 by 15 inches complete with four chases register points &c £22
- Type cases of various sizes and with any required selection of types Moulds for casting iollers Tools, &c to order


SECTION III -CASES FOR ADDITIONAL TYPES

- SMALL TYPE TRAY 10 by 6 inches with a selection of about 600 Roman or Italic types of small size of either of the numbers 17 to 20 £1
- FYPE BOOK 15 by 12 inches with a selection of about 1 500 types comprising eight varieties of small types for headings cards &c as described in page 55 of pumphlet, £2 10s
- LARGI TYPE TRAY 22 by 24 mehes partitioned after the mode of the printing office for containing larger quantities of type of anyl and 7s
- HAND CHASE in a painted case, with cushion roller ink and inking tray £1 5s

PRINTING APPARATUS FOR THL USE OF AMATEURS

A pamphlet containing full and practical instructions for the use of Cowife and Innting I arise also the description of larger presses on the same principle and various other apparatus for the Amateur Typographir—The pamphlet contains literarise numerous specimens of plain and ornamental typis, brass rules checks borders ornaments, corners arms &c &c

ELLIPTICAL CUTTING FRAME

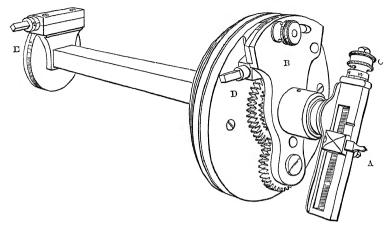


MANUFACTURED BY

HOLIZAPFFEL & CO.

64, CHARING CROSS, AND 127, LONG ACRE, LONDON


THE CLITPICAL CUTTING FRAME invented by CAPTAIN ASH HEICS is employed in the lathe for ornamenting tuned surfaces with elliptical figures after the same general method that the excentic cutting frame is employed for producing circular figures on similar surfaces—viz—the object to be ornamented is fixed on the lathe mandrel and motion is given to the tool by the Elliptical Cutting Linne—which is fitted to the receptacle of the sliding rest and driven by a band leading from the overhead motion

The Elliptical Cutting Frame is capable of producing llipses of all proportions from a right line to a circle according as it may be adjusted and the ellipses may be aligned either in circular order by the employment of the division plate or in a ctilinear order by the motion of the sliding rest or the two movements may be combined at pleasure. An almost infinite variety of patterns of a highly ornamental

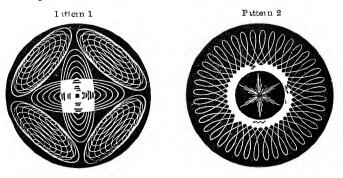

FILIPTICAL CUTTING FRAME

character will therefore be produced by the elliptical movement alone. In addition to which the instrument is idapted to produce epicycloidal patterns of 4 loops similar to those produced in the geometric churk, these looped figures may likewise be made in all proportions, and be placed in any positions.

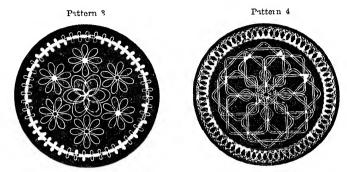

I rom those comprehensive powers of the l lliquid Cutting Frame it results that any defined arrangements may be produced of circles elliques hight lines of 4 looped figures—the instrument is therefore a most desirable delition to all lathes to confumental turning and if required its powers may be still further increased by the addition of other opaciel and all patterns or by combining its measurements with those of the executric chuck or other apparatus for commental turning


General Pomarks on the Action of the Elliptical Cuffing Frame

The elliptical movement of the tool is produced as in the goometric pen and in Ibbetson's geometric chuck by the combination of two circular movements in oppo site directions the one of which trivels it double the angular velicity of the other In the I lliptical Cutting frame this is effected by the train of whicels seen in the front of the instrument which we so arranged that the excentive frame carrying the tool A makes two revolutions to the right while the radial flange B makes one revolution to the left and the proportions of the ellipse described by the tool depend upon the relative degrees of excentricity given to A and b 1hus when A and B no both placed central the tool has no executaristy and merely produces a dot When excentileity is given to A ilone the tool describes a circle the ridius of which will depend upon the movement given to the sciew of the excentric frame under the guid ince of the micrometer head C which has ten divisions Supposing the executiveity to be equal to 4 turns of the serew or 40 divisions of the micrometer head and that it is desired to convert the encle into a traight line the flange B is al a moved 40 divisions by means of the adjusting screw D upon which a winch h indle is tempor unly fitted

Any series of ellipses between the strught line and the circle may be described by reducing the executiveity of the radial flage B. Thus if it be shift d 5 divisions between each figure a series of 7 ellipses will be produced gradually advancing from the right line to the circle. Any other number of divisions may be adopted in the same number the instrument being so adjusted that equal numbers of divisions on 1 and 6 days produce the strught line. Series of concentric ellipses are produced by adjusting both A and B. thus in pattern 1. A was shifted 4 divisions and b two divisions between every cut

EPICYCLOIDAL CUITING FRAME,

FOR IRODUCING COMPOUND FIGURES WITH INTERNAL OR EXPLENAL LOOPS
OR CUSIS

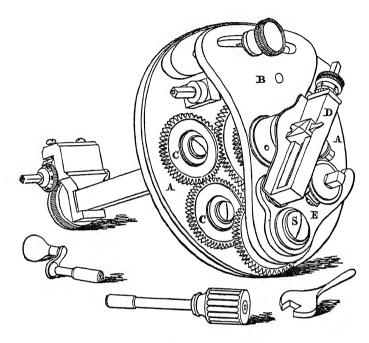

MADE BY

HOLIZAPFFEL & CO.

64, CHARING CROSS, AND 127, LONG ACRE, LONDON


THE EPICYCLOIDAL CUTTING FRAME is in extension of the principle of the Elliptical Cutting Frame to adapt the instrument to the production of patterns more nearly resembling the figures made by the Geometric Chuck

The Epicycloidal Cutting Frame as usually supplied will produce about 40 figures of from 2 to 90 loops every one of which admits of considerable variety both of size and proportion and if desired at any subsequent time the number of patterns may be considerably increased

Nearly the whole of the figures belong to the class of epicycloids in which every loop overlaps or extends beyond the preceding loop. These patterns are very effective and admit of considerable variation in form and dimensions by simple change of excentricities. All the patterns consist of a single line and many of them may be easily made to cover a surface of from 3 to 3½ inches diameter.

To fucilitate the manipulation of the Epicycloidal Cutting Frame, it has been so arranged that the settings required to produce the entire series of patterns are limited to the exchange of two wheels upon one arbon which may be readily detached and reinstated without difficulty. All the patterns produced by the Hilpitcal Cutting Frame may be produced on a more extended scale by the Epicycloidal Cutting Frame.

DIAGRAMS ILLUSTRATING THE EPICYCLOID L CUTTING FRAME

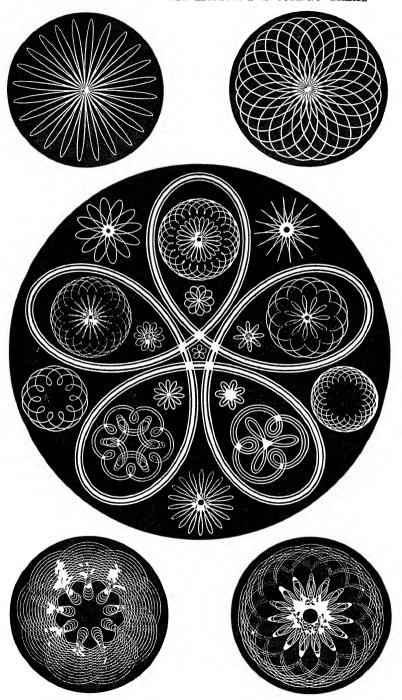

ROSE CUTTING FRAME

For Producing Rose Engine Patteins


IN ORDINARY TURNING LATHES,

MADE BY

HOLTZAPFFEL & CO,

ENGINE, LATHE, AND TOOL MANUFACTURERS,

64 CHARING CROSS & 127 LONG ACRL LOYDON

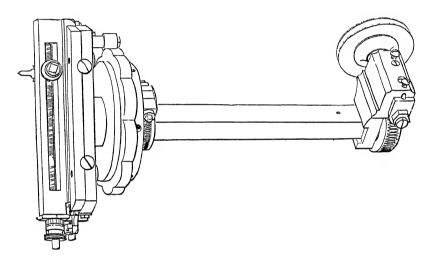

Fhis Instrument is employed in the sliding rest in the same manner as the Eccentric Cutting Frame and its management is almost as simple. It is capable of producing upon surfaces nearly the whole of the ornamental patterns that have been hitherto confined to the Rose Engine the use of which has been much retarded by the expense and size of the machine and the numerous apparatus required for its development

A more compact and less expensive apparatus for Rose Engine Turning his long been a desideratum with Amateurs HOLIZAPPIEL & Co have therefore much pleasure in submitting the present instrument to the notice of their patrons

The variety of the ornamental patterns produced by the Rose Cutting Frame 18 limited solely by the number of rosettes—these may be increased to any desired extent but as the instrument admits of numerous variations being produced from one rosette—only a moderate number will generally be required


In illustration of the performance of this instrument six simple patterns from six different rosettes are printed on the opposite page and on the following six variations of one of these rosettes—many other patterns may be produced from the same rosette and in those offered it will be observed that only the most simple apparatus have been employed in combination with the Rose Cutting Frame

ILLUSTRATIONS

OR,

HOLTZAPFFEL & CO'S ROSE CUTTING FRAME

Simple Patterns produced from Rosettes A, B C, D, E, F

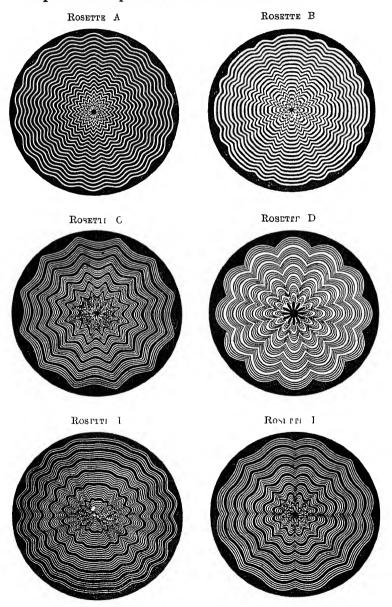

ILLUSTRATIONS

HOLTZAPFFEL & CO'S ROSE CUTTING FRAME


Compound Patterns produced from Rosette D

ROSLTTE D with Stop


ROSETTE D with Tangent Screu




ROSETTE D with Slide Rest
Movement

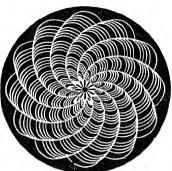

ROSETTE D with Tangent Screw and Slide Rest Movement

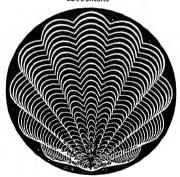

POSETTE D with Director Plate of the Lathe

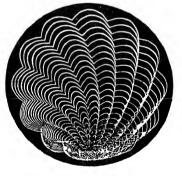

ROSETTE D with Division Plate and Slide Rest Movement



